

DeKalb County School District/Elementary Schools

Ashford Park Elementary

Final

School Assessment Report

May 19, 2016



PARSONS

Table of Contents

School Executive Summary	4
School Condition Summary	6
<u>1955, 1960 Building</u>	8
Executive Summary	8
Condition Summary	9
Photo Album	10
Condition Detail	11
System Listing	12
Renewal Schedule	14
Forecasted Sustainment Requirement	17
Deficiency Summary By System	18
Deficiency Summary By Priority	19
Deficiency By Priority Investment	20
Deficiency Summary By Category	21
Deficiency Details By Priority	22
<u>1960 Storage</u>	35
Executive Summary	35
Condition Summary	36
Photo Album	37
Condition Detail	38
System Listing	39
Renewal Schedule	40
Forecasted Sustainment Requirement	43
Deficiency Summary By System	44
Deficiency Summary By Priority	45
Deficiency By Priority Investment	46
Deficiency Summary By Category	47
Deficiency Details By Priority	48
<u>2000 Gym</u>	49

School Assessment Report

Executive Summary	49
Condition Summary	50
Photo Album	51
Condition Detail	52
System Listing	53
Renewal Schedule	54
Forecasted Sustainment Requirement	56
Deficiency Summary By System	57
Deficiency Summary By Priority	58
Deficiency By Priority Investment	59
Deficiency Summary By Category	60
Deficiency Details By Priority	61
Site	65
Executive Summary	65
Condition Summary	66
Photo Album	67
Condition Detail	68
System Listing	69
Renewal Schedule	70
Forecasted Sustainment Requirement	72
Deficiency Summary By System	73
Deficiency Summary By Priority	74
Deficiency By Priority Investment	75
Deficiency Summary By Category	76
Deficiency Details By Priority	77
Glossary	83

School Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Gross Area (SF):	56,558
Year Built:	1955
Last Renovation:	
Replacement Value:	\$13,070,064
Repair Cost:	\$6,674,512.34
Total FCI:	51.07 %
Total RSLI:	28.14 %
FCA Score:	48.93



Description:

The Ashford Park Elementary School campus consists of two buildings located at 2968 Cravenridge Drive NE in Atlanta, Georgia. The original campus was constructed in 1955, an addition to the main school building was constructed in 1960, and a gymnasium building was constructed in 2000. In addition to these buildings, the campus contains a storage building, covered walkway, hard surface play area, and playing field. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report for each building and site improvement on the campus.

School Assessment Report - Ashford Park Elementary

Attributes:**General Attributes:**

Assigned Region:	Region 1	Board District:	District 2
DOE Facility:	3050	Geographic Region:	Region 1
HS Attendance Area:	Chamblee HS	Jurisdictional City:	City of Brookhaven
Site Acreage:	7		

School Condition Summary

The Table below shows the RSLI and FCI for each major system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.


Current Investment Requirement and Condition by Uniformat Classification

UNIFORMAT Classification	RSLI%	FCI %	Current Repair
A10 - Foundations	44.71 %	0.00 %	\$0.00
A20 - Basement Construction	0.00 %	0.00 %	\$0.00
B10 - Superstructure	49.74 %	0.00 %	\$0.00
B20 - Exterior Enclosure	32.01 %	32.49 %	\$428,343.31
B30 - Roofing	4.77 %	103.47 %	\$1,161,101.19
C10 - Interior Construction	30.32 %	34.52 %	\$250,569.00
C20 - Stairs	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	8.37 %	68.93 %	\$1,169,439.00
D10 - Conveying	0.00 %	0.00 %	\$0.00
D20 - Plumbing	51.00 %	34.56 %	\$474,323.29
D30 - HVAC	67.59 %	16.13 %	\$322,503.00
D40 - Fire Protection	0.00 %	0.00 %	\$0.00
D50 - Electrical	3.80 %	60.65 %	\$812,263.65
E10 - Equipment	0.00 %	110.00 %	\$627,390.00
E20 - Furnishings	0.00 %	110.00 %	\$297,155.00
G20 - Site Improvements	7.18 %	90.24 %	\$611,939.67
G30 - Site Mechanical Utilities	2.93 %	98.26 %	\$406,256.11
G40 - Site Electrical Utilities	21.23 %	54.40 %	\$113,229.12
Totals:	28.14 %	51.07 %	\$6,674,512.34

Condition Deficiency Priority

Facility Name	Gross Area (S.F.)	FCI %	1 Priority	2 Priority	3 Priority	4 Priority	5 Priority
1955, 1960 Building	50,970	49.41	\$0.00	\$128,848.26	\$5,230,921.53	\$0.00	\$0.00
1960 Storage	110	0.00	\$0.00	\$0.00	\$0.00	\$0.00	\$0.00
2000 Gym	5,478	20.05	\$0.00	\$0.00	\$183,317.65	\$0.00	\$0.00
Site	56,558	87.05	\$0.00	\$0.00	\$1,131,424.90	\$0.00	\$0.00
Total:		51.07	\$0.00	\$128,848.26	\$6,545,664.08	\$0.00	\$0.00

Deficiencies By Priority

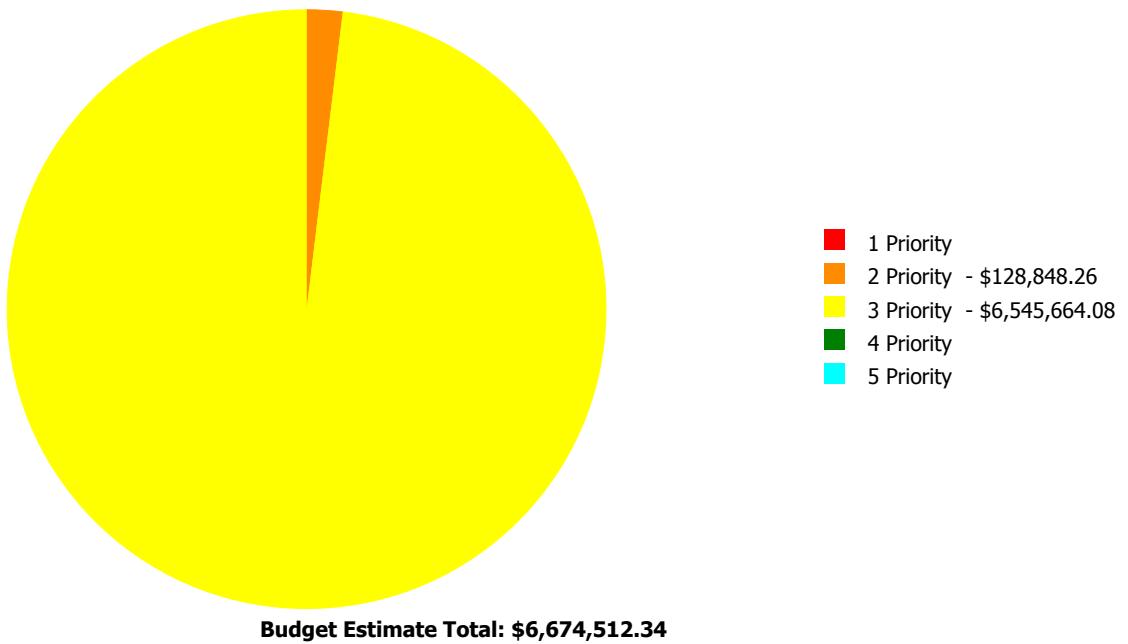

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	50,970
Year Built:	1955
Last Renovation:	1986
Replacement Value:	\$10,847,735
Repair Cost:	\$5,359,769.79
Total FCI:	49.41 %
Total RSLI:	28.22 %
FCA Score:	50.59



Description:

The main building at Ashford Park Elementary School is a one-story building located at 2968 Cravenridge Drive NE in Atlanta, Georgia. Originally built in 1955, there has been one addition in 1960 and a number of partial renovations since 1986. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:

Building Codes:	2010, 2011	Fire Sprinkler System:	No
-----------------	------------	------------------------	----

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	40.00 %	0.00 %	\$0.00
A20 - Basement Construction	0.00 %	0.00 %	\$0.00
B10 - Superstructure	40.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	26.98 %	35.85 %	\$428,343.31
B30 - Roofing	0.00 %	110.05 %	\$1,161,101.19
C10 - Interior Construction	23.02 %	40.83 %	\$250,569.00
C20 - Stairs	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	8.45 %	68.05 %	\$1,082,526.00
D10 - Conveying	0.00 %	0.00 %	\$0.00
D20 - Plumbing	52.10 %	37.03 %	\$474,323.29
D30 - HVAC	70.56 %	13.51 %	\$252,302.00
D40 - Fire Protection	0.00 %	0.00 %	\$0.00
D50 - Electrical	1.43 %	62.69 %	\$786,060.00
E10 - Equipment	0.00 %	110.00 %	\$627,390.00
E20 - Furnishings	0.00 %	110.00 %	\$297,155.00
Totals:	28.22 %	49.41 %	\$5,359,769.79

School Assessment Report - 1955, 1960 Building

Photo Album

The photo album consists of the various cardinal directions of the building.

1). North Elevation - Apr 16, 2015



2). West Elevation - Apr 17, 2015



3). South Elevation - Apr 17, 2015



4). East Elevation - Apr 17, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

School Assessment Report - 1955, 1960 Building

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$6.42	S.F.	50,970	100	1955	2055		40.00 %	0.00 %	40			\$327,227
A1020	Special Foundations	\$4.39	S.F.	10,000	100	1955	2055		40.00 %	0.00 %	40			\$43,900
A1030	Slab on Grade	\$7.00	S.F.	50,970	100	1955	2055		40.00 %	0.00 %	40			\$356,790
A2010	Basement Excavation	\$0.00	S.F.	0	100	1955	2055		40.00 %	0.00 %	40			\$0
A2020	Basement Walls	\$0.00	S.F.	0	100	1955	2055		40.00 %	0.00 %	40			\$0
B1010	Floor Construction	\$15.41	S.F.	10,000	100	1955	2055		40.00 %	0.00 %	40			\$154,100
B1020	Roof Construction	\$5.27	S.F.	50,970	100	1955	2055		40.00 %	0.00 %	40			\$268,612
B2010	Exterior Walls	\$15.81	S.F.	50,970	100	1955	2055		40.00 %	0.07 %	40		\$551.31	\$805,836
B2020	Exterior Windows	\$6.71	S.F.	50,970	30	1955	1985		0.00 %	110.00 %	-30		\$376,210.00	\$342,009
B2030	Exterior Doors	\$0.92	S.F.	50,970	30	1955	1985		0.00 %	110.00 %	-30		\$51,582.00	\$46,892
B3010	Roof Coverings - Asphalt Shingles	\$0.00	S.F.	0	0	1955			0.00 %	0.00 %				\$0
B3010	Roof Coverings - BUR	\$20.70	S.F.	50,970	20	2005	2025	2015	0.00 %	110.05 %	0		\$1,161,101.19	\$1,055,079
B3010	Roof Coverings - EPDM	\$0.00	S.F.	0	15	1955	1970		0.00 %	0.00 %	-45			\$0
B3010	Roof Coverings - Preformed Metal	\$0.00	S.F.	0	30	1955	1985		0.00 %	0.00 %	-30			\$0
B3010	Roof Coverings - Standing Seam Metal	\$0.00	S.F.	0	75	1955	2030		20.00 %	0.00 %	15			\$0
B3020	Roof Openings	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C1010	Partitions	\$6.93	S.F.	50,970	100	1955	2055		40.00 %	0.00 %	40			\$353,222
C1020	Interior Doors	\$2.35	S.F.	50,970	30	1955	1985		0.00 %	80.00 %	-30		\$95,824.00	\$119,780
C1030	Fittings	\$2.76	S.F.	50,970	20	1955	1975		0.00 %	110.00 %	-40		\$154,745.00	\$140,677
C2010	Stair Construction	\$0.00	S.F.	0	100	1955	2055		40.00 %	0.00 %	40			\$0
C3010	Wall Finishes - Ceramic & Glazed	\$10.13	S.F.	20,388	30	1955	1985	2020	16.67 %	0.00 %	5			\$206,530
C3010	Wall Finishes - Paint	\$1.92	S.F.	30,582	10	2004	2014		0.00 %	110.00 %	-1		\$64,589.00	\$58,717
C3010	Wall Finishes - Wall Coverings	\$0.00	S.F.	0	10	1955	1965		0.00 %	0.00 %	-50			\$0
C3020	Floor Finishes - Carpet	\$8.39	S.F.	2,548	8	1955	1963		0.00 %	110.00 %	-52		\$23,515.00	\$21,378
C3020	Floor Finishes - Ceramic & Quarry Tile	\$14.32	S.F.	3,568	50	1955	2005		0.00 %	110.00 %	-10		\$56,203.00	\$51,094
C3020	Floor Finishes - Terrazzo	\$52.34	S.F.	7,646	80	1955	2035		25.00 %	0.00 %	20			\$400,192
C3020	Floor Finishes - VCT	\$9.43	S.F.	37,208	20	1955	1975		0.00 %	110.00 %	-40		\$385,959.00	\$350,871
C3020	Floor Finishes - Wood	\$0.00	S.F.	0	20	1955	1975		0.00 %	0.00 %	-40			\$0
C3030	Ceiling Finishes	\$9.85	S.F.	50,970	20	1955	1975		0.00 %	110.00 %	-40		\$552,260.00	\$502,055
D1010	Elevators and Lifts	\$0.00	S.F.	0	30	1955	1985		0.00 %	0.00 %	-30			\$0
D2010	Plumbing Fixtures	\$17.44	S.F.	50,970	20	2010	2030		75.00 %	7.44 %	15		\$66,156.29	\$888,917
D2020	Domestic Water Distribution	\$3.93	S.F.	50,970	30	1955	1985	2015	0.00 %	110.00 %	0		\$220,343.00	\$200,312
D2030	Sanitary Waste	\$3.35	S.F.	50,970	30	1955	1985	2015	0.00 %	110.00 %	0		\$187,824.00	\$170,750
D2040	Rain Water Drainage	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0

School Assessment Report - 1955, 1960 Building

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
D2090	Other Plumbing Systems - Natural Gas	\$0.41	S.F.	50,970	30	1986	2016		3.33 %	0.00 %	1			\$20,898
D3020	Heat Generating Systems	\$4.50	S.F.	50,970	30	1955	1985		0.00 %	110.00 %	-30		\$252,302.00	\$229,365
D3030	Cooling Generating Systems	\$4.66	S.F.	50,970	30	2010	2040		83.33 %	0.00 %	25			\$237,520
D3040	Distribution & Exhaust Systems	\$4.43	S.F.	50,970	30	2006	2036		70.00 %	0.00 %	21			\$225,797
D3050	Terminal & Package Units	\$18.29	S.F.	50,970	15	2014	2029		93.33 %	0.00 %	14			\$932,241
D3060	Controls & Instrumentation	\$3.55	S.F.	50,970	20	2004	2024		45.00 %	0.00 %	9			\$180,944
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$1.21	S.F.	50,970	30	1990	2020		16.67 %	0.00 %	5			\$61,674
D4010	Sprinklers	\$0.00	S.F.	0	30	1955	1985		0.00 %	0.00 %	-30			\$0
D4020	Standpipes	\$0.00	S.F.	0	30	1955	1985		0.00 %	0.00 %	-30			\$0
D5010	Electrical Service/Distribution	\$1.79	S.F.	50,970	30	1986	2016		3.33 %	0.00 %	1			\$91,236
D5020	Branch Wiring	\$6.69	S.F.	50,970	30	1986	2016	2015	0.00 %	110.00 %	0		\$375,088.00	\$340,989
D5020	Lighting	\$8.79	S.F.	50,970	30	1986	2016		3.33 %	0.00 %	1			\$448,026
D5030	Communications and Security - Clock & PA Systems	\$5.53	S.F.	50,970	10	2004	2014		0.00 %	110.00 %	-1		\$310,051.00	\$281,864
D5030	Communications and Security - Fire Alarm	\$1.21	S.F.	50,970	10	2004	2014		0.00 %	110.00 %	-1		\$67,841.00	\$61,674
D5030	Communications and Security - Security & CCTV	\$0.59	S.F.	50,970	10	2004	2014		0.00 %	110.00 %	-1		\$33,080.00	\$30,072
E1010	Commercial Equipment	\$0.00	S.F.	0	20	1955	1975		0.00 %	0.00 %	-40			\$0
E1020	Institutional Equipment	\$0.76	S.F.	50,970	20	1955	1975		0.00 %	110.00 %	-40		\$42,611.00	\$38,737
E1090	Other Equipment (Kitchen Equipment)	\$10.43	S.F.	50,970	20	1955	1975		0.00 %	110.00 %	-40		\$584,779.00	\$531,617
E2010	Fixed Furnishings	\$5.30	S.F.	50,970	20	1955	1975		0.00 %	110.00 %	-40		\$297,155.00	\$270,141
Total													\$5,359,769.79	\$10,847,735

School Assessment Report - 1955, 1960 Building

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$5,359,770	\$634,661	\$0	\$0	\$0	\$342,014	\$0	\$0	\$29,788	\$259,699	\$639,114	\$7,265,047
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1020 - Special Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1010 - Floor Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$551	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$551
B2020 - Exterior Windows	\$376,210	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$376,210
B2030 - Exterior Doors	\$51,582	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$51,582
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Asphalt Shingles	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - BUR	\$1,161,101	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,161,101
B3010 - Roof Coverings - EPDM	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Preformed Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3020 - Roof Openings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

School Assessment Report - 1955, 1960 Building

C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$95,824	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$95,824
C1030 - Fittings	\$154,745	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$154,745
C20 - Stairs	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
*C2010 - Stair Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic & Glazed	\$0	\$0	\$0	\$0	\$0	\$263,367	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$263,367
C3010 - Wall Finishes - Paint	\$64,589	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$86,802	\$0	\$151,391
C3010 - Wall Finishes - Wall Coverings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Carpet	\$23,515	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$53,303
C3020 - Floor Finishes - Ceramic & Quarry Tile	\$56,203	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$56,203
C3020 - Floor Finishes - Terrazzo	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - VCT	\$385,959	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$385,959
C3020 - Floor Finishes - Wood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$552,260	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$552,260
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D10 - Conveying	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D1010 - Elevators and Lifts	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$66,156	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$66,156
D2020 - Domestic Water Distribution	\$220,343	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$220,343
D2030 - Sanitary Waste	\$187,824	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$187,824
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2090 - Other Plumbing Systems - Natural Gas	\$0	\$23,677	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$23,677
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3020 - Heat Generating Systems	\$252,302	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$252,302
D3030 - Cooling Generating Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3040 - Distribution & Exhaust Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3050 - Terminal & Package Units	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3060 - Controls & Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$259,699	\$0	\$259,699
D3090 - Other HVAC Systems/Equip - Kitchen Hood	\$0	\$0	\$0	\$0	\$0	\$0	\$78,646	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$78,646
D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


School Assessment Report - 1955, 1960 Building

D4010 - Sprinklers	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D4020 - Standpipes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$103,371	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$103,371
D5020 - Branch Wiring	\$375,088	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$375,088
D5020 - Lighting	\$0	\$507,614	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$507,614
D5030 - Communications and Security - Clock & PA Systems	\$310,051	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$416,683	\$726,734
D5030 - Communications and Security - Fire Alarm	\$67,841	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$91,173	\$159,014
D5030 - Communications and Security - Security & CCTV	\$33,080	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$44,457	\$77,537
E - Equipment & Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E10 - Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1010 - Commercial Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1020 - Institutional Equipment	\$42,611	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$42,611
E1090 - Other Equipment (Kitchen Equipment)	\$584,779	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$584,779
E20 - Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E2010 - Fixed Furnishings	\$297,155	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$297,155

* Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

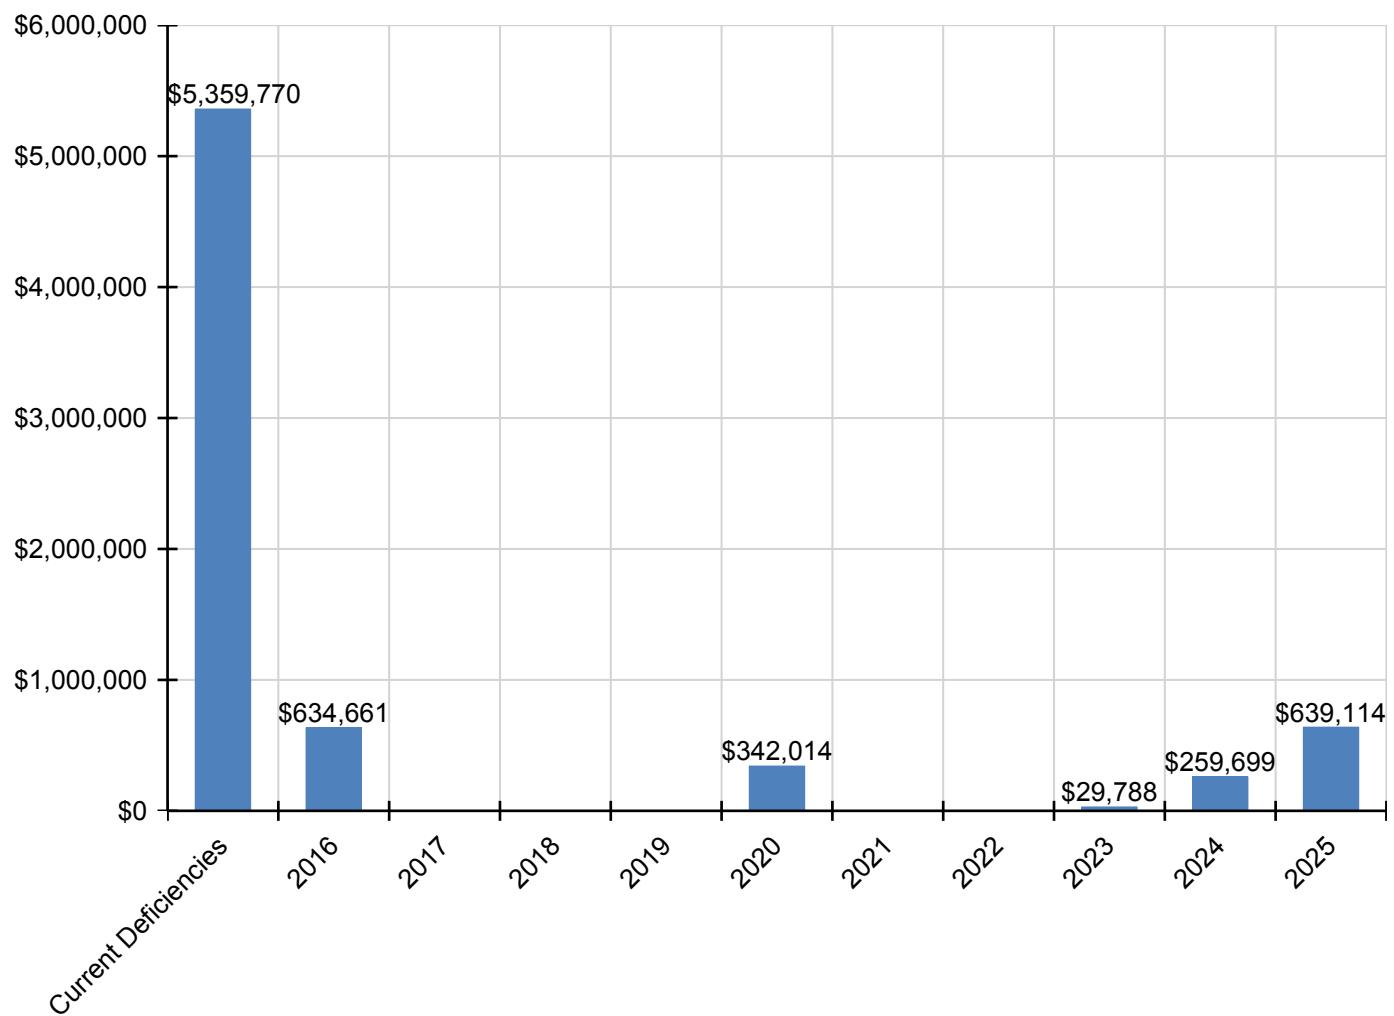

Deficiency Summary by System


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

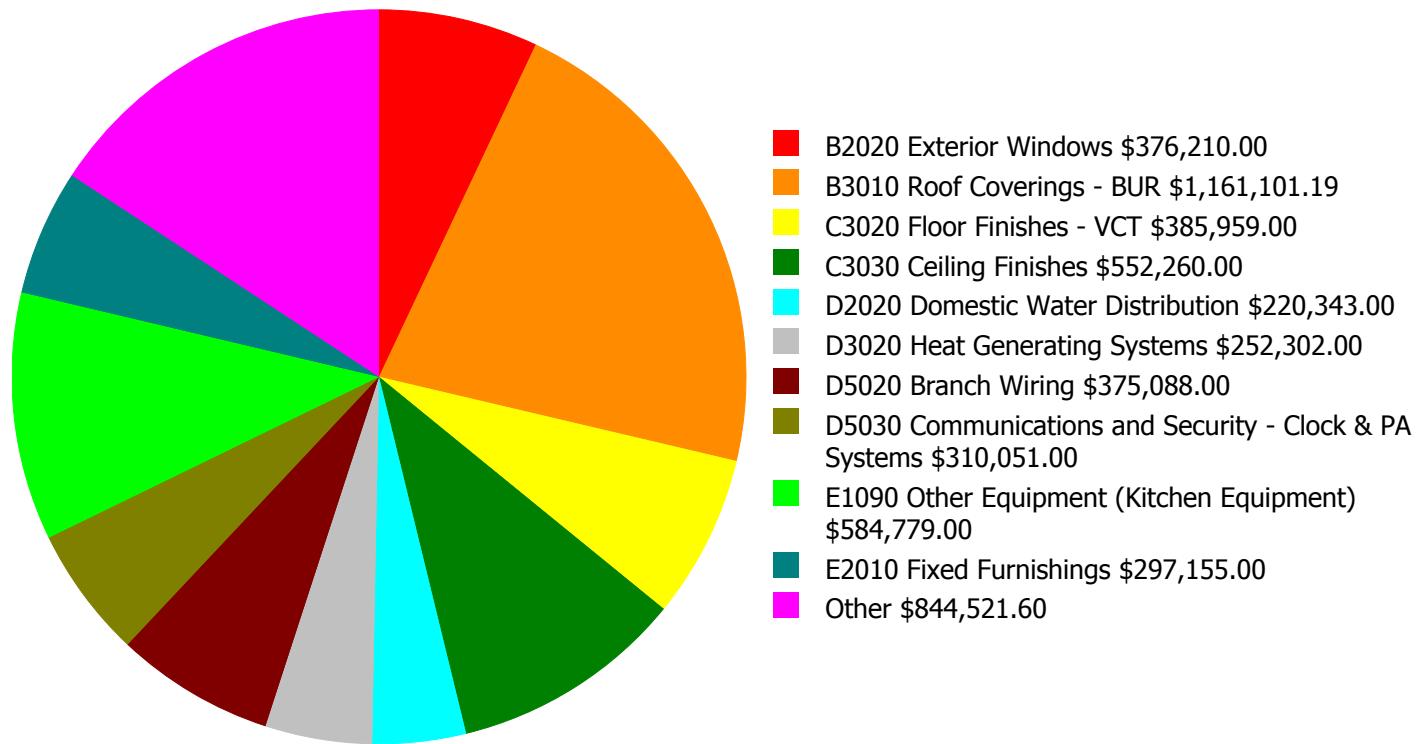

Budget Estimate Total: \$5,359,769.79

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

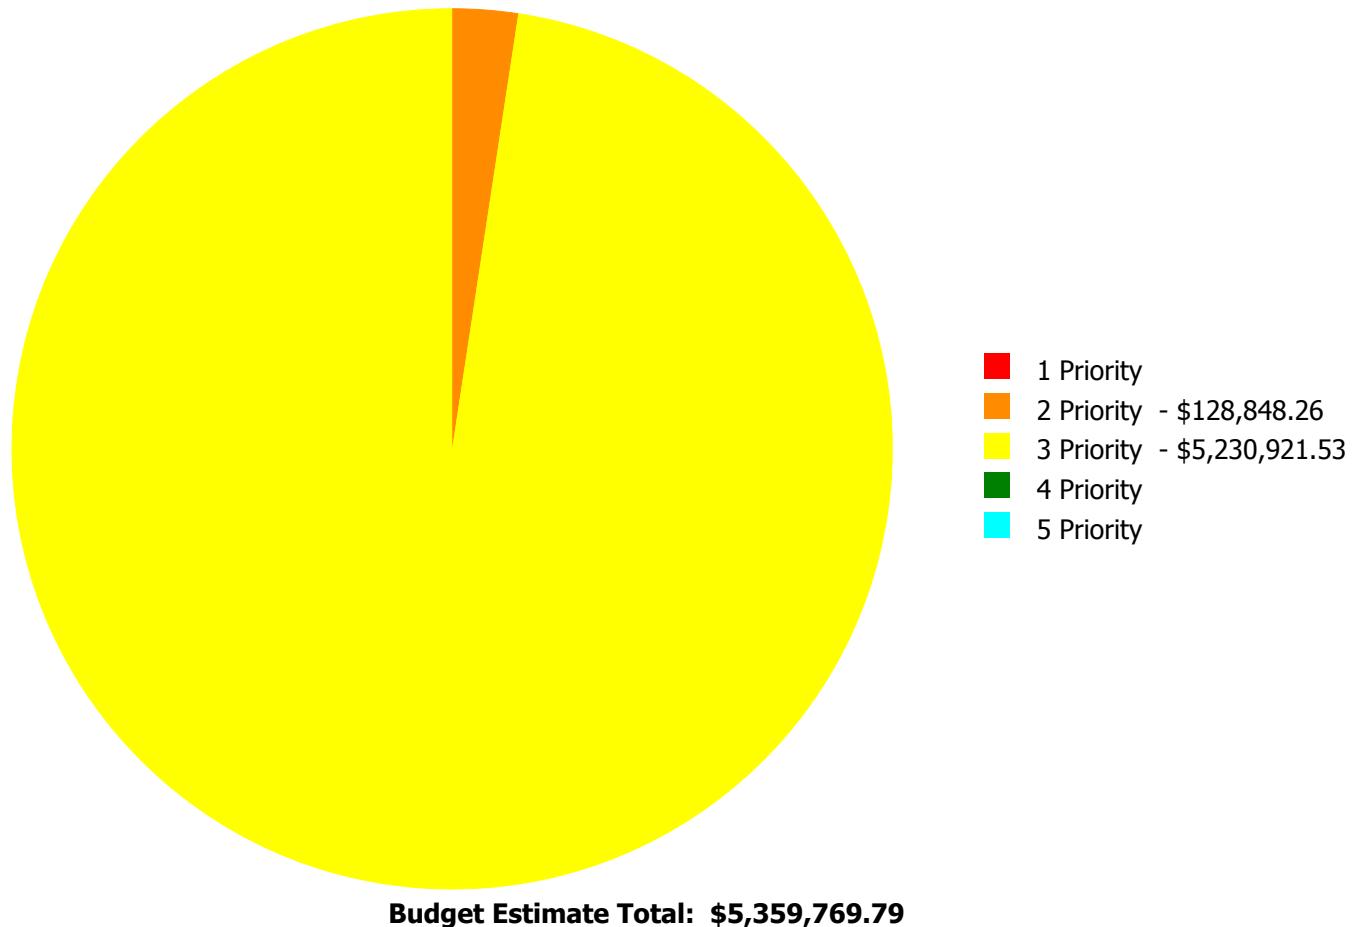

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards..
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
B2010	Exterior Walls	\$0.00	\$551.31	\$0.00	\$0.00	\$0.00	\$551.31
B2020	Exterior Windows	\$0.00	\$0.00	\$376,210.00	\$0.00	\$0.00	\$376,210.00
B2030	Exterior Doors	\$0.00	\$0.00	\$51,582.00	\$0.00	\$0.00	\$51,582.00
B3010	Roof Coverings - BUR	\$0.00	\$0.00	\$1,161,101.19	\$0.00	\$0.00	\$1,161,101.19
C1020	Interior Doors	\$0.00	\$0.00	\$95,824.00	\$0.00	\$0.00	\$95,824.00
C1030	Fittings	\$0.00	\$0.00	\$154,745.00	\$0.00	\$0.00	\$154,745.00
C3010	Wall Finishes - Paint	\$0.00	\$0.00	\$64,589.00	\$0.00	\$0.00	\$64,589.00
C3020	Floor Finishes - Carpet	\$0.00	\$0.00	\$23,515.00	\$0.00	\$0.00	\$23,515.00
C3020	Floor Finishes - Ceramic & Quarry Tile	\$0.00	\$0.00	\$56,203.00	\$0.00	\$0.00	\$56,203.00
C3020	Floor Finishes - VCT	\$0.00	\$0.00	\$385,959.00	\$0.00	\$0.00	\$385,959.00
C3030	Ceiling Finishes	\$0.00	\$0.00	\$552,260.00	\$0.00	\$0.00	\$552,260.00
D2010	Plumbing Fixtures	\$0.00	\$60,455.95	\$5,700.34	\$0.00	\$0.00	\$66,156.29
D2020	Domestic Water Distribution	\$0.00	\$0.00	\$220,343.00	\$0.00	\$0.00	\$220,343.00
D2030	Sanitary Waste	\$0.00	\$0.00	\$187,824.00	\$0.00	\$0.00	\$187,824.00
D3020	Heat Generating Systems	\$0.00	\$0.00	\$252,302.00	\$0.00	\$0.00	\$252,302.00
D5020	Branch Wiring	\$0.00	\$0.00	\$375,088.00	\$0.00	\$0.00	\$375,088.00
D5030	Communications and Security - Clock & PA Systems	\$0.00	\$0.00	\$310,051.00	\$0.00	\$0.00	\$310,051.00
D5030	Communications and Security - Fire Alarm	\$0.00	\$67,841.00	\$0.00	\$0.00	\$0.00	\$67,841.00
D5030	Communications and Security - Security & CCTV	\$0.00	\$0.00	\$33,080.00	\$0.00	\$0.00	\$33,080.00
E1020	Institutional Equipment	\$0.00	\$0.00	\$42,611.00	\$0.00	\$0.00	\$42,611.00
E1090	Other Equipment (Kitchen Equipment)	\$0.00	\$0.00	\$584,779.00	\$0.00	\$0.00	\$584,779.00
E2010	Fixed Furnishings	\$0.00	\$0.00	\$297,155.00	\$0.00	\$0.00	\$297,155.00
	Total:	\$0.00	\$128,848.26	\$5,230,921.53	\$0.00	\$0.00	\$5,359,769.79

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

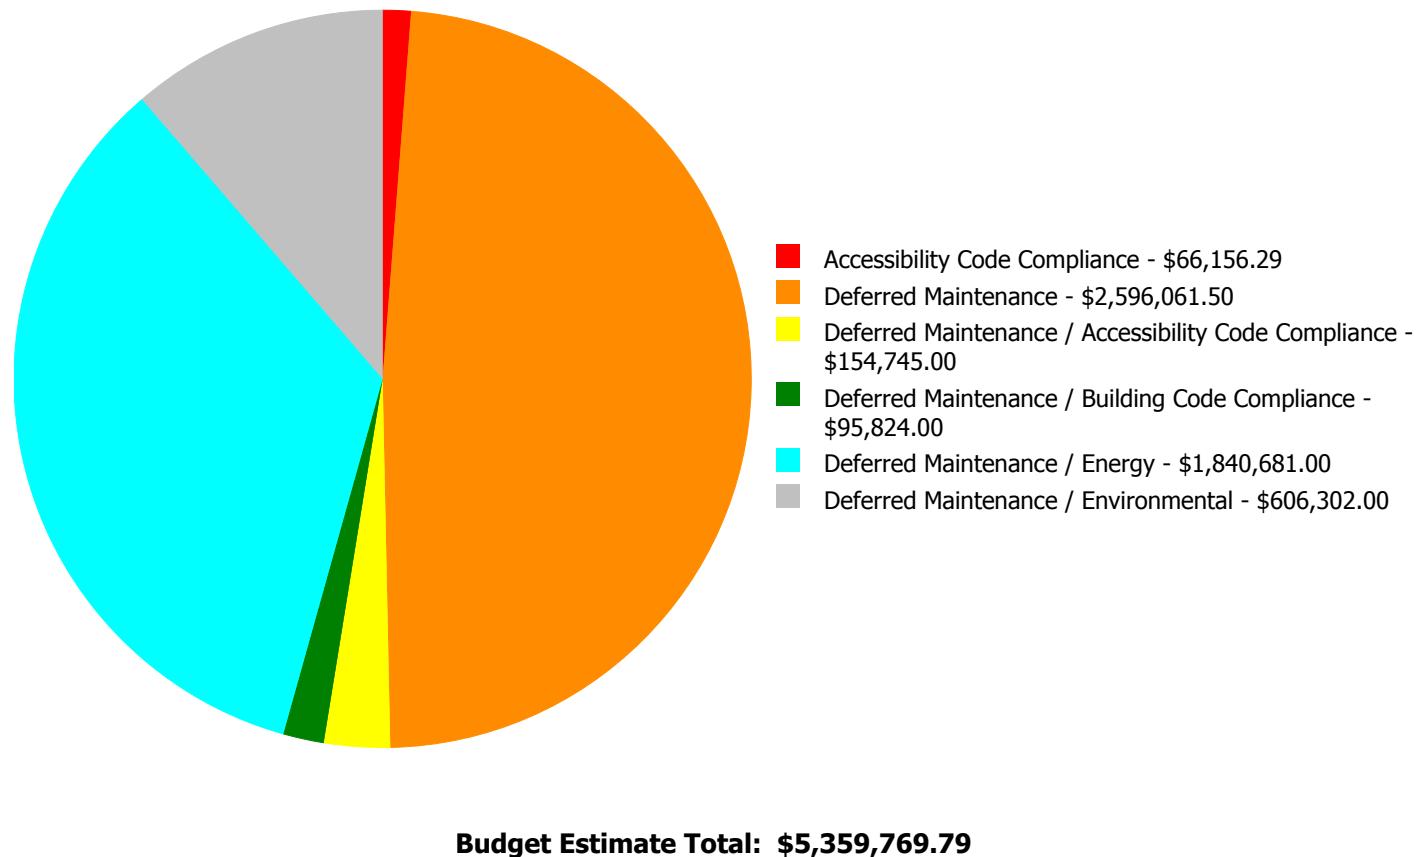

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 2 Priority:

System: B2010 - Exterior Walls



Location: Throughout Building

Distress: Damaged

Category: Deferred Maintenance

Priority: 2 Priority

Correction: Repair / Replace expansion joint caulk material

Qty: 50.00

Unit of Measure: L.F.

Estimate: \$551.31

Assessor Name: Ben Nixon

Date Created: 04/16/2015

Notes: Expansion joints need to be repaired/replaced.

System: D2010 - Plumbing Fixtures



Location: Throughout Building

Distress: Needs Remediation

Category: Accessibility Code Compliance

Priority: 2 Priority

Correction: Add ADA compliant rest room.

Qty: 2.00

Unit of Measure: Ea.

Estimate: \$60,455.95

Assessor Name: Sam Mandola

Date Created: 04/16/2015

Notes: Student restrooms should be modified to increase ADA accessibility.

School Assessment Report - 1955, 1960 Building

System: D5030 - Communications and Security - Fire Alarm



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 2 Priority

Correction: Renew System

Qty: 50,970.00

Unit of Measure: S.F.

Estimate: \$67,841.00

Assessor Name: Sam Mandola

Date Created: 04/11/2015

Notes: The fire alarm system is beyond its expected service life and should be scheduled for replacement.

Priority 3 Priority:

System: B2020 - Exterior Windows



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 50,970.00

Unit of Measure: S.F.

Estimate: \$376,210.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The aluminum frame, operable, single pane windows are aged, not energy efficient, and should be replaced. The windows leak and do not lock properly.

System: B2030 - Exterior Doors



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 50,970.00

Unit of Measure: S.F.

Estimate: \$51,582.00

Assessor Name: Ben Nixon

Date Created: 04/16/2015

Notes: The original exterior doors are aged, rusted, and should be replaced.

System: B3010 - Roof Coverings - BUR



Location: Roof

Distress: Damaged

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 50,970.00

Unit of Measure: S.F.

Estimate: \$1,160,587.00

Assessor Name: Ben Nixon

Date Created: 04/16/2015

Notes: The roof covering has delaminating, worn and ponding rain water, and should be replaced.

System: B3010 - Roof Coverings - BUR



Location: Roof

Distress: Damaged

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Replace galvanized steel gutter, 6" box type, 26 ga.

Qty: 20.00

Unit of Measure: L.F.

Estimate: \$514.19

Assessor Name: Ben Nixon

Date Created: 04/16/2015

Notes: Roof gutter and several downspouts are damaged on the south classroom wing.

School Assessment Report - 1955, 1960 Building

System: C1020 - Interior Doors



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Building Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 50,970.00

Unit of Measure: S.F.

Estimate: \$95,824.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Interior doors are beyond their expected service life, not ADA or building code compliant, and should be replaced.

System: C1030 - Fittings



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 50,970.00

Unit of Measure: S.F.

Estimate: \$154,745.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Fittings, such as toilet partitions, handrails and signage, are beyond their expected service life, not ADA compliant, and should be replaced.

School Assessment Report - 1955, 1960 Building

System: C3010 - Wall Finishes - Paint



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 30,582.00

Unit of Measure: S.F.

Estimate: \$64,589.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The painted wall finishes are beyond their expected service life, scuffed and stained, and should be replaced.

System: C3020 - Floor Finishes - Carpet



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 2,548.00

Unit of Measure: S.F.

Estimate: \$23,515.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The carpet in the offices and classrooms is aged, stained and frayed, and should be replaced.

School Assessment Report - 1955, 1960 Building

System: C3020 - Floor Finishes - Ceramic & Quarry Tile



Location: Kitchen and Restrooms

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 3,568.00

Unit of Measure: S.F.

Estimate: \$56,203.00

Assessor Name: Ben Nixon

Date Created: 04/17/2015

Notes: The tile floor covering is beyond its expected service life, cracked, patched and worn, and should be replaced.

System: C3020 - Floor Finishes - VCT



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Environmental

Priority: 3 Priority

Correction: Renew System

Qty: 37,208.00

Unit of Measure: S.F.

Estimate: \$385,959.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The VCT flooring is aged, cracked and worn, and should be replaced.

School Assessment Report - 1955, 1960 Building

System: C3030 - Ceiling Finishes



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 50,970.00

Unit of Measure: S.F.

Estimate: \$552,260.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The original ceiling finishes are aged, failing, and should be replaced.

System: D2010 - Plumbing Fixtures



Location: South Classroom Hallway

Distress: Needs Remediation

Category: Accessibility Code Compliance

Priority: 3 Priority

Correction: Remove/replace drinking fountain w/recessed ADA compliant drinking fountain

Qty: 1.00

Unit of Measure: Ea.

Estimate: \$5,700.34

Assessor Name: Ben Nixon

Date Created: 04/16/2015

Notes: Water fountain protrudes into the hallway more than four inches. Protrusion is not ADA compliant if more than four inches.

System: D2020 - Domestic Water Distribution



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Environmental

Priority: 3 Priority

Correction: Renew System

Qty: 50,970.00

Unit of Measure: S.F.

Estimate: \$220,343.00

Assessor Name: Sam Mandola

Date Created: 04/11/2015

Notes: The domestic water distribution system is beyond its expected service life, has water quality issues, and should be scheduled for replacement. SPLOST project 400-422 to replace backflow preventer.

System: D2030 - Sanitary Waste



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 50,970.00

Unit of Measure: S.F.

Estimate: \$187,824.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The sanitary waste system is aged, has reported periodic failures and foul odors and should be replaced.

System: D3020 - Heat Generating Systems



Location: Mechanical Room

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 50,970.00

Unit of Measure: S.F.

Estimate: \$252,302.00

Assessor Name: Sam Mandola

Date Created: 04/11/2015

Notes: The gas-fired boilers are operational and in fair condition, but are aging, inefficient, becoming logistically unsupportable, and should be scheduled for replacement.

System: D5020 - Branch Wiring



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 50,970.00

Unit of Measure: S.F.

Estimate: \$375,088.00

Assessor Name: Ben Nixon

Date Created: 01/08/2016

Notes: Branch wiring is nearing the end of its expected service life, inadequate, and should be replaced. The building does not have enough electrical outlets to serve current computer needs.

School Assessment Report - 1955, 1960 Building

System: D5030 - Communications and Security - Clock & PA Systems



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 50,970.00

Unit of Measure: S.F.

Estimate: \$310,051.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Clock and PA systems are beyond their expected service life, inadequate, and should be scheduled for replacement.

System: D5030 - Communications and Security - Security & CCTV



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 50,970.00

Unit of Measure: S.F.

Estimate: \$33,080.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The security and CCTV systems are beyond their expected service life and should be scheduled for replacement.

System: E1020 - Institutional Equipment



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 50,970.00

Unit of Measure: S.F.

Estimate: \$42,611.00

Assessor Name: Ben Nixon

Date Created: 01/08/2016

Notes: Institutional equipment, such as theater and stage equipment, library equipment and audio-visual equipment, is beyond its expected service life and should be scheduled for replacement.

System: E1090 - Other Equipment (Kitchen Equipment)



Location: Kitchen

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 50,970.00

Unit of Measure: S.F.

Estimate: \$584,779.00

Assessor Name: Sam Mandola

Date Created: 04/11/2015

Notes: The original kitchen equipment exhaust system is beyond its expected service life, becoming logistically unsupportable, and should be replaced. SPLOST project 400-422 to replace the kitchen equipment.

School Assessment Report - 1955, 1960 Building

System: E2010 - Fixed Furnishings



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 50,970.00

Unit of Measure: S.F.

Estimate: \$297,155.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Fixed furnishings, such as built-in cabinets, are beyond their expected service life, damaged and worn, and should be replaced.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	110
Year Built:	1960
Last Renovation:	
Replacement Value:	\$8,379
Repair Cost:	\$0.00
Total FCI:	0.00 %
Total RSLI:	52.01 %
FCA Score:	100.00



Description:

The storage building at Ashford Park Elementary School is located at 2968 Cravenridge Drive NE in Atlanta, Georgia. Originally built in 1960, there have been no additions and no major renovations. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:

Building Codes:	Fire Sprinkler System:	No
-----------------	------------------------	----

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	45.00 %	0.00 %	\$0.00
A20 - Basement Construction	0.00 %	0.00 %	\$0.00
B10 - Superstructure	45.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	45.78 %	0.00 %	\$0.00
B30 - Roofing	75.00 %	0.00 %	\$0.00
C10 - Interior Construction	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	0.00 %	0.00 %	\$0.00
D20 - Plumbing	0.00 %	0.00 %	\$0.00
D50 - Electrical	0.00 %	0.00 %	\$0.00
Totals:	52.02 %	0.00 %	\$0.00

Photo Album

The photo album consists of the various cardinal directions of the building.

1). South Elevation - Apr 16, 2015



2). East Elevation - Apr 16, 2015



3). North Elevation - Apr 16, 2015



4). West Elevation - Apr 16, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

School Assessment Report - 1960 Storage

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$4.49	S.F.	0	100	1960	2060		45.00 %	0.00 %	45			\$0
A1030	Slab on Grade	\$3.60	S.F.	110	100	1960	2060		45.00 %	0.00 %	45			\$396
A2010	Basement Excavation	\$0.22	S.F.	0	100	1960	2060		45.00 %	0.00 %	45			\$0
A2020	Basement Walls	\$3.52	S.F.	0	100	1960	2060		45.00 %	0.00 %	45			\$0
B1020	Roof Construction	\$16.33	S.F.	110	100	1960	2060		45.00 %	0.00 %	45			\$1,796
B2010	Exterior Walls	\$38.65	S.F.	110	100	1960	2060		45.00 %	0.00 %	45			\$4,252
B2020	Exterior Windows	\$4.87	S.F.	0	30	1960	1990		0.00 %	0.00 %	-25			\$0
B2030	Exterior Doors	\$0.80	S.F.	110	30	2010	2040		83.33 %	0.00 %	25			\$88
B3010	Roof Coverings	\$16.79	S.F.	110	20	2010	2030		75.00 %	0.00 %	15			\$1,847
C1010	Partitions	\$13.04	S.F.	0	40	1960	2000		0.00 %	0.00 %	-15			\$0
C1020	Interior Doors	\$2.61	S.F.	0	30	1960	1990		0.00 %	0.00 %	-25			\$0
C1030	Fittings	\$3.04	S.F.	0	20	1960	1980		0.00 %	0.00 %	-35			\$0
C3010	Wall Finishes	\$1.61	S.F.	0	20	1960	1980		0.00 %	0.00 %	-35			\$0
C3020	Floor Finishes	\$6.58	S.F.	0	20	1960	1980		0.00 %	0.00 %	-35			\$0
C3030	Ceiling Finishes	\$6.06	S.F.	0	20	1960	1980		0.00 %	0.00 %	-35			\$0
D2040	Rain Water Drainage	\$1.55	S.F.	0	30	1960	1990		0.00 %	0.00 %	-25			\$0
D5010	Electrical Service/Distribution	\$3.06	S.F.	0	30	1960	1990		0.00 %	0.00 %	-25			\$0
D5020	Lighting and Branch Wiring	\$12.57	S.F.	0	30	1960	1990		0.00 %	0.00 %	-25			\$0
Total										52.02 %				\$8,379

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

School Assessment Report - 1960 Storage


System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2020 - Exterior Windows	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting and Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

School Assessment Report - 1960 Storage

* Indicates non-renewable system

Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

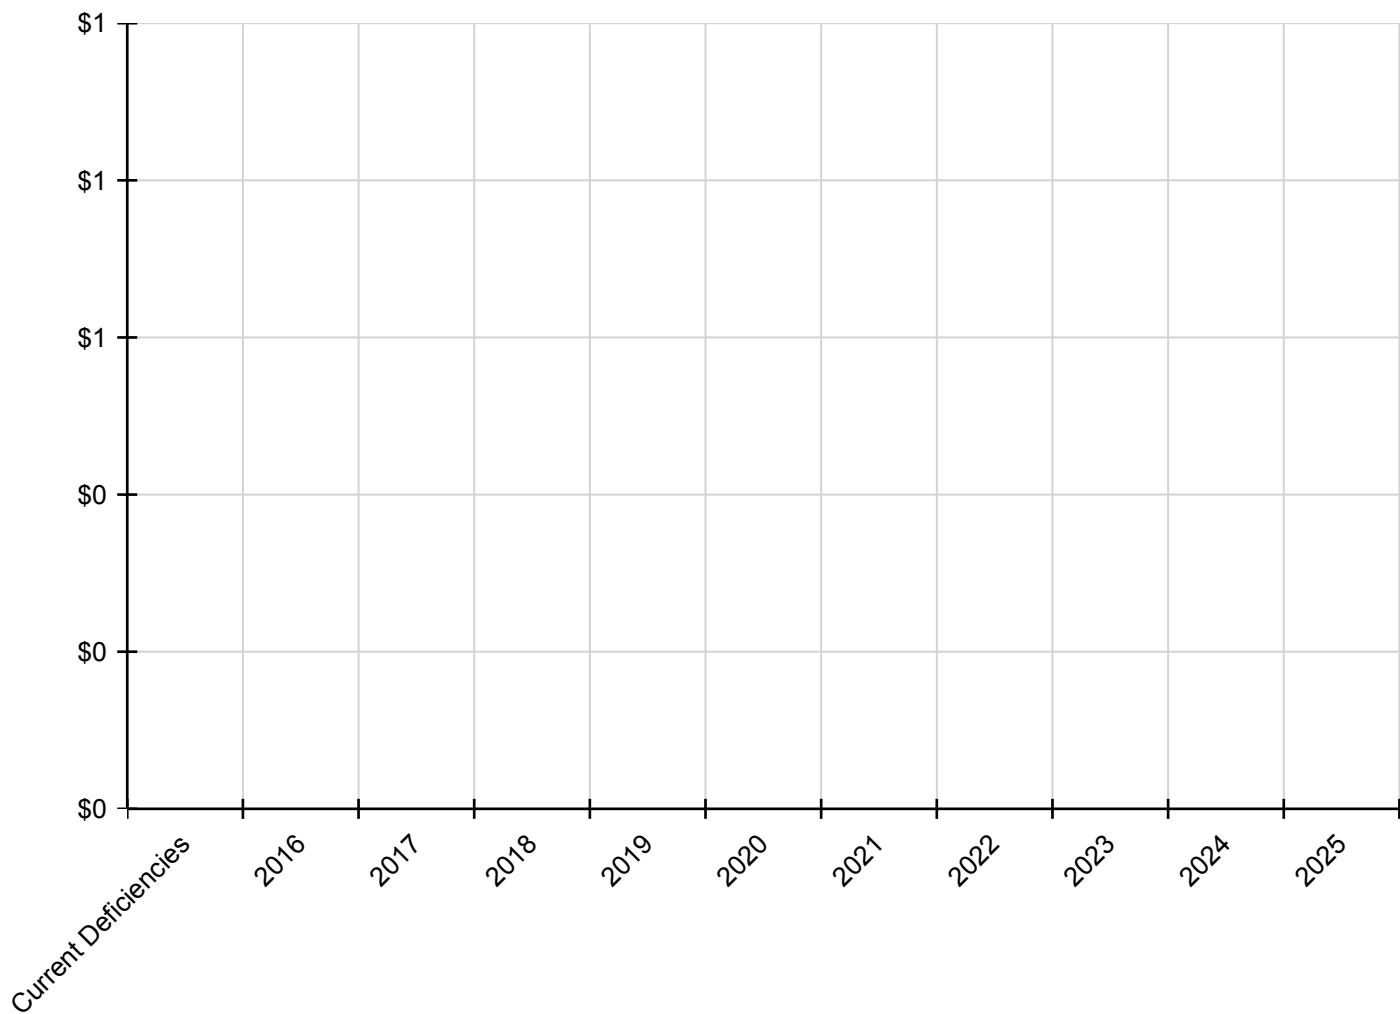

Deficiency Summary by System

Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

No data found for this asset

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

No data found for this asset

Deficiency By Priority Investment Table

The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards..
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

No data found for this asset

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

No data found for this asset

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

No data found for this asset

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	5,478
Year Built:	2000
Last Renovation:	
Replacement Value:	\$914,268
Repair Cost:	\$183,317.65
Total FCI:	20.05 %
Total RSLI:	55.50 %
FCA Score:	79.95



Description:

The 2000 gymnasium at Ashford Park Elementary School is a one-story building located at 2968 Cravenridge Drive NE in Atlanta, Georgia. There have been no additions and no major renovations to this building. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:

Building Codes:	2020	Fire Sprinkler System:	No
-----------------	------	------------------------	----

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	85.00 %	0.00 %	\$0.00
B10 - Superstructure	85.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	81.77 %	0.00 %	\$0.00
B30 - Roofing	80.00 %	0.00 %	\$0.00
C10 - Interior Construction	70.21 %	0.00 %	\$0.00
C30 - Interior Finishes	7.11 %	82.13 %	\$86,913.00
D20 - Plumbing	35.54 %	0.00 %	\$0.00
D30 - HVAC	25.62 %	53.04 %	\$70,201.00
D40 - Fire Protection	0.00 %	0.00 %	\$0.00
D50 - Electrical	38.53 %	30.64 %	\$26,203.65
Totals:	55.50 %	20.05 %	\$183,317.65

School Assessment Report - 2000 Gym

Photo Album

The photo album consists of the various cardinal directions of the building.

1). North Elevation - Apr 16, 2015



2). West Elevation - Apr 16, 2015



3). South Elevation - Apr 16, 2015



4). East Elevation - Apr 16, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

School Assessment Report - 2000 Gym

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$9.34	S.F.	5,478	100	2000	2100		85.00 %	0.00 %	85			\$51,165
A1030	Slab on Grade	\$6.21	S.F.	5,478	100	2000	2100		85.00 %	0.00 %	85			\$34,018
B1020	Roof Construction	\$21.36	S.F.	5,478	100	2000	2100		85.00 %	0.00 %	85			\$117,010
B2010	Exterior Walls	\$19.80	S.F.	5,478	100	2000	2100		85.00 %	0.00 %	85			\$108,464
B2030	Exterior Doors	\$2.01	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$11,011
B3010	Roof Coverings - Standing Seam Metal	\$11.91	S.F.	5,478	75	2000	2075		80.00 %	0.00 %	60			\$65,243
C1010	Partitions	\$12.78	S.F.	5,478	100	2000	2100		85.00 %	0.00 %	85			\$70,009
C1020	Interior Doors	\$4.24	S.F.	5,478	40	2000	2040		62.50 %	0.00 %	25			\$23,227
C1030	Fittings	\$3.46	S.F.	5,478	20	2000	2020		25.00 %	0.00 %	5			\$18,954
C3010	Wall Finishes - Ceramic	\$6.65	S.F.	0	30	2000	2030		50.00 %	0.00 %	15			\$0
C3010	Wall Finishes - Paint	\$1.41	S.F.	5,478	10	2000	2010		0.00 %	109.99 %	-5		\$8,496.00	\$7,724
C3020	Floor Finishes - Ceramic Tile	\$6.67	S.F.	274	50	2000	2050		70.00 %	0.00 %	35			\$1,828
C3020	Floor Finishes - Neoprene	\$14.46	S.F.	4,930	8	2000	2008		0.00 %	110.00 %	-7		\$78,417.00	\$71,288
C3020	Floor Finishes - VCT	\$5.01	S.F.	274	20	2000	2020		25.00 %	0.00 %	5			\$1,373
C3030	Ceiling Finishes	\$4.31	S.F.	5,478	20	2000	2020		25.00 %	0.00 %	5			\$23,610
D2010	Plumbing Fixtures	\$9.66	S.F.	5,478	20	2000	2020		25.00 %	0.00 %	5			\$52,917
D2020	Domestic Water Distribution	\$5.85	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$32,046
D2030	Sanitary Waste	\$0.87	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$4,766
D2040	Rain Water Drainage	\$0.22	S.F.	0	30	2000	2030		50.00 %	0.00 %	15			\$0
D2090	Other Plumbing Systems - Natural Gas	\$0.32	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$1,753
D3040	Distribution Systems & Exhaust Systems	\$12.25	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$67,106
D3050	Terminal & Package Units	\$11.65	S.F.	5,478	15	2000	2015		0.00 %	110.00 %	0		\$70,201.00	\$63,819
D3060	Controls & Instrumentation	\$0.26	S.F.	5,478	20	2000	2020		25.00 %	0.00 %	5			\$1,424
D4010	Sprinklers	\$3.84	S.F.	0	30	2000	2030		50.00 %	0.00 %	15			\$0
D5010	Electrical Service/Distribution	\$1.24	S.F.	5,478	40	2000	2040		62.50 %	0.00 %	25			\$6,793
D5020	Branch Wiring	\$5.24	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$28,705
D5020	Lighting	\$5.24	S.F.	5,478	30	2000	2030		50.00 %	9.62 %	15		\$2,762.65	\$28,705
D5030	Communications and Security - Fire Alarm	\$2.13	S.F.	5,478	15	2000	2015	2015	0.00 %	110.00 %	0		\$12,835.00	\$11,668
D5030	Communications and Security - Public Address & Clock System	\$0.88	S.F.	5,478	15	2000	2015		0.00 %	110.00 %	0		\$5,303.00	\$4,821
D5030	Communications and Security - Security & CCTV	\$0.88	S.F.	5,478	15	2000	2015	2015	0.00 %	110.00 %	0		\$5,303.00	\$4,821
		Total							55.50 %	20.05 %				\$183,317.65
														\$914,268

School Assessment Report - 2000 Gym

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$183,318	\$0	\$0	\$0	\$0	\$125,324	\$0	\$0	\$99,336	\$0	\$11,418	\$419,396
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$0	\$0	\$0	\$0	\$0	\$24,170	\$0	\$0	\$0	\$0	\$0	\$24,170
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Paint	\$8,496	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$11,418	\$19,914
C3020 - Floor Finishes - Ceramic Tile	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Neoprene	\$78,417	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$99,336	\$0	\$0	\$177,753
C3020 - Floor Finishes - VCT	\$0	\$0	\$0	\$0	\$0	\$0	\$1,751	\$0	\$0	\$0	\$0	\$1,751
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$30,108	\$0	\$0	\$0	\$0	\$0	\$30,108
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


School Assessment Report - 2000 Gym

D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0	\$67,480	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$67,480
D2020 - Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2030 - Sanitary Waste	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2090 - Other Plumbing Systems - Natural Gas	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3040 - Distribution Systems & Exhaust Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3050 - Terminal & Package Units	\$70,201	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$70,201
D3060 - Controls & Instrumentation	\$0	\$0	\$0	\$0	\$0	\$1,817	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,817
D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D4010 - Sprinklers	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting	\$2,763	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$2,763
D5030 - Communications and Security - Fire Alarm	\$12,835	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$12,835
D5030 - Communications and Security - Public Address & Clock System	\$5,303	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$5,303
D5030 - Communications and Security - Security & CCTV	\$5,303	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$5,303

* Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

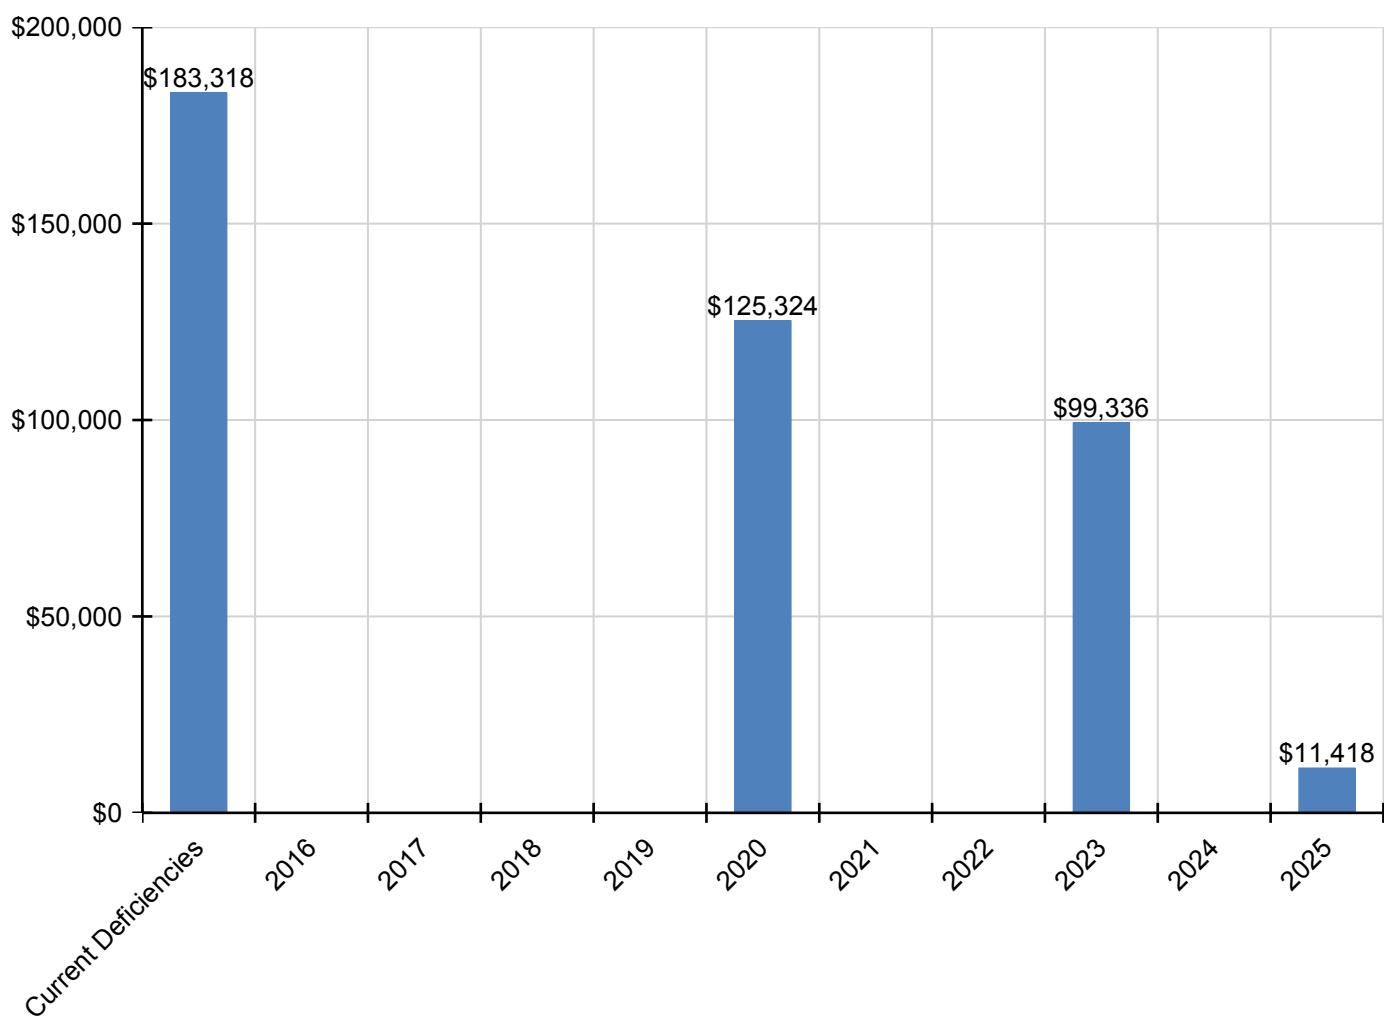


Deficiency Summary by System

Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

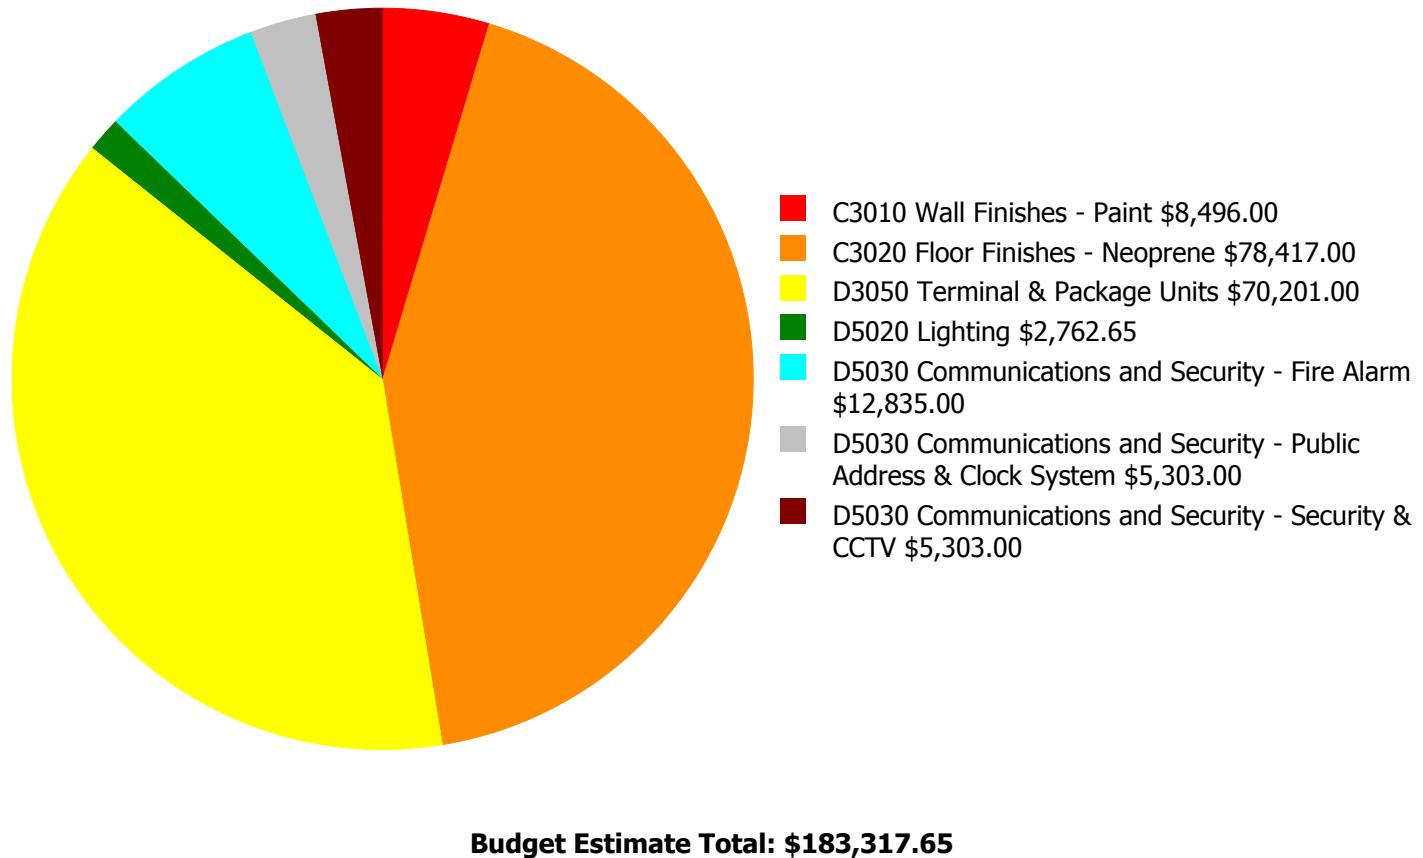

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

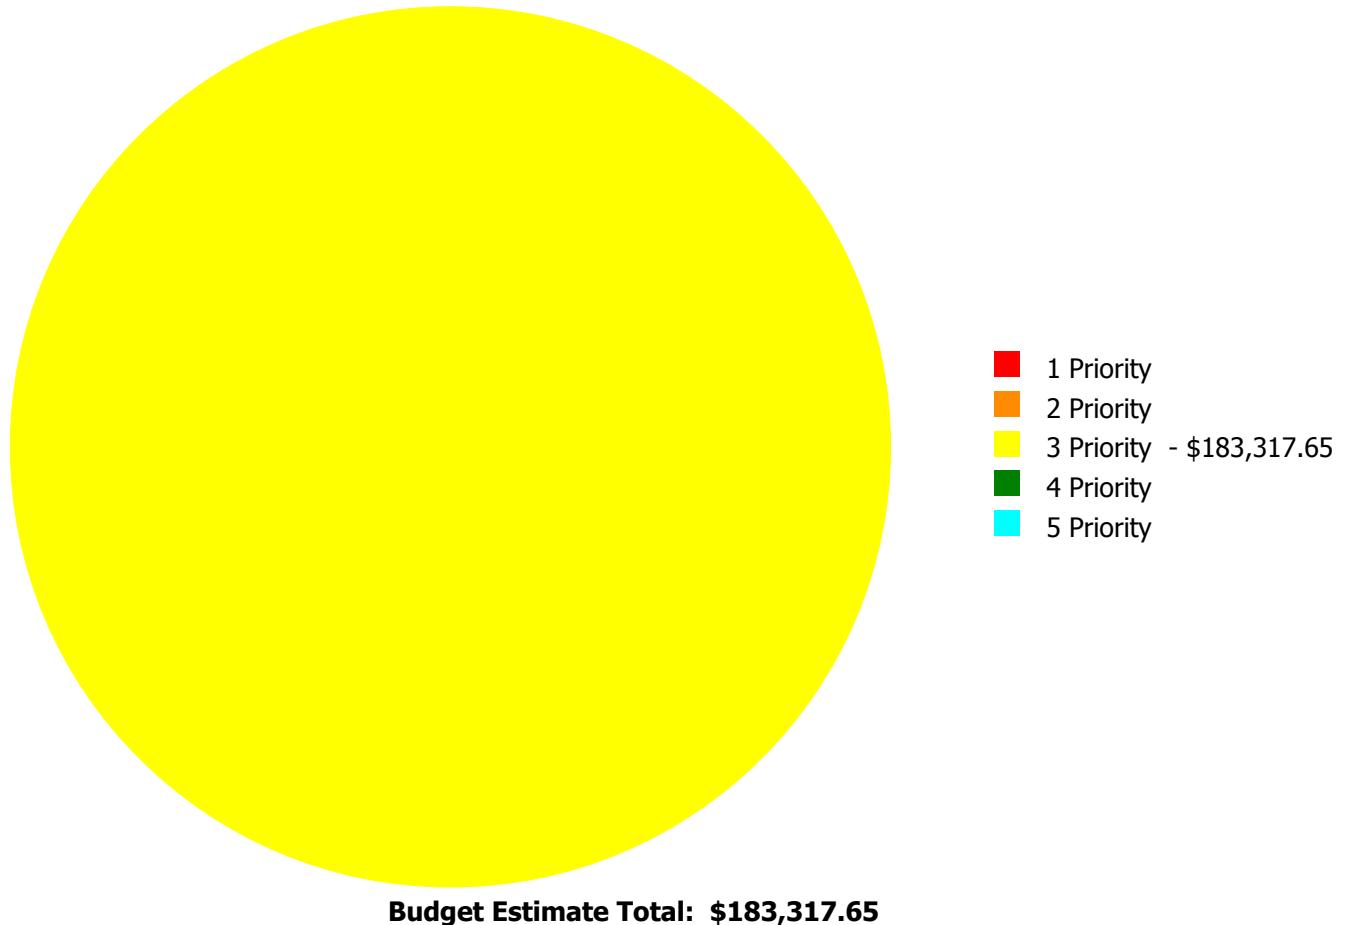

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards..
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
C3010	Wall Finishes - Paint	\$0.00	\$0.00	\$8,496.00	\$0.00	\$0.00	\$8,496.00
C3020	Floor Finishes - Neoprene	\$0.00	\$0.00	\$78,417.00	\$0.00	\$0.00	\$78,417.00
D3050	Terminal & Package Units	\$0.00	\$0.00	\$70,201.00	\$0.00	\$0.00	\$70,201.00
D5020	Lighting	\$0.00	\$0.00	\$2,762.65	\$0.00	\$0.00	\$2,762.65
D5030	Communications and Security - Fire Alarm	\$0.00	\$0.00	\$12,835.00	\$0.00	\$0.00	\$12,835.00
D5030	Communications and Security - Public Address & Clock System	\$0.00	\$0.00	\$5,303.00	\$0.00	\$0.00	\$5,303.00
D5030	Communications and Security - Security & CCTV	\$0.00	\$0.00	\$5,303.00	\$0.00	\$0.00	\$5,303.00
Total:		\$0.00	\$0.00	\$183,317.65	\$0.00	\$0.00	\$183,317.65

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

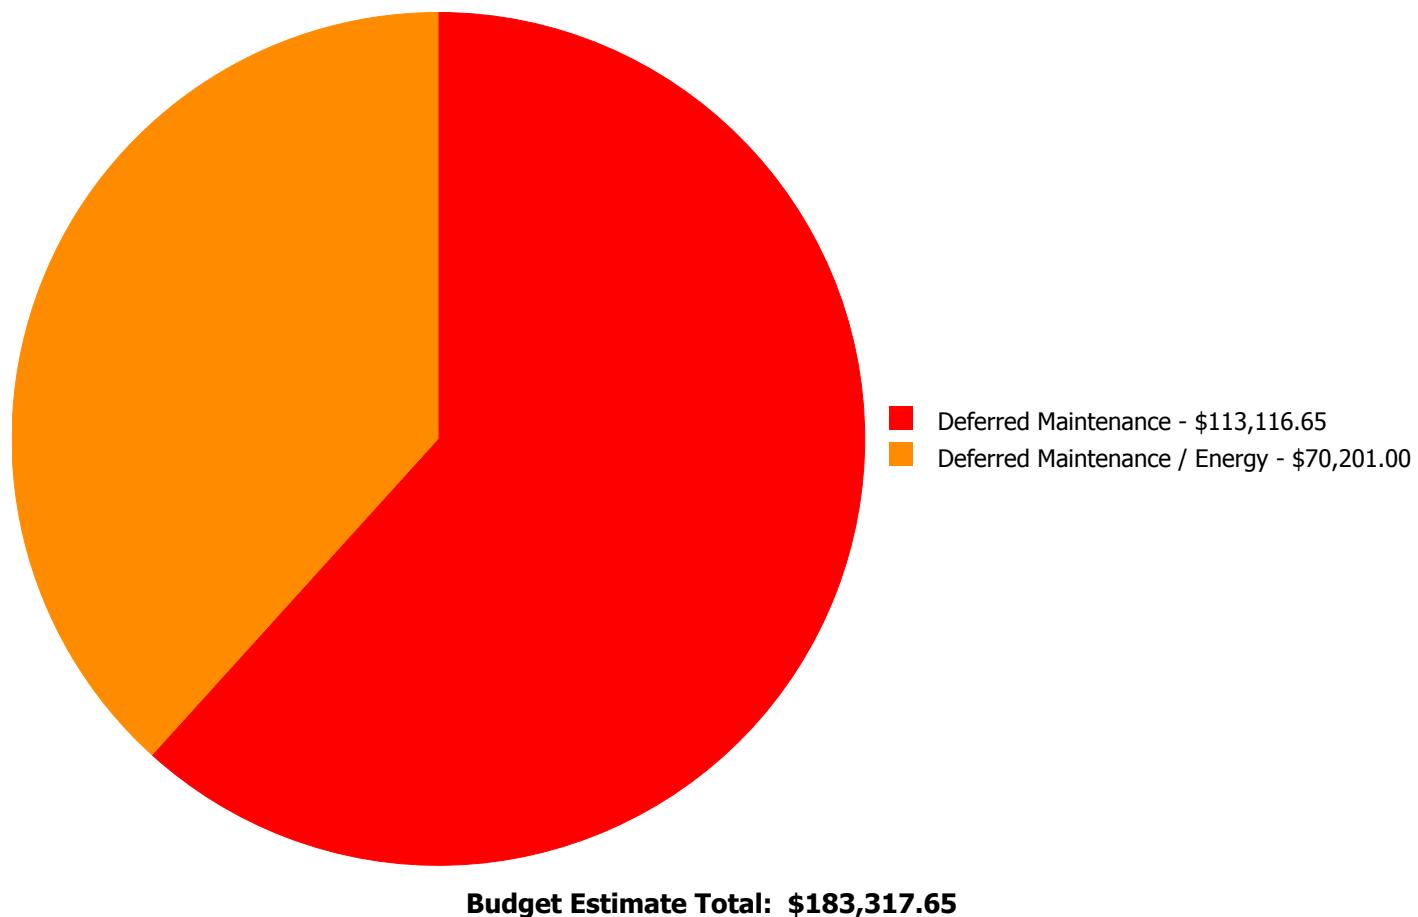

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 3 Priority:

System: C3010 - Wall Finishes - Paint



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.


Estimate: \$8,496.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The painted wall finishes are beyond their expected service life, damaged, faded and stained, and should be replaced.

System: C3020 - Floor Finishes - Neoprene

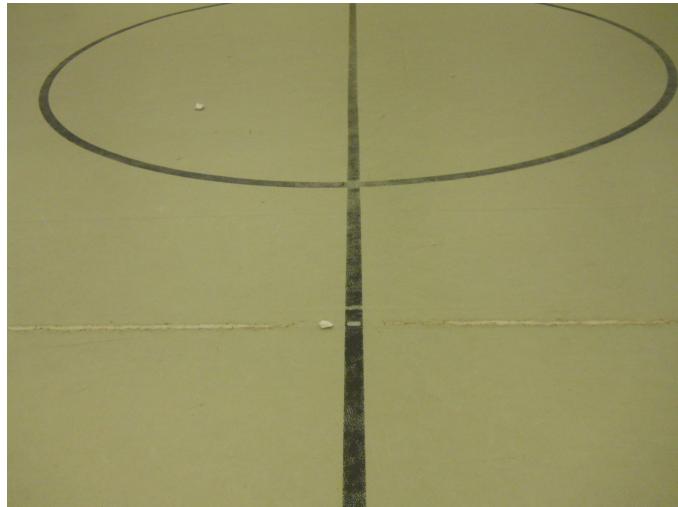

Location: Basketball Court

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 4,930.00

Unit of Measure: S.F.

Estimate: \$78,417.00

Assessor Name: Sam Mandola

Date Created: 04/11/2015

Notes: The athletic floor covering is beyond its expected service life, worn and separating, and should be replaced.

School Assessment Report - 2000 Gym

System: D3050 - Terminal & Package Units



Location: Throughout Building

Distress: Inadequate

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$70,201.00

Assessor Name: Sam Mandola

Date Created: 04/11/2015

Notes: One PTAC AC unit is located in the office area of the gym. It is beyond its expected service life. The main gym area does not have air conditioning and it should be provided. SPLOST project 400-422 to install a 20 ton HVAC package in the gym.

System: D5020 - Lighting



Location: Throughout Building

Distress: Inadequate

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Replace lamps (2 lamps), 4', 34 W energy saver

Qty: 64.00

Unit of Measure: Ea.

Estimate: \$2,762.65

Assessor Name: Sam Mandola

Date Created: 04/16/2015

Notes: Re-lamp and ballast the light fixtures from T12 to T8 lamps.

School Assessment Report - 2000 Gym

System: D5030 - Communications and Security - Fire Alarm



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$12,835.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The fire alarm system is beyond its expected service life and should be scheduled for replacement.

System: D5030 - Communications and Security - Public Address & Clock System



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$5,303.00

Assessor Name: Ben Nixon

Date Created: 06/25/2015

Notes: The public address and clock system is beyond its expected service life and should be scheduled for replacement.

School Assessment Report - 2000 Gym

System: D5030 - Communications and Security - Security & CCTV



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$5,303.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The security and CCTV systems are beyond their expected service life and should be scheduled for replacement.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	56,558
Year Built:	1955
Last Renovation:	
Replacement Value:	\$1,299,682
Repair Cost:	\$1,131,424.90
Total FCI:	87.05 %
Total RSLI:	8.08 %
FCA Score:	12.95



Description:

The Ashford Elementary School site was originally constructed in 1955, has a total area of 7 acres, and is occupied by approximately 56,598 square feet of permanent building space. Campus site features include paved driveways and parking lots, pedestrian pavement, flag pole, landscaping, and fencing. Site mechanical and electrical features include water, sewer, natural gas, and site lighting. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report for the site features.

Attributes:

General Attributes:

Site Code:	1025
------------	------

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
G20 - Site Improvements	7.18 %	90.24 %	\$611,939.67
G30 - Site Mechanical Utilities	2.93 %	98.26 %	\$406,256.11
G40 - Site Electrical Utilities	21.23 %	54.40 %	\$113,229.12
Totals:	8.08 %	87.05 %	\$1,131,424.90

Photo Album

The photo album consists of the various cardinal directions of the building.

1). Aerial Image of Ashford Park Elementary School - Oct 20, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

School Assessment Report - Site

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
G2010	Roadways	\$5.17	S.F.	11,419	25	1955	1980		0.00 %	110.00 %	-35		\$64,939.85	\$59,036
G2020	Parking Lots	\$4.56	S.F.	6,523	25	1955	1980		0.00 %	110.00 %	-35		\$32,719.37	\$29,745
G2030	Pedestrian Paving	\$1.50	S.F.	56,558	30	1955	1985		0.00 %	110.00 %	-30		\$93,320.70	\$84,837
G2040	Baseball Field	\$8.35	S.F.		20	1955	1975		0.00 %	0.00 %	-40			\$0
G2040	Canopies	\$0.29	S.F.		25	1955	1980		0.00 %	0.00 %	-35			\$0
G2040	Covered Walkways	\$48.72	S.F.	2,500	25	2000	2025		40.00 %	0.00 %	10			\$121,800
G2040	Fencing & Guardrails	\$0.91	S.F.	56,558	30	1955	1985		0.00 %	110.00 %	-30		\$56,614.56	\$51,468
G2040	Football Field	\$5.85	S.F.		20	1955	1975		0.00 %	0.00 %	-40			\$0
G2040	Hard Surface Play Area	\$6.26	S.F.	7,726	20	1955	1975		0.00 %	110.00 %	-40		\$53,201.24	\$48,365
G2040	Playing Field	\$3.92	S.F.	51,237	20	1955	1975		0.00 %	110.00 %	-40		\$220,933.94	\$200,849
G2040	Soccer/Lacross Field	\$5.00	S.F.		20	1955	1975		0.00 %	0.00 %	-40			\$0
G2040	Softball Field	\$8.86	S.F.		20	1955	1975		0.00 %	0.00 %	-40			\$0
G2040	Tennis Courts	\$18.47	S.F.		20	1955	1975		0.00 %	0.00 %	-40			\$0
G2040	Track	\$7.04	S.F.		10	1955	1965		0.00 %	0.00 %	-50			\$0
G2050	Landscaping	\$1.45	S.F.	56,558	10	1955	1965		0.00 %	110.00 %	-50		\$90,210.01	\$82,009
G3010	Water Supply	\$1.83	S.F.	56,558	50	1955	2005		0.00 %	110.00 %	-10		\$113,851.25	\$103,501
G3020	Sanitary Sewer	\$1.15	S.F.	56,558	50	1955	2005		0.00 %	110.00 %	-10		\$71,545.87	\$65,042
G3030	Storm Sewer	\$3.55	S.F.	56,558	50	1955	2005		0.00 %	110.00 %	-10		\$220,858.99	\$200,781
G3060	Fuel Distribution	\$0.78	S.F.	56,558	40	1986	2026		27.50 %	0.00 %	11			\$44,115
G4010	Electrical Distribution	\$1.86	S.F.	56,558	50	1986	2036		42.00 %	0.00 %	21			\$105,198
G4020	Site Lighting	\$1.15	S.F.	56,558	30	1986	2016	2015	0.00 %	110.00 %	0		\$71,545.87	\$65,042
G4030	Site Communications & Security	\$0.67	S.F.	56,558	10	1955	1965		0.00 %	110.00 %	-50		\$41,683.25	\$37,894
Total													\$1,131,424.90	\$1,299,682

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

School Assessment Report - Site


Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$1,131,425	\$0	\$357,311	\$1,488,736								
G - Building Sitework	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G20 - Site Improvements	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2010 - Roadways	\$64,940	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$64,940
G2020 - Parking Lots	\$32,719	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$32,719
G2030 - Pedestrian Paving	\$93,321	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$93,321
G2040 - Baseball Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Canopies	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Covered Walkways	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$180,058	\$180,058
G2040 - Fencing & Guardrails	\$56,615	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$56,615
G2040 - Football Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Hard Surface Play Area	\$53,201	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$53,201
G2040 - Playing Field	\$220,934	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$220,934
G2040 - Soccer/Lacross Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Softball Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Tennis Courts	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Track	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2050 - Landscaping	\$90,210	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$121,235	\$211,445
G30 - Site Mechanical Utilities	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G3010 - Water Supply	\$113,851	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$113,851
G3020 - Sanitary Sewer	\$71,546	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$71,546
G3030 - Storm Sewer	\$220,859	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$220,859
G3060 - Fuel Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G40 - Site Electrical Utilities	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G4010 - Electrical Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G4020 - Site Lighting	\$71,546	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$71,546
G4030 - Site Communications & Security	\$41,683	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$56,018	\$97,702

* Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

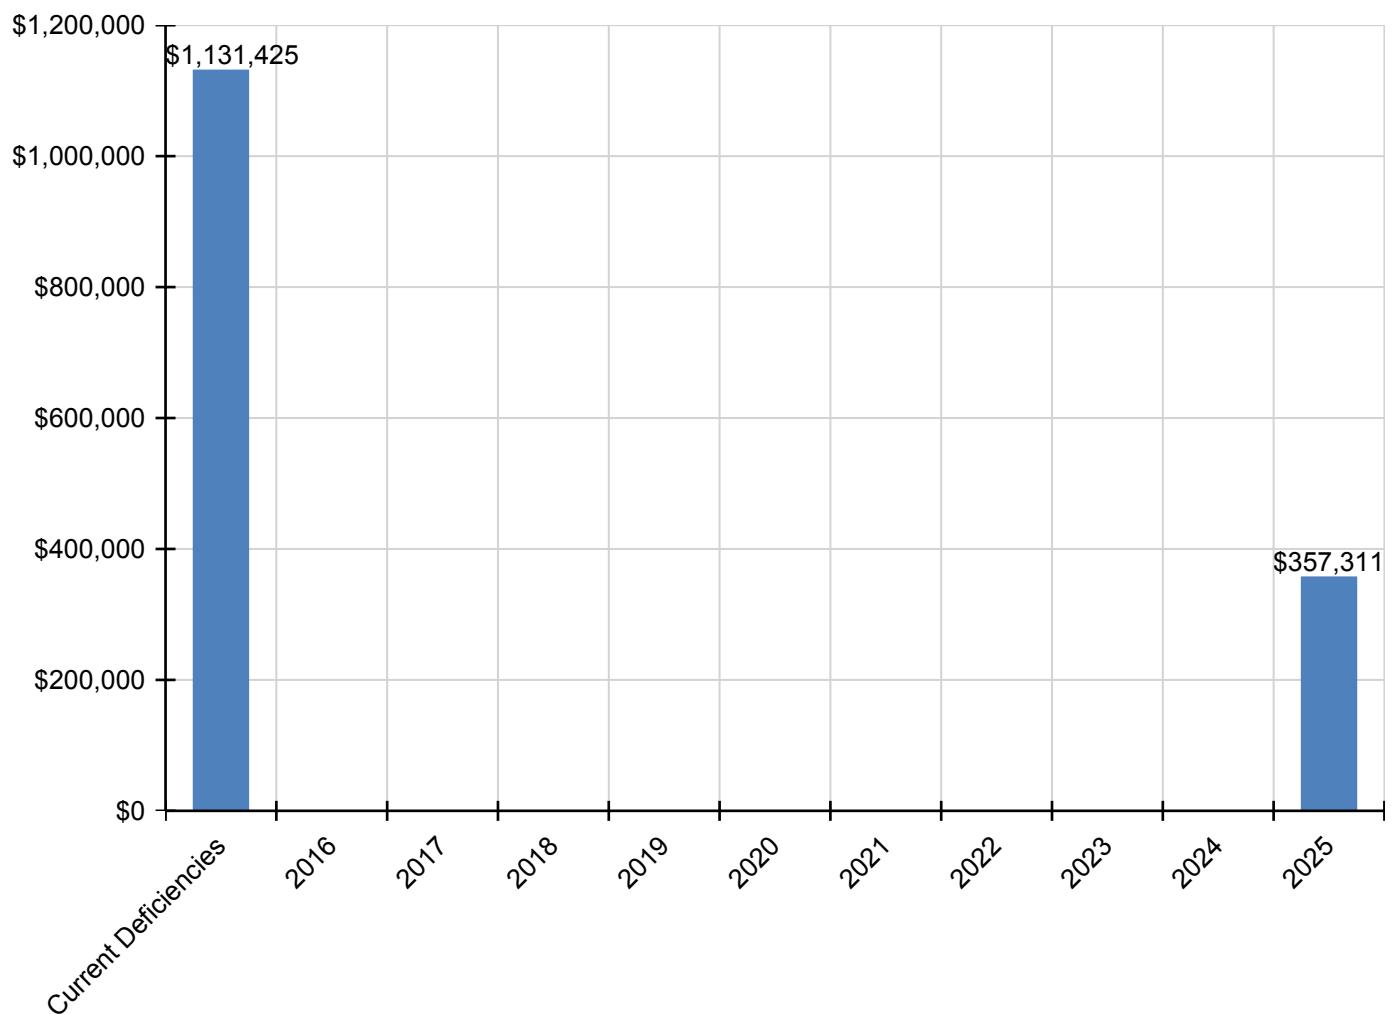


Deficiency Summary by System

Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

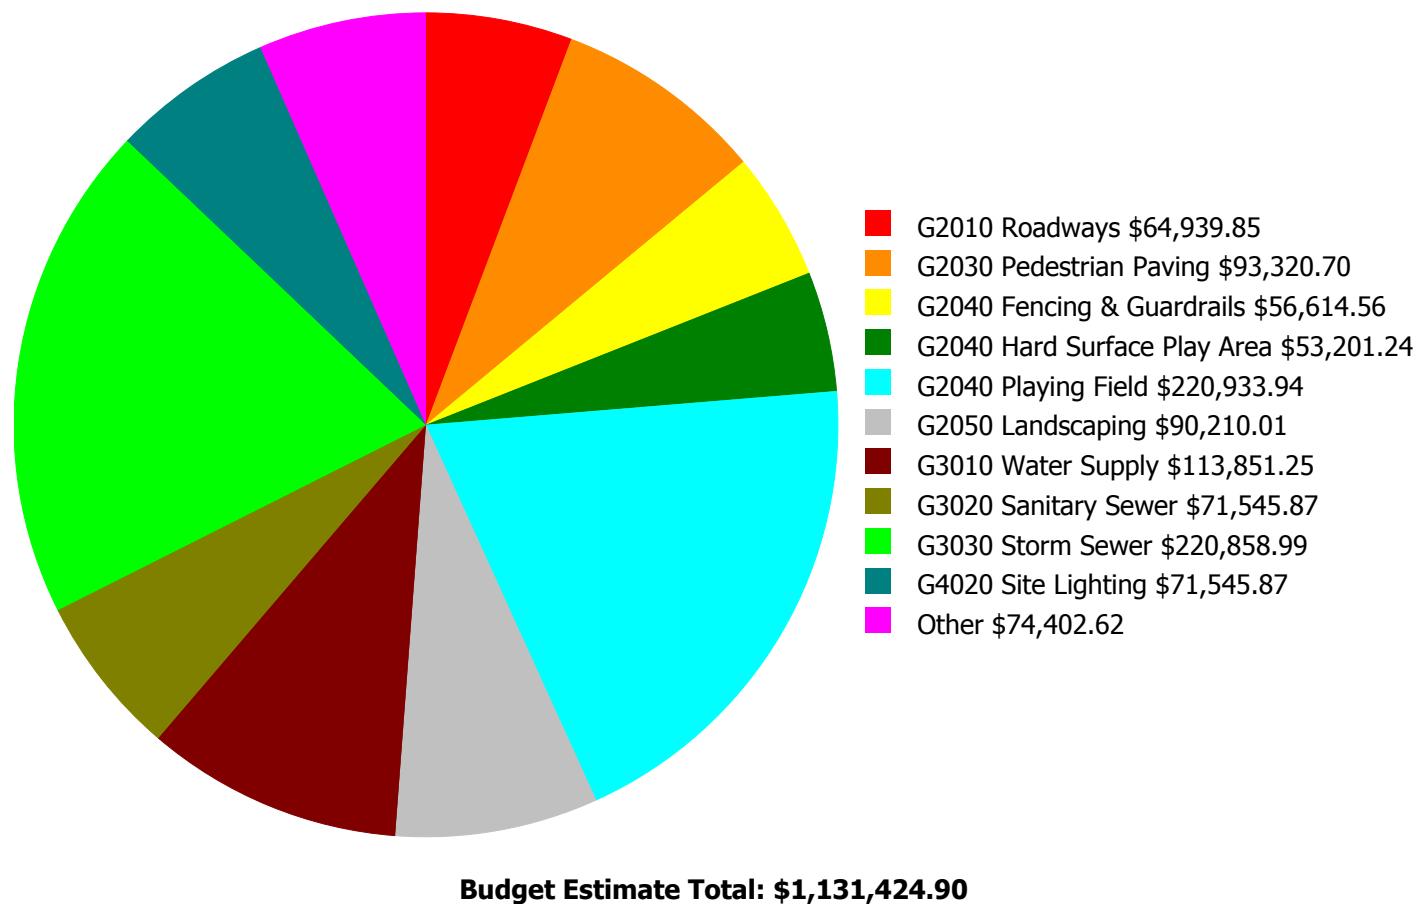

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

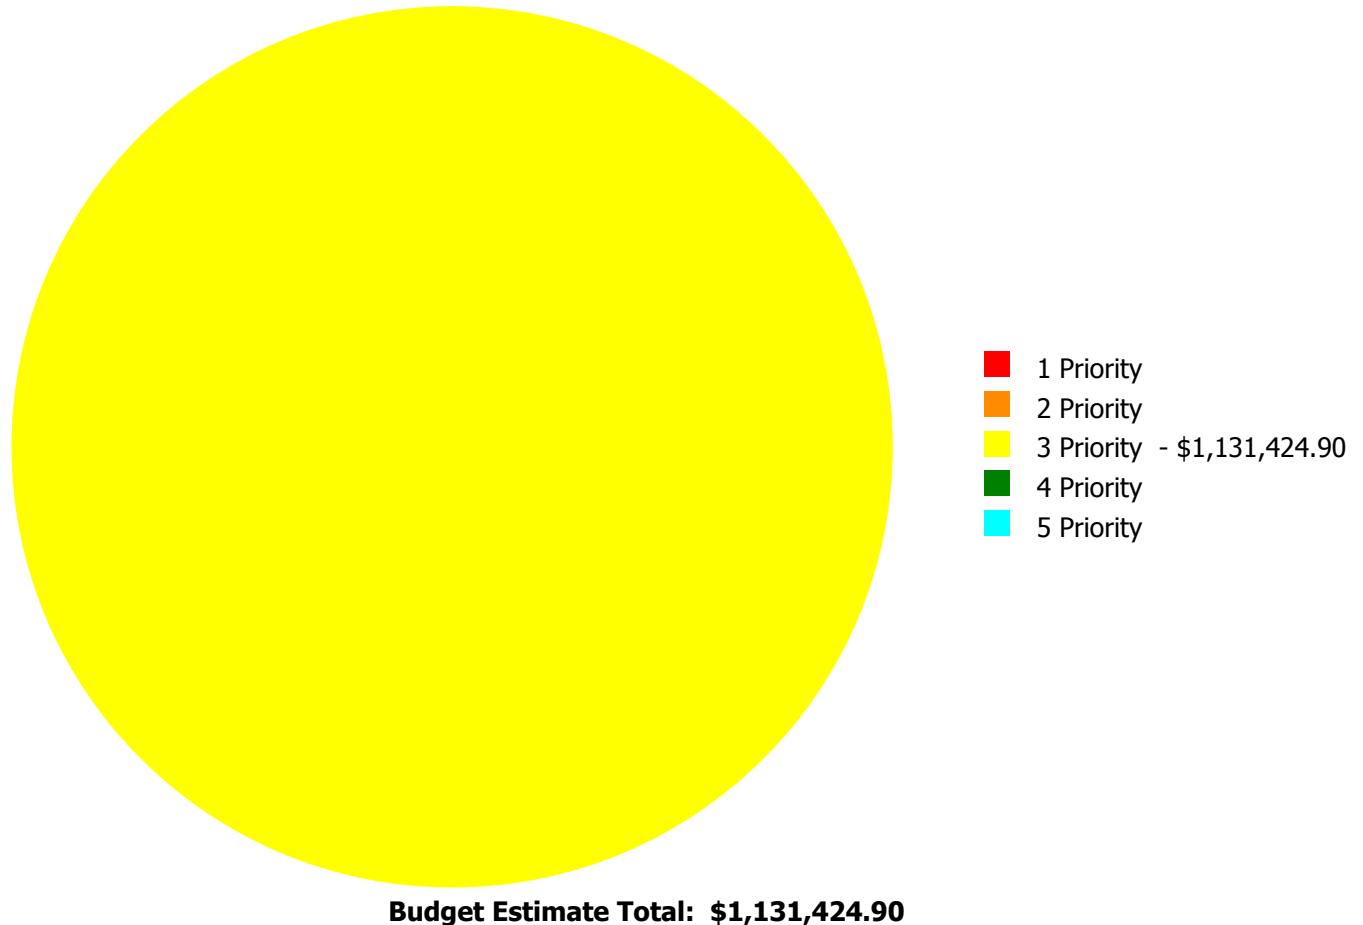

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards..
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
G2010	Roadways	\$0.00	\$0.00	\$64,939.85	\$0.00	\$0.00	\$64,939.85
G2020	Parking Lots	\$0.00	\$0.00	\$32,719.37	\$0.00	\$0.00	\$32,719.37
G2030	Pedestrian Paving	\$0.00	\$0.00	\$93,320.70	\$0.00	\$0.00	\$93,320.70
G2040	Fencing & Guardrails	\$0.00	\$0.00	\$56,614.56	\$0.00	\$0.00	\$56,614.56
G2040	Hard Surface Play Area	\$0.00	\$0.00	\$53,201.24	\$0.00	\$0.00	\$53,201.24
G2040	Playing Field	\$0.00	\$0.00	\$220,933.94	\$0.00	\$0.00	\$220,933.94
G2050	Landscaping	\$0.00	\$0.00	\$90,210.01	\$0.00	\$0.00	\$90,210.01
G3010	Water Supply	\$0.00	\$0.00	\$113,851.25	\$0.00	\$0.00	\$113,851.25
G3020	Sanitary Sewer	\$0.00	\$0.00	\$71,545.87	\$0.00	\$0.00	\$71,545.87
G3030	Storm Sewer	\$0.00	\$0.00	\$220,858.99	\$0.00	\$0.00	\$220,858.99
G4020	Site Lighting	\$0.00	\$0.00	\$71,545.87	\$0.00	\$0.00	\$71,545.87
G4030	Site Communications & Security	\$0.00	\$0.00	\$41,683.25	\$0.00	\$0.00	\$41,683.25
	Total:	\$0.00	\$0.00	\$1,131,424.90	\$0.00	\$0.00	\$1,131,424.90

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

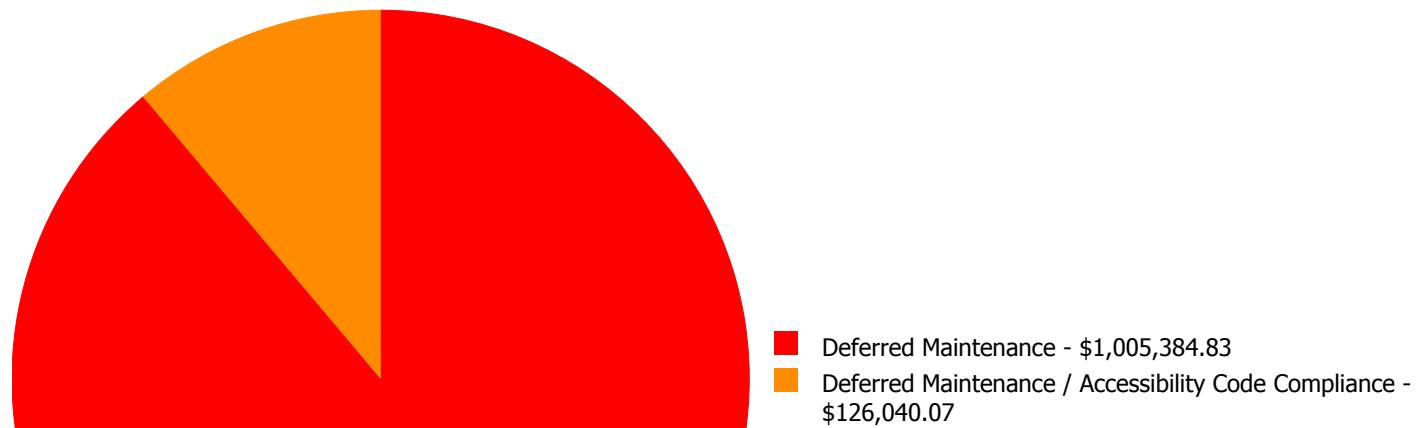

Budget Estimate Total: \$1,131,424.90

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 3 Priority:

System: G2010 - Roadways



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 11,419.00

Unit of Measure: S.F.

Estimate: \$64,939.85

Assessor Name: Eduardo Lopez

Date Created: 04/16/2015

Notes: Roadways are beyond their expected service life and should be scheduled for replacement.

System: G2020 - Parking Lots



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 6,523.00

Unit of Measure: S.F.

Estimate: \$32,719.37

Assessor Name: Eduardo Lopez

Date Created: 04/16/2015

Notes: The parking lots are beyond their expected service life, inadequate for school staff, not ADA compliant, and should be replaced. Parking spaces are not paved or properly marked on the pavement or with signage.

School Assessment Report - Site

System: G2030 - Pedestrian Paving



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 56,558.00

Unit of Measure: S.F.

Estimate: \$93,320.70

Assessor Name: Eduardo Lopez

Date Created: 04/16/2015

Notes: Pedestrian paving is beyond its expected service life, badly damaged with trip hazards, not ADA compliant, and should be scheduled for replacement.

System: G2040 - Fencing & Guardrails



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 56,558.00

Unit of Measure: S.F.

Estimate: \$56,614.56

Assessor Name: Eduardo Lopez

Date Created: 04/16/2015

Notes: Fencing is beyond its expected service life and should be scheduled for replacement.

School Assessment Report - Site

System: G2040 - Hard Surface Play Area



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 7,726.00

Unit of Measure: S.F.

Estimate: \$53,201.24

Assessor Name: Eduardo Lopez

Date Created: 04/16/2015

Notes: The hard surface play area is beyond its expected service life, damaged with cracks and loss of surface, and should be replaced.

System: G2040 - Playing Field



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 51,237.00

Unit of Measure: S.F.

Estimate: \$220,933.94

Assessor Name: Eduardo Lopez

Date Created: 10/30/2015

Notes: The playing field is beyond its expected service life, worn and bare, and should be replaced to prevent erosion.

School Assessment Report - Site

System: G2050 - Landscaping



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 56,558.00

Unit of Measure: S.F.

Estimate: \$90,210.01

Assessor Name: Eduardo Lopez

Date Created: 04/16/2015

Notes: Landscaping is beyond its expected service life and should be scheduled for replacement.

System: G3010 - Water Supply



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 56,558.00

Unit of Measure: S.F.

Estimate: \$113,851.25

Assessor Name: Eduardo Lopez

Date Created: 04/16/2015

Notes: The site water supply system is beyond its expected service life and should be scheduled for replacement.

School Assessment Report - Site

System: G3020 - Sanitary Sewer



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 56,558.00

Unit of Measure: S.F.

Estimate: \$71,545.87

Assessor Name: Eduardo Lopez

Date Created: 04/16/2015

Notes: The site sanitary sewer system is beyond its expected service life and should be scheduled for replacement.

System: G3030 - Storm Sewer



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 56,558.00

Unit of Measure: S.F.

Estimate: \$220,858.99

Assessor Name: Eduardo Lopez

Date Created: 04/16/2015

Notes: The storm sewer system is beyond its expected service life and should be scheduled for replacement.

School Assessment Report - Site

System: G4020 - Site Lighting



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 56,558.00

Unit of Measure: S.F.

Estimate: \$71,545.87

Assessor Name: Eduardo Lopez

Date Created: 05/05/2015

Notes: Site lighting is beyond its expected service life, inadequate, and should be scheduled for replacement.

System: G4030 - Site Communications & Security



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 56,558.00

Unit of Measure: S.F.

Estimate: \$41,683.25

Assessor Name: Eduardo Lopez

Date Created: 04/16/2015

Notes: The site communications and security systems are beyond their expected service life and should be scheduled for replacement.

Glossary

Abandoned	A facility owned by a district that is not occupied and not maintained. See Vacant.
Additional Cost	Total project cost is composed of hard and soft costs. Additional costs or soft expenses are costs that are necessary to accomplish the corrective work but are not directly attributable to the deficient systems direct construction cost, which are often referred to as hard cost. The components included in the soft costs vary by owner but usually include architect and contractor fees, contingencies and other owner-incurred costs necessary to fully develop and build a facility. These soft cost factors can be adjusted anytime within the eCOMET® database at the owner's discretion.
Assessment	Visual survey of a facility to determine its condition. It involves looking at the age of systems, reviewing information from local sources and visual evidence of potential problems to assign a condition rating. It does not include destructive testing of materials or testing of systems or equipment for functionality.
ASTM	ASTM International (ASTM): Originally known as the American Society for Testing and Materials, ASTM is an international standards organization that develops and publishes voluntary consensus technical standards for a wide range of materials, products, systems, and services.
BOMA	Building Owners Managers of America (BOMA): National organization of public and private facility owners focused on building management tools and maintenance techniques. eCOMET® reference: Building and component system effective economic life expectancies.
Building	A fully enclosed and roofed structure that can be traversed internally without exiting to the exterior.
Building Addition	An area, space or component of a building added to a building after the original building's year built date. NOTE: As a convention in the database, "Main" was used to designate the original building. Additions built prior to 1983 (30 years) were included in the main building area calculations to reflect their predicted system depreciation characteristics and remaining service life.
Building Systems	eCOMET® uses UNIFORMAT II to organize building data. UNIFORMAT II was originally developed by the federal General Services Administration to delineate building costs by systems rather than by material. UNIFORMAT II was formalized by an NIST standard, NISTIR 6389 in 1999. It has been further quantified and updated by ASTM standard 2005, E1557-05. The Construction Specifications Institute, CSI, has taken over the standard as part of their MasterFormat / MasterSpec system.
Calculated Next Renewal	The year a system or building element would be expected to expire based solely on the date it was installed and the expected useful lifetime for that kind of system.
Capital Renewal	Capital renewal refers to the cyclical replacement of building systems or elements as they become obsolete or beyond their useful life. It is not normally included in an annual operating/maintenance budget. See calculated next renewal and next renewal.
City Cost Index (CCI)	RS Means provides building system, equipment, and construction costs at a national level. The City Cost Index (also provided by RS Means) localizes those costs to a geographic region of the United States. In eCOMET®, each building or site is assigned a City Cost Index, which adjusts all of the associated costs for systems, deficiencies and inventory to the local value.
Condition	Condition refers to the state of physical fitness or readiness of a facility system or system element for its intended use.
Condition Budget	The Condition Budget, also known as Condition Needs, represents the budgeted contractor installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging the work.

School Assessment Report - Ashford Park Elementary

Condition Index (CI) %	The Condition Index (CI) also known as the Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) Value divided by the sum of a system's Replacement Value (both values exclude soft cost to simplify calculation updates) expressed as a percentage ranging from 100.00% (new) to 0.00% (expired - no remaining life).
Construction Specifications Institute	Construction Specifications Institute: Primary national organization specializing in construction materials data and data location in construction documents. eCOMET® reference: UNIFORMAT II materials classification.
Correction	Correction refers to an assessor's recommended deficiency repair or replacement action. For any system or element deficiency, there can be multiple and alternative solutions for its repair or replacement. A Correction is user defined and tied to a UNIFORMAT II element, or system it is intended to address. It excludes other peripheral costs that may also be included in the packaging of repair, replacement or renewal improvements that may also be triggered by the deficiency correction.
Cost Model	A cost model is a list of facility systems which could represent the installed systems a given facility. Included in the cost model are standard unit cost estimates, gross areas, life cycles and installed dates. Also represented is the repair cost for deficient systems, replacement values. See eCOMET® cost models.
Criteria	Criteria refer to the set of requirements, guidelines or standards that are assessed and rated to develop a score.
Current Period	The Current Period is the current year plus a user defined number of forward years.
Current Replacement Value (CRV)	The Current Replacement Value (CRV) of a facility, building or system represents the hypothetical cost of rebuilding or replacing an existing facility under today's codes and construction standards, using its current configuration. It is calculated by multiplying the gross area of the facility by a square foot cost developed in that facility's cost model. Replacement cost includes construction costs and owner's additional or soft costs for fees, permits and other expenses to reflect a total project cost.
Deferred Maintenance	Deferred maintenance is condition work deferred on a planned or unplanned basis to a future budget cycle or postponed until funds are available.
Deficiency	A deficiency is a repair item that is damaged, missing, inadequate or insufficient for an intended purpose.
Deficiency Category	Deficiency Category refers to the type or class of a user defined deficiency grouping with shared or similar characteristics. Category descriptions include, but are not limited to: Accessibility Code Compliance, Appearance, Building Code Compliance, Deferred Maintenance, Energy, Environmental, Life Safety Code Compliance, and Safety.
Deficiency Distress	Deficiency Distress refers to a user-defined root cause of a deficiency. Distress descriptions are: Beyond Service Life, Damaged, Inadequate, Needs Remediation, and Missing.
Deficiency Priority	Deficiency Priority refers to a deficiency's urgency for repair as determined by the assessment team. Deficiencies were assigned a priority of 1 through 5, with Priority 1 deficiencies being the most urgent.
eCOMET®	Energy and Condition Management Estimation Technology (eCOMET®) is Parsons proprietary facility asset management software developed to provide facility managers with a state of the art, web-based tool to develop and maintain a comprehensive database of FCA data and information used for facility asset management, maintenance and repair, and capital renewal planning. eCOMET® is used by Parsons and its clients as the primary tool for collecting FCA data, preparing cost estimates, generating individual facility reports and cost estimates, and developing the overall capital renewal program.

School Assessment Report - Ashford Park Elementary

eCOMET® Cost Models	eCOMET® cost models are derived from RS Means Square Foot Cost Data cost models and these models are used to develop the current replacement value (CRV) and assign life cycle costs to the various systems within a building. Cost models are assigned current costs-per-square-foot to establish replacement values. The Cost models are designed to represent a client specific facility that meets local standards cost trends.
Element	Elements are the major components that comprise building systems as defined by UNIFORMAT II.
Expected Life	Also referred to as Useful Life. See Useful Life definition.
Facility	A facility refers to site(s), building(s), or building addition(s), or combinations thereof that provide a particular service or support of an educational purpose.
Facility Attributes	Customizable eCOMET® fields to identify attributes specific to a facility. These fields are part of the eCOMET® database set-up with the owner.
Facility Condition Assessment (FCA)	A facility condition assessment (FCA) is a visual inspection of buildings and grounds at a facility to identify and estimate current and future needed repairs or replacements of major systems for planning and budgeting purposes. It is typically performed for organizations that are tasked with the day to day maintenance, operation, and capital renewal (replacement) of building systems and components of a large inventory of facilities. The primary goal of an FCA is to objectively and quantifiably identify, inspect, and prioritize the repair and replacement needs of the building and ground systems (e.g., roofs, windows, doors, floor finishes, plumbing fixtures, parking lot, and sidewalks) within facilities that have either failed or have surpassed their service life, and to identify and forecast future capital replacement needs for systems that have not yet failed, but planned replacement of those systems is needed to ensure that the facilities will continue to meet the mission of the organization.
Facility Condition Index (FCI)	FCI is an industry-standard measurement of a facility's condition expressed as a percentage from 0.00% to 100.00% that is derived by dividing the cost to correct a facility's deficiencies by its Current Replacement Value (CRV). The higher the FCI the poorer the condition of a facility. After an FCI is established for all buildings within a portfolio, a building's condition can be ranked relative to other buildings. The FCI may also represent the condition of a portfolio based on the cumulative FCIs of the portfolio's facilities.
Forecast Period	The Forecast Period refers to a user defined number of years forward of the Current Period.
Gen (Generate)	The Cost Model has a Gen box for each system line item. By checking the box, eCOMET® will generate life cycle deficiencies based on the Year Installed and the Life for that system. Systems that typically do not re-generate (foundations, floor construction, roof construction, basement walls, etc.) would not have the Gen box checked as those systems would not re-generate at the end of a life cycle. In those instances, it would be more practical and cost effective to demolish the entire facility than renew those systems.
Gross Square Feet (GSF)	The area of the enclosed floor space of a building or building addition in square feet measured to the outside face of the enclosing wall.
Life cycle	Life cycle refers to the period of time that a building or site system or element can be expected to adequately serve its intended function. Parsons assigns expected life cycles to all building systems based on Building Operators and Managers of America (BOMA) recommended life cycles, manufacturers suggested life, and RS Means cost data, and client-provided historical data. BOMA standards are a nationally recognized source of life cycle data for various components and/or systems associated with facilities. RS Means is a national company specializing in construction estimating and costs.
Next Renewal	Next Renewal refers to a manually-adjusted expected useful life of a system or element based on on-site inspection either by reducing or extending the Calculated Next Renewal to more accurately reflect current conditions.

School Assessment Report - Ashford Park Elementary

Order of Magnitude	Order of Magnitude refers to a rough approximation made with a degree of knowledge and confidence that the budgeted, projected or estimated cost falls within a reasonable range of cost values.
Remaining Service Life (RSL)	RSL is the number of years of service remaining for a system or equipment item. It is automatically calculated based on the difference between the current year and the Calculated Next Renewal date or the Next Renewal date whichever one is the later date.
Renewal Factors	Renewal factors represent the difference in cost of renovating or replacing an existing system, rather than new construction of a building system. For example, installing a new built-up roof on an existing building would include removing and disposing of the old roof, a cost not associated with new construction. Using a renewal premium to account for demolition and other difficulty costs, Parsons typically assigns a renewal factor of 110%.
Renewal Schedule	A timeline by year that indicates when the systems will need to be renewed and the estimated price of the renewal.
Repair Cost	Repair cost is the sum of all the deficiencies associated with a building or multiple buildings/facilities. It will include any applied soft costs or City Cost Indexes.
Replacement Value	See Current Replacement Value.
Site	A facility's grounds and its utilities, roadways, landscaping, fencing and other typical land improvements needed to support a facility.
Soft Costs	Soft Costs are a construction industry term that refers to expense items that are not considered direct construction costs. Soft costs are user-defined and include architectural, engineering, management, testing, and mitigation fees, and other owner pre- and post-construction expenses.
Sustainability	Sustainability refers to the collection of policies and strategies that meet society's present needs without compromising the ability of future generations to meet their own needs.
System	System refers to building and related site work elements as described by ASTM UNIFORMAT II Classification for Building Elements (E1557-97), a format for classifying major facility elements common to most buildings. Elements usually perform a given function regardless of the design specification construction method or materials used. See also UNIFORMAT II.
System Generated Deficiency	eCOMET® automatically generates system deficiencies based on system life cycles using the systems installation dates as the base year. By adjusting the Next Renewal date ahead or behind the predicted or stated life cycle date, a system cost will come due earlier or later than the originally installed life cycle date. This utility accounts for good maintenance conditions and a longer life, or early expiration of a system life due to any number of adverse factors such as poor installation, acts of god, material defects, poor design applications and other factors that may shorten the life of a material or system. It is important to mention that the condition of the systems is not necessarily a reflection of maintenance practices, but a combination of system usage and age.
UNIFORMAT	ASTM UNIFORMAT II, Classification for Building Elements (E1557-97), a publication of the Construction Specification Institute (CSI), is a format used to classify major facility components common to most buildings. The format is based on functional elements or parts of a facility characterized by their functions without regard to the materials and methods used to accomplish them. These elements are often referred to as systems or assemblies.
Unit Price	The Unit Price (Raw) x (100% + the Additional Cost Template percentage).
Unit Price (Raw)	The actual \$/sq. ft cost being used for the building and systems. It will include adjustments for the City Cost Index applied to the facility.

School Assessment Report - Ashford Park Elementary

Useful Life	Also known as Expected Life, Useful Life refers to the intrinsic period of time a system or element is expected to perform as intended. Useful life is generally provided by manufacturers of materials, systems and elements through their literature, testing and experience. Useful Lives in the database are derived from the Building Owners and Managers (BOMA) organization's guidelines, RSMeans cost data, and from client- defined historical experience.
Vacant	Vacant refers to a facility that is not occupied but is a maintained facility by a district. See Abandoned.
Year Built	The year that a building or addition was originally built based on its date of substantial completion or occupancy.
Year Installed	The year a system or element was built or the most recent major renovation date where a minimum of 70% of the system's Current Replacement Value (CRV) was replaced.