

DeKalb County School District/Elementary Schools

Hawthorne Elementary

Final

School Assessment Report

May 19, 2016



Table of Contents

School Executive Summary	4
School Condition Summary	6
<u>1961, 1963, 1966 Building</u>	8
Executive Summary	8
Condition Summary	9
Photo Album	10
Condition Detail	11
System Listing	12
Renewal Schedule	14
Forecasted Sustainment Requirement	17
Deficiency Summary By System	18
Deficiency Summary By Priority	19
Deficiency By Priority Investment	20
Deficiency Summary By Category	21
Deficiency Details By Priority	22
<u>2003 Gym</u>	36
Executive Summary	36
Condition Summary	37
Photo Album	38
Condition Detail	39
System Listing	40
Renewal Schedule	41
Forecasted Sustainment Requirement	43
Deficiency Summary By System	44
Deficiency Summary By Priority	45
Deficiency By Priority Investment	46
Deficiency Summary By Category	47
Deficiency Details By Priority	48
<u>Site</u>	49

School Assessment Report

Executive Summary	49
Condition Summary	50
Photo Album	51
Condition Detail	52
System Listing	53
Renewal Schedule	54
Forecasted Sustainment Requirement	56
Deficiency Summary By System	57
Deficiency Summary By Priority	58
Deficiency By Priority Investment	59
Deficiency Summary By Category	60
Deficiency Details By Priority	61
<u>Storage</u>	68
Executive Summary	68
Condition Summary	69
Photo Album	70
Condition Detail	71
System Listing	72
Renewal Schedule	73
Forecasted Sustainment Requirement	76
Deficiency Summary By System	77
Deficiency Summary By Priority	78
Deficiency By Priority Investment	79
Deficiency Summary By Category	80
Deficiency Details By Priority	81
Glossary	82

School Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as $100 - \text{Total FCI}$ (without the %) where 100 is best and 0 is worst condition.

Gross Area (SF):	53,528
Year Built:	1961
Last Renovation:	2011
Replacement Value:	\$12,517,775
Repair Cost:	\$7,882,525.00
Total FCI:	62.97 %
Total RSLI:	24.89 %
FCA Score:	37.03



Description:

The Hawthorne Elementary School campus consists of two buildings located at 2535 Caladium Drive NE in Atlanta, Georgia. The original campus was constructed in 1961, additions to the main school building were constructed in 1963 and 1966, and a gymnasium building was constructed in 2003. In addition to these buildings, the campus contains a storage building, covered walkway, hard surface play area, playing field, and playground. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report for each building and site improvement on the campus.

School Assessment Report - Hawthorne Elementary

Attributes:

General Attributes:

Assigned Region:	Region 2	Board District:	District 4
DOE Facility:	5057	Geographic Region:	Region 2
HS Attendance Area:	Lakeside HS	Jurisdictional City:	DeKalb County (Unincorporated)
Site Acreage:	12.3		

School Condition Summary

The Table below shows the RSLI and FCI for each major system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.


Current Investment Requirement and Condition by Uniformat Classification

UNIFORMAT Classification	RSLI%	FCI %	Current Repair
A10 - Foundations	50.88 %	0.00 %	\$0.00
A20 - Basement Construction	65.06 %	0.00 %	\$0.00
B10 - Superstructure	59.20 %	0.00 %	\$0.00
B20 - Exterior Enclosure	53.51 %	3.87 %	\$48,788.00
B30 - Roofing	83.93 %	0.19 %	\$2,032.00
C10 - Interior Construction	49.82 %	13.16 %	\$91,661.00
C20 - Stairs	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	24.50 %	47.36 %	\$798,501.00
D10 - Conveying	0.00 %	110.00 %	\$12,129.00
D20 - Plumbing	4.10 %	102.51 %	\$1,394,814.00
D30 - HVAC	2.08 %	106.16 %	\$2,081,476.00
D40 - Fire Protection	0.00 %	0.00 %	\$0.00
D50 - Electrical	2.95 %	102.66 %	\$1,314,660.00
E10 - Equipment	0.00 %	110.00 %	\$524,176.00
E20 - Furnishings	0.00 %	110.00 %	\$283,182.00
F10 - Special Construction	20.00 %	0.00 %	\$0.00
G20 - Site Improvements	2.75 %	104.19 %	\$729,933.03
G30 - Site Mechanical Utilities	0.00 %	110.00 %	\$384,491.62
G40 - Site Electrical Utilities	0.00 %	110.00 %	\$216,681.35
Totals:	24.89 %	62.97 %	\$7,882,525.00

Condition Deficiency Priority

Facility Name	Gross Area (S.F.)	FCI %	1 Priority	2 Priority	3 Priority	4 Priority	5 Priority
1961, 1963, 1966 Building	47,940	62.59	\$0.00	\$1,791,374.00	\$4,687,539.00	\$0.00	\$0.00
2003 Gym	5,478	7.71	\$0.00	\$0.00	\$70,201.00	\$0.00	\$0.00
Site	53,528	106.73	\$0.00	\$67,712.92	\$1,263,393.08	\$0.00	\$0.00
Storage	110	24.00	\$0.00	\$0.00	\$2,305.00	\$0.00	\$0.00
Total:		62.97	\$0.00	\$1,859,086.92	\$6,023,438.08	\$0.00	\$0.00

Deficiencies By Priority

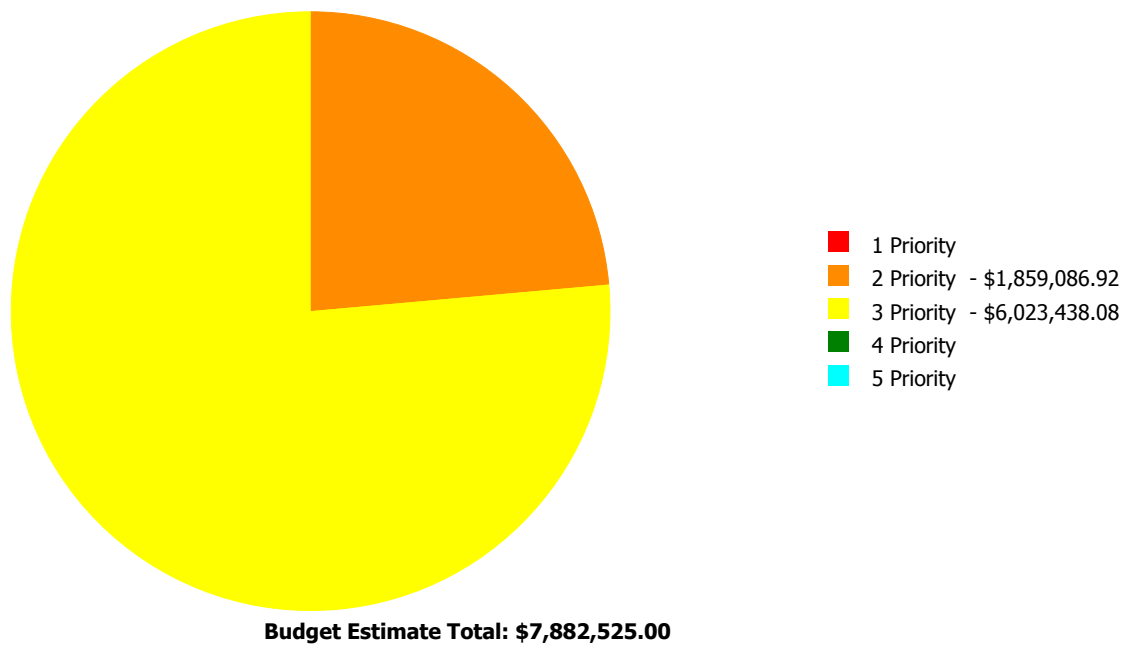

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	47,940
Year Built:	1961
Last Renovation:	2011
Replacement Value:	\$10,350,895
Repair Cost:	\$6,478,913.00
Total FCI:	62.59 %
Total RSLI:	24.22 %
FCA Score:	37.41



Description:

The main building at Hawthorne Elementary School is a one-story building located at 2535 Caladium Drive N.E. in Atlanta, Georgia. Originally built in 1961, there have been two additions in 1963 and 1966, two minor renovations in 1995 and 2011, and planned renovations under SPLOST IV. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:

Building Codes:	2010, 2011, 2012	Fire Sprinkler System:	No
-----------------	------------------	------------------------	----

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	46.00 %	0.00 %	\$0.00
A20 - Basement Construction	0.00 %	0.00 %	\$0.00
B10 - Superstructure	46.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	50.13 %	4.26 %	\$48,515.00
B30 - Roofing	84.08 %	0.00 %	\$0.00
C10 - Interior Construction	44.76 %	15.68 %	\$91,661.00
C20 - Stairs	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	24.14 %	50.36 %	\$798,501.00
D10 - Conveying	0.00 %	110.00 %	\$12,129.00
D20 - Plumbing	0.00 %	110.00 %	\$1,394,814.00
D30 - HVAC	0.00 %	110.00 %	\$2,011,275.00
D40 - Fire Protection	0.00 %	0.00 %	\$0.00
D50 - Electrical	0.00 %	110.00 %	\$1,314,660.00
E10 - Equipment	0.00 %	110.00 %	\$524,176.00
E20 - Furnishings	0.00 %	110.00 %	\$283,182.00
F10 - Special Construction	20.00 %	0.00 %	\$0.00
Totals:	24.22 %	62.59 %	\$6,478,913.00

Photo Album

The photo album consists of the various cardinal directions of the building.

1). West Elevation - Jul 16, 2015



2). North Elevation - Jul 16, 2015



3). South Elevation - Jul 16, 2015



4). East Elevation - Jul 16, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

School Assessment Report - 1961, 1963, 1966 Building

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$6.49	S.F.	47,940	100	1961	2061		46.00 %	0.00 %	46			\$311,131
A1020	Special Foundations	\$4.46	S.F.		100				0.00 %	0.00 %				\$0
A1030	Slab on Grade	\$7.09	S.F.	47,940	100	1961	2061		46.00 %	0.00 %	46			\$339,895
A2010	Basement Excavation	\$0.00	S.F.		100	1961	2061		46.00 %	0.00 %	46			\$0
A2020	Basement Walls	\$0.00	S.F.		100	1961	2061		46.00 %	0.00 %	46			\$0
B1010	Floor Construction	\$0.00	S.F.		100	1961	2061		46.00 %	0.00 %	46			\$0
B1020	Roof Construction	\$5.34	S.F.	47,940	100	1961	2061		46.00 %	0.00 %	46			\$256,000
B2010	Exterior Walls	\$16.02	S.F.	47,940	100	1961	2061		46.00 %	0.00 %	46			\$767,999
B2020	Exterior Windows	\$6.79	S.F.	47,940	30	2005	2035		66.67 %	0.00 %	20			\$325,513
B2030	Exterior Doors	\$0.92	S.F.	47,940	30	1961	1991		0.00 %	110.00 %	-24		\$48,515.00	\$44,105
B3010	Roof Coverings - Asphal Shingles	\$0.00	S.F.		10	1961	1971		0.00 %	0.00 %	-44			\$0
B3010	Roof Coverings - BUR	\$20.70	S.F.	47,940	25	2011	2036		84.00 %	0.00 %	21			\$992,358
B3010	Roof Coverings - EPDM	\$0.00	S.F.		15	1961	1976		0.00 %	0.00 %	-39			\$0
B3010	Roof Coverings - Preformed Metal	\$0.00	S.F.		30	1961	1991		0.00 %	0.00 %	-24			\$0
B3010	Roof Coverings - Standing Seam Metal	\$0.00	S.F.		75	1961	2036		28.00 %	0.00 %	21			\$0
B3020	Roof Openings	\$0.63	S.F.	47,940	30	2011	2041		86.67 %	0.00 %	26			\$30,202
C1010	Partitions	\$7.01	S.F.	47,940	100	1961	2061		46.00 %	0.00 %	46			\$336,059
C1020	Interior Doors	\$2.39	S.F.	47,940	30	1961	1991		0.00 %	80.00 %	-24		\$91,661.00	\$114,577
C1030	Fittings	\$2.79	S.F.	47,940	20	2011	2031		80.00 %	0.00 %	16			\$133,753
C2010	Stair Construction	\$1.81	S.F.	0	100	1961	2061		46.00 %	0.00 %	46			\$0
C3010	Wall Finishes - Ceramic & Glazed	\$10.27	S.F.	26,709	30	1961	1991		0.00 %	110.00 %	-24		\$301,732.00	\$274,301
C3010	Wall Finishes - Paint	\$1.93	S.F.	26,709	10	1961	1971		0.00 %	110.00 %	-44		\$56,703.00	\$51,548
C3010	Wall Finishes - Wall Coverings	\$0.00	S.F.		10	1961	1971		0.00 %	0.00 %	-44			\$0
C3020	Floor Finishes - Carpet	\$8.50	S.F.	4,551	8	1961	1969		0.00 %	110.00 %	-46		\$42,552.00	\$38,684
C3020	Floor Finishes - Ceramic & Quarry Tile	\$14.49	S.F.	3,242	50	1961	2011		0.00 %	110.00 %	-4		\$51,674.00	\$46,977
C3020	Floor Finishes - Terrazzo	\$53.01	S.F.	7,191	50	1961	2011		0.00 %	0.00 %	-4			\$381,195
C3020	Floor Finishes - VCT	\$9.54	S.F.	32,956	20	1961	1981		0.00 %	110.00 %	-34		\$345,840.00	\$314,400
C3020	Floor Finishes - Wood	\$0.00	S.F.		20	1961	1981		0.00 %	0.00 %	-34			\$0
C3030	Ceiling Finishes	\$9.98	S.F.	47,940	20	2011	2031		80.00 %	0.00 %	16			\$478,441
D1010	Elevators and Lifts	\$0.23	S.F.	47,940	30			2015	0.00 %	110.00 %	0		\$12,129.00	\$11,026
D2010	Plumbing Fixtures	\$17.66	S.F.	47,940	30	1961	1991		0.00 %	110.00 %	-24		\$931,282.00	\$846,620
D2020	Domestic Water Distribution	\$3.99	S.F.	47,940	30	1961	1991		0.00 %	110.00 %	-24		\$210,409.00	\$191,281
D2030	Sanitary Waste	\$3.41	S.F.	47,940	30	1961	1991		0.00 %	110.00 %	-24		\$179,823.00	\$163,475
D2040	Rain Water Drainage	\$0.98	S.F.	47,940	30	1961	1991		0.00 %	110.00 %	-24		\$51,679.00	\$46,981

School Assessment Report - 1961, 1963, 1966 Building

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
D2090	Other Plumbing Systems - Natural Gas	\$0.41	S.F.	47,940	40	1961	2001		0.00 %	110.00 %	-14		\$21,621.00	\$19,655
D3020	Heat Generating Systems	\$4.55	S.F.	47,940	30	1961	1991		0.00 %	110.00 %	-24		\$239,940.00	\$218,127
D3030	Cooling Generating Systems	\$4.73	S.F.	47,940	25	1985	2010		0.00 %	110.00 %	-5		\$249,432.00	\$226,756
D3040	Distribution & Exhaust Systems	\$5.51	S.F.	47,940	30	1961	1991		0.00 %	110.00 %	-24		\$290,564.00	\$264,149
D3050	Terminal & Package Units	\$18.52	S.F.	47,940	15	1995	2010		0.00 %	110.00 %	-5		\$976,634.00	\$887,849
D3060	Controls & Instrumentation	\$3.60	S.F.	47,940	20	1995	2015		0.00 %	110.00 %	0		\$189,842.00	\$172,584
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$1.23	S.F.	47,940	30	1961	1991		0.00 %	110.00 %	-24		\$64,863.00	\$58,966
D4010	Sprinklers	\$4.75	S.F.	0	30				0.00 %	0.00 %				\$0
D4020	Standpipes	\$0.51	S.F.	0	30				0.00 %	0.00 %				\$0
D5010	Electrical Service/Distribution	\$1.81	S.F.	47,940	40	1961	2001		0.00 %	110.00 %	-14		\$95,449.00	\$86,771
D5020	Branch Wiring	\$6.78	S.F.	47,940	30	1961	1991		0.00 %	110.00 %	-24		\$357,537.00	\$325,033
D5020	Lighting	\$8.90	S.F.	47,940	30	1995	2025	2015	0.00 %	110.00 %	0		\$469,333.00	\$426,666
D5030	Communications and Security - Clock & PA Systems	\$5.60	S.F.	47,940	15	1995	2010		0.00 %	110.00 %	-5		\$295,310.00	\$268,464
D5030	Communications and Security - Fire Alarm	\$1.23	S.F.	47,940	15	1995	2010		0.00 %	110.00 %	-5		\$64,863.00	\$58,966
D5030	Communications and Security - Security & CCTV	\$0.61	S.F.	47,940	15	1995	2010		0.00 %	110.00 %	-5		\$32,168.00	\$29,243
D5090	Other Electrical Systems - Emergency Generator	\$0.35	S.F.	0	15	1961	1976		0.00 %	0.00 %	-39			\$0
E1010	Commercial Equipment	\$7.92	S.F.	0	20	1961	1981		0.00 %	0.00 %	-34			\$0
E1020	Institutional Equipment	\$0.40	S.F.	47,940	20	1961	1981		0.00 %	110.00 %	-34		\$21,094.00	\$19,176
E1090	Other Equipment - Kitchen Equipment	\$9.54	S.F.	47,940	20	1961	1981		0.00 %	110.00 %	-34		\$503,082.00	\$457,348
E2010	Fixed Furnishings	\$5.37	S.F.	47,940	20	1961	1981		0.00 %	110.00 %	-34		\$283,182.00	\$257,438
F1010	Special Structures - Canopies	\$1.61	S.F.	47,940	25	1961	1986	2020	20.00 %	0.00 %	5			\$77,183
Total									24.22 %	62.59 %			\$6,478,913.00	\$10,350,895

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$6,478,913	\$0	\$0	\$0	\$0	\$98,425	\$0	\$0	\$53,904	\$0	\$76,204	\$6,707,445
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1020 - Special Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1010 - Floor Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2020 - Exterior Windows	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$48,515	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$48,515
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Asphal Shingles	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - BUR	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - EPDM	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Preformed Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3020 - Roof Openings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

School Assessment Report - 1961, 1963, 1966 Building

C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$91,661	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$91,661
C1030 - Fittings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C20 - Stairs	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* C2010 - Stair Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic & Glazed	\$301,732	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$301,732
C3010 - Wall Finishes - Paint	\$56,703	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$76,204	\$132,907
C3010 - Wall Finishes - Wall Coverings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Carpet	\$42,552	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$53,904	\$0	\$0	\$96,456
C3020 - Floor Finishes - Ceramic & Quarry Tile	\$51,674	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$51,674
C3020 - Floor Finishes - Terrazzo	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - VCT	\$345,840	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$345,840
C3020 - Floor Finishes - Wood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D10 - Conveying	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D1010 - Elevators and Lifts	\$12,129	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$12,129
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$931,282	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$931,282
D2020 - Domestic Water Distribution	\$210,409	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$210,409
D2030 - Sanitary Waste	\$179,823	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$179,823
D2040 - Rain Water Drainage	\$51,679	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$51,679
D2090 - Other Plumbing Systems - Natural Gas	\$21,621	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$21,621
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3020 - Heat Generating Systems	\$239,940	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$239,940
D3030 - Cooling Generating Systems	\$249,432	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$249,432
D3040 - Distribution & Exhaust Systems	\$290,564	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$290,564
D3050 - Terminal & Package Units	\$976,634	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$976,634
D3060 - Controls & Instrumentation	\$189,842	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$189,842
D3090 - Other HVAC Systems/Equip - Kitchen Hood	\$64,863	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$64,863
D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


School Assessment Report - 1961, 1963, 1966 Building

D4010 - Sprinklers	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D4020 - Standpipes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$95,449	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$95,449
D5020 - Branch Wiring	\$357,537	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$357,537
D5020 - Lighting	\$469,333	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$469,333
D5030 - Communications and Security - Clock & PA Systems	\$295,310	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$295,310
D5030 - Communications and Security - Fire Alarm	\$64,863	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$64,863
D5030 - Communications and Security - Security & CCTV	\$32,168	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$32,168
D5090 - Other Electrical Systems - Emergency Generator	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E - Equipment & Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E10 - Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1010 - Commercial Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1020 - Institutional Equipment	\$21,094	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$21,094
E1090 - Other Equipment - Kitchen Equipment	\$503,082	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$503,082
E20 - Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E2010 - Fixed Furnishings	\$283,182	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$283,182
F - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F10 - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F1010 - Special Structures - Canopies	\$0	\$0	\$0	\$0	\$0	\$98,425	\$0	\$0	\$0	\$0	\$0	\$98,425

* Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

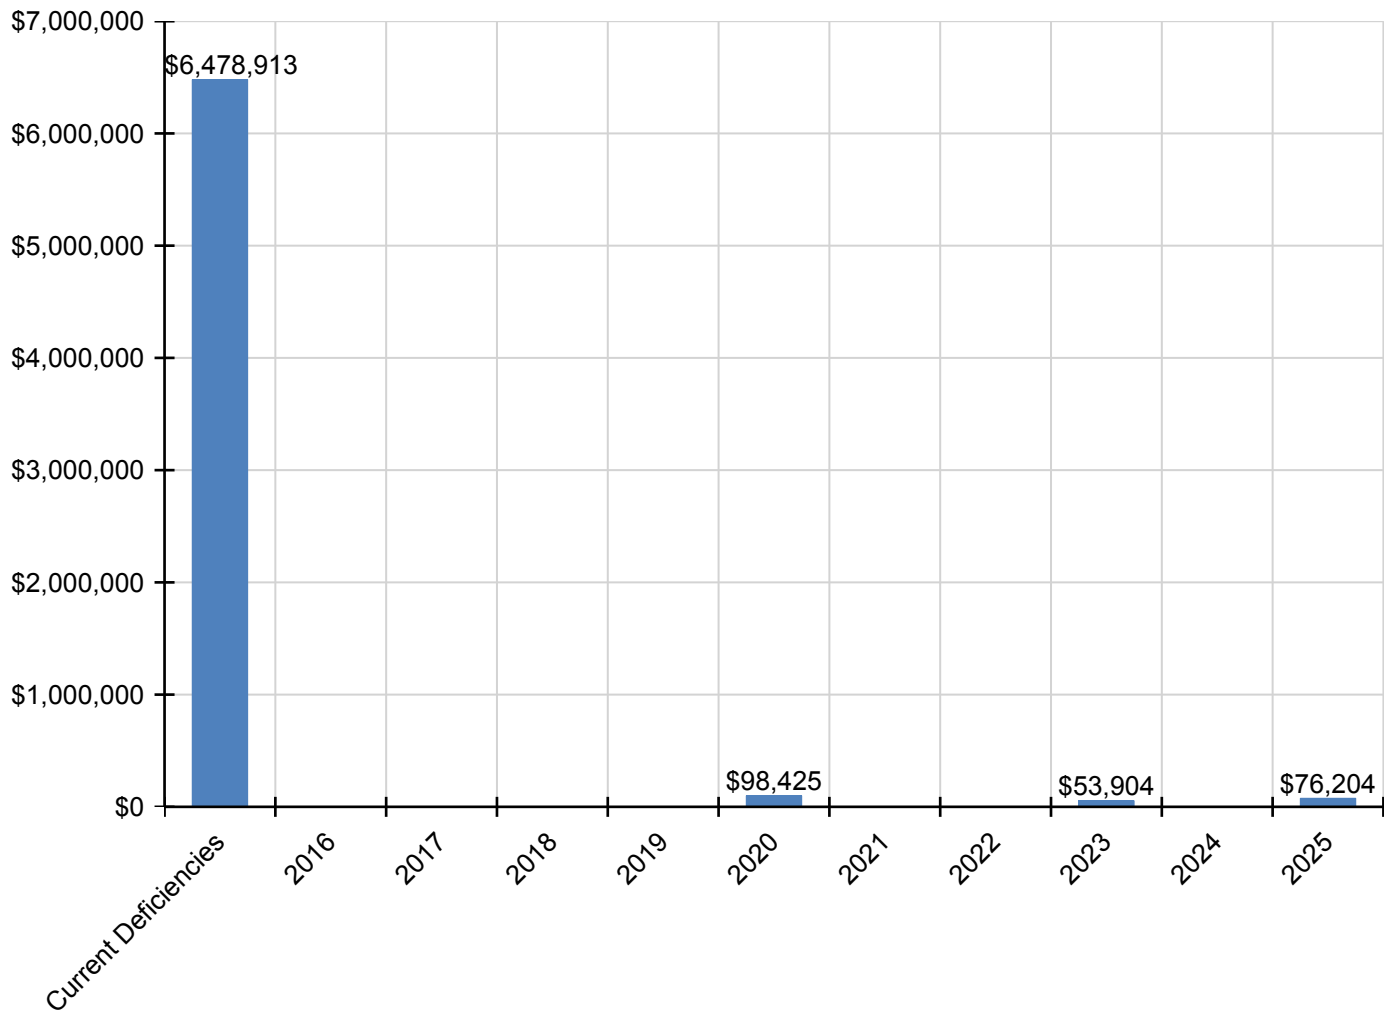

Deficiency Summary by System


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

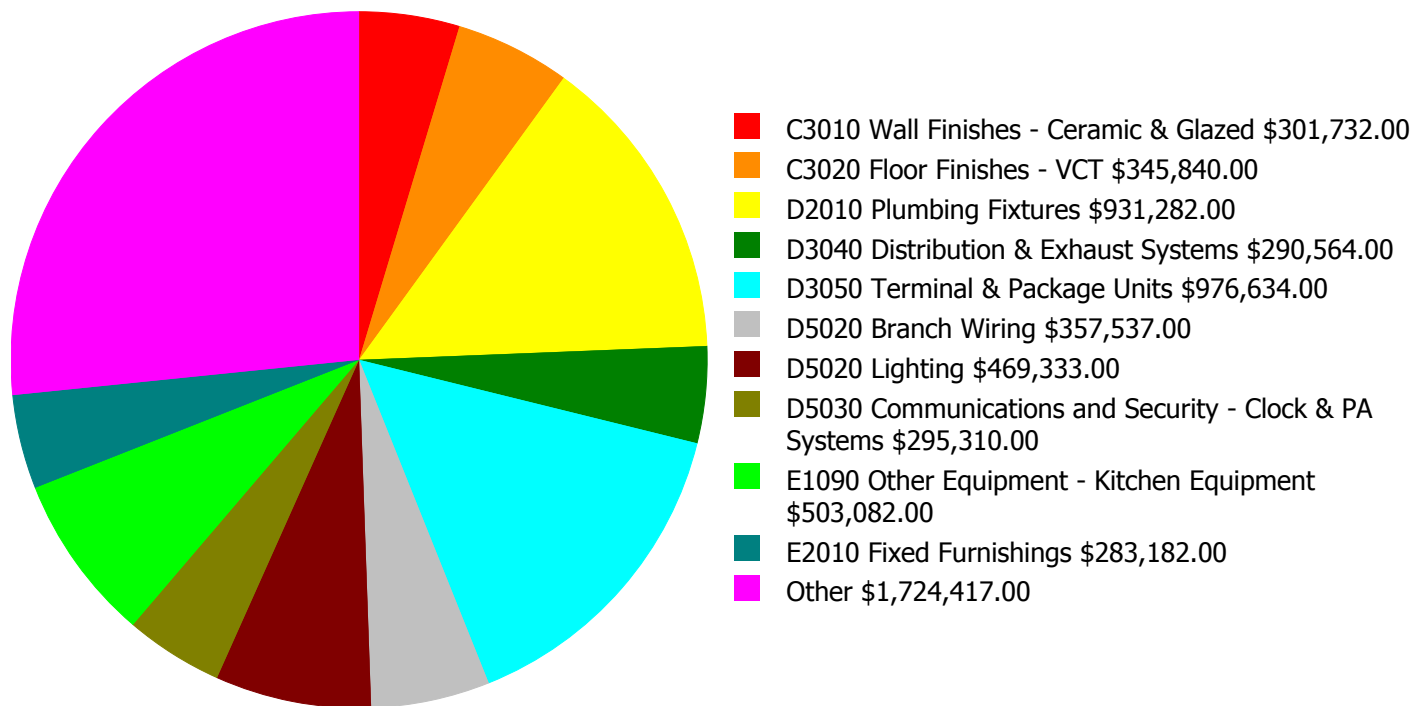

Budget Estimate Total: \$6,478,913.00

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

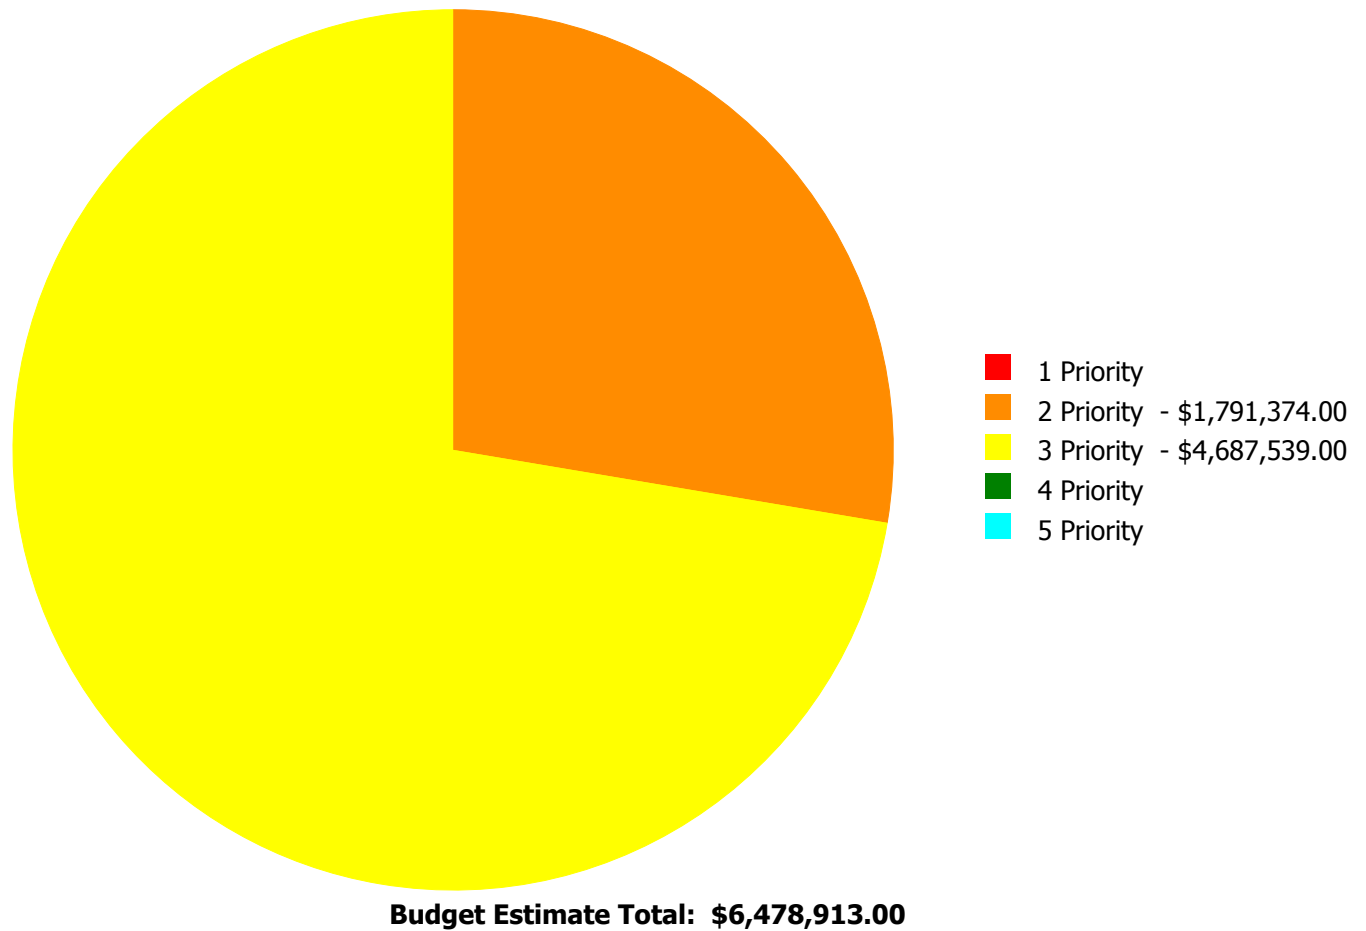

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards.
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
B2030	Exterior Doors	\$0.00	\$0.00	\$48,515.00	\$0.00	\$0.00	\$48,515.00
C1020	Interior Doors	\$0.00	\$0.00	\$91,661.00	\$0.00	\$0.00	\$91,661.00
C3010	Wall Finishes - Ceramic & Glazed	\$0.00	\$0.00	\$301,732.00	\$0.00	\$0.00	\$301,732.00
C3010	Wall Finishes - Paint	\$0.00	\$0.00	\$56,703.00	\$0.00	\$0.00	\$56,703.00
C3020	Floor Finishes - Carpet	\$0.00	\$0.00	\$42,552.00	\$0.00	\$0.00	\$42,552.00
C3020	Floor Finishes - Ceramic & Quarry Tile	\$0.00	\$0.00	\$51,674.00	\$0.00	\$0.00	\$51,674.00
C3020	Floor Finishes - VCT	\$0.00	\$0.00	\$345,840.00	\$0.00	\$0.00	\$345,840.00
D1010	Elevators and Lifts	\$0.00	\$0.00	\$12,129.00	\$0.00	\$0.00	\$12,129.00
D2010	Plumbing Fixtures	\$0.00	\$931,282.00	\$0.00	\$0.00	\$0.00	\$931,282.00
D2020	Domestic Water Distribution	\$0.00	\$0.00	\$210,409.00	\$0.00	\$0.00	\$210,409.00
D2030	Sanitary Waste	\$0.00	\$0.00	\$179,823.00	\$0.00	\$0.00	\$179,823.00
D2040	Rain Water Drainage	\$0.00	\$51,679.00	\$0.00	\$0.00	\$0.00	\$51,679.00
D2090	Other Plumbing Systems - Natural Gas	\$0.00	\$0.00	\$21,621.00	\$0.00	\$0.00	\$21,621.00
D3020	Heat Generating Systems	\$0.00	\$0.00	\$239,940.00	\$0.00	\$0.00	\$239,940.00
D3030	Cooling Generating Systems	\$0.00	\$0.00	\$249,432.00	\$0.00	\$0.00	\$249,432.00
D3040	Distribution & Exhaust Systems	\$0.00	\$290,564.00	\$0.00	\$0.00	\$0.00	\$290,564.00
D3050	Terminal & Package Units	\$0.00	\$0.00	\$976,634.00	\$0.00	\$0.00	\$976,634.00
D3060	Controls & Instrumentation	\$0.00	\$0.00	\$189,842.00	\$0.00	\$0.00	\$189,842.00
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$0.00	\$64,863.00	\$0.00	\$0.00	\$0.00	\$64,863.00
D5010	Electrical Service/Distribution	\$0.00	\$95,449.00	\$0.00	\$0.00	\$0.00	\$95,449.00
D5020	Branch Wiring	\$0.00	\$357,537.00	\$0.00	\$0.00	\$0.00	\$357,537.00
D5020	Lighting	\$0.00	\$0.00	\$469,333.00	\$0.00	\$0.00	\$469,333.00
D5030	Communications and Security - Clock & PA Systems	\$0.00	\$0.00	\$295,310.00	\$0.00	\$0.00	\$295,310.00
D5030	Communications and Security - Fire Alarm	\$0.00	\$0.00	\$64,863.00	\$0.00	\$0.00	\$64,863.00
D5030	Communications and Security - Security & CCTV	\$0.00	\$0.00	\$32,168.00	\$0.00	\$0.00	\$32,168.00
E1020	Institutional Equipment	\$0.00	\$0.00	\$21,094.00	\$0.00	\$0.00	\$21,094.00
E1090	Other Equipment - Kitchen Equipment	\$0.00	\$0.00	\$503,082.00	\$0.00	\$0.00	\$503,082.00
E2010	Fixed Furnishings	\$0.00	\$0.00	\$283,182.00	\$0.00	\$0.00	\$283,182.00
	Total:	\$0.00	\$1,791,374.00	\$4,687,539.00	\$0.00	\$0.00	\$6,478,913.00

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

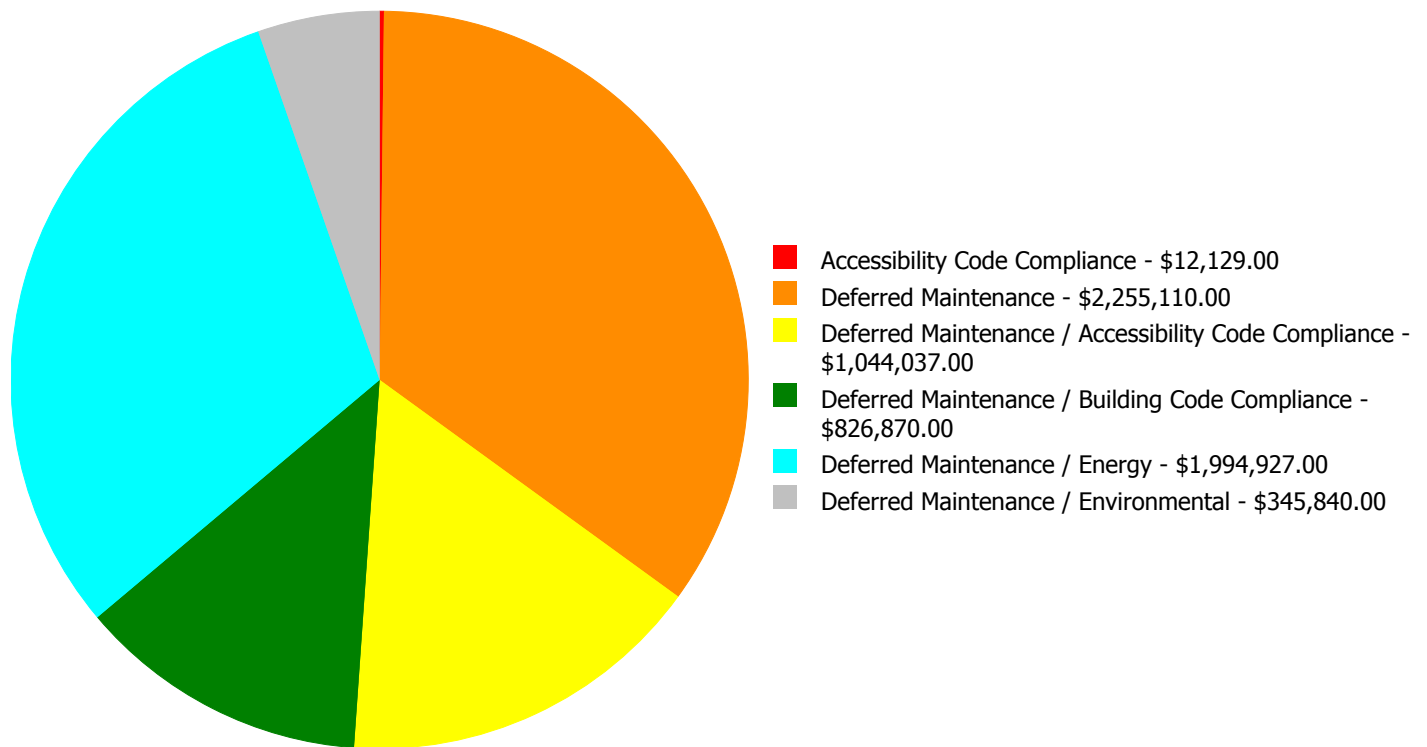

Budget Estimate Total: \$6,478,913.00

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 2 Priority:

System: D2010 - Plumbing Fixtures



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code Compliance

Priority: 2 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$931,282.00

Assessor Name: Sam Mandola

Date Created: 04/11/2015

Notes: The plumbing fixtures are beyond their expected service life, worn, inadequate, and should be scheduled for replacement, including upgrades to improve ADA accessibility. Water fountains protrude into the hallway more than allowable under ADA.

System: D2040 - Rain Water Drainage



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 2 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$51,679.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The rain water drainage system is beyond its expected service life, in poor condition, and should be scheduled for replacement. SPLOST project 414-422 to replace/repair rain water roof drainage.

System: D3040 - Distribution & Exhaust Systems



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 2 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$290,564.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The distribution and exhaust systems are beyond their expected serve life, inadequate, and should be scheduled for replacement. There is no exhaust in the restrooms. SPLOST project 414-422 to replace the exhaust systems throughout the building.

System: D3090 - Other HVAC Systems/Equip - Kitchen Hood



Location: Kitchen

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 2 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$64,863.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The kitchen hood system is beyond its expected service life and should be scheduled for replacement. SPLOST project 414-422 to replace kitchen hood.

System: D5010 - Electrical Service/Distribution



Location: Main Switch Room/Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 2 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$95,449.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The electrical service/distribution system is beyond its expected service life and should be scheduled for replacement. SPLOST project 414-422 to replace electrical service and distribution system to eliminate outages and breaker tripping.

System: D5020 - Branch Wiring



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Building Code Compliance

Priority: 2 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$357,537.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The branch wiring system is beyond its expected service life, inadequate, not building code compliant, and should be scheduled for replacement. Electrical outlets in wet areas are not GFI. SPLOST project 414-422 to evaluate the need to replace the branch wiring system to support the current building loads.

Priority 3 Priority:

System: B2030 - Exterior Doors



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$48,515.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The original exterior doors are aged, rusted, and should be replaced. SPLOST project 414-422 to replace exterior doors.

System: C1020 - Interior Doors



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$91,661.00

Assessor Name: Ben Nixon

Date Created: 07/15/2015

Notes: The interior doors are aged, failing, not ADA compliant, and should be repaired or replaced.

System: C3010 - Wall Finishes - Ceramic & Glazed



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 26,709.00

Unit of Measure: S.F.


Estimate: \$301,732.00

Assessor Name: Ben Nixon

Date Created: 07/15/2015

Notes: The ceramic wall finishes are aged, scuffed, faded and stained, and should be replaced.

System: C3010 - Wall Finishes - Paint

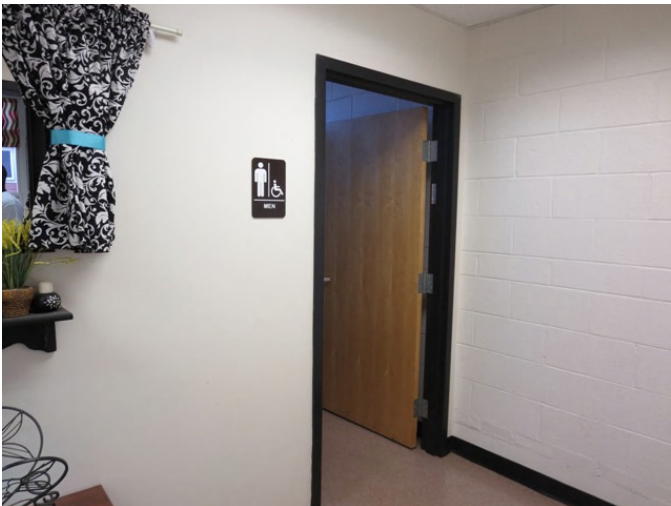

Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 26,709.00

Unit of Measure: S.F.

Estimate: \$56,703.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The painted wall finish has some deterioration due to age and use, and should be replaced.

System: C3020 - Floor Finishes - Carpet



Location: Media Center

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 4,551.00

Unit of Measure: S.F.


Estimate: \$42,552.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The carpet is beyond its expected service life, stained, and should be replaced.

System: C3020 - Floor Finishes - Ceramic & Quarry Tile

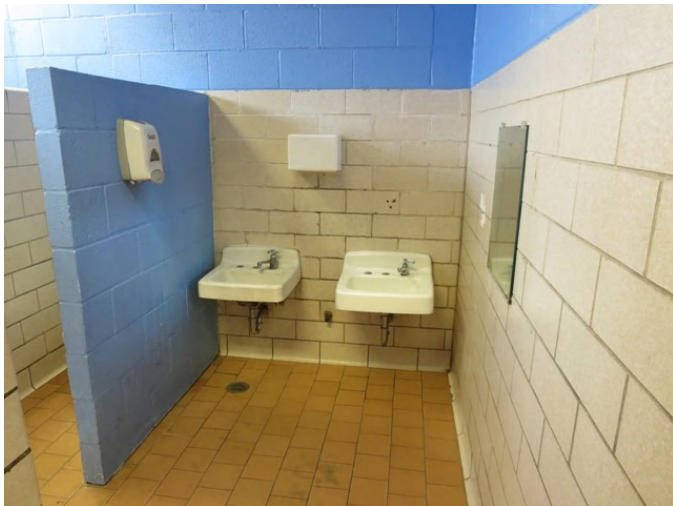

Location: Kitchen and Restrooms

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 3,242.00

Unit of Measure: S.F.

Estimate: \$51,674.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The tile floor covering is beyond its expected service life, cracked, patched and worn, and should be replaced.

System: C3020 - Floor Finishes - VCT



Location: Cafeteria and Some Classrooms

Distress: Beyond Service Life

Category: Deferred Maintenance / Environmental

Priority: 3 Priority

Correction: Renew System

Qty: 32,956.00

Unit of Measure: S.F.

Estimate: \$345,840.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The VCT flooring is aged, cracked and worn, and should be replaced.

System: D1010 - Elevators and Lifts



Location: Cafeteria/Stage

Distress: Missing

Category: Accessibility Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$12,129.00

Assessor Name: Ben Nixon

Date Created: 10/21/2015

Notes: The stage is not wheelchair accessible. Provide a chairlift or other means to comply with ADA standards.

System: D2020 - Domestic Water Distribution



Location: Throughout Building
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 47,940.00
Unit of Measure: S.F.
Estimate: \$210,409.00
Assessor Name: Ben Nixon
Date Created: 04/11/2015

Notes: The domestic water distribution system is beyond its expected service life, inadequate, and should be scheduled for replacement. There is no hot water in some of the restrooms.

System: D2030 - Sanitary Waste



Location: Throughout Building
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 47,940.00
Unit of Measure: S.F.
Estimate: \$179,823.00
Assessor Name: Sam Mandola
Date Created: 04/11/2015

Notes: The sanitary waste system is beyond its expected service life and should be scheduled for replacement.

System: D2090 - Other Plumbing Systems - Natural Gas



Location: South Side of Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$21,621.00

Assessor Name: Sam Mandola

Date Created: 04/11/2015

Notes: The natural gas system is beyond its expected service life and should be scheduled for replacement. SPLOST project 414-422 to replace/repair natural gas system and replace grease trap.

System: D3020 - Heat Generating Systems



Location: Mechanical Room

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$239,940.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The heat generating system is beyond its expected service life and should be scheduled for replacement.

System: D3030 - Cooling Generating Systems



Location: South Side of Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$249,432.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The cooling generating system is beyond its expected service life and should be scheduled for replacement.

System: D3050 - Terminal & Package Units



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$976,634.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The terminal and package units are beyond their expected service life and should be scheduled for replacement. HVAC fans, including those within AHUs, do not have permanent belt guards as required by OSHA.

System: D3060 - Controls & Instrumentation



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$189,842.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The controls and instrumentation system is beyond its expected service life and should be scheduled for replacement.

System: D5020 - Lighting



Location: Throughout Building

Distress: Inadequate

Category: Deferred Maintenance / Building Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$469,333.00

Assessor Name: Ben Nixon

Date Created: 07/16/2015

Notes: SPLOST project 414-422 to replace current lighting fixtures with 277 volt throughout the building. Emergency lighting is missing in hallways.

System: D5030 - Communications and Security - Clock & PA Systems



Location: Throughout Building
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 47,940.00
Unit of Measure: S.F.
Estimate: \$295,310.00
Assessor Name: Ben Nixon
Date Created: 04/11/2015

Notes: Clock and PA systems are beyond their expected service life and should be scheduled for replacement.

System: D5030 - Communications and Security - Fire Alarm



Location: Throughout Building
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 47,940.00
Unit of Measure: S.F.
Estimate: \$64,863.00
Assessor Name: Ben Nixon
Date Created: 04/11/2015

Notes: The fire alarm system, including primary and secondary panels, are beyond their service life and should be scheduled for replacement.

System: D5030 - Communications and Security - Security & CCTV



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$32,168.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The security and CCTV systems are beyond their expected service life, inadequate, and should be scheduled for replacement.

System: E1020 - Institutional Equipment



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$21,094.00

Assessor Name: Ben Nixon

Date Created: 07/15/2015

Notes: Institutional equipment, such as theater and stage equipment, is beyond its expected service life and should be scheduled for replacement.

System: E1090 - Other Equipment - Kitchen Equipment



Location: Kitchen

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$503,082.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Kitchen equipment is beyond its expected service life and should be scheduled for replacement. The grease trap no longer functions as intended and is scheduled to be replaced under SPLOST.

System: E2010 - Fixed Furnishings



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 47,940.00

Unit of Measure: S.F.

Estimate: \$283,182.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Fixed furnishings are beyond their expected service life and should be scheduled for replacement.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	5,478
Year Built:	2003
Last Renovation:	
Replacement Value:	\$910,151
Repair Cost:	\$70,201.00
Total FCI:	7.71 %
Total RSLI:	64.27 %
FCA Score:	92.29



Description:

The 2000 gymnasium at Hawthorne Elementary School is a one-story building located at 2535 Caladium Drive N.E. in Atlanta, Georgia. There have been no additions or major renovations to this building. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:

Building Codes:	2020	Fire Sprinkler System:	No
-----------------	------	------------------------	----

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	88.00 %	0.00 %	\$0.00
B10 - Superstructure	88.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	85.42 %	0.00 %	\$0.00
B30 - Roofing	84.00 %	0.00 %	\$0.00
C10 - Interior Construction	76.16 %	0.00 %	\$0.00
C30 - Interior Finishes	30.25 %	0.00 %	\$0.00
D20 - Plumbing	60.19 %	0.00 %	\$0.00
D30 - HVAC	30.85 %	53.04 %	\$70,201.00
D40 - Fire Protection	0.00 %	0.00 %	\$0.00
D50 - Electrical	44.11 %	0.00 %	\$0.00
Totals:	64.27 %	7.71 %	\$70,201.00

Photo Album

The photo album consists of the various cardinal directions of the building.

1). North Elevation - Jul 16, 2015



2). West Elevation - Jul 16, 2015



3). East Elevation - Jul 16, 2015



4). South Elevation - Jul 16, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$9.34	S.F.	5,478	100	2003	2103		88.00 %	0.00 %	88			\$51,165
A1030	Slab on Grade	\$6.21	S.F.	5,478	100	2003	2103		88.00 %	0.00 %	88			\$34,018
B1020	Roof Construction	\$21.36	S.F.	5,478	100	2003	2103		88.00 %	0.00 %	88			\$117,010
B2010	Exterior Walls	\$19.80	S.F.	5,478	100	2003	2103		88.00 %	0.00 %	88			\$108,464
B2030	Exterior Doors	\$2.01	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$11,011
B3010	Roof Coverings - Standing Seam Metal	\$11.91	S.F.	5,478	75	2003	2078		84.00 %	0.00 %	63			\$65,243
C1010	Partitions	\$12.78	S.F.	5,478	100	2003	2103		88.00 %	0.00 %	88			\$70,009
C1020	Interior Doors	\$4.24	S.F.	5,478	40	2003	2043		70.00 %	0.00 %	28			\$23,227
C1030	Fittings	\$3.46	S.F.	5,478	20	2003	2023		40.00 %	0.00 %	8			\$18,954
C3010	Wall Finishes - Ceramic	\$6.65	S.F.		30	2003	2033		60.00 %	0.00 %	18			\$0
C3010	Wall Finishes - Paint	\$1.41	S.F.	5,478	10	2013	2023		80.00 %	0.00 %	8			\$7,724
C3020	Floor Finishes - Ceramic Tile	\$6.67	S.F.	253	50	2003	2053		76.00 %	0.00 %	38			\$1,688
C3020	Floor Finishes - Neoprene	\$14.46	S.F.	4,554	15	2003	2018		20.00 %	0.00 %	3			\$65,851
C3020	Floor Finishes - VCT	\$5.01	S.F.	325	15	2003	2018		20.00 %	0.00 %	3			\$1,628
C3030	Ceiling Finishes	\$4.31	S.F.	5,478	20	2003	2023		40.00 %	0.00 %	8			\$23,610
D2010	Plumbing Fixtures	\$9.66	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$52,917
D2020	Domestic Water Distribution	\$5.85	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$32,046
D2030	Sanitary Waste	\$0.87	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$4,766
D2040	Rain Water Drainage	\$0.22	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$1,205
D2090	Other Plumbing Systems - Natural Gas	\$0.32	S.F.	5,478	40	2003	2043		70.00 %	0.00 %	28			\$1,753
D3040	Distribution Systems & Exhaust Systems	\$12.25	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$67,106
D3050	Terminal & Package Units	\$11.65	S.F.	5,478	15	2003	2018	2015	0.00 %	110.00 %	0		\$70,201.00	\$63,819
D3060	Controls & Instrumentation	\$0.26	S.F.	5,478	20	2003	2023		40.00 %	0.00 %	8			\$1,424
D4010	Sprinklers	\$3.84	S.F.	0	30	2003	2033		60.00 %	0.00 %	18			\$0
D5010	Electrical Service/Distribution	\$1.24	S.F.	5,478	40	2003	2043		70.00 %	0.00 %	28			\$6,793
D5020	Branch Wiring	\$5.24	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$28,705
D5020	Lighting	\$5.24	S.F.	5,478	20	2003	2023		40.00 %	0.00 %	8			\$28,705
D5030	Communications and Security - Fire Alarm	\$2.13	S.F.	5,478	15	2003	2018		20.00 %	0.00 %	3			\$11,668
D5030	Communications and Security - Public Address & Clock System	\$0.88	S.F.	5,478	15	2003	2018		20.00 %	0.00 %	3			\$4,821
D5030	Communications and Security - Security & CCTV	\$0.88	S.F.	5,478	15	2003	2018		20.00 %	0.00 %	3			\$4,821
Total									64.27 %	7.71 %			\$70,201.00	\$910,151

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$70,201	\$0	\$0	\$106,724	\$0	\$0	\$0	\$0	\$112,056	\$0	\$0	\$288,981
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$26,411	\$0	\$0	\$26,411
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Paint	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$10,762	\$0	\$0	\$10,762
C3020 - Floor Finishes - Ceramic Tile	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Neoprene	\$0	\$0	\$0	\$79,153	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$79,153
C3020 - Floor Finishes - VCT	\$0	\$0	\$0	\$1,957	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,957
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$32,899	\$0	\$0	\$32,899
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


School Assessment Report - 2003 Gym

D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2020 - Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2030 - Sanitary Waste	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2090 - Other Plumbing Systems - Natural Gas	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3040 - Distribution Systems & Exhaust Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3050 - Terminal & Package Units	\$70,201	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$70,201
D3060 - Controls & Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,985	\$0	\$0	\$1,985
D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D4010 - Sprinklers	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$39,998	\$0	\$0	\$39,998
D5030 - Communications and Security - Fire Alarm	\$0	\$0	\$0	\$14,025	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$14,025
D5030 - Communications and Security - Public Address & Clock System	\$0	\$0	\$0	\$5,795	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$5,795
D5030 - Communications and Security - Security & CCTV	\$0	\$0	\$0	\$5,795	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$5,795

* Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

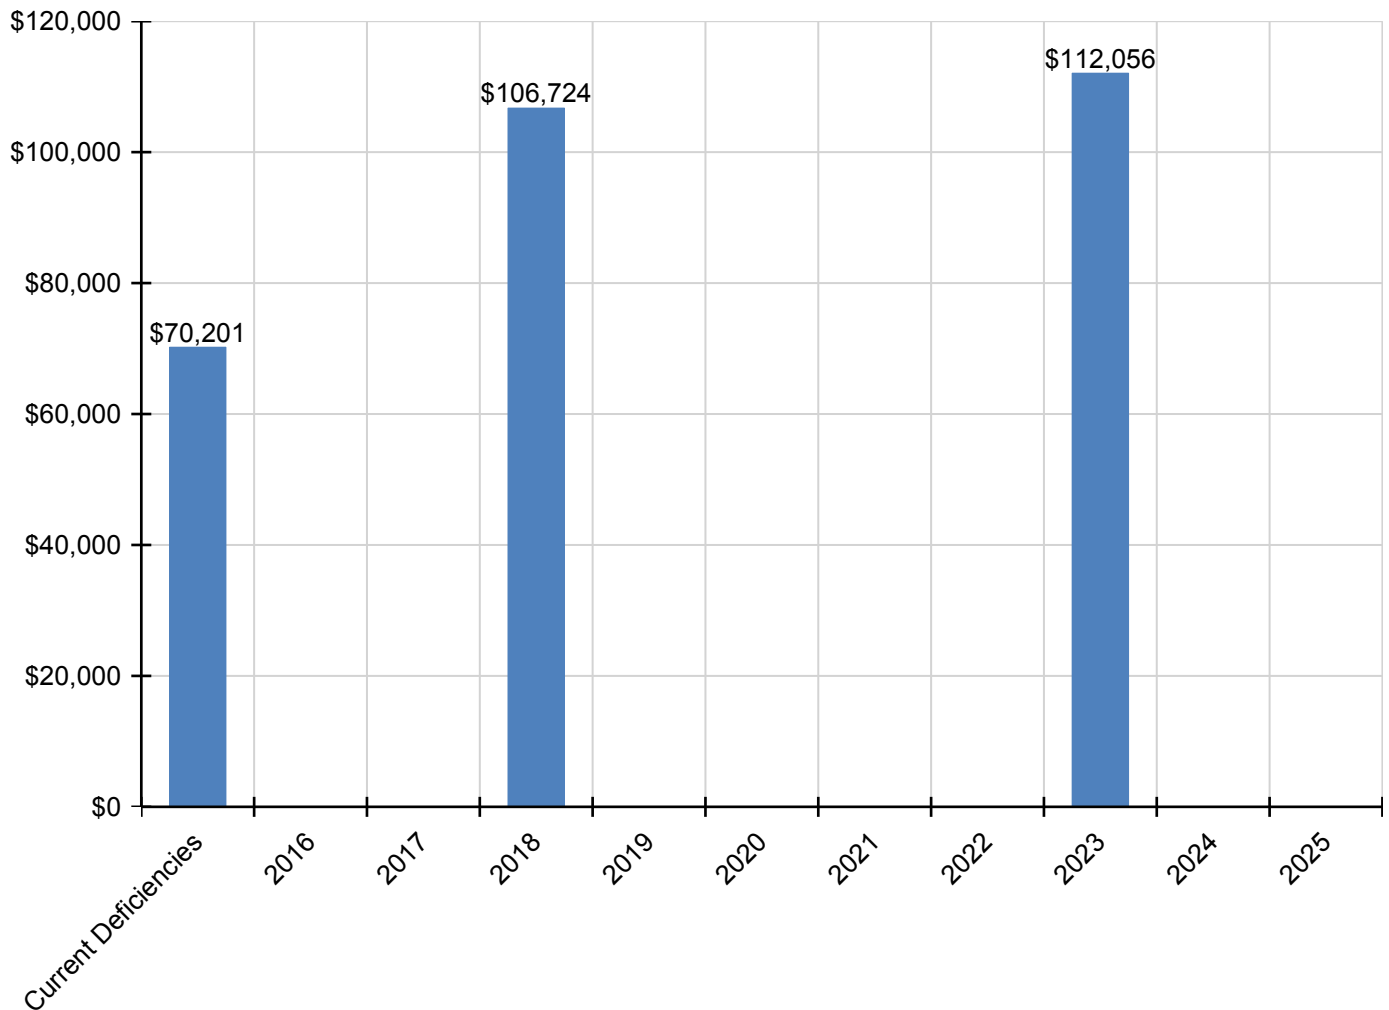


Deficiency Summary by System

Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

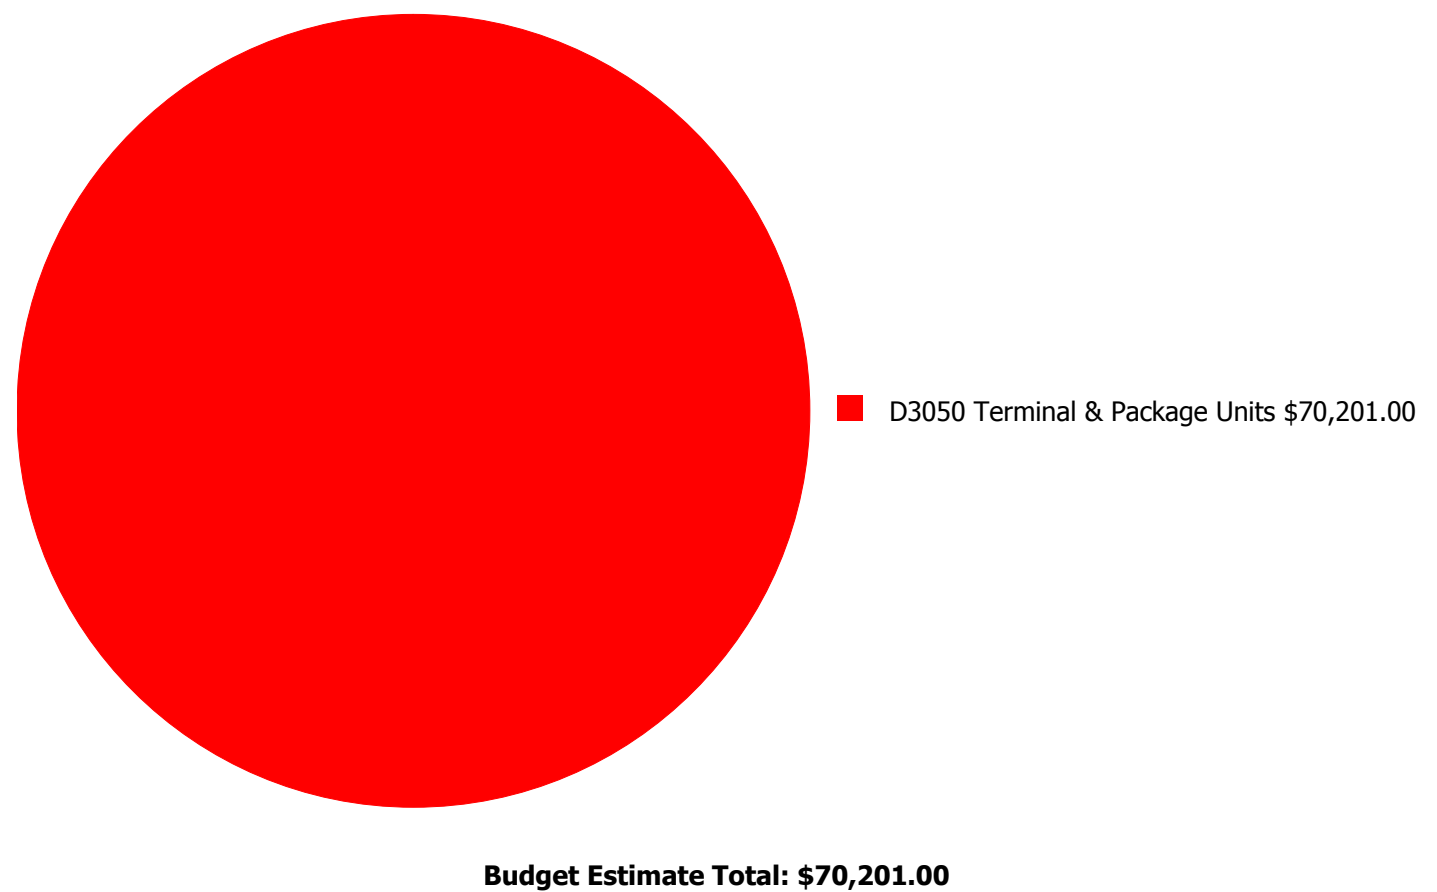

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

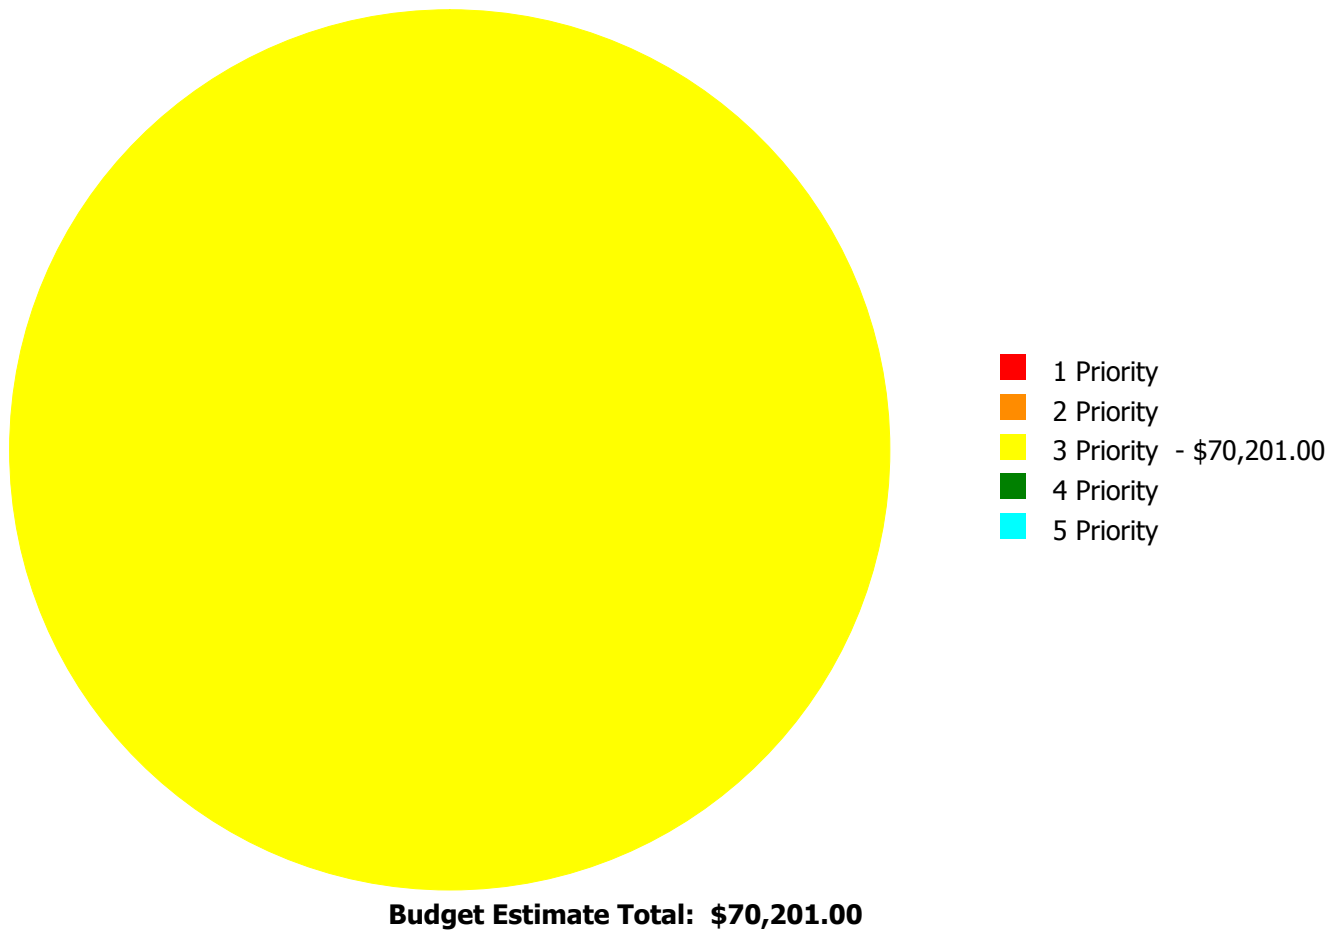

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards.
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
D3050	Terminal & Package Units	\$0.00	\$0.00	\$70,201.00	\$0.00	\$0.00	\$70,201.00
	Total:	\$0.00	\$0.00	\$70,201.00	\$0.00	\$0.00	\$70,201.00

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

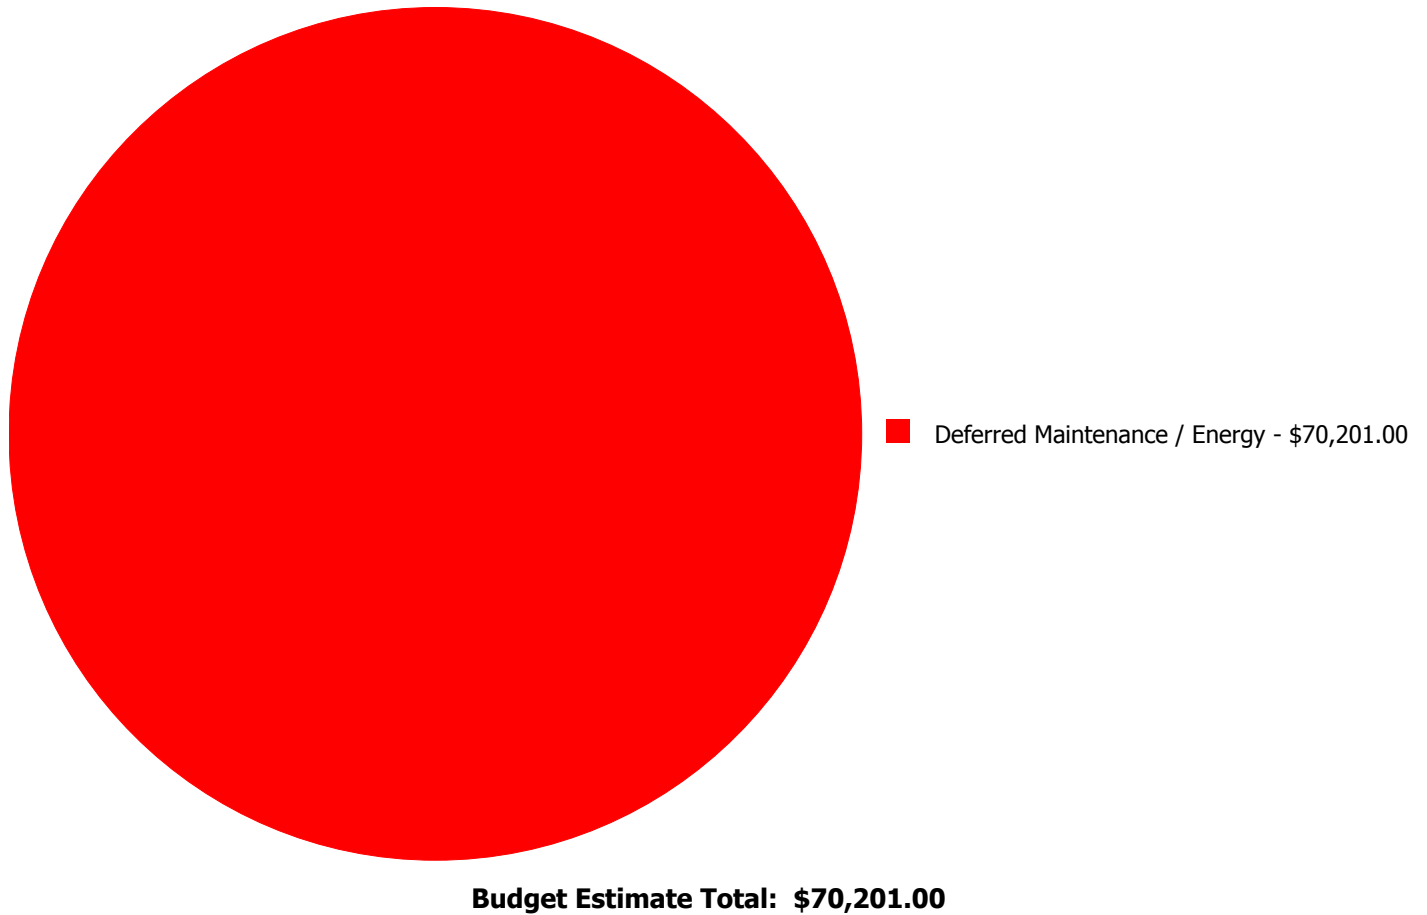

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 3 Priority:

System: D3050 - Terminal & Package Units



Location: Throughout Building

Distress: Inadequate

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$70,201.00

Assessor Name: Eduardo Lopez

Date Created: 07/16/2015

Notes: The primary heating and cooling system consist of fuel fired unit heaters and ventilation fans. The office heating and cooling consist of a single PTAC unit. These should be replaced with a single package unit.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as $100 - \text{Total FCI}$ (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	53,528
Year Built:	1961
Last Renovation:	
Replacement Value:	\$1,247,123
Repair Cost:	\$1,331,106.00
Total FCI:	106.73 %
Total RSLI:	1.54 %
FCA Score:	0.00



Description:

The Hawthorne Elementary School site was originally constructed in 1961, has a total area of 12.3 acres, and is occupied by approximately 53,528 square feet of permanent building space. Campus site features include paved driveways and parking lots, pedestrian pavement, covered walkways, flag pole, landscaping, open fields, playgrounds and fencing. Site mechanical and electrical features include water, sewer, natural gas, and site lighting. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report for the site features.

Attributes:

General Attributes:

Site Code: 1285

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
G20 - Site Improvements	2.75 %	104.19 %	\$729,933.03
G30 - Site Mechanical Utilities	0.00 %	110.00 %	\$384,491.62
G40 - Site Electrical Utilities	0.00 %	110.00 %	\$216,681.35
Totals:	1.54 %	106.73 %	\$1,331,106.00

Photo Album

The photo album consists of the various cardinal directions of the building.

1). Aerial Image of Hawthorne Elementary
School - Oct 21, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
G2010	Roadways	\$5.17	S.F.	33,692	25	1961	1986		0.00 %	110.00 %	-29		\$191,606.40	\$174,188
G2020	Parking Lots	\$4.56	S.F.	9,612	25	1961	1986		0.00 %	110.00 %	-29		\$48,213.79	\$43,831
G2030	Pedestrian Paving	\$1.50	S.F.	53,528	30	1961	1991		0.00 %	110.00 %	-24		\$88,321.20	\$80,292
G2040	Baseball Field	\$8.35	S.F.		20	1961	1981		0.00 %	0.00 %	-34			\$0
G2040	Canopies	\$0.29	S.F.		25	1961	1986		0.00 %	0.00 %	-29			\$0
G2040	Covered Walkways	\$48.72	S.F.	760	25	2003	2028		52.00 %	0.00 %	13			\$37,027
G2040	Fencing & Guardrails	\$0.91	S.F.	53,528	30	1961	1991		0.00 %	110.00 %	-24		\$53,581.53	\$48,710
G2040	Football Field	\$5.85	S.F.		20	1961	1981		0.00 %	0.00 %	-34			\$0
G2040	Hard Surface Play Area	\$6.26	S.F.	8,416	20	1961	1981		0.00 %	110.00 %	-34		\$57,952.58	\$52,684
G2040	Playing Field	\$3.92	S.F.	47,514	20	1961	1981		0.00 %	110.00 %	-34		\$204,880.37	\$186,255
G2040	Soccer/Lacross Field	\$5.00	S.F.		20	1961	1981		0.00 %	0.00 %	-34			\$0
G2040	Softball Field	\$8.86	S.F.		0				0.00 %	0.00 %				\$0
G2040	Tennis Courts	\$18.47	S.F.		20	1961	1981		0.00 %	0.00 %	-34			\$0
G2040	Track	\$7.04	S.F.		10	1961	1971		0.00 %	0.00 %	-44			\$0
G2050	Landscaping	\$1.45	S.F.	53,528	15	1961	1976		0.00 %	110.00 %	-39		\$85,377.16	\$77,616
G3010	Water Supply	\$1.83	S.F.	53,528	50	1961	2011		0.00 %	110.00 %	-4		\$107,751.86	\$97,956
G3020	Sanitary Sewer	\$1.15	S.F.	53,528	50	1961	2011		0.00 %	110.00 %	-4		\$67,712.92	\$61,557
G3030	Storm Sewer	\$3.55	S.F.	53,528	50	1961	2011		0.00 %	110.00 %	-4		\$209,026.84	\$190,024
G3060	Fuel Distribution	\$0.78	S.F.		40	1961	2001		0.00 %	0.00 %	-14			\$0
G4010	Electrical Distribution	\$1.86	S.F.	53,528	50	1961	2011		0.00 %	110.00 %	-4		\$109,518.29	\$99,562
G4020	Site Lighting	\$1.15	S.F.	53,528	30	1961	1991		0.00 %	110.00 %	-24		\$67,712.92	\$61,557
G4030	Site Communications & Security	\$0.67	S.F.	53,528	10	1961	1971		0.00 %	110.00 %	-44		\$39,450.14	\$35,864
Total									1.54 %	106.73 %			\$1,331,106.00	\$1,247,123

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

School Assessment Report - Site


Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$1,331,106	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$53,018	\$1,384,124
G - Building Sitework	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G20 - Site Improvements	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2010 - Roadways	\$191,606	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$191,606
G2020 - Parking Lots	\$48,214	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$48,214
G2030 - Pedestrian Paving	\$88,321	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$88,321
G2040 - Baseball Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Canopies	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Covered Walkways	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Fencing & Guardrails	\$53,582	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$53,582
G2040 - Football Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Hard Surface Play Area	\$57,953	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$57,953
G2040 - Playing Field	\$204,880	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$204,880
G2040 - Soccer/Lacross Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Softball Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Tennis Courts	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Track	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2050 - Landscaping	\$85,377	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$85,377
G30 - Site Mechanical Utilities	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G3010 - Water Supply	\$107,752	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$107,752
G3020 - Sanitary Sewer	\$67,713	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$67,713
G3030 - Storm Sewer	\$209,027	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$209,027
G3060 - Fuel Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G40 - Site Electrical Utilities	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G4010 - Electrical Distribution	\$109,518	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$109,518
G4020 - Site Lighting	\$67,713	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$67,713
G4030 - Site Communications & Security	\$39,450	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$53,018	\$92,468

* Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

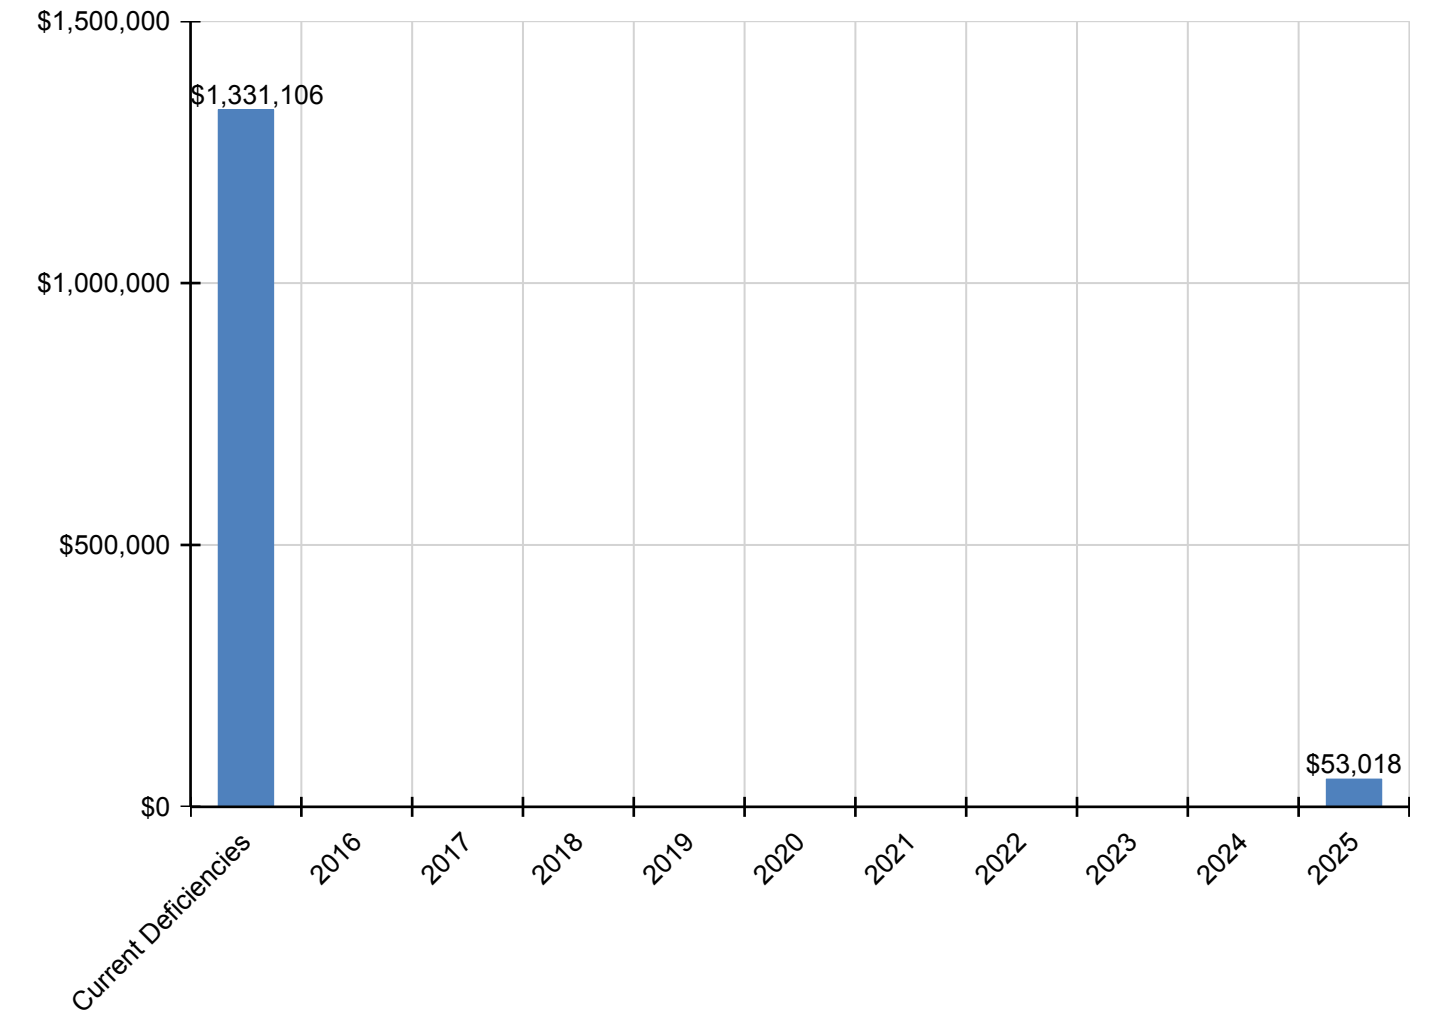

Deficiency Summary by System


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

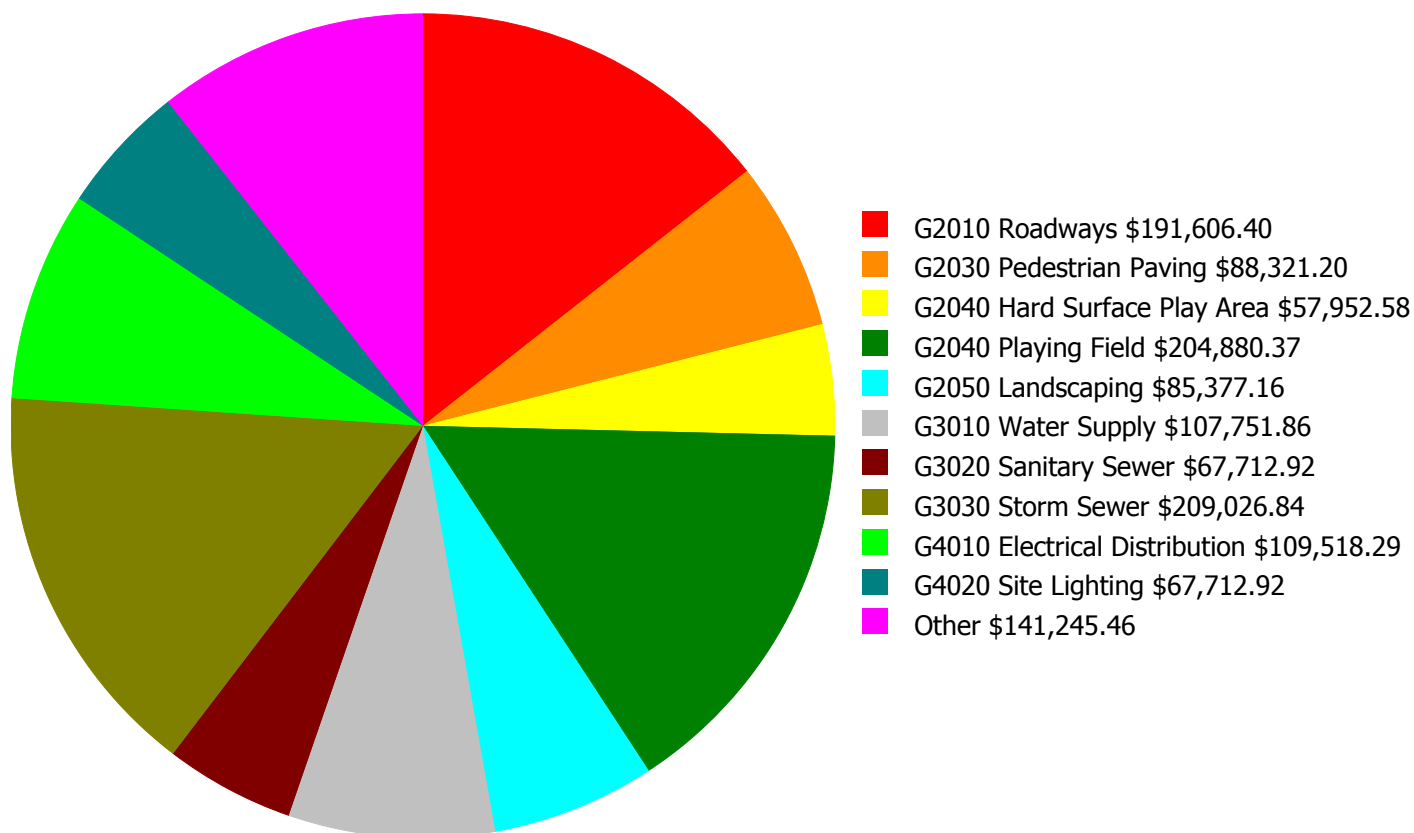

Budget Estimate Total: \$1,331,106.00

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

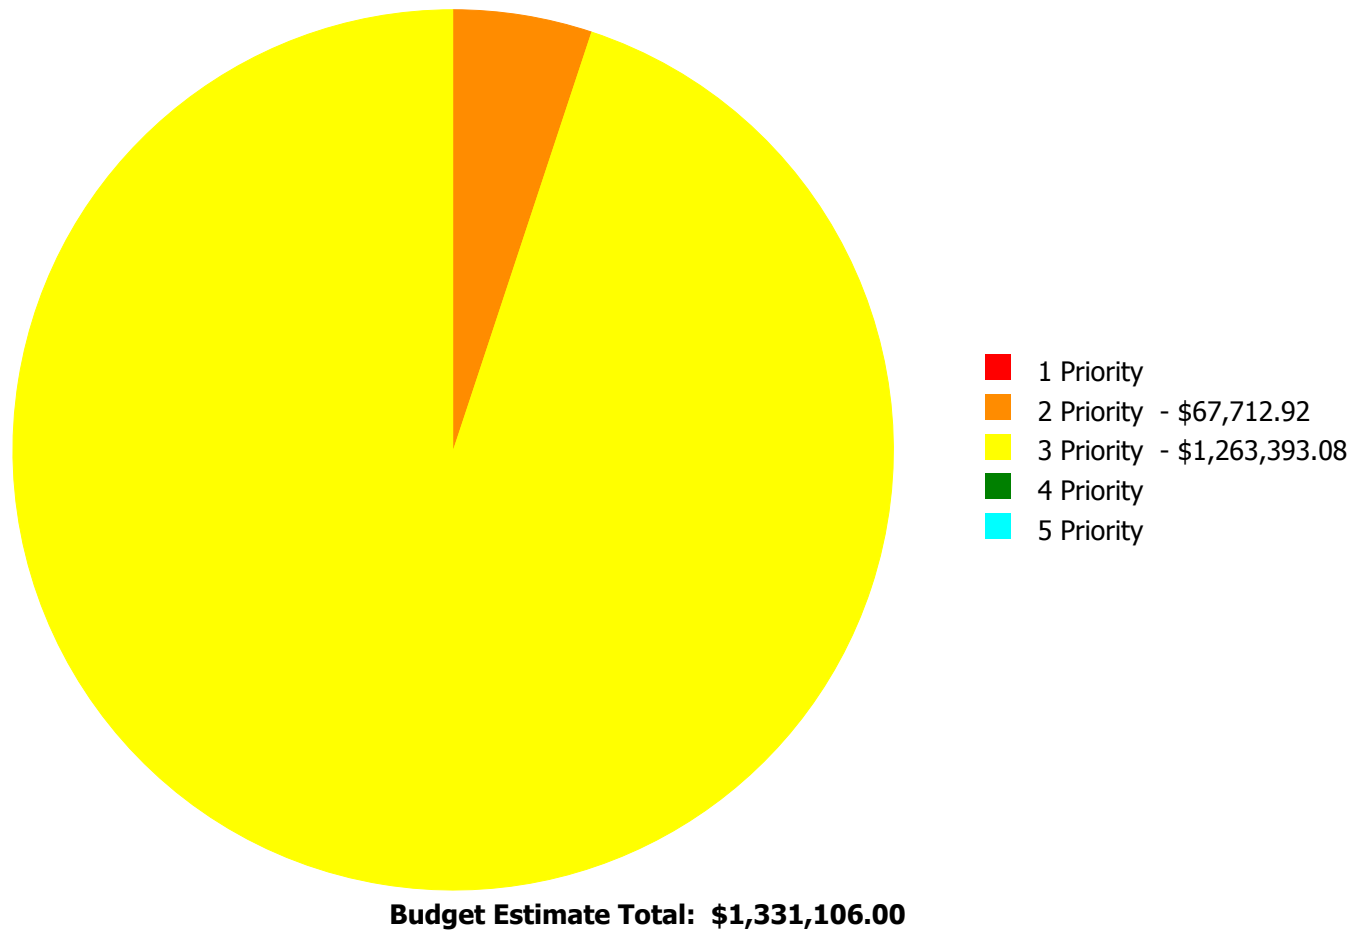

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards. .
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
G2010	Roadways	\$0.00	\$0.00	\$191,606.40	\$0.00	\$0.00	\$191,606.40
G2020	Parking Lots	\$0.00	\$0.00	\$48,213.79	\$0.00	\$0.00	\$48,213.79
G2030	Pedestrian Paving	\$0.00	\$0.00	\$88,321.20	\$0.00	\$0.00	\$88,321.20
G2040	Fencing & Guardrails	\$0.00	\$0.00	\$53,581.53	\$0.00	\$0.00	\$53,581.53
G2040	Hard Surface Play Area	\$0.00	\$0.00	\$57,952.58	\$0.00	\$0.00	\$57,952.58
G2040	Playing Field	\$0.00	\$0.00	\$204,880.37	\$0.00	\$0.00	\$204,880.37
G2050	Landscaping	\$0.00	\$0.00	\$85,377.16	\$0.00	\$0.00	\$85,377.16
G3010	Water Supply	\$0.00	\$0.00	\$107,751.86	\$0.00	\$0.00	\$107,751.86
G3020	Sanitary Sewer	\$0.00	\$0.00	\$67,712.92	\$0.00	\$0.00	\$67,712.92
G3030	Storm Sewer	\$0.00	\$0.00	\$209,026.84	\$0.00	\$0.00	\$209,026.84
G4010	Electrical Distribution	\$0.00	\$0.00	\$109,518.29	\$0.00	\$0.00	\$109,518.29
G4020	Site Lighting	\$0.00	\$67,712.92	\$0.00	\$0.00	\$0.00	\$67,712.92
G4030	Site Communications & Security	\$0.00	\$0.00	\$39,450.14	\$0.00	\$0.00	\$39,450.14
	Total:	\$0.00	\$67,712.92	\$1,263,393.08	\$0.00	\$0.00	\$1,331,106.00

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

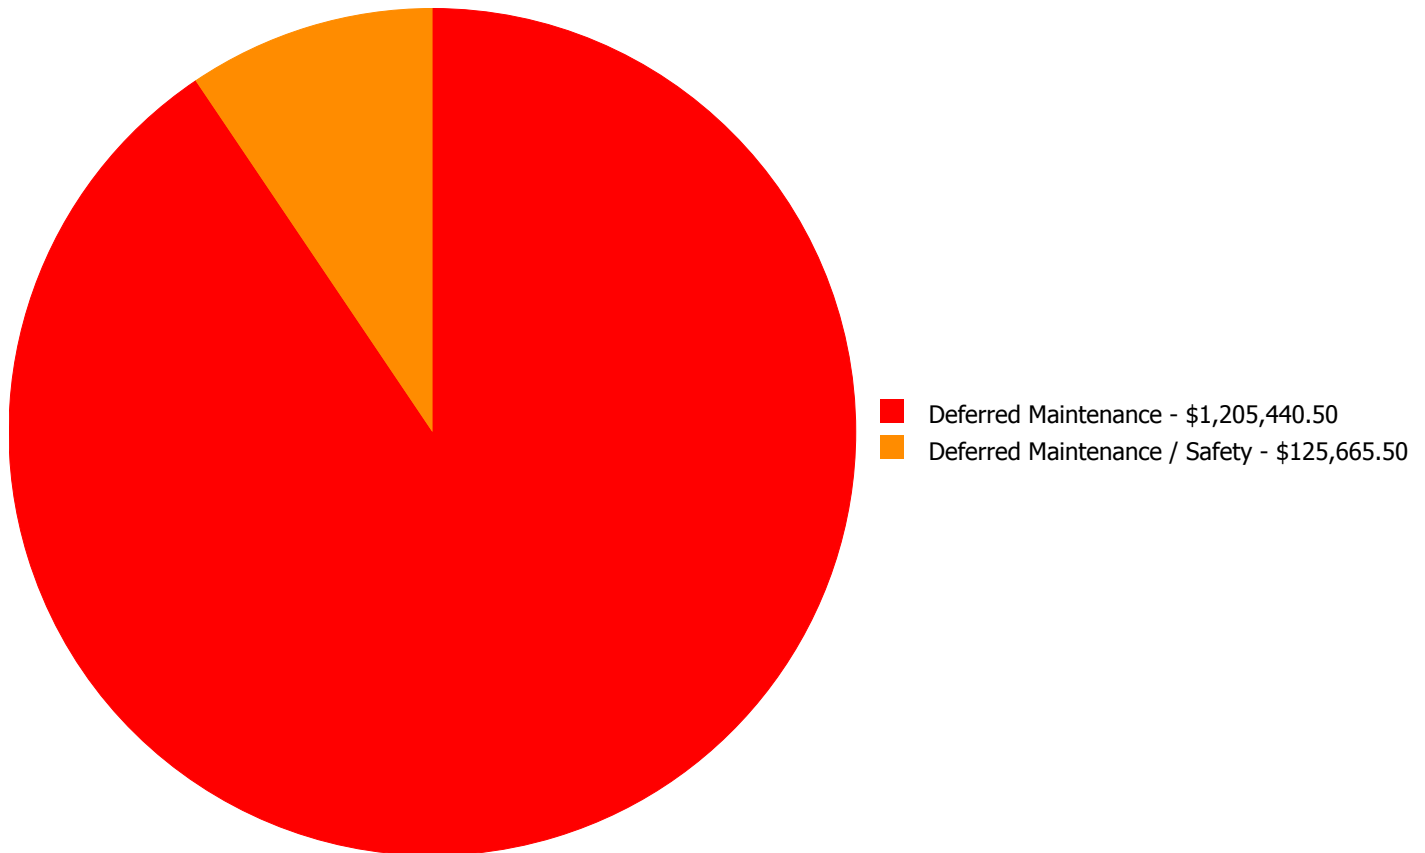

Budget Estimate Total: \$1,331,106.00

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 2 Priority:

System: G4020 - Site Lighting



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance / Safety

Priority: 2 Priority

Correction: Renew System

Qty: 53,528.00

Unit of Measure: S.F.

Estimate: \$67,712.92

Assessor Name: Sam Mandola

Date Created: 07/16/2015

Notes: Site lighting is beyond its expected service life, inadequate, and should be scheduled for replacement/upgrade to provide better coverage.

Priority 3 Priority:

System: G2010 - Roadways



Location: West Side of Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 33,692.00

Unit of Measure: S.F.

Estimate: \$191,606.40

Assessor Name: Eduardo Lopez

Date Created: 07/16/2015

Notes: Roadways are beyond their expected service life, have some deterioration, and should be scheduled for replacement.

System: G2020 - Parking Lots



Location: South Side of Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 9,612.00

Unit of Measure: S.F.

Estimate: \$48,213.79

Assessor Name: Sam Mandola

Date Created: 07/16/2015

Notes: The parking lots are beyond their expected service life, deteriorating, not fully ADA compliant, and should be replaced.

System: G2030 - Pedestrian Paving



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 53,528.00

Unit of Measure: S.F.

Estimate: \$88,321.20

Assessor Name: Sam Mandola

Date Created: 07/16/2015

Notes: Pedestrian paving is beyond its expected service life, damaged, and should be replaced. SPLOST project 414-422 to replace/repair pedestrian paving throughout site.

System: G2040 - Fencing & Guardrails



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 53,528.00

Unit of Measure: S.F.

Estimate: \$53,581.53

Assessor Name: Eduardo Lopez

Date Created: 07/16/2015

Notes: Fencing is beyond its expected service life and should be scheduled for replacement.

System: G2040 - Hard Surface Play Area



Location: South Site of Site

Distress: Beyond Service Life

Category: Deferred Maintenance / Safety

Priority: 3 Priority

Correction: Renew System

Qty: 8,416.00

Unit of Measure: S.F.

Estimate: \$57,952.58

Assessor Name: Eduardo Lopez

Date Created: 07/16/2015

Notes: The hard surface play area is beyond its expected service life, damaged with cracks, and should be replaced. Basketball goals are also damaged and should be replaced.

System: G2040 - Playing Field



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 47,514.00

Unit of Measure: S.F.

Estimate: \$204,880.37

Assessor Name: Eduardo Lopez

Date Created: 10/30/2015

Notes: The playing field is beyond its expected service life, worn and bare, and should be replaced and barricaded to prevent erosion and damage from cars driving on it.

System: G2050 - Landscaping



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 53,528.00

Unit of Measure: S.F.

Estimate: \$85,377.16

Assessor Name: Eduardo Lopez

Date Created: 07/16/2015

Notes: Landscaping is beyond its expected service life, damaged, and should be replaced. In addition, the site does not drain properly in all areas; SPLOST project 414-422 to review and make repairs.

System: G3010 - Water Supply



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 53,528.00

Unit of Measure: S.F.

Estimate: \$107,751.86

Assessor Name: Eduardo Lopez

Date Created: 07/16/2015

Notes: The site water supply system is beyond its expected service life and should be scheduled for replacement.

System: G3020 - Sanitary Sewer



Location: Site
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 53,528.00
Unit of Measure: S.F.
Estimate: \$67,712.92
Assessor Name: Eduardo Lopez
Date Created: 07/16/2015

Notes: The site sanitary sewer system is beyond its expected service life and should be scheduled for replacement.

System: G3030 - Storm Sewer



Location: Site
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 53,528.00
Unit of Measure: S.F.
Estimate: \$209,026.84
Assessor Name: Sam Mandola
Date Created: 07/16/2015

Notes: The storm sewer system is beyond its expected service life and should be scheduled for replacement. Site does not drain properly in all areas; SPLOST project 414-422 to review and make repairs.

System: G4010 - Electrical Distribution



Location: Site
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 53,528.00
Unit of Measure: S.F.
Estimate: \$109,518.29
Assessor Name: Eduardo Lopez
Date Created: 07/16/2015

Notes: The site electrical distribution system is beyond its expected service life and should be scheduled for replacement.

System: G4030 - Site Communications & Security



Location: Site
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 53,528.00
Unit of Measure: S.F.
Estimate: \$39,450.14
Assessor Name: Sam Mandola
Date Created: 07/16/2015

Notes: The site communications and security systems are beyond their expected service life, inadequate, and should be scheduled for replacement. School staff reports the need for security cameras in the parking lot.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	110
Year Built:	1980
Last Renovation:	
Replacement Value:	\$9,606
Repair Cost:	\$2,305.00
Total FCI:	24.00 %
Total RSLI:	49.73 %
FCA Score:	76.00



Description:

The storage building at Hawthorne Elementary School is a one-story building located at 2535 Caladium Drive N.E. in Atlanta, Georgia. Originally built in 1980, there have been no additions or major renovations to this building. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:

Building Codes:

Fire Sprinkler System:

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	65.00 %	0.00 %	\$0.00
A20 - Basement Construction	65.00 %	0.00 %	\$0.00
B10 - Superstructure	65.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	59.28 %	5.86 %	\$273.00
B30 - Roofing	0.00 %	110.02 %	\$2,032.00
C10 - Interior Construction	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	0.00 %	0.00 %	\$0.00
D20 - Plumbing	0.00 %	0.00 %	\$0.00
D50 - Electrical	0.00 %	0.00 %	\$0.00
Totals:	49.73 %	24.00 %	\$2,305.00

Photo Album

The photo album consists of the various cardinal directions of the building.

1). South Elevation - Jul 16, 2015



2). East Elevation - Jul 16, 2015



3). North Elevation - Jul 16, 2015



4). West Elevation - Jul 16, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$4.49	S.F.	110	100	1980	2080		65.00 %	0.00 %	65			\$494
A1030	Slab on Grade	\$3.60	S.F.	110	100	1980	2080		65.00 %	0.00 %	65			\$396
A2010	Basement Excavation	\$0.22	S.F.	110	100	1980	2080		65.00 %	0.00 %	65			\$24
A2020	Basement Walls	\$3.52	S.F.	110	100	1980	2080		65.00 %	0.00 %	65			\$387
B1020	Roof Construction	\$16.33	S.F.	110	100	1980	2080		65.00 %	0.00 %	65			\$1,796
B2010	Exterior Walls	\$38.65	S.F.	110	100	1980	2080		65.00 %	0.00 %	65			\$4,252
B2020	Exterior Windows	\$1.46	S.F.	110	30	1980	2010		0.00 %	0.00 %	-5			\$161
B2030	Exterior Doors	\$2.26	S.F.	110	30	1980	2010		0.00 %	109.64 %	-5		\$273.00	\$249
B3010	Roof Coverings	\$16.79	S.F.	110	20	1980	2000		0.00 %	110.02 %	-15		\$2,032.00	\$1,847
C1010	Partitions	\$0.00	S.F.	110	40	1980	2020		12.50 %	0.00 %	5			\$0
C1020	Interior Doors	\$0.00	S.F.	110	30	1980	2010		0.00 %	0.00 %	-5			\$0
C1030	Fittings	\$0.00	S.F.	110	20	1980	2000		0.00 %	0.00 %	-15			\$0
C3010	Wall Finishes	\$0.00	S.F.	110	20	1980	2000		0.00 %	0.00 %	-15			\$0
C3020	Floor Finishes	\$0.00	S.F.	110	20	1980	2000		0.00 %	0.00 %	-15			\$0
C3030	Ceiling Finishes	\$0.00	S.F.	110	20	1980	2000		0.00 %	0.00 %	-15			\$0
D2040	Rain Water Drainage	\$0.00	S.F.	110	30	1980	2010		0.00 %	0.00 %	-5			\$0
D5010	Electrical Service/Distribution	\$0.00	S.F.	110	30	1980	2010		0.00 %	0.00 %	-5			\$0
D5020	Lighting and Branch Wiring	\$0.00	S.F.	110	30	1980	2010		0.00 %	0.00 %	-5			\$0
Total									49.73 %	24.00 %			\$2,305.00	\$9,606

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%


School Assessment Report - Storage

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$2,305	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$2,305
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2020 - Exterior Windows	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$273	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$273
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings	\$2,032	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$2,032
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting and Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

** Indicates non-renewable system*


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

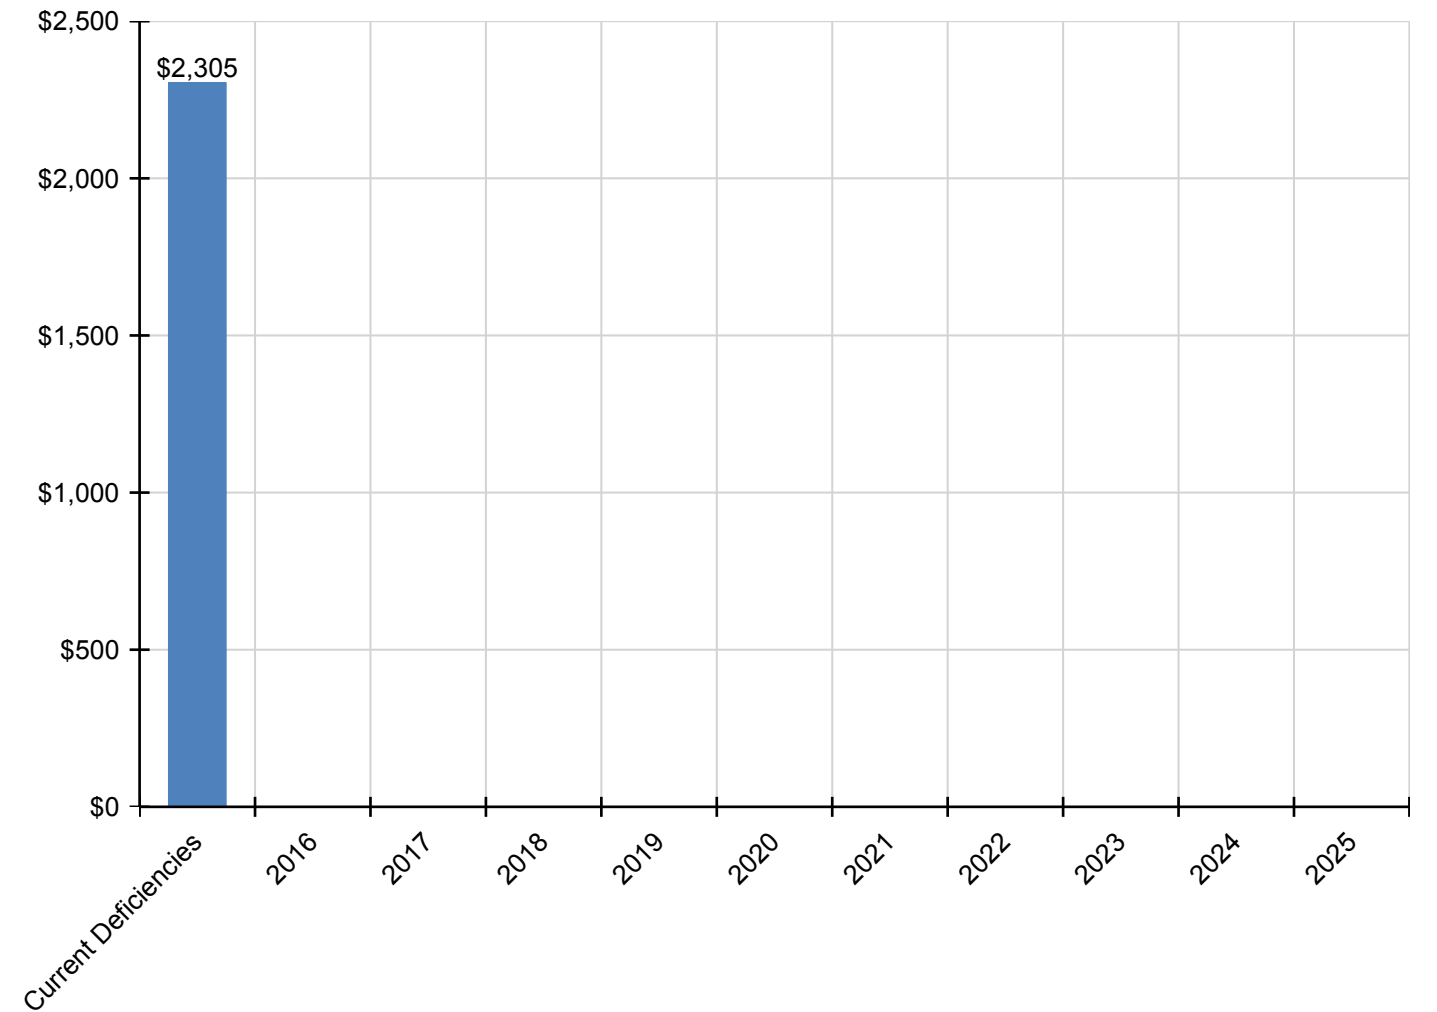


Deficiency Summary by System

Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

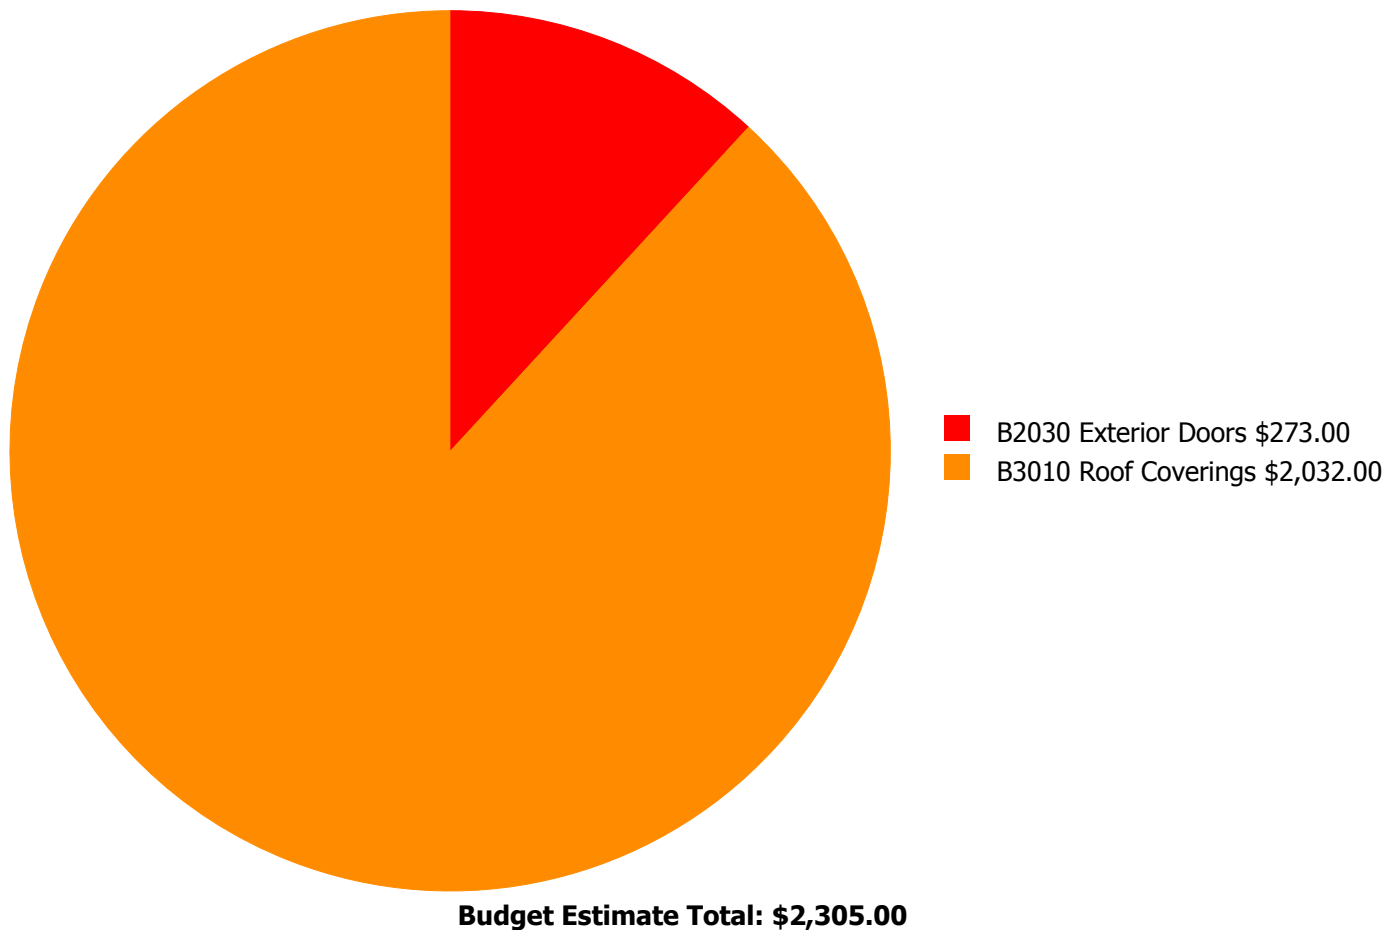

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

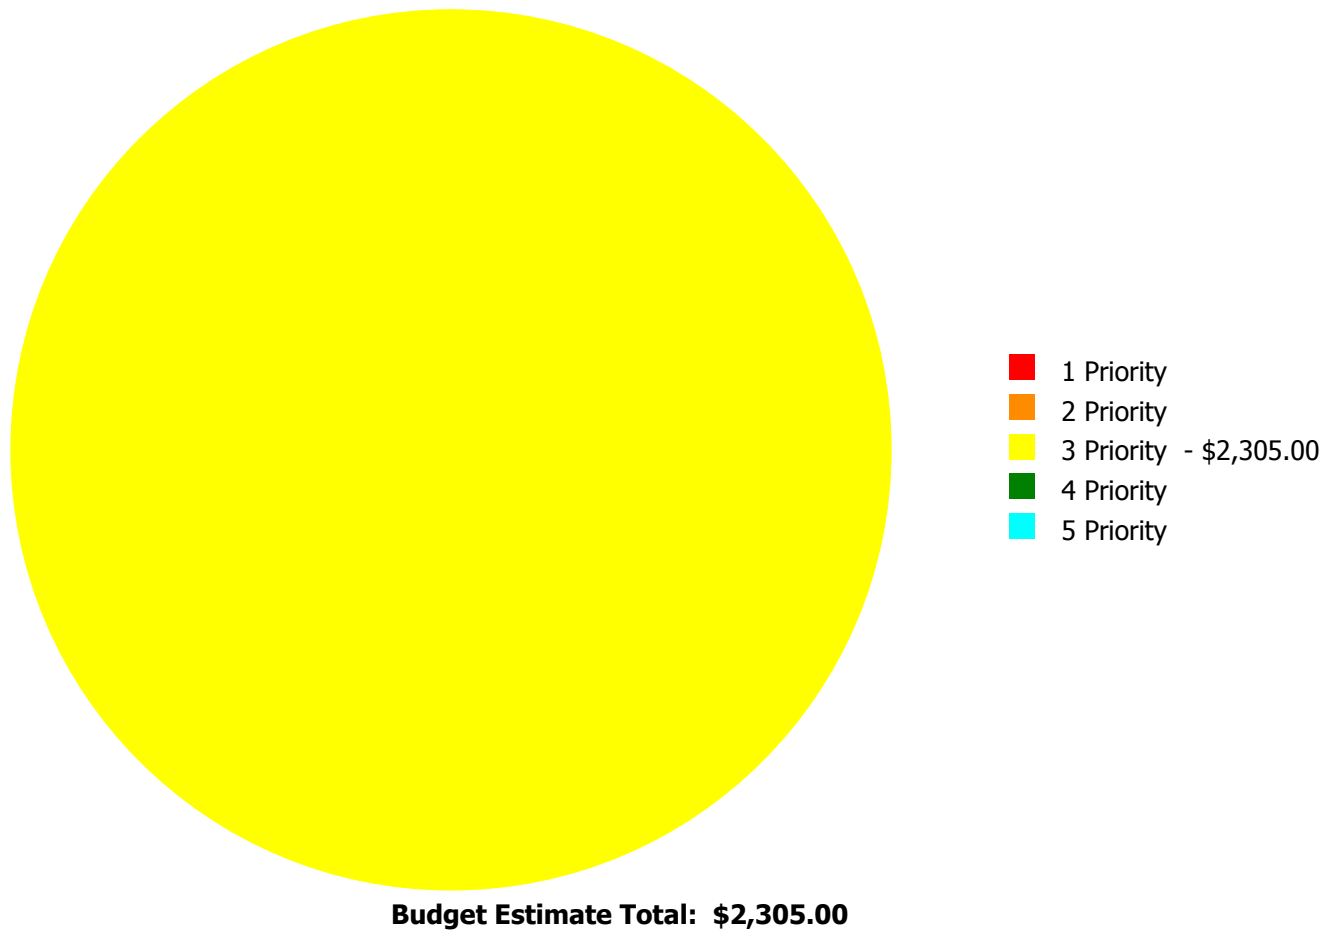

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards. .
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
B2030	Exterior Doors	\$0.00	\$0.00	\$273.00	\$0.00	\$0.00	\$273.00
B3010	Roof Coverings	\$0.00	\$0.00	\$2,032.00	\$0.00	\$0.00	\$2,032.00
	Total:	\$0.00	\$0.00	\$2,305.00	\$0.00	\$0.00	\$2,305.00

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

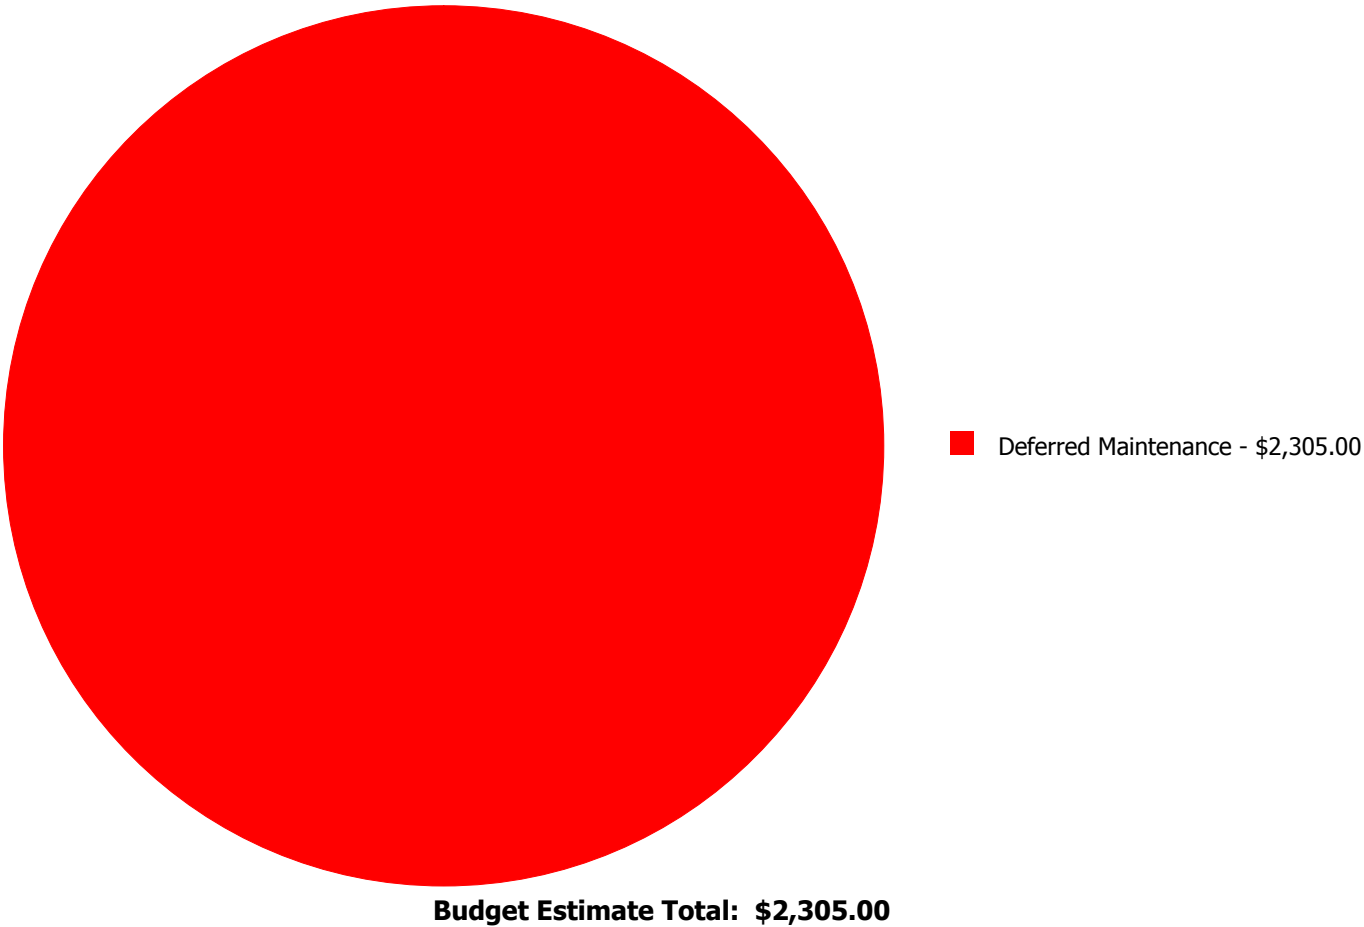

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 3 Priority:

System: B2030 - Exterior Doors



Location: South Elevation

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 110.00

Unit of Measure: S.F.

Estimate: \$273.00

Assessor Name: Sam Mandola

Date Created: 07/16/2015

Notes: The original exterior door is aged, rusted, and should be replaced.

System: B3010 - Roof Coverings



Location: Roof

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 110.00

Unit of Measure: S.F.

Estimate: \$2,032.00

Assessor Name: Somnath Das

Date Created: 07/16/2015

Notes: The built-up roof covering is aged, showing signs of failure, and should be replaced.

Glossary

Abandoned	A facility owned by a district that is not occupied and not maintained. See Vacant.
Additional Cost	Total project cost is composed of hard and soft costs. Additional costs or soft expenses are costs that are necessary to accomplish the corrective work but are not directly attributable to the deficient systems direct construction cost, which are often referred to as hard cost. The components included in the soft costs vary by owner but usually include architect and contractor fees, contingencies and other owner-incurred costs necessary to fully develop and build a facility. These soft cost factors can be adjusted anytime within the eCOMET® database at the owner's discretion.
Assessment	Visual survey of a facility to determine its condition. It involves looking at the age of systems, reviewing information from local sources and visual evidence of potential problems to assign a condition rating. It does not include destructive testing of materials or testing of systems or equipment for functionality.
ASTM	ASTM International (ASTM): Originally known as the American Society for Testing and Materials, ASTM is an international standards organization that develops and publishes voluntary consensus technical standards for a wide range of materials, products, systems, and services.
BOMA	Building Owners Managers of America (BOMA): National organization of public and private facility owners focused on building management tools and maintenance techniques. eCOMET® reference: Building and component system effective economic life expectancies.
Building	A fully enclosed and roofed structure that can be traversed internally without exiting to the exterior.
Building Addition	An area, space or component of a building added to a building after the original building's year built date. NOTE: As a convention in the database, "Main" was used to designate the original building. Additions built prior to 1983 (30 years) were included in the main building area calculations to reflect their predicted system depreciation characteristics and remaining service life.
Building Systems	eCOMET® uses UNIFORMAT II to organize building data. UNIFORMAT II was originally developed by the federal General Services Administration to delineate building costs by systems rather than by material. UNIFORMAT II was formalized by an NIST standard, NISTIR 6389 in 1999. It has been further quantified and updated by ASTM standard 2005, E1557-05. The Construction Specifications Institute, CSI, has taken over the standard as part of their MasterFormat / MasterSpec system.
Calculated Next Renewal	The year a system or building element would be expected to expire based solely on the date it was installed and the expected useful lifetime for that kind of system.
Capital Renewal	Capital renewal refers to the cyclical replacement of building systems or elements as they become obsolete or beyond their useful life. It is not normally included in an annual operating/maintenance budget. See calculated next renewal and next renewal.
City Cost Index (CCI)	RS Means provides building system, equipment, and construction costs at a national level. The City Cost Index (also provided by RS Means) localizes those costs to a geographic region of the United States. In eCOMET®, each building or site is assigned a City Cost Index, which adjusts all of the associated costs for systems, deficiencies and inventory to the local value.
Condition	Condition refers to the state of physical fitness or readiness of a facility system or system element for its intended use.
Condition Budget	The Condition Budget, also known as Condition Needs, represents the budgeted contractor installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging the work.

School Assessment Report - Hawthorne Elementary

Condition Index (CI) %	The Condition Index (CI) also known as the Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) Value divided by the sum of a system's Replacement Value (both values exclude soft cost to simplify calculation updates) expressed as a percentage ranging from 100.00% (new) to 0.00% (expired - no remaining life).
Construction Specifications Institute	Construction Specifications Institute: Primary national organization specializing in construction materials data and data location in construction documents. eCOMET® reference: UNIFORMAT II materials classification.
Correction	Correction refers to an assessor's recommended deficiency repair or replacement action. For any system or element deficiency, there can be multiple and alternative solutions for its repair or replacement. A Correction is user defined and tied to a UNIFORMAT II element, or system it is intended to address. It excludes other peripheral costs that may also be included in the packaging of repair, replacement or renewal improvements that may also be triggered by the deficiency correction.
Cost Model	A cost model is a list of facility systems which could represent the installed systems a given facility. Included in the cost model are standard unit cost estimates, gross areas, life cycles and installed dates. Also represented is the repair cost for deficient systems, replacement values. See eCOMET® cost models.
Criteria	Criteria refer to the set of requirements, guidelines or standards that are assessed and rated to develop a score.
Current Period	The Current Period is the current year plus a user defined number of forward years.
Current Replacement Value (CRV)	The Current Replacement Value (CRV) of a facility, building or system represents the hypothetical cost of rebuilding or replacing an existing facility under today's codes and construction standards, using its current configuration. It is calculated by multiplying the gross area of the facility by a square foot cost developed in that facility's cost model. Replacement cost includes construction costs and owner's additional or soft costs for fees, permits and other expenses to reflect a total project cost.
Deferred Maintenance	Deferred maintenance is condition work deferred on a planned or unplanned basis to a future budget cycle or postponed until funds are available.
Deficiency	A deficiency is a repair item that is damaged, missing, inadequate or insufficient for an intended purpose.
Deficiency Category	Deficiency Category refers to the type or class of a user defined deficiency grouping with shared or similar characteristics. Category descriptions include, but are not limited to: Accessibility Code Compliance, Appearance, Building Code Compliance, Deferred Maintenance, Energy, Environmental, Life Safety Code Compliance, and Safety.
Deficiency Distress	Deficiency Distress refers to a user-defined root cause of a deficiency. Distress descriptions are: Beyond Service Life, Damaged, Inadequate, Needs Remediation, and Missing.
Deficiency Priority	Deficiency Priority refers to a deficiency's urgency for repair as determined by the assessment team. Deficiencies were assigned a priority of 1 through 5, with Priority 1 deficiencies being the most urgent.
eCOMET®	Energy and Condition Management Estimation Technology (eCOMET®) is Parsons proprietary facility asset management software developed to provide facility managers with a state of the art, web-based tool to develop and maintain a comprehensive database of FCA data and information used for facility asset management, maintenance and repair, and capital renewal planning. eCOMET® is used by Parsons and its clients as the primary tool for collecting FCA data, preparing cost estimates, generating individual facility reports and cost estimates, and developing the overall capital renewal program.

School Assessment Report - Hawthorne Elementary

eCOMET® Cost Models	eCOMET® cost models are derived from RS Means Square Foot Cost Data cost models and these models are used to develop the current replacement value (CRV) and assign life cycle costs to the various systems within a building. Cost models are assigned current costs-per-square-foot to establish replacement values. The Cost models are designed to represent a client specific facility that meets local standards cost trends.
Element	Elements are the major components that comprise building systems as defined by UNIFORMAT II.
Expected Life	Also referred to as Useful Life. See Useful Life definition.
Facility	A facility refers to site(s), building(s), or building addition(s), or combinations thereof that provide a particular service or support of an educational purpose.
Facility Attributes	Customizable eCOMET® fields to identify attributes specific to a facility. These fields are part of the eCOMET® database set-up with the owner.
Facility Condition Assessment (FCA)	A facility condition assessment (FCA) is a visual inspection of buildings and grounds at a facility to identify and estimate current and future needed repairs or replacements of major systems for planning and budgeting purposes. It is typically performed for organizations that are tasked with the day to day maintenance, operation, and capital renewal (replacement) of building systems and components of a large inventory of facilities. The primary goal of an FCA is to objectively and quantifiably identify, inspect, and prioritize the repair and replacement needs of the building and ground systems (e.g., roofs, windows, doors, floor finishes, plumbing fixtures, parking lot, and sidewalks) within facilities that have either failed or have surpassed their service life, and to identify and forecast future capital replacement needs for systems that have not yet failed, but planned replacement of those systems is needed to ensure that the facilities will continue to meet the mission of the organization.
Facility Condition Index (FCI)	FCI is an industry-standard measurement of a facility's condition expressed as a percentage from 0.00% to 100.00% that is derived by dividing the cost to correct a facility's deficiencies by its Current Replacement Value (CRV). The higher the FCI the poorer the condition of a facility. After an FCI is established for all buildings within a portfolio, a building's condition can be ranked relative to other buildings. The FCI may also represent the condition of a portfolio based on the cumulative FCIs of the portfolio's facilities.
Forecast Period	The Forecast Period refers to a user defined number of years forward of the Current Period.
Gen (Generate)	The Cost Model has a Gen box for each system line item. By checking the box, eCOMET® will generate life cycle deficiencies based on the Year Installed and the Life for that system. Systems that typically do not re-generate (foundations, floor construction, roof construction, basement walls, etc.) would not have the Gen box checked as those systems would not re-generate at the end of a life cycle. In those instances, it would be more practical and cost effective to demolish the entire facility than renew those systems.
Gross Square Feet (GSF)	The area of the enclosed floor space of a building or building addition in square feet measured to the outside face of the enclosing wall.
Life cycle	Life cycle refers to the period of time that a building or site system or element can be expected to adequately serve its intended function. Parsons assigns expected life cycles to all building systems based on Building Operators and Managers of America (BOMA) recommended life cycles, manufacturers suggested life, and RS Means cost data, and client-provided historical data. BOMA standards are a nationally recognized source of life cycle data for various components and/or systems associated with facilities. RS Means is a national company specializing in construction estimating and costs.
Next Renewal	Next Renewal refers to a manually-adjusted expected useful life of a system or element based on on-site inspection either by reducing or extending the Calculated Next Renewal to more accurately reflect current conditions.

School Assessment Report - Hawthorne Elementary

Order of Magnitude	Order of Magnitude refers to a rough approximation made with a degree of knowledge and confidence that the budgeted, projected or estimated cost falls within a reasonable range of cost values.
Remaining Service Life (RSL)	RSL is the number of years of service remaining for a system or equipment item. It is automatically calculated based on the difference between the current year and the Calculated Next Renewal date or the Next Renewal date whichever one is the later date.
Renewal Factors	Renewal factors represent the difference in cost of renovating or replacing an existing system, rather than new construction of a building system. For example, installing a new built-up roof on an existing building would include removing and disposing of the old roof, a cost not associated with new construction. Using a renewal premium to account for demolition and other difficulty costs, Parsons typically assigns a renewal factor of 110%.
Renewal Schedule	A timeline by year that indicates when the systems will need to be renewed and the estimated price of the renewal.
Repair Cost	Repair cost is the sum of all the deficiencies associated with a building or multiple buildings/facilities. It will include any applied soft costs or City Cost Indexes.
Replacement Value	See Current Replacement Value.
Site	A facility's grounds and its utilities, roadways, landscaping, fencing and other typical land improvements needed to support a facility.
Soft Costs	Soft Costs are a construction industry term that refers to expense items that are not considered direct construction costs. Soft costs are user-defined and include architectural, engineering, management, testing, and mitigation fees, and other owner pre- and post-construction expenses.
Sustainability	Sustainability refers to the collection of policies and strategies that meet society's present needs without compromising the ability of future generations to meet their own needs.
System	System refers to building and related site work elements as described by ASTM UNIFORMAT II Classification for Building Elements (E1557-97), a format for classifying major facility elements common to most buildings. Elements usually perform a given function regardless of the design specification construction method or materials used. See also UNIFORMAT II.
System Generated Deficiency	eCOMET® automatically generates system deficiencies based on system life cycles using the systems installation dates as the base year. By adjusting the Next Renewal date ahead or behind the predicted or stated life cycle date, a system cost will come due earlier or later than the originally installed life cycle date. This utility accounts for good maintenance conditions and a longer life, or early expiration of a system life due to any number of adverse factors such as poor installation, acts of god, material defects, poor design applications and other factors that may shorten the life of a material or system. It is important to mention that the condition of the systems is not necessarily a reflection of maintenance practices, but a combination of system usage and age.
UNIFORMAT	ASTM UNIFORMAT II, Classification for Building Elements (E1557-97), a publication of the Construction Specification Institute (CSI), is a format used to classify major facility components common to most buildings. The format is based on functional elements or parts of a facility characterized by their functions without regard to the materials and methods used to accomplish them. These elements are often referred to as systems or assemblies.
Unit Price	The Unit Price (Raw) x (100% + the Additional Cost Template percentage).
Unit Price (Raw)	The actual \$/sq. ft cost being used for the building and systems. It will include adjustments for the City Cost Index applied to the facility.

School Assessment Report - Hawthorne Elementary

Useful Life	Also known as Expected Life, Useful Life refers to the intrinsic period of time a system or element is expected to perform as intended. Useful life is generally provided by manufacturers of materials, systems and elements through their literature, testing and experience. Useful Lives in the database are derived from the Building Owners and Managers (BOMA) organization's guidelines, RSMeans cost data, and from client- defined historical experience.
Vacant	Vacant refers to a facility that is not occupied but is a maintained facility by a district. See Abandoned.
Year Built	The year that a building or addition was originally built based on its date of substantial completion or occupancy.
Year Installed	The year a system or element was built or the most recent major renovation date where a minimum of 70% of the system's Current Replacement Value (CRV) was replaced.