

| School Name: Marbut Theme ES | | | | Grade Configuration: PK-5 |
|------------------------------|------------------|--------------------|--------|---|
| Score: 76.09 | | | | |
| Category | Points Earned | Possible Points | Rating | Comment |
| Art | | | | |
| Environment | 0.337 | 0.421 | Good | |
| Size | 0.842 | 1.053 | Good | |
| Location | 0.253 | 0.316 | Good | |
| Storage/Fixed Equip | 0.205 | 0.316 | Fair | The art room does not have a separate storage space as required by standard. |
| Computer Labs | | | | |
| Environment | 0.246 | 0.307 | Good | |
| Size | 0.384 | 0.768 | Poor | The size of the computer lab meets approximately 60% of the standard. |
| Location | 0.150 | 0.230 | Fair | The lab is located to the rear of the school by the gym. |
| Storage/Fixed Equip | 0.150 | 0.230 | Fair | The lab has limited storage. It has motion-sensor lighting, but does not have security cameras. |
| Early Childhood Education | | | | |
| Environment | 0.292 | 0.450 | Fair | HVAC temperatures are inconsistent across the campus. |
| Size | 1.125 | 1.125 | Excel | |
| Location | 0.337 | 0.337 | Excel | |
| Storage/Fixed Equip | 0.337 | 0.337 | Excel | |
| General Classrooms | | | | |
| Environment | 3.528 | 4.410 | Good | |
| Size | 8.820 | 11.025 | Good | |
| Location | 2.646 | 3.307 | Good | |
| Storage/Fixed Equip | 2.646 | 3.307 | Good | |
| Instructional Resource Rooms | | | | |
| Environment | 0.518 | 0.648 | Good | |
| Size | 1.296 | 1.620 | Good | |
| Location | 0.389 | 0.486 | Good | |
| 2/22/2016 | | | | Page 1 of |

Page 1 of 5



| School Name: Marbut Theme ES | | | | Grade Configuration: PK-5 |
|---------------------------------|------------------|--------------------|--------|--|
| Score: 76.09 | | | | |
| Category | Points Earned | Possible Points | Rating | Comment |
| Instructional Resource Rooms | | | | |
| Storage/Fixed Equip | 0.389 | 0.486 | Good | |
| Kindergarten & Pre-Kindergarten | | | | |
| Environment | 0.244 | 0.375 | Fair | HVAC temperatures are inconsistent across campus. |
| Size | 0.938 | 0.938 | Excel | |
| Location | 0.282 | 0.282 | Excel | |
| Storage/Fixed Equip | 0.282 | 0.282 | Excel | |
| Learning Environment | | | | |
| Learning Style Variety | 3.600 | 4.500 | Good | |
| Interior Environment | 1.440 | 1.800 | Good | |
| Exterior Environment | 1.080 | 1.350 | Good | |
| Environment | 0.570 | 0.877 | Fair | There is natural lighting that brightens the overall environment of the media center. HVAC temperatures are inconsistent. Limited space is challenging when staff design spatial configured lessons. |
| Media Center | | | | |
| Size | 1.425 | 2.193 | Fair | The media center at Marbut meets approximately 76% of the size criteria. |
| Location | 0.526 | 0.658 | Good | |
| Storage/Fixed Equip | 0.526 | 0.658 | Good | There is limited storage. |
| Music | | | | |
| Environment | 0.433 | 0.667 | Fair | There is a single music program at Marbut Elementary School. The HVAC temperature is adequate, but there are roof leaks. |
| Size | 1.083 | 1.667 | Fair | The general music room meets the specifications for square footage, but the site lacks a second music program. |
| Location | 0.325 | 0.500 | Fair | The general music classroom is located to the far side of campus. A second program is unavailable. |



| School Name: Marbut Theme ES | | | | Grade Configuration: PK-5 |
|----------------------------------|------------------|--------------------|--------|--|
| Score: 76.09 | | | | |
| Category | Points Earned | Possible Points | Rating | Comment |
| Music | | | | |
| Storage/Fixed Equip | 0.325 | 0.500 | Fair | A 210 square foot storage closet is available in the general music room. The second program is non-existent. |
| Performing Arts | | | | |
| Environment | 0.354 | 0.544 | Fair | The multi-purpose space within the cafeteria has a stage with ADA access from the rear. There are no dressing rooms available. |
| Size | 1.088 | 1.360 | Good | |
| Location | 0.326 | 0.408 | Good | |
| Storage/Fixed Equip | 0.326 | 0.408 | Good | |
| Physical Education | | | | |
| Environment | 1.382 | 1.728 | Good | |
| Size | 3.456 | 4.320 | Good | |
| Location | 1.037 | 1.296 | Good | |
| Storage/Fixed Equip | 1.037 | 1.296 | Good | Storage is adequate; however safety pads were missing. |
| Science | | | | |
| Environment | 0.360 | 0.450 | Good | |
| Size | 0.900 | 1.125 | Good | |
| Location | 0.270 | 0.337 | Good | |
| Storage/Fixed Equip | 0.270 | 0.337 | Good | |
| Self-Contained Special Education | | | | |
| Environment | 0.000 | 0.432 | Unsat | Marbut does not have self-contained special education space. |
| Size | 0.000 | 1.080 | Unsat | Marbut does not have self-contained special education space. |
| Location | 0.000 | 0.324 | Unsat | Marbut does not have self-contained special education space. |
| Storage/Fixed Equip | 0.000 | 0.324 | Unsat | Marbut does not have self-contained special education space. |



School Name: Marbut Theme ES **Grade Configuration:** PK-5 76.09 Score: **Points** Possible Category Earned **Points** Rating Comment Non-Instructional Spaces Administration 1.842 2.302 Good Cafeteria 2.925 4.500 Fair Cafeteria storage cannot accommodate all tables and chairs. The student restroom closest to the cafeteria does not have hot water. Food Service and Prep 4.467 5.584 Good Clinic 0.421 0.526 Good Counseling 0.211 0.263 Good **Custodial and Maintenance** 0.292 0.450 Fair The facility lacks a receiving area. Student Restrooms 0.639 0.798 Good **Faculty Work Space and Toilets** 0.912 1.140 Good **Outside Spaces** Vehicular Traffic 1.170 1.800 Fair The bus loading zone lacks covered walkways. The drop-off/pick-up area does not have a covered loading area. Pedestrian Traffic 0.701 0.876 Good **Parking** 0.585 0.731 Good Play Areas 1.369 2.107 Fair There are hard surface and grass areas for playing. The playground is not ADA accessible. There are a bank of steps to travel in reaching the playing fields. A drive is available to access the lower fields. Playground equipment area needs an enhanced ground surface to cushion falls. Safety and Security 0.677 Fencing 0.440Fair There is a need for enhanced fencing to limit community access. Signage & Way Finding 0.720 0.900 Good There were no surveillance or search signs posted on campus. Ease of Supervision 2.160 2.700 Good **Controlled Entrances** 0.292 0.450 Fair There is a buzzer and card access system available at the site. The site lacks a security vestibule. Security staff monitor the main entrance for enhanced supervision. Technology Readiness 1.500 1.500 IDF & MDF Environment Good

Page 4 of 5



| School Name: Marbut Theme ES | | | | Grade Configuration: PK-5 |
|------------------------------------|------------------|--------------------|--------|---|
| Score: 76.09 | | | | |
| Category | Points Earned | Possible Points | Rating | Comment |
| Technology Readiness | | | | |
| Electrical Power | 0.500 | 1.000 | Fair | The school needs to be upgraded to meet the standard of seven quads per classroom, a duplex in the ceiling and on the front wall. |
| Equity of Access, Wireless & Drops | 1.000 | 1.000 | Good | |
| LAN Connectivity | 1.500 | 1.500 | Good | |
| WAN Backbone | 1.000 | 1.000 | Good | |
| LAN-WAN Performance | 0.670 | 1.000 | Fair | The Internet is slow and unreliable at times. |
| Faculty & Staff Technology | 1.000 | 1.000 | Good | |
| Laptop Carts | 0.500 | 1.000 | Fair | GFI concern - can't plug in security camera and charge carts simultaneously. |
| Telephone/PA | 0.500 | 1.000 | Fair | PA does not cover the exterior areas. |
| Total | 76.09 / | 100.00 = | 76.09 | |

2/23/2016 Page 5 of 5