**DeKalb County School District/Elementary Schools** 

# **Canby Lane Elementary**

School Assessment Report
May 19, 2016



# **Table of Contents**

School Executive Summary	4
School Condition Summary	6
1967, 1969 Building	3
Executive Summary	3
Condition Summary	9
Photo Album	10
Condition Detail	11
System Listing	12
Renewal Schedule	14
Forecasted Sustainment Requirement	17
Deficiency Summary By System	18
Deficiency Summary By Priority	19
Deficiency By Priority Investment	20
Deficiency Summary By Category	2′
Deficiency Details By Priority	22
1994 Addition	37
Executive Summary	37
Condition Summary	38
Photo Album	39
Condition Detail	40
System Listing	4
Renewal Schedule	43
Forecasted Sustainment Requirement	46
Deficiency Summary By System	47
Deficiency Summary By Priority	48
Deficiency By Priority Investment	49
Deficiency Summary By Category	50
Deficiency Details By Priority	5′
<u>2000 Gym</u>	57

# School Assessment Report

I	Executive Summary	57
	Condition Summary	58
I	Photo Album	59
(	Condition Detail	60
	System Listing	61
	Renewal Schedule	62
	Forecasted Sustainment Requirement	64
	Deficiency Summary By System	65
	Deficiency Summary By Priority	66
	Deficiency By Priority Investment	67
	Deficiency Summary By Category	68
	Deficiency Details By Priority	69
<u>Site</u>		72
I	Executive Summary	72
	Condition Summary	73
ı	Photo Album	74
(	Condition Detail	75
	System Listing	76
	Renewal Schedule	77
	Forecasted Sustainment Requirement	79
	Deficiency Summary By System	80
	Deficiency Summary By Priority	81
	Deficiency By Priority Investment	82
	Deficiency Summary By Category	83
	Deficiency Details By Priority	84
(	Glossary	89

### **School Executive Summary**

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. Facility Condition Index ( FCI) is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term FCA Score is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Gross Area (SF): 70,126

Year Built: 1967

Last Renovation:

Replacement Value: \$16,042,511

Repair Cost: \$9,483,597.77

Total FCI: 59.12 %

Total RSLI: 20.50 %

FCA Score: 40.88



#### **Description:**

The Canby Lane Elementary School campus consists of two buildings located at 4150 Green Hawk Trail in Decatur, Georgia. The original campus was constructed in 1967, additions to the main school building were constructed in 1969 and 1994, and a gymnasium building was constructed in 2000. In addition to the buildings, the campus contains a covered walkway, hard surface play area, playgrounds, and playing field. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report for each building and site improvement on the campus.

## School Assessment Report - Canby Lane Elementary

#### **Attributes:**

#### **General Attributes:**

Assigned Region: Region 5 Board District: District 5 DOE Facility: 3052 Geographic Region: Region 5

HS Attendance Area: Towers HS Jurisdictional City: DeKalb County (Unincorporated)

Site Acreage: 11.6

## **School Condition Summary**

The Table below shows the RSLI and FCI for each major system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.


#### **Current Investment Requirement and Condition by Uniformat Classification**

UNIFORMAT Classification	RSLI%	FCI %	<b>Current Repair</b>
A10 - Foundations	60.19 %	0.00 %	\$0.00
A20 - Basement Construction	0.00 %	0.00 %	\$0.00
B10 - Superstructure	64.67 %	0.00 %	\$0.00
B20 - Exterior Enclosure	44.04 %	26.05 %	\$430,835.00
B30 - Roofing	6.83 %	83.03 %	\$1,191,920.00
C10 - Interior Construction	38.94 %	32.83 %	\$295,535.00
C20 - Stairs	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	3.98 %	78.88 %	\$1,573,033.00
D10 - Conveying	0.00 %	0.00 %	\$0.00
D20 - Plumbing	34.56 %	25.99 %	\$468,274.00
D30 - HVAC	12.19 %	83.74 %	\$2,161,360.00
D40 - Fire Protection	30.00 %	0.00 %	\$0.00
D50 - Electrical	6.08 %	90.40 %	\$1,529,934.77
E10 - Equipment	0.00 %	110.00 %	\$555,952.00
E20 - Furnishings	0.00 %	110.00 %	\$381,876.00
F10 - Special Construction	0.00 %	0.00 %	\$0.00
G20 - Site Improvements	8.15 %	79.82 %	\$694,318.00
G30 - Site Mechanical Utilities	3.57 %	11.74 %	\$60,168.00
G40 - Site Electrical Utilities	2.02 %	54.40 %	\$140,392.00
Totals:	20.50 %	59.12 %	\$9,483,597.77

### **Condition Deficiency Priority**

Facility Name	Gross Area (S.F.)	FCI %	1 Priority	2 Priority	3 Priority	4 Priority	5 Priority
1967, 1969 Building	50,800	69.11	\$0.00	\$201,168.00	\$7,249,721.77	\$0.00	\$0.00
1994 Addition	13,848	38.29	\$0.00	\$0.00	\$1,039,485.00	\$0.00	\$0.00
2000 Gym	5,478	10.86	\$0.00	\$0.00	\$98,345.00	\$0.00	\$0.00
Site	70,126	54.55	\$0.00	\$88,709.00	\$806,169.00	\$0.00	\$0.00
Total:		59.12	\$0.00	\$289,877.00	\$9,193,720.77	\$0.00	\$0.00

# **Deficiencies By Priority**

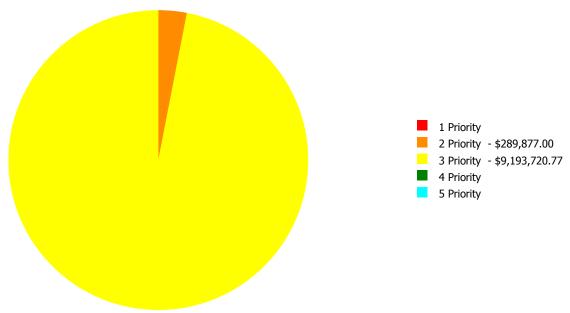

#### **Executive Summary**

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The Repair Cost (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. Facility Condition Index ( FCI) is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term FCA Score is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function: Elementary School

Gross Area (SF): 50,800

Year Built: 1967

Last Renovation:

Replacement Value: \$10,781,403

Repair Cost: \$7,450,889.77

Total FCI: 69.11 %

Total RSLI: 17.16 %

FCA Score: 30.89



#### **Description:**

The main building at Canby Lane Elementary School main building is a one-story building located at 4150 Green Hawk Trail in Decatur, Georgia. Original constructed in 1967, there have been two additions in 1969 and 1994, and no major renovations. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

#### **Attributes:**

**General Attributes:** 

Building Codes: 2010, 2011 Fire Sprinkler System: No

# **Condition Summary**

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.


UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	52.00 %	0.00 %	\$0.00
A20 - Basement Construction	0.00 %	0.00 %	\$0.00
B10 - Superstructure	52.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	35.10 %	35.74 %	\$430,835.00
B30 - Roofing	0.00 %	110.00 %	\$1,191,920.00
C10 - Interior Construction	29.90 %	40.86 %	\$253,035.00
C20 - Stairs	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	1.15 %	78.26 %	\$1,245,729.00
D10 - Conveying	0.00 %	0.00 %	\$0.00
D20 - Plumbing	34.66 %	34.85 %	\$468,274.00
D30 - HVAC	13.31 %	83.24 %	\$1,612,697.00
D40 - Fire Protection	0.00 %	0.00 %	\$0.00
D50 - Electrical	0.00 %	110.42 %	\$1,398,464.77
E10 - Equipment	0.00 %	110.00 %	\$549,859.00
E20 - Furnishings	0.00 %	110.00 %	\$300,076.00
F10 - Special Construction	0.00 %	0.00 %	\$0.00
Totals:	17.16 %	69.11 %	\$7,450,889.77

# **Photo Album**

The photo album consists of the various cardinal directions of the building.

1). Northeast Elevation - Feb 09, 2011







3). West Elevation - Feb 09, 2011



4). North Elevation - Feb 09, 2011



5). North Elevation - Feb 09, 2011



#### **Condition Detail**

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

- 1. System Code: A code that identifies the system.
- 2. System Description: A brief description of a system present in the building.
- 3. Unit Price \$: The unit price of the system.
- 4. UoM: The unit of measure of the system.
- 5. Qty: The quantity for the system.
- 6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
- 7. Year Installed: The date of system installation.
- 8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
- 9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
- 10. RSLI: The Remaining Service Life Index of the system.
- 11. FCI: The Facility Condition Index of the system.
- 12. RSL: Remaining Service Life in years.
- 13. eCR: eCOMET Condition Rating (not used in this assessment).
- 14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
- 15. Replacement Value \$: The replacement cost of the system.

# **System Listing**

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$ UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$6.49 S.F.	50,800	100	1967	2067		52.00 %	0.00 %	52			\$329,692
A1020	Special Foundations	\$4.46 S.F.	0	100	1967	2067		52.00 %	0.00 %	52			\$0
A1030	Slab on Grade	\$7.09 S.F.	50,800	100	1967	2067		52.00 %	0.00 %	52			\$360,172
A2010	Basement Excavation	\$0.26 S.F.	0	100	1967	2067		52.00 %	0.00 %	52			\$0
A2020	Basement Walls	\$6.13 S.F.	0	100	1967	2067		52.00 %	0.00 %	52			\$0
B1010	Floor Construction	\$15.61 S.F.	0	100	1967	2067		52.00 %	0.00 %	52			\$0
B1020	Roof Construction	\$5.34 S.F.	50,800	100	1967	2067		52.00 %	0.00 %	52			\$271,272
B2010	Exterior Walls	\$16.02 S.F.	50,800	100	1967	2067		52.00 %	0.00 %	52			\$813,816
B2020	Exterior Windows	\$6.79 S.F.	50,800	30	1967	1997		0.00 %	110.00 %	-18		\$379,425.00	\$344,932
B2030	Exterior Doors	\$0.92 S.F.	50,800	30	1967	1997		0.00 %	110.00 %	-18		\$51,410.00	\$46,736
B3010	Roof Coverings - Asphal Shingles	\$4.32 S.F.	0	10	1967	1977		0.00 %	0.00 %	-38			\$0
B3010	Roof Coverings - BUR	\$20.70 S.F.	50,800	25	1967	1992		0.00 %	110.00 %	-23		\$1,156,716.00	\$1,051,560
B3010	Roof Coverings - EPDM	\$3.33 S.F.	0	15	1967	1982		0.00 %	0.00 %	-33			\$0
B3010	Roof Coverings - Preformed Metal	\$5.01 S.F.	0	30	1967	1997		0.00 %	0.00 %	-18			\$0
B3010	Roof Coverings - Standing Seam Metal	\$27.45 S.F.	0	75	1967	2042		36.00 %	0.00 %	27			\$0
B3020	Roof Openings	\$0.63 S.F.	50,800	30	1967	1997		0.00 %	110.00 %	-18		\$35,204.00	\$32,004
C1010	Partitions	\$7.01 S.F.	50,800	100	1967	2067		52.00 %	0.00 %	52			\$356,108
C1020	Interior Doors	\$2.39 S.F.	50,800	30	1967	1997		0.00 %	80.00 %	-18		\$97,130.00	\$121,412
C1030	Fittings	\$2.79 S.F.	50,800	20	1967	1987		0.00 %	110.00 %	-28		\$155,905.00	\$141,732
C2010	Stair Construction	\$1.81 S.F.	0	100	1967	2067		52.00 %	0.00 %	52			\$0
C3010	Wall Finishes - Ceramic & Glazed	\$10.27 S.F.	19,392	30	1967	1997		0.00 %	110.00 %	-18		\$219,071.00	\$199,156
C3010	Wall Finishes - Paint	\$1.93 S.F.	29,088	10	2005	2015		0.00 %	110.00 %	0		\$61,754.00	\$56,140
C3010	Wall Finishes - Wall Coverings	\$2.13 S.F.	0	10	1967	1977		0.00 %	0.00 %	-38			\$0
C3020	Floor Finishes - Carpet	\$8.50 S.F.	5,144	8	1995	2003		0.00 %	110.00 %	-12		\$48,096.00	\$43,724
C3020	Floor Finishes - Ceramic & Quarry Tile	\$14.49 S.F.	3,814	50	1967	2017		4.00 %	0.00 %	2			\$55,265
C3020	Floor Finishes - Terrazzo	\$53.01 S.F.	7,620	50	1967	2017		4.00 %	0.00 %	2			\$403,936
C3020	Floor Finishes - VCT	\$9.54 S.F.	34,222	20	1967	1987		0.00 %	110.00 %	-28		\$359,126.00	\$326,478
C3020	Floor Finishes - Wood	\$14.70 S.F.	0	20	1967	1987		0.00 %	0.00 %	-28			\$0
C3030	Ceiling Finishes	\$9.98 S.F.	50,800	20	1967	1987		0.00 %	110.00 %	-28		\$557,682.00	\$506,984
D1010	Elevators and Lifts	\$1.17 S.F.	0	30	1967	1997		0.00 %	0.00 %	-18			\$0
D2010	Plumbing Fixtures	\$17.66 S.F.	50,800	30	2000	2030		50.00 %	0.00 %	15			\$897,128
D2020	Domestic Water Distribution	\$3.99 S.F.	50,800	30	1967	1997		0.00 %	110.00 %	-18		\$222,961.00	\$202,692
D2030	Sanitary Waste	\$3.41 S.F.	50,800	30	1967	1997		0.00 %	110.00 %	-18		\$190,551.00	\$173,228
D2040	Rain Water Drainage	\$0.98 S.F.	50,800	30	1967	1997		0.00 %	110.00 %	-18		\$54,762.00	\$49,784

# School Assessment Report - 1967, 1969 Building

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
D2090	Other Plumbing Systems - Natural Gas	\$0.41	S.F.	50,800	40	2008	2048		82.50 %	0.00 %	33			\$20,828
D3020	Heat Generating Systems	\$4.55	S.F.	50,800	30	2006	2036		70.00 %	0.00 %	21			\$231,140
D3030	Cooling Generating Systems	\$4.73	S.F.	50,800	25	2000	2025		40.00 %	0.00 %	10			\$240,284
D3040	Distribution & Exhaust Systems	\$5.51	S.F.	50,800	30	1967	1997		0.00 %	110.00 %	-18		\$307,899.00	\$279,908
D3050	Terminal & Package Units	\$18.52	S.F.	50,800	15	1967	1982		0.00 %	110.00 %	-33		\$1,034,898.00	\$940,816
D3060	Controls & Instrumentation	\$3.60	S.F.	50,800	20	1967	1987		0.00 %	110.00 %	-28		\$201,168.00	\$182,880
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$1.23	S.F.	50,800	30	1967	1997		0.00 %	110.00 %	-18		\$68,732.00	\$62,484
D4010	Sprinklers	\$4.75	S.F.	0	30				0.00 %	0.00 %				\$0
D4020	Standpipes	\$0.51	S.F.	0	30				0.00 %	0.00 %				\$0
D5010	Electrical Service/Distribution	\$1.81	S.F.	50,800	40	1967	2007		0.00 %	110.00 %	-8		\$101,143.00	\$91,948
D5020	Branch Wiring	\$6.78	S.F.	50,800	30	1967	1997		0.00 %	110.00 %	-18		\$378,866.00	\$344,424
D5020	Lighting	\$8.90	S.F.	50,800	30	1967	1997		0.00 %	110.00 %	-18		\$497,332.00	\$452,120
D5030	Communications and Security - Clock & PA Systems	\$5.60	S.F.	50,800	15	1967	1982		0.00 %	110.00 %	-33		\$312,928.00	\$284,480
D5030	Communications and Security - Fire Alarm	\$1.23	S.F.	50,800	15	1967	1982		0.00 %	110.00 %	-33		\$68,732.00	\$62,484
D5030	Communications and Security - Security & CCTV	\$0.61	S.F.	50,800	15	1967	1982		0.00 %	110.00 %	-33		\$34,087.00	\$30,988
D5090	Other Electrical Systems - Emergency Generator	\$0.35	S.F.	0	15	1967	1982		0.00 %	0.00 %	-33		\$5,376.77	\$0
E1010	Commercial Equipment	\$0.83	S.F.	0	20	1967	1987		0.00 %	0.00 %	-28			\$0
E1020	Institutional Equipment	\$0.40	S.F.	50,800	20	1967	1987		0.00 %	110.00 %	-28		\$22,352.00	\$20,320
E1090	Other Equipment (Kitchen Equipment)	\$9.44	S.F.	50,800	20	1967	1987		0.00 %	110.00 %	-28		\$527,507.00	\$479,552
E2010	Fixed Furnishings	\$5.37	S.F.	50,800	20	1967	1987		0.00 %	110.00 %	-28		\$300,076.00	\$272,796
F1010	Special Structures - Canopies	\$1.61	S.F.	0	25	1967	1992		0.00 %	0.00 %	-23			\$0
								Total	17.16 %	69.11 %			\$7,450,889.77	\$10,781,403

# **Renewal Schedule**

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$7,450,890	\$0	\$535,883	\$0	\$0	\$0	\$0	\$0	\$60,927	\$0	\$438,205	\$8,485,905
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1020 - Special Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1010 - Floor Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2020 - Exterior Windows	\$379,425	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$379,425
B2030 - Exterior Doors	\$51,410	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$51,410
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Asphal Shingles	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - BUR	\$1,156,716	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,156,716
B3010 - Roof Coverings - EPDM	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Preformed Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3020 - Roof Openings	\$35,204	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$35,204
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

# School Assessment Report - 1967, 1969 Building

C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$97,130	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$97,130
C1030 - Fittings	\$155,905	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$155,905
C20 - Stairs	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* C2010 - Stair Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic & Glazed	\$219,071	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$219,071
C3010 - Wall Finishes - Paint	\$61,754	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$82,992	\$144,746
C3010 - Wall Finishes - Wall Coverings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Carpet	\$48,096	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$60,927	\$0	\$0	\$109,023
C3020 - Floor Finishes - Ceramic & Quarry Tile	\$0	\$0	\$64,493	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$64,493
C3020 - Floor Finishes - Terrazzo	\$0	\$0	\$471,390	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$471,390
C3020 - Floor Finishes - VCT	\$359,126	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$359,126
C3020 - Floor Finishes - Wood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$557,682	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$557,682
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D10 - Conveying	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D1010 - Elevators and Lifts	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2020 - Domestic Water Distribution	\$222,961	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$222,961
D2030 - Sanitary Waste	\$190,551	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$190,551
D2040 - Rain Water Drainage	\$54,762	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$54,762
D2090 - Other Plumbing Systems - Natural Gas	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3020 - Heat Generating Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3030 - Cooling Generating Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$355,213	\$355,213
D3040 - Distribution & Exhaust Systems	\$307,899	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$307,899
D3050 - Terminal & Package Units	\$1,034,898	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,034,898
D3060 - Controls & Instrumentation	\$201,168	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$201,168
D3090 - Other HVAC Systems/Equip - Kitchen Hood	\$68,732	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$68,732
D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


# School Assessment Report - 1967, 1969 Building

D4010 - Sprinklers	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D4020 - Standpipes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$101,143	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$101,143
D5020 - Branch Wiring	\$378,866	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$378,866
D5020 - Lighting	\$497,332	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$497,332
D5030 - Communications and Security - Clock & PA Systems	\$312,928	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$312,928
D5030 - Communications and Security - Fire Alarm	\$68,732	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$68,732
D5030 - Communications and Security - Security & CCTV	\$34,087	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$34,087
D5090 - Other Electrical Systems - Emergency Generator	\$5,377	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$5,377
E - Equipment & Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E10 - Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1010 - Commercial Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1020 - Institutional Equipment	\$22,352	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$22,352
E1090 - Other Equipment (Kitchen Equipment)	\$527,507	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$527,507
E20 - Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E2010 - Fixed Furnishings	\$300,076	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$300,076
F - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F10 - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F1010 - Special Structures - Canopies	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

<sup>\*</sup> Indicates non-renewable system


# **Forecasted Capital Renewal Requirement**

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

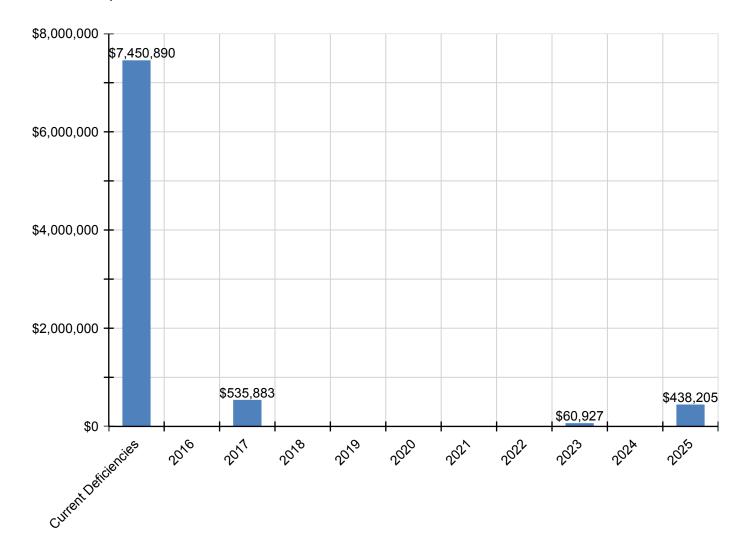

### **Deficiency Summary by System**


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

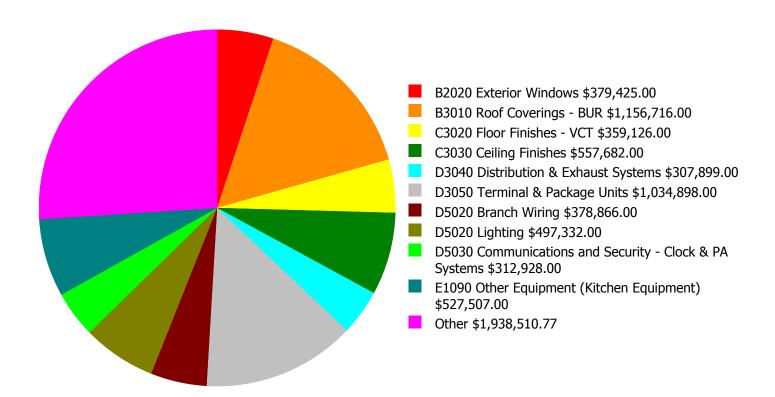

**Budget Estimate Total: \$7,450,889.77** 

# **Deficiency Summary by Priority**

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

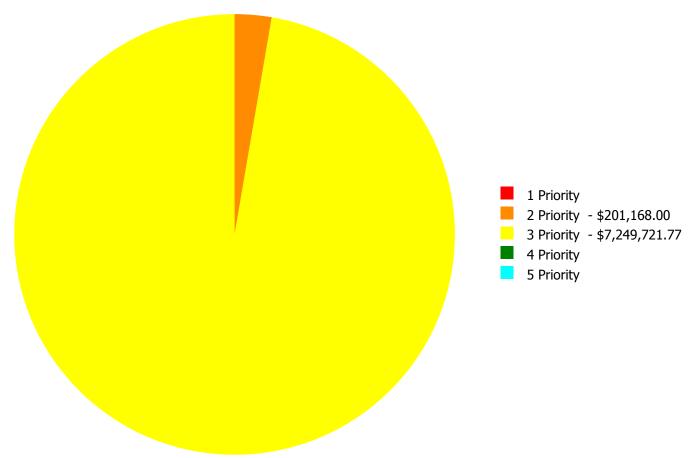

**Budget Estimate Total: \$7,450,889.77** 

#### **Deficiency By Priority Investment Table**


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards..
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System							
Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
B2020	Exterior Windows	\$0.00	\$0.00	\$379,425.00	\$0.00	\$0.00	\$379,425.00
B2030	Exterior Doors	\$0.00	\$0.00	\$51,410.00	\$0.00	\$0.00	\$51,410.00
B3010	Roof Coverings - BUR	\$0.00	\$0.00	\$1,156,716.00	\$0.00	\$0.00	\$1,156,716.00
B3020	Roof Openings	\$0.00	\$0.00	\$35,204.00	\$0.00	\$0.00	\$35,204.00
C1020	Interior Doors	\$0.00	\$0.00	\$97,130.00	\$0.00	\$0.00	\$97,130.00
C1030	Fittings	\$0.00	\$0.00	\$155,905.00	\$0.00	\$0.00	\$155,905.00
C3010	Wall Finishes - Ceramic & Glazed	\$0.00	\$0.00	\$219,071.00	\$0.00	\$0.00	\$219,071.00
C3010	Wall Finishes - Paint	\$0.00	\$0.00	\$61,754.00	\$0.00	\$0.00	\$61,754.00
C3020	Floor Finishes - Carpet	\$0.00	\$0.00	\$48,096.00	\$0.00	\$0.00	\$48,096.00
C3020	Floor Finishes - VCT	\$0.00	\$0.00	\$359,126.00	\$0.00	\$0.00	\$359,126.00
C3030	Ceiling Finishes	\$0.00	\$0.00	\$557,682.00	\$0.00	\$0.00	\$557,682.00
D2020	Domestic Water Distribution	\$0.00	\$0.00	\$222,961.00	\$0.00	\$0.00	\$222,961.00
D2030	Sanitary Waste	\$0.00	\$0.00	\$190,551.00	\$0.00	\$0.00	\$190,551.00
D2040	Rain Water Drainage	\$0.00	\$0.00	\$54,762.00	\$0.00	\$0.00	\$54,762.00
D3040	Distribution & Exhaust Systems	\$0.00	\$0.00	\$307,899.00	\$0.00	\$0.00	\$307,899.00
D3050	Terminal & Package Units	\$0.00	\$0.00	\$1,034,898.00	\$0.00	\$0.00	\$1,034,898.00
D3060	Controls & Instrumentation	\$0.00	\$201,168.00	\$0.00	\$0.00	\$0.00	\$201,168.00
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$0.00	\$0.00	\$68,732.00	\$0.00	\$0.00	\$68,732.00
D5010	Electrical Service/Distribution	\$0.00	\$0.00	\$101,143.00	\$0.00	\$0.00	\$101,143.00
D5020	Branch Wiring	\$0.00	\$0.00	\$378,866.00	\$0.00	\$0.00	\$378,866.00
D5020	Lighting	\$0.00	\$0.00	\$497,332.00	\$0.00	\$0.00	\$497,332.00
D5030	Communications and Security - Clock & PA Systems	\$0.00	\$0.00	\$312,928.00	\$0.00	\$0.00	\$312,928.00
D5030	Communications and Security - Fire Alarm	\$0.00	\$0.00	\$68,732.00	\$0.00	\$0.00	\$68,732.00
D5030	Communications and Security - Security & CCTV	\$0.00	\$0.00	\$34,087.00	\$0.00	\$0.00	\$34,087.00
D5090	Other Electrical Systems - Emergency Generator	\$0.00	\$0.00	\$5,376.77	\$0.00	\$0.00	\$5,376.77
E1020	Institutional Equipment	\$0.00	\$0.00	\$22,352.00	\$0.00	\$0.00	\$22,352.00
E1090	Other Equipment (Kitchen Equipment)	\$0.00	\$0.00	\$527,507.00	\$0.00	\$0.00	\$527,507.00
E2010	Fixed Furnishings	\$0.00	\$0.00	\$300,076.00	\$0.00	\$0.00	\$300,076.00
	Total:	\$0.00	\$201,168.00	\$7,249,721.77	\$0.00	\$0.00	\$7,450,889.77

## **Deficiency Summary by Category**

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

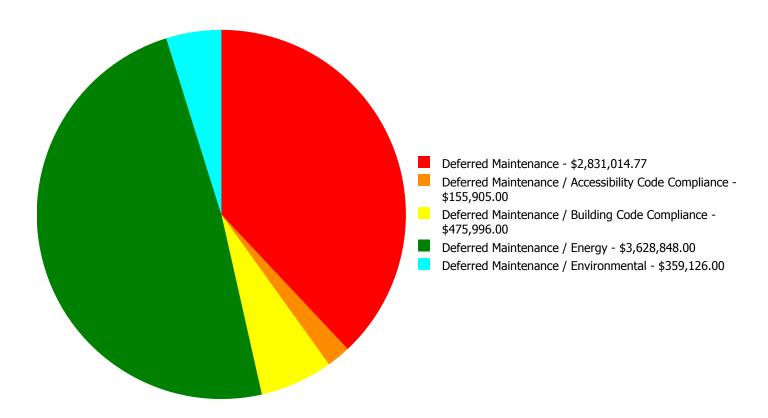

**Budget Estimate Total: \$7,450,889.77** 

## **Deficiency Details by Priority**

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

#### **Priority 2 Priority:**

#### **System: D3060 - Controls & Instrumentation**



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance / Energy

**Priority:** 2 Priority

**Correction:** Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$201,168.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

**Notes:** The controls and instrumentation system is beyond its expected service life, aged, and should be scheduled for replacement in conjunction with the building HVAC system.

#### **Priority 3 Priority:**

#### **System: B2020 - Exterior Windows**



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance / Energy

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$379,425.00

**Assessor Name:** Ben Nixon

**Date Created:** 04/11/2015

**Notes:** The exterior window system is beyond its expected service life, not energy efficient, and should be replaced.

#### System: B2030 - Exterior Doors



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance / Energy

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$51,410.00

**Assessor Name:** Ben Nixon

**Date Created:** 04/11/2015

**Notes:** The exterior doors are beyond their expected service life and should be replaced.

#### System: B3010 - Roof Coverings - BUR



**Location:** Roof

**Distress:** Beyond Service Life

Category: Deferred Maintenance / Energy

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$1,156,716.00

Assessor Name: Sam Mandola

**Date Created:** 04/11/2015

**Notes:** The roof covering is beyond its expected service life, has reported leaks, and should be replaced. SPLOST project 102-422 to replace the roof on the 1967 and 1969 buildings.

#### System: B3020 - Roof Openings



**Location:** Roof

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$35,204.00

Assessor Name: Sam Mandola

**Date Created:** 04/11/2015

**Notes:** Roof openings are beyond their expected service life and should be scheduled for replacement in conjunction with the roof. SPLOST project 102-422 to add roof hatches and ladders to the 1967 and 1969 buildings.

#### System: C1020 - Interior Doors



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance / Building Code

Compliance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$97,130.00

**Assessor Name:** Ben Nixon

**Date Created:** 04/11/2015

**Notes:** Interior doors are beyond their expected service life, do not operate properly, are not ADA or building code compliant, and should be scheduled for replacement.

#### System: C1030 - Fittings



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance / Accessibility Code

Compliance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.


**Estimate:** \$155,905.00

Assessor Name: Sam Mandola

**Date Created:** 04/11/2015

**Notes:** Fittings, such as toilet partitions, handrails and signage, are beyond their expected service life, not ADA compliant, and should be replaced. SPLOST project 102-422 to renovate hall restrooms for ADA compliance.

#### System: C3010 - Wall Finishes - Ceramic & Glazed

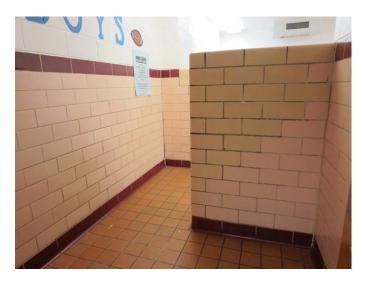

**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 19,392.00

**Unit of Measure:** S.F.

**Estimate:** \$219,071.00

**Assessor Name:** Ben Nixon

**Date Created:** 04/11/2015

Notes: Wall tiles are beyond their expected service life and should be replaced.

#### System: C3010 - Wall Finishes - Paint



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 29,088.00

**Unit of Measure:** S.F.


**Estimate:** \$61,754.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

Notes: The painted wall finishes are beyond their expected service life and should be replaced.

#### System: C3020 - Floor Finishes - Carpet

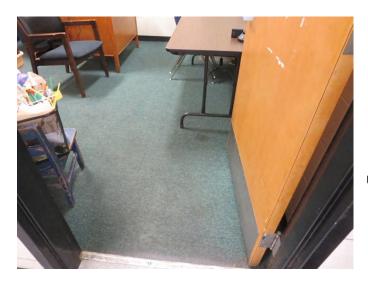

**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 5,144.00

**Unit of Measure:** S.F.

**Estimate:** \$48,096.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

Notes: The carpet is beyond its expected service life, worn and stained, and should be replaced.

#### System: C3020 - Floor Finishes - VCT



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance / Environmental

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 34,222.00

**Unit of Measure:** S.F.

**Estimate:** \$359,126.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

**Notes:** The VCT and VAT flooring is beyond its expected service life and should be replaced.

#### System: C3030 - Ceiling Finishes



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$557,682.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

**Notes:** The acoustical ceiling system is beyond its expected service life, stained from roof leaks, and should be replaced.

#### System: D2020 - Domestic Water Distribution



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 50,800.00

Unit of Measure: S.F.


**Estimate:** \$222,961.00

Assessor Name: Ben Nixon

**Date Created:** 05/27/2015

Notes: The domestic water distribution system is beyond its expected service life and should be scheduled for replacement.

#### System: D2030 - Sanitary Waste

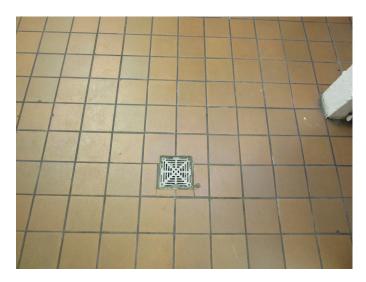

**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$190,551.00

Assessor Name: Sam Mandola

**Date Created:** 05/27/2015

**Notes:** The sanitary waste system is aged, failing and should be replaced. SPLOST project 102-422 to replace grease trap and backflow preventer.

#### System: D2040 - Rain Water Drainage



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$54,762.00

Assessor Name: Sam Mandola

**Date Created:** 05/27/2015

**Notes:** The rainwater drainage system is beyond its expected service life and should be scheduled for replacement. Rainwater drainage replacement is an add alternate scope under SPLOST IV.

#### System: D3040 - Distribution & Exhaust Systems



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance / Energy

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$307,899.00

**Assessor Name:** Ben Nixon

**Date Created:** 04/11/2015

**Notes:** The distribution and exhaust systems are aged, failing, and should be replaced.

#### System: D3050 - Terminal & Package Units



Location: Roof

**Distress:** Beyond Service Life

Category: Deferred Maintenance / Energy

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$1,034,898.00

Assessor Name: Sam Mandola

**Date Created:** 04/11/2015

**Notes:** The terminal and package units are beyond their expected service life, failing, and should be scheduled for replacement. SPLOST project 102-422 to replace the chiller, roof top units and fan coil units on the 1967 and 1969 buildings.

#### System: D3090 - Other HVAC Systems/Equip - Kitchen Hood



Location: Kitchen

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$68,732.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

Notes: The kitchen hood system is beyond its expected service life and should be scheduled for replacement.

#### System: D5010 - Electrical Service/Distribution



**Location:** Main Switch Room/Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$101,143.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

**Notes:** The electrical service/distribution system is aged, failing, and should be replaced.

#### System: D5020 - Branch Wiring



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance / Building Code

Compliance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$378,866.00

Assessor Name: Ben Nixon

**Date Created:** 05/27/2015

**Notes:** The branch wiring system is aged, failing or non functional, and should be replaced. Electrical outlets are not GFI in wet areas.

# System: D5020 - Lighting



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance / Energy

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$497,332.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

**Notes:** The lighting system is beyond its expected service life, inadequate, and should be scheduled for replacement. School staff report that lighting is not consistent throughout the building and some lights are not functioning.

#### System: D5030 - Communications and Security - Clock & PA Systems



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$312,928.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

**Notes:** Clock and PA systems are beyond their expected service life and should be scheduled for replacement. School staff report a constant beeping noise after PA use.

#### System: D5030 - Communications and Security - Fire Alarm



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$68,732.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

**Notes:** The fire alarm system is beyond its expected service life and should be scheduled for replacement.

#### System: D5030 - Communications and Security - Security & CCTV



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$34,087.00

**Assessor Name:** Ben Nixon

**Date Created:** 04/11/2015

Notes: The security and CCTV systems are beyond their expected service life and should be scheduled for replacement.

#### System: D5090 - Other Electrical Systems - Emergency Generator



**Location:** Exterior of Building

**Distress:** Missing

**Category:** Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Add/Replace Generator

**Qty:** 1.00

Unit of Measure: Ea.

**Estimate:** \$5,376.77

Assessor Name: Ben Nixon

**Date Created:** 07/02/2015

**Notes:** Emergency generator is missing and should be provided. Emergency generator to be provided under SPLOST project 421-321 -015G, Bulk Purchase Program Emergency Generator Installation. Installation should include transfer switch.

#### System: E1020 - Institutional Equipment



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$22,352.00

**Assessor Name:** Ben Nixon

**Date Created:** 04/11/2015

**Notes:** Institutional equipment, such as theater and stage equipment and library equipment, is beyond its expected service life and should be scheduled for replacement.

#### System: E1090 - Other Equipment (Kitchen Equipment)



**Location:** Kitchen

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$527,507.00

Assessor Name: Sam Mandola

**Date Created:** 04/11/2015

**Notes:** Kitchen equipment is beyond its expected service life and should be scheduled for replacement. SPLOST project 102-422 to replace the kitchen equipment as add alternate.

#### **System: E2010 - Fixed Furnishings**



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 50,800.00

**Unit of Measure:** S.F.

**Estimate:** \$300,076.00

**Assessor Name:** Ben Nixon

**Date Created:** 04/11/2015

**Notes:** Fixed furnishings are beyond their expected service life and should be scheduled for replacement.

### **Executive Summary**

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The Repair Cost (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. Facility Condition Index ( FCI) is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term FCA Score is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	13,848
Year Built:	1994
Last Renovation:	
Replacement Value:	\$2,715,107
Repair Cost:	\$1,039,485.00
Total FCI:	38.29 %
Total RSLI:	28.89 %
FCA Score:	61.71



#### **Description:**

The 1994 classroom addition at Canby Lane Elementary School is a one-story building located at 4150 Green Hawk Trail. There have been no major renovations to this addition. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

#### **Attributes:**

General Attributes:			
Building Codes:	2020	Fire Sprinkler System:	Yes

# **Condition Summary**

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	79.00 %	0.00 %	\$0.00
A20 - Basement Construction	0.00 %	0.00 %	\$0.00
B10 - Superstructure	79.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	63.08 %	0.00 %	\$0.00
B30 - Roofing	16.00 %	0.00 %	\$0.00
C10 - Interior Construction	51.31 %	25.18 %	\$42,500.00
C20 - Stairs	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	2.34 %	105.57 %	\$317,298.00
D10 - Conveying	0.00 %	0.00 %	\$0.00
D20 - Plumbing	30.27 %	0.00 %	\$0.00
D30 - HVAC	4.48 %	93.58 %	\$478,462.00
D40 - Fire Protection	30.00 %	0.00 %	\$0.00
D50 - Electrical	22.32 %	32.83 %	\$113,332.00
E10 - Equipment	0.00 %	110.00 %	\$6,093.00
E20 - Furnishings	0.00 %	110.00 %	\$81,800.00
F10 - Special Construction	0.00 %	0.00 %	\$0.00
Totals:	28.89 %	38.29 %	\$1,039,485.00

# **Photo Album**

The photo album consists of the various cardinal directions of the building.

1). South Elevation - Feb 09, 2011



2). East Elevation - Feb 09, 2011



3). West Elevation - Feb 09, 2011



4). North Elevation - Feb 09, 2011



### **Condition Detail**

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

- 1. System Code: A code that identifies the system.
- 2. System Description: A brief description of a system present in the building.
- 3. Unit Price \$: The unit price of the system.
- 4. UoM: The unit of measure of the system.
- 5. Qty: The quantity for the system.
- 6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
- 7. Year Installed: The date of system installation.
- 8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
- 9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
- 10. RSLI: The Remaining Service Life Index of the system.
- 11. FCI: The Facility Condition Index of the system.
- 12. RSL: Remaining Service Life in years.
- 13. eCR: eCOMET Condition Rating (not used in this assessment).
- 14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
- 15. Replacement Value \$: The replacement cost of the system.

# **System Listing**

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

A0100   Standard Foundations   So.40   St.   13,848   10   1994   2094   79.00 %   0.00 %   79   589,   5								Calc Next	Next						
A1020   Special Foundations	System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Renewal Year	Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A2030   Sab on Grade	A1010	Standard Foundations	\$6.49	S.F.	13,848	100	1994	2094		79.00 %	0.00 %	79			\$89,874
A2010   Basement Karaviton   \$0.26   S.F.   0   100   1994   2094   79.00 %   0.00 %   79	A1020	Special Foundations	\$4.46	S.F.	0	100	1994	2094		79.00 %	0.00 %	79			\$0
A2020   Basement Walls	A1030	Slab on Grade	\$7.09	S.F.	13,848	100	1994	2094		79.00 %	0.00 %	79			\$98,182
BID10   Roor Construction   \$15.61   S.F.   0   100   1994   2094   79.00 %   0.00 %   79   373   373   374   374   374   375   37	A2010	Basement Excavation	\$0.26	S.F.	0	100	1994	2094		79.00 %	0.00 %	79			\$0
B1020   Roof Construction	A2020	Basement Walls	\$6.13	S.F.	0	100	1994	2094		79.00 %	0.00 %	79			\$0
B2010   Exterior Walls	B1010	Floor Construction	\$15.61	S.F.	0	100	1994	2094		79.00 %	0.00 %	79			\$0
B2020   Exterior Windows	B1020	Roof Construction	\$5.34	S.F.	13,848	100	1994	2094		79.00 %	0.00 %	79			\$73,948
B2030   Exterior Doors   S0.02   S.F.   13,848   30   1994   2024   30.00 %   0.00 %   9   512,	B2010	Exterior Walls	\$16.02	S.F.	13,848	100	1994	2094		79.00 %	0.00 %	79			\$221,845
B3010   Roof Coverings - Asphal Shingles	B2020	Exterior Windows	\$6.79	S.F.	13,848	30	1994	2024		30.00 %	0.00 %	9			\$94,028
B3010   Roof Coverings - BUR	B2030	Exterior Doors	\$0.92	S.F.	13,848	30	1994	2024		30.00 %	0.00 %	9			\$12,740
B3010   Roof Coverings - EPDM   \$3.33   S.F.   0   15   1994   2009   0.00 %   0.00 %   -6	B3010	Roof Coverings - Asphal Shingles	\$4.32	S.F.	0	10	1994	2004		0.00 %	0.00 %	-11			\$0
B3010   Roof Coverings - Preformed Metal   \$5.01   S.F.   0   30   1994   2024   30.00 % 0.00 % 9	B3010	Roof Coverings - BUR	\$20.70	S.F.	13,848	25	1994	2019		16.00 %	0.00 %	4			\$286,654
B3010   Roof Coverings - Standing Seam Metal   \$27.45   S.F.   0   75   1994   2069   72.00 %   0.00 %   54	B3010	Roof Coverings - EPDM	\$3.33	S.F.	0	15	1994	2009		0.00 %	0.00 %	-6			\$0
B3020   Roof Openings   \$0.63   S.F.   0   30   1994   2024   30.00 %   0.00 %   9	B3010	Roof Coverings - Preformed Metal	\$5.01	S.F.	0	30	1994	2024		30.00 %	0.00 %	9			\$0
C1010   Partitions	B3010	Roof Coverings - Standing Seam Metal	\$27.45	S.F.	0	75	1994	2069		72.00 %	0.00 %	54			\$0
C1020   Interior Doors	B3020	Roof Openings	\$0.63	S.F.	0	30	1994	2024		30.00 %	0.00 %	9			\$0
C1030         Fittings         \$2.79         S.F.         13,848         20         1994         2014         0.00 %         110.00 %         -1         \$42,500.00         \$38,           C2010         Stair Construction         \$1.81         S.F.         0         100         1994         2094         79.00 %         0.00 %         79           C3010         Wall Finishes - Ceramic & Glazed         \$10.27         S.F.         0         30         1994         2024         30.00 %         0.00 %         9           C3010         Wall Finishes - Paint         \$1.93         S.F.         13,848         10         2004         2014         0.00 %         10.00 %         -1         \$29,399.00         \$26,           C3010         Wall Finishes - Paint         \$1.35         S.F.         0         10         1994         2004         0.00 %         10.00 %         -1         \$29,399.00         \$26,           C3010         Wall Finishes - Paint         \$1.49         S.F.         587         8         1994         2004         0.00 %         0.00 %         -1         \$29,399.00         \$26,           C3020         Floor Finishes - Cerpet         \$8.50         S.F.         189,4         2002	C1010	Partitions	\$7.01	S.F.	13,848	100	1994	2094		79.00 %	0.00 %	79			\$97,074
C2010         Stair Construction         \$1.81         S.F.         0         100         1994         2094         79.00 %         0.00 %         79           C3010         Wall Finishes - Ceramic & Glazed         \$10.27         S.F.         0         30         1994         2024         30.00 %         0.00 %         9           C3010         Wall Finishes - Paint         \$1.93         S.F.         13,848         10         2004         2014         0.00 %         110.00 %         -1         \$29,399.00         \$26,           C3010         Wall Finishes - Wall Coverings         \$2.13         S.F.         0         10         1994         2004         0.00 %         10.00 %         -1         \$29,399.00         \$26,           C3020         Floor Finishes - Wall Coverings         \$2.13         S.F.         0         10         1994         2004         0.00 %         0.00 %         -11           C3020         Floor Finishes - Carpet         \$8.50         S.F.         836         50         1994         2004         58.00 %         0.00 %         29         \$12,           C3020         Floor Finishes - Ceramic & Quarry Tile         \$14.79         S.F.         12,425         20         1994         2044	C1020	Interior Doors	\$2.39	S.F.	13,848	30	1994	2024		30.00 %	0.00 %	9			\$33,097
C3010         Wall Finishes - Ceramic & Glazed         \$10.27         S.F.         0         30         1994         2024         30.00 %         0.00 %         9           C3010         Wall Finishes - Paint         \$1.93         S.F.         13,848         10         2004         2014         0.00 %         110.00 %         -1         \$29,399.00         \$26,           C3010         Wall Finishes - Wall Coverings         \$2.13         S.F.         0         10         1994         2004         0.00 %         10.00 %         -11         10           C3020         Floor Finishes - Carpet         \$8.50         S.F.         587         8         1994         2002         0.00 %         10.98 %         -13         \$5,488.00         \$44           C3020         Floor Finishes - Ceramic & Quarry Tile         \$14.49         S.F.         836         50         1994         2044         58.00 %         0.00 %         29         \$12,           C3020         Floor Finishes - Terrazzo         \$53.01         S.F.         0         50         1994         2044         58.00 %         0.00 %         29           C3020         Floor Finishes - VCT         \$9.54         S.F.         12,425         20         1994	C1030	Fittings	\$2.79	S.F.	13,848	20	1994	2014		0.00 %	110.00 %	-1		\$42,500.00	\$38,636
C3010         Wall Finishes - Paint         \$1.93         S.F.         13,848         10         2004         2014         0.00 %         110.00 %         -1         \$29,399.00         \$26,           C3010         Wall Finishes - Wall Coverings         \$2.13         S.F.         0         10         1994         2004         0.00 %         0.00 %         -11         -11         \$29,399.00         \$26,           C3020         Floor Finishes - Carpet         \$8.50         S.F.         587         8         1994         2002         0.00 %         109.98 %         -13         \$5,488.00         \$4,           C3020         Floor Finishes - Ceramic & Quarry Tile         \$14.49         S.F.         836         50         1994         2044         58.00 %         0.00 %         29         \$12,           C3020         Floor Finishes - Terrazzo         \$53.01         S.F.         0         50         1994         2044         58.00 %         0.00 %         29         \$12,           C3020         Floor Finishes - VCT         \$9.54         S.F.         12,425         20         1994         2014         0.00 %         10.00 %         -1         \$130,388.00         \$118,           C3020         Floor Finishes - W	C2010	Stair Construction	\$1.81	S.F.	0	100	1994	2094		79.00 %	0.00 %	79			\$0
C3010         Wall Finishes - Wall Coverings         \$2.13         S.F.         0         10         1994         2004         0.00 %         0.00 %         -11            C3020         Floor Finishes - Carpet         \$8.50         S.F.         587         8         1994         2002         0.00 %         109.98 %         -13         \$5,488.00         \$4,           C3020         Floor Finishes - Ceramic & Quarry Tile         \$14.49         S.F.         836         50         1994         2044         58.00 %         0.00 %         29         \$12,           C3020         Floor Finishes - Terrazzo         \$53.01         S.F.         0         50         1994         2044         58.00 %         0.00 %         29         \$12,           C3020         Floor Finishes - Terrazzo         \$53.01         S.F.         0         50         1994         2044         58.00 %         0.00 %         29         \$12,           C3020         Floor Finishes - VCT         \$9.54         S.F.         12,425         20         1994         2014         0.00 %         110.00 %         -1         \$130,388.00         \$118,           C3030         Ceiling Finishes         \$9.98         S.F.         13,848	C3010	Wall Finishes - Ceramic & Glazed	\$10.27	S.F.	0	30	1994	2024		30.00 %	0.00 %	9			\$0
C3020   Floor Finishes - Carpet   \$8.50   S.F.   587   8   1994   2002   0.00 %   109.98 %   -13   \$5,488.00   \$4,000	C3010	Wall Finishes - Paint	\$1.93	S.F.	13,848	10	2004	2014		0.00 %	110.00 %	-1		\$29,399.00	\$26,727
C3020       Floor Finishes - Ceramic & Quarry Tile       \$14.49       S.F.       836       50       1994       2044       58.00 %       0.00 %       29       \$12,         C3020       Floor Finishes - Terrazzo       \$53.01       S.F.       0       50       1994       2044       58.00 %       0.00 %       29       29         C3020       Floor Finishes - VCT       \$9.54       S.F.       12,425       20       1994       2014       0.00 %       110.00 %       -1       \$130,388.00       \$118,         C3020       Floor Finishes - Wood       \$14.70       S.F.       0       20       1994       2014       0.00 %       10.00 %       -1       \$130,388.00       \$118,         C3030       Ceiling Finishes       \$9.98       S.F.       13,848       20       1994       2014       0.00 %       10.00 %       -1       \$152,023.00       \$138,         D1010       Elevators and Lifts       \$1.17       S.F.       0       30       1994       2024       30.00 %       0.00 %       9       \$244,         D2010       Plumbing Fixtures       \$17.66       S.F.       13,848       30       1994       2024       30.00 %       0.00 %       9       \$55,	C3010	Wall Finishes - Wall Coverings	\$2.13	S.F.	0	10	1994	2004		0.00 %	0.00 %	-11			\$0
C3020         Floor Finishes - Terrazzo         \$53.01         S.F.         0         50         1994         2044         58.00 %         0.00 %         29           C3020         Floor Finishes - VCT         \$9.54         S.F.         12,425         20         1994         2014         0.00 %         110.00 %         -1         \$130,388.00         \$118,           C3020         Floor Finishes - Wood         \$14.70         S.F.         0         20         1994         2014         0.00 %         0.00 %         -1         \$130,388.00         \$118,           C3030         Ceiling Finishes         \$9.98         S.F.         13,848         20         1994         2014         0.00 %         0.00 %         -1         \$152,023.00         \$138,           D1010         Elevators and Lifts         \$1.17         S.F.         0         30         1994         2024         30.00 %         0.00 %         9         \$244,           D2010         Plumbing Fixtures         \$1.766         S.F.         13,848         30         1994         2024         30.00 %         0.00 %         9         \$55,           D2020         Domestic Water Distribution         \$3.99         S.F.         13,848         30	C3020	Floor Finishes - Carpet	\$8.50	S.F.	587	8	1994	2002		0.00 %	109.98 %	-13		\$5,488.00	\$4,990
C3020         Floor Finishes - VCT         \$9.54         S.F.         12,425         20         1994         2014         0.00 %         110.00 %         -1         \$130,388.00         \$118,           C3020         Floor Finishes - Wood         \$14.70         S.F.         0         20         1994         2014         0.00 %         0.00 %         -1         -1           C3030         Ceiling Finishes         \$9.98         S.F.         13,848         20         1994         2014         0.00 %         110.00 %         -1         \$152,023.00         \$138,           D1010         Elevators and Lifts         \$1.17         S.F.         0         30         1994         2024         30.00 %         0.00 %         9         \$1244,           D2010         Plumbing Fixtures         \$17.66         S.F.         13,848         30         1994         2024         30.00 %         0.00 %         9         \$244,           D2020         Domestic Water Distribution         \$3.99         S.F.         13,848         30         1994         2024         30.00 %         0.00 %         9         \$55,           D2030         Sanitary Waste         \$3.41         S.F.         13,848         30         1994	C3020	Floor Finishes - Ceramic & Quarry Tile	\$14.49	S.F.	836	50	1994	2044		58.00 %	0.00 %	29			\$12,114
C3020         Floor Finishes - Wood         \$14.70         S.F.         0         20         1994         2014         0.00 %         0.00 %         -1         -1           C3030         Ceiling Finishes         \$9.98         S.F.         13,848         20         1994         2014         0.00 %         110.00 %         -1         \$152,023.00         \$138,           D1010         Elevators and Lifts         \$1.17         S.F.         0         30         1994         2024         30.00 %         0.00 %         9         9           D2010         Plumbing Fixtures         \$17.66         S.F.         13,848         30         1994         2024         30.00 %         0.00 %         9         \$244,           D2020         Domestic Water Distribution         \$3.99         S.F.         13,848         30         1994         2024         30.00 %         0.00 %         9         \$55,           D2030         Sanitary Waste         \$3.41         S.F.         13,848         30         1994         2024         30.00 %         0.00 %         9         \$55,	C3020	Floor Finishes - Terrazzo	\$53.01	S.F.	0	50	1994	2044		58.00 %	0.00 %	29			\$0
C3030         Ceiling Finishes         \$9.98         S.F.         13,848         20         1994         2014         0.00 %         110.00 %         -1         \$152,023.00         \$138,000           D1010         Elevators and Lifts         \$1.17         S.F.         0         30         1994         2024         30.00 %         0.00 %         9         9           D2010         Plumbing Fixtures         \$17.66         S.F.         13,848         30         1994         2024         30.00 %         0.00 %         9         \$244,           D2020         Domestic Water Distribution         \$3.99         S.F.         13,848         30         1994         2024         30.00 %         0.00 %         9         \$55,           D2030         Sanitary Waste         \$3.41         S.F.         13,848         30         1994         2024         30.00 %         0.00 %         9         \$47,	C3020	Floor Finishes - VCT	\$9.54	S.F.	12,425	20	1994	2014		0.00 %	110.00 %	-1		\$130,388.00	\$118,535
D1010         Elevators and Lifts         \$1.17 S.F.         0 30 1994         2024         30.00 % 0.00 % 9         9           D2010         Plumbing Fixtures         \$17.66 S.F.         13,848 30 1994         2024         30.00 % 0.00 % 9         \$244,           D2020         Domestic Water Distribution         \$3.99 S.F.         13,848 30 1994         2024         30.00 % 0.00 % 9         \$55,           D2030         Sanitary Waste         \$3.41 S.F.         13,848 30 1994         2024         30.00 % 0.00 % 9         \$47,	C3020	Floor Finishes - Wood	\$14.70	S.F.	0	20	1994	2014		0.00 %	0.00 %	-1			\$0
D2010         Plumbing Fixtures         \$17.66         S.F.         13,848         30         1994         2024         30.00 %         0.00 %         9         \$244,           D2020         Domestic Water Distribution         \$3.99         S.F.         13,848         30         1994         2024         30.00 %         0.00 %         9         \$55,           D2030         Sanitary Waste         \$3.41         S.F.         13,848         30         1994         2024         30.00 %         0.00 %         9         \$47,	C3030	Ceiling Finishes	\$9.98	S.F.	13,848	20	1994	2014		0.00 %	110.00 %	-1		\$152,023.00	\$138,203
D2020         Domestic Water Distribution         \$3.99         S.F.         13,848         30         1994         2024         30.00%         0.00%         9         \$55,           D2030         Sanitary Waste         \$3.41         S.F.         13,848         30         1994         2024         30.00%         0.00%         9         \$47,	D1010	Elevators and Lifts	\$1.17	S.F.	0	30	1994	2024		30.00 %	0.00 %	9			\$0
D2030 Sanitary Waste \$3.41 S.F. 13,848 30 1994 2024 30.00 % 0.00 % 9 \$47,	D2010	Plumbing Fixtures	\$17.66	S.F.	13,848	30	1994	2024		30.00 %	0.00 %	9			\$244,556
	D2020	Domestic Water Distribution	\$3.99	S.F.	13,848	30	1994	2024		30.00 %	0.00 %	9			\$55,254
D2040 Rain Water Drainage \$0.98 S.F. 13,848 30 1994 2024 30.00 % 0.00 % 9 \$13,	D2030	Sanitary Waste	\$3.41	S.F.	13,848	30	1994	2024		30.00 %	0.00 %	9			\$47,222
	D2040	Rain Water Drainage	\$0.98	S.F.	13,848	30	1994	2024		30.00 %	0.00 %	9			\$13,571

# School Assessment Report - 1994 Addition

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
D2090	Other Plumbing Systems - Natural Gas	\$0.41	S.F.	13,848	40	1994	2034		47.50 %	0.00 %	19			\$5,678
D3020	Heat Generating Systems	\$4.55	S.F.	0	30	1994	2024		30.00 %	0.00 %	9			\$0
D3030	Cooling Generating Systems	\$4.73	S.F.	0	25	1994	2019		16.00 %	0.00 %	4			\$0
D3040	Distribution & Exhaust Systems	\$5.51	S.F.	13,848	30	1994	2024		30.00 %	0.00 %	9			\$76,302
D3050	Terminal & Package Units	\$27.81	S.F.	13,848	15	1994	2009		0.00 %	110.00 %	-6		\$423,624.00	\$385,113
D3060	Controls & Instrumentation	\$3.60	S.F.	13,848	20	1994	2014		0.00 %	110.00 %	-1		\$54,838.00	\$49,853
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$1.23	S.F.	0	30	1994	2024		30.00 %	0.00 %	9			\$0
D4010	Sprinklers	\$4.75	S.F.	13,848	30	1994	2024		30.00 %	0.00 %	9			\$65,778
D4020	Standpipes	\$0.51	S.F.	0	30	1994	2024		30.00 %	0.00 %	9			\$0
D5010	Electrical Service/Distribution	\$1.81	S.F.	13,848	40	1994	2034		47.50 %	0.00 %	19			\$25,065
D5020	Branch Wiring	\$6.78	S.F.	13,848	30	1994	2024		30.00 %	0.00 %	9			\$93,889
D5020	Lighting	\$8.90	S.F.	13,848	30	1994	2024		30.00 %	0.00 %	9			\$123,247
D5030	Communications and Security - Clock & PA Systems	\$5.60	S.F.	13,848	15	1994	2009		0.00 %	110.00 %	-6		\$85,304.00	\$77,549
D5030	Communications and Security - Fire Alarm	\$1.23	S.F.	13,848	15	1994	2009		0.00 %	110.00 %	-6		\$18,736.00	\$17,033
D5030	Communications and Security - Security & CCTV	\$0.61	S.F.	13,848	15	1994	2009		0.00 %	110.00 %	-6		\$9,292.00	\$8,447
D5090	Other Electrical Systems - Emergency Generator	\$0.35	S.F.	0	15	1994	2009		0.00 %	0.00 %	-6			\$0
E1010	Commercial Equipment	\$0.83	S.F.	0	20	1994	2014		0.00 %	0.00 %	-1			\$0
E1020	Institutional Equipment	\$0.40	S.F.	13,848	20	1994	2014		0.00 %	110.00 %	-1		\$6,093.00	\$5,539
E1090	Other Equipment (Kitchen Equipment)	\$0.00	S.F.	0	20	1994	2014		0.00 %	0.00 %	-1			\$0
E2010	Fixed Furnishings	\$5.37	S.F.	13,848	20	1994	2014		0.00 %	110.00 %	-1		\$81,800.00	\$74,364
F1010	Special Structures - Canopies	\$1.61	S.F.	0	25	1994	2019		16.00 %	0.00 %	4			\$0
								Total	28.89 %	38.29 %			\$1,039,485.00	\$2,715,107

# **Renewal Schedule**

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$1,039,485	\$0	\$0	\$0	\$354,894	\$0	\$0	\$0	\$6,952	\$1,220,906	\$39,510	\$2,661,747
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1020 - Special Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1010 - Floor Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2020 - Exterior Windows	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$134,954	\$0	\$134,954
B2030 - Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$18,285	\$0	\$18,285
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Asphal Shingles	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - BUR	\$0	\$0	\$0	\$0	\$354,894	\$0	\$0	\$0	\$0	\$0	\$0	\$354,894
B3010 - Roof Coverings - EPDM	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Preformed Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3020 - Roof Openings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

# School Assessment Report - 1994 Addition

C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$34,546	\$0	\$34,546
C1030 - Fittings	\$42,500	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$42,500
C20 - Stairs	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* C2010 - Stair Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic & Glazed	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Paint	\$29,399	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$39,510	\$68,909
C3010 - Wall Finishes - Wall Coverings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Carpet	\$5,488	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$6,952	\$0	\$0	\$12,440
C3020 - Floor Finishes - Ceramic & Quarry Tile	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Terrazzo	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - VCT	\$130,388	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$130,388
C3020 - Floor Finishes - Wood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$152,023	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$152,023
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D10 - Conveying	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D1010 - Elevators and Lifts	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$350,998	\$0	\$350,998
D2020 - Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$79,303	\$0	\$79,303
D2030 - Sanitary Waste	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$67,775	\$0	\$67,775
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$19,478	\$0	\$19,478
D2090 - Other Plumbing Systems - Natural Gas	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3020 - Heat Generating Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3030 - Cooling Generating Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3040 - Distribution & Exhaust Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$109,514	\$0	\$109,514
D3050 - Terminal & Package Units	\$423,624	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$423,624
D3060 - Controls & Instrumentation	\$54,838	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$54,838
D3090 - Other HVAC Systems/Equip - Kitchen Hood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


# School Assessment Report - 1994 Addition

1	ı				I							
D4010 - Sprinklers	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$94,408	\$0	\$94,408
D4020 - Standpipes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$134,754	\$0	\$134,754
D5020 - Lighting	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$176,891	\$0	\$176,891
D5030 - Communications and Security - Clock & PA Systems	\$85,304	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$85,304
D5030 - Communications and Security - Fire Alarm	\$18,736	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$18,736
D5030 - Communications and Security - Security & CCTV	\$9,292	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$9,292
D5090 - Other Electrical Systems - Emergency Generator	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E - Equipment & Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E10 - Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1010 - Commercial Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1020 - Institutional Equipment	\$6,093	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$6,093
E1090 - Other Equipment (Kitchen Equipment)	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E20 - Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E2010 - Fixed Furnishings	\$81,800	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$81,800
F - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F10 - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F1010 - Special Structures - Canopies	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

<sup>\*</sup> Indicates non-renewable system


# **Forecasted Capital Renewal Requirement**

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

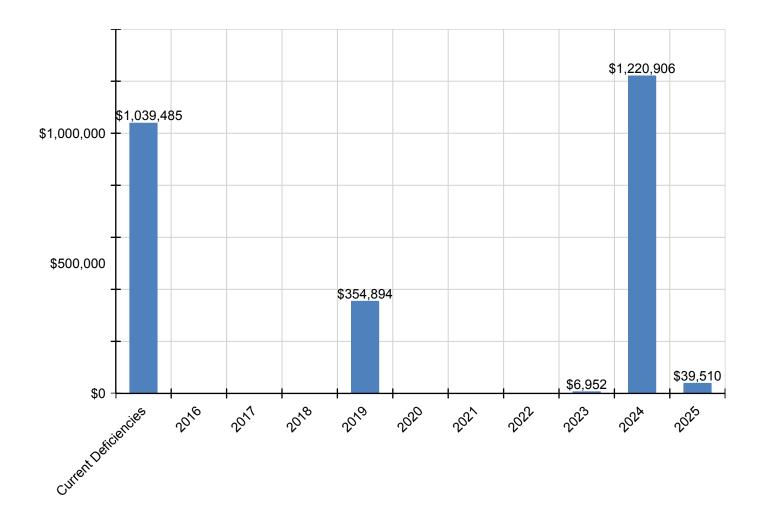

## **Deficiency Summary by System**


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

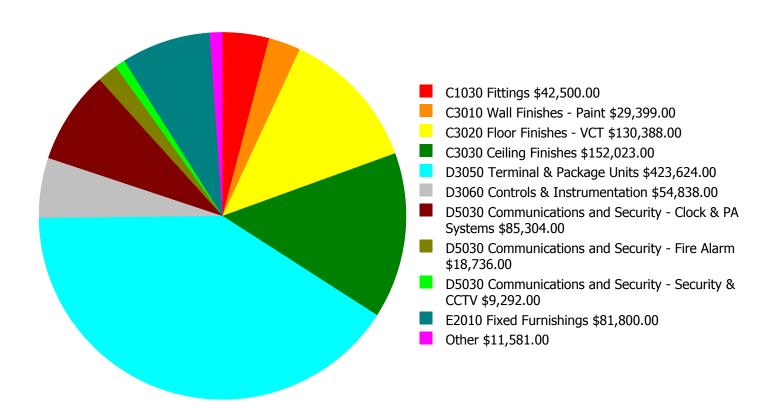

Budget Estimate Total: \$1,039,485.00

# **Deficiency Summary by Priority**

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

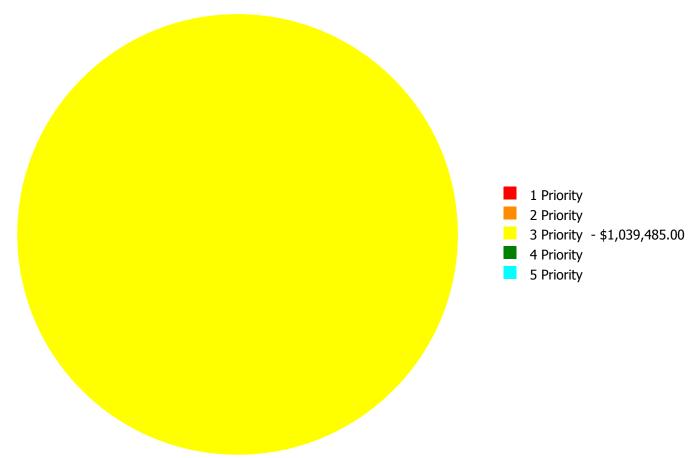

### **Deficiency By Priority Investment Table**


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards..
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System							
Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
C1030	Fittings	\$0.00	\$0.00	\$42,500.00	\$0.00	\$0.00	\$42,500.00
C3010	Wall Finishes - Paint	\$0.00	\$0.00	\$29,399.00	\$0.00	\$0.00	\$29,399.00
C3020	Floor Finishes - Carpet	\$0.00	\$0.00	\$5,488.00	\$0.00	\$0.00	\$5,488.00
C3020	Floor Finishes - VCT	\$0.00	\$0.00	\$130,388.00	\$0.00	\$0.00	\$130,388.00
C3030	Ceiling Finishes	\$0.00	\$0.00	\$152,023.00	\$0.00	\$0.00	\$152,023.00
D3050	Terminal & Package Units	\$0.00	\$0.00	\$423,624.00	\$0.00	\$0.00	\$423,624.00
D3060	Controls & Instrumentation	\$0.00	\$0.00	\$54,838.00	\$0.00	\$0.00	\$54,838.00
D5030	Communications and Security - Clock & PA Systems	\$0.00	\$0.00	\$85,304.00	\$0.00	\$0.00	\$85,304.00
D5030	Communications and Security - Fire Alarm	\$0.00	\$0.00	\$18,736.00	\$0.00	\$0.00	\$18,736.00
D5030	Communications and Security - Security & CCTV	\$0.00	\$0.00	\$9,292.00	\$0.00	\$0.00	\$9,292.00
E1020	Institutional Equipment	\$0.00	\$0.00	\$6,093.00	\$0.00	\$0.00	\$6,093.00
E2010	Fixed Furnishings	\$0.00	\$0.00	\$81,800.00	\$0.00	\$0.00	\$81,800.00
	Total:	\$0.00	\$0.00	\$1,039,485.00	\$0.00	\$0.00	\$1,039,485.00

# **Deficiency Summary by Category**

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

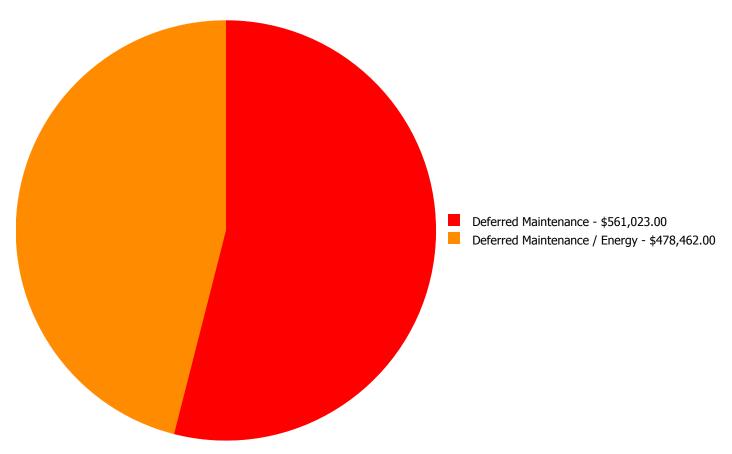

**Budget Estimate Total: \$1,039,485.00** 

## **Deficiency Details by Priority**

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

#### **Priority 3 Priority:**

System: C1030 - Fittings



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 13,848.00

**Unit of Measure:** S.F.

**Estimate:** \$42,500.00

**Assessor Name:** Ben Nixon

**Date Created:** 04/11/2015

**Notes:** Fittings, such as toilet partitions, handrails and signage, are beyond their expected service life, deteriorating, and should be replaced.

#### System: C3010 - Wall Finishes - Paint



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 13,848.00

**Unit of Measure:** S.F.

**Estimate:** \$29,399.00

**Assessor Name:** Ben Nixon

**Date Created:** 04/11/2015

**Notes:** The painted wall finish is deteriorating due to age and use, and should be replaced.

### System: C3020 - Floor Finishes - Carpet



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 587.00

**Unit of Measure:** S.F.

**Estimate:** \$5,488.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

**Notes:** The carpet is deteriorating due to age and use, and should be replaced.

#### **System: C3020 - Floor Finishes - VCT**



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 12,425.00

**Unit of Measure:** S.F.

**Estimate:** \$130,388.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

**Notes:** The VCT flooring has some deterioration due to use, and should be replaced.

### System: C3030 - Ceiling Finishes



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 13,848.00

**Unit of Measure:** S.F.

**Estimate:** \$152,023.00

Assessor Name: Sam Mandola

**Date Created:** 04/11/2015

**Notes:** The acoustical ceiling system has some deterioration due to age and roof leaks, and should be replaced. SPLOST IV is replacing the ceiling tiles in the corridors only.

#### System: D3050 - Terminal & Package Units



Location: Roof

**Distress:** Beyond Service Life

Category: Deferred Maintenance / Energy

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 13,848.00

**Unit of Measure:** S.F.

**Estimate:** \$423,624.00

Assessor Name: Sam Mandola

**Date Created:** 04/11/2015

**Notes:** The terminal and package units are beyond their expected service life and should be scheduled for replacement. SPLOST project 102-422 to replace the roof top units on the 1994 building.

#### System: D3060 - Controls & Instrumentation



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance / Energy

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 13,848.00

**Unit of Measure:** S.F.

**Estimate:** \$54,838.00

Assessor Name: Ben Nixon

**Date Created:** 03/02/2016

Notes: Controls and instrumentation are beyond their expected service life and should be scheduled for replacement.

#### System: D5030 - Communications and Security - Clock & PA Systems



**Location:** Throughout Building

**Distress:** Beyond Service Life

**Category:** Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 13,848.00

**Unit of Measure:** S.F.

**Estimate:** \$85,304.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

**Notes:** Clock and PA systems are beyond their expected service life and should be scheduled for replacement. School staff report a constant beeping noise after PA use.

### System: D5030 - Communications and Security - Fire Alarm



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 13,848.00

**Unit of Measure:** S.F.

**Estimate:** \$18,736.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

**Notes:** The fire alarm system is beyond its expected service life and should be scheduled for replacement.

#### System: D5030 - Communications and Security - Security & CCTV



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 13,848.00

**Unit of Measure:** S.F.

**Estimate:** \$9,292.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

Notes: The security and CCTV systems are beyond their expected service life and should be scheduled for replacement.

#### System: E1020 - Institutional Equipment



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 13,848.00

**Unit of Measure:** S.F.

**Estimate:** \$6,093.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

**Notes:** Institutional equipment, such as audio-visual equipment, is beyond its expected service life and should be scheduled for replacement.

#### System: E2010 - Fixed Furnishings



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 13,848.00

**Unit of Measure:** S.F.

**Estimate:** \$81,800.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

Notes: Fixed furnishings are beyond their expected service life and should be scheduled for replacement.

### **Executive Summary**

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The Repair Cost (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. Facility Condition Index ( FCI) is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term FCA Score is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	5,478
Year Built:	2000
Last Renovation:	
Replacement Value:	\$905,485
Repair Cost:	\$98,345.00
Total FCI:	10.86 %
Total RSLI:	61.86 %
FCA Score:	89.14



#### **Description:**

The 2000 gymnasium at Canby Lane Elementary School is a one-story building located at 4150 Green Hawk Trail in Decatur, Georgia. There have been no addition or major renovations to this building. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

#### **Attributes:**

<b>General Attributes:</b>				
Building Codes:	2030	Fire Sprinkler System:	No	

# **Condition Summary**

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.


UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	85.00 %	0.00 %	\$0.00
B10 - Superstructure	85.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	81.77 %	0.00 %	\$0.00
B30 - Roofing	80.00 %	0.00 %	\$0.00
C10 - Interior Construction	70.21 %	0.00 %	\$0.00
C30 - Interior Finishes	52.96 %	9.82 %	\$10,006.00
D20 - Plumbing	50.24 %	0.00 %	\$0.00
D30 - HVAC	25.62 %	53.04 %	\$70,201.00
D40 - Fire Protection	0.00 %	0.00 %	\$0.00
D50 - Electrical	31.94 %	22.48 %	\$18,138.00
Totals:	61.86 %	10.86 %	\$98,345.00

# **Photo Album**

The photo album consists of the various cardinal directions of the building.

1). East Elevation - Feb 09, 2011







3). West Elevation - Feb 09, 2011



4). North Elevation - Feb 09, 2011



### **Condition Detail**

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

- 1. System Code: A code that identifies the system.
- 2. System Description: A brief description of a system present in the building.
- 3. Unit Price \$: The unit price of the system.
- 4. UoM: The unit of measure of the system.
- 5. Qty: The quantity for the system.
- 6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
- 7. Year Installed: The date of system installation.
- 8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
- 9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
- 10. RSLI: The Remaining Service Life Index of the system.
- 11. FCI: The Facility Condition Index of the system.
- 12. RSL: Remaining Service Life in years.
- 13. eCR: eCOMET Condition Rating (not used in this assessment).
- 14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
- 15. Replacement Value \$: The replacement cost of the system.

# **System Listing**

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$9.34	S.F.	5,478	100	2000	2100		85.00 %	0.00 %	85			\$51,165
A1030	Slab on Grade	\$6.21	S.F.	5,478	100	2000	2100		85.00 %	0.00 %	85			\$34,018
B1020	Roof Construction	\$21.36	S.F.	5,478	100	2000	2100		85.00 %	0.00 %	85			\$117,010
B2010	Exterior Walls	\$19.80	S.F.	5,478	100	2000	2100		85.00 %	0.00 %	85			\$108,464
B2030	Exterior Doors	\$2.01	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$11,011
B3010	Roof Coverings - Standing Seam Metal	\$11.91	S.F.	5,478	75	2000	2075		80.00 %	0.00 %	60			\$65,243
C1010	Partitions	\$12.78	S.F.	5,478	100	2000	2100		85.00 %	0.00 %	85			\$70,009
C1020	Interior Doors	\$4.24	S.F.	5,478	40	2000	2040		62.50 %	0.00 %	25			\$23,227
C1030	Fittings	\$3.46	S.F.	5,478	20	2000	2020		25.00 %	0.00 %	5			\$18,954
C3010	Wall Finishes - Ceramic	\$6.65	S.F.	0	30	2000	2030		50.00 %	0.00 %	15			\$0
C3010	Wall Finishes - Paint	\$1.41	S.F.	5,478	10	2000	2010		0.00 %	109.99 %	-5		\$8,496.00	\$7,724
C3020	Floor Finishes - Ceramic Tile	\$6.67	S.F.	274	30	2000	2030		50.00 %	0.00 %	15			\$1,828
C3020	Floor Finishes - Neoprene	\$14.46	S.F.	4,656	50	2000	2050		70.00 %	0.00 %	35			\$67,326
C3020	Floor Finishes - VCT	\$5.01	S.F.	274	15	2000	2015		0.00 %	109.98 %	0		\$1,510.00	\$1,373
C3030	Ceiling Finishes	\$4.31	S.F.	5,478	20	2000	2020		25.00 %	0.00 %	5			\$23,610
D2010	Plumbing Fixtures	\$9.66	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$52,917
D2020	Domestic Water Distribution	\$5.85	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$32,046
D2030	Sanitary Waste	\$0.87	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$4,766
D2040	Rain Water Drainage	\$0.22	S.F.	0	30	2000	2030		50.00 %	0.00 %	15			\$0
D2090	Other Plumbing Systems - Natural Gas	\$0.32	S.F.	5,478	40	2000	2040		62.50 %	0.00 %	25			\$1,753
D3040	Distribution Systems & Exhaust Systems	\$12.25	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$67,106
D3050	Terminal & Package Units	\$11.65	S.F.	5,478	15	2000	2015		0.00 %	110.00 %	0		\$70,201.00	\$63,819
D3060	Controls & Instrumentation	\$0.26	S.F.	5,478	20	2000	2020		25.00 %	0.00 %	5			\$1,424
D4010	Sprinklers	\$3.84	S.F.	0	30	2000	2030		50.00 %	0.00 %	15			\$0
D5010	Electrical Service/Distribution	\$1.24	S.F.	5,478	40	2000	2040		62.50 %	0.00 %	25			\$6,793
D5020	Branch Wiring	\$5.24	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$28,705
D5020	Lighting	\$5.24	S.F.	5,478	20	2000	2020		25.00 %	0.00 %	5			\$28,705
D5030	Communications and Security - Fire Alarm	\$2.13	S.F.	5,478	15	2000	2015		0.00 %	110.00 %	0		\$12,835.00	\$11,668
D5030	Communications and Security - Public Address & Clock System	\$0.88	S.F.	0	15	2000	2015		0.00 %	0.00 %	0			\$0
D5030	Communications and Security - Security & CCTV	\$0.88	S.F.	5,478	15	2000	2015		0.00 %	110.00 %	0		\$5,303.00	\$4,821
								Total	61.86 %	10.86 %			\$98,345.00	\$905,485

# **Renewal Schedule**

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$98,345	\$0	\$0	\$0	\$0	\$92,698	\$0	\$0	\$0	\$0	\$11,418	\$202,461
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$0	\$0	\$0	\$0	\$0	\$24,170	\$0	\$0	\$0	\$0	\$0	\$24,170
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Paint	\$8,496	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$11,418	\$19,914
C3020 - Floor Finishes - Ceramic Tile	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Neoprene	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - VCT	\$1,510	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,510
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$30,108	\$0	\$0	\$0	\$0	\$0	\$30,108
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


# School Assessment Report - 2000 Gym

D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2020 - Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2030 - Sanitary Waste	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2090 - Other Plumbing Systems - Natural Gas	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3040 - Distribution Systems & Exhaust Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3050 - Terminal & Package Units	\$70,201	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$70,201
D3060 - Controls & Instrumentation	\$0	\$0	\$0	\$0	\$0	\$1,817	\$0	\$0	\$0	\$0	\$0	\$1,817
D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D4010 - Sprinklers	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting	\$0	\$0	\$0	\$0	\$0	\$36,604	\$0	\$0	\$0	\$0	\$0	\$36,604
D5030 - Communications and Security - Fire Alarm	\$12,835	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$12,835
D5030 - Communications and Security - Public Address & Clock System	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5030 - Communications and Security - Security & CCTV	\$5,303	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$5,303

<sup>\*</sup> Indicates non-renewable system


# **Forecasted Capital Renewal Requirement**

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

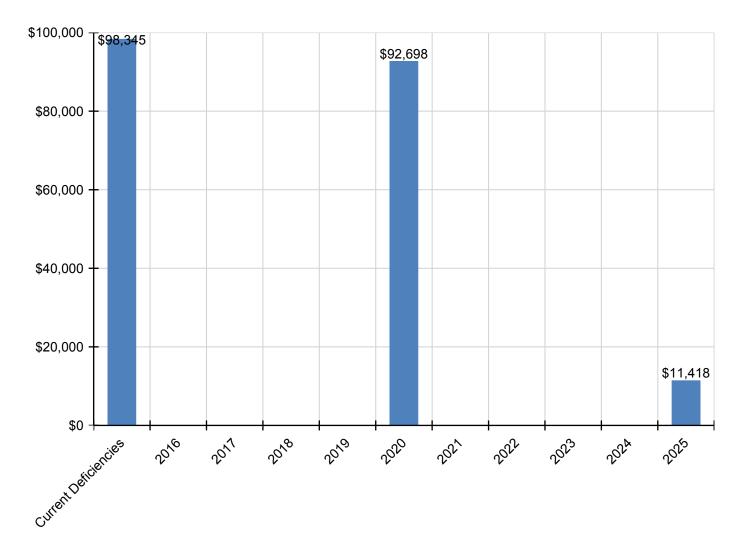

## **Deficiency Summary by System**


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

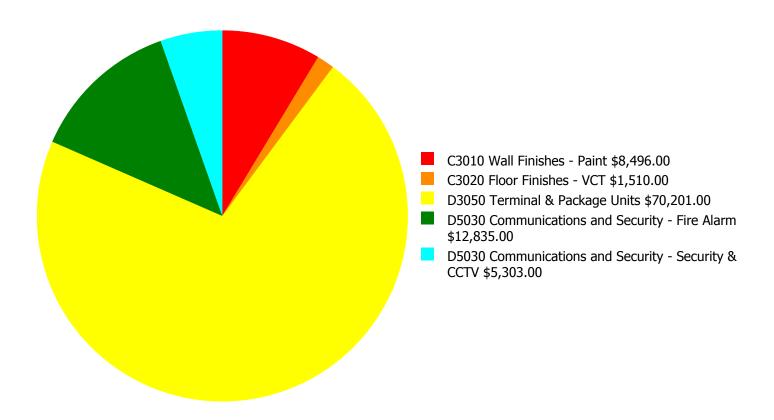

**Budget Estimate Total: \$98,345.00** 

# **Deficiency Summary by Priority**

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

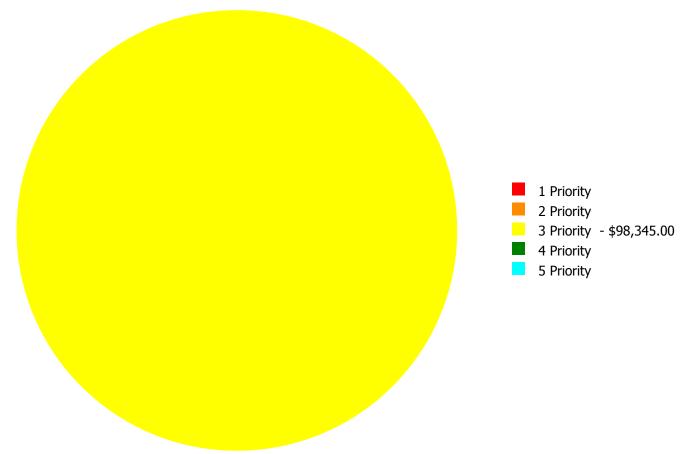

### **Deficiency By Priority Investment Table**


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards..
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
C3010	Wall Finishes - Paint	\$0.00	\$0.00	\$8,496.00	\$0.00	\$0.00	\$8,496.00
C3020	Floor Finishes - VCT	\$0.00	\$0.00	\$1,510.00	\$0.00	\$0.00	\$1,510.00
D3050	Terminal & Package Units	\$0.00	\$0.00	\$70,201.00	\$0.00	\$0.00	\$70,201.00
D5030	Communications and Security - Fire Alarm	\$0.00	\$0.00	\$12,835.00	\$0.00	\$0.00	\$12,835.00
D5030	Communications and Security - Security & CCTV	\$0.00	\$0.00	\$5,303.00	\$0.00	\$0.00	\$5,303.00
	Total:	\$0.00	\$0.00	\$98,345.00	\$0.00	\$0.00	\$98,345.00

# **Deficiency Summary by Category**

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

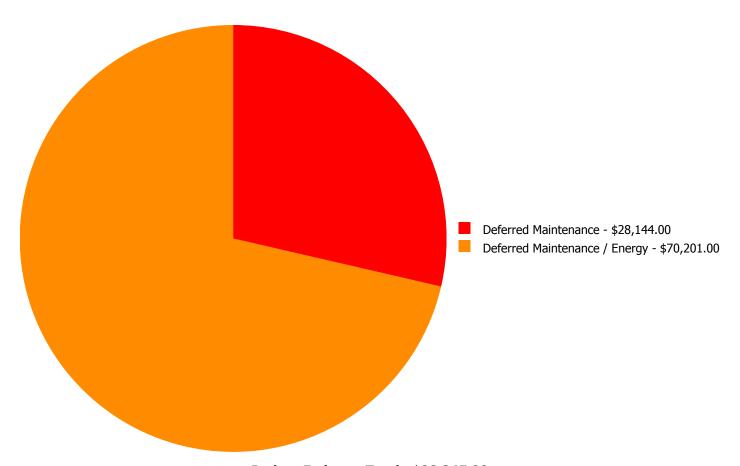

**Budget Estimate Total: \$98,345.00** 

## **Deficiency Details by Priority**

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

#### **Priority 3 Priority:**

System: C3010 - Wall Finishes - Paint



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 5,478.00

**Unit of Measure:** S.F.


**Estimate:** \$8,496.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

Notes: The painted wall finishes are beyond their expected service life and should be replaced.

#### System: C3020 - Floor Finishes - VCT

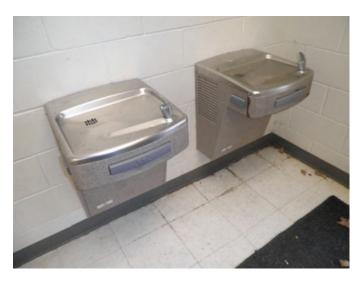

**Location:** Entrance Area and Offices

**Distress:** Beyond Service Life

**Category:** Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 274.00

**Unit of Measure:** S.F.

**Estimate:** \$1,510.00

Assessor Name: Ben Nixon

**Date Created:** 04/11/2015

**Notes:** The VCT floor covering is beyond its expected service life and should be replaced.

#### System: D3050 - Terminal & Package Units



**Location:** Throughout Building

**Distress:** Inadequate

Category: Deferred Maintenance / Energy

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 5,478.00

**Unit of Measure:** S.F.

**Estimate:** \$70,201.00

Assessor Name: Sam Mandola

**Date Created:** 04/11/2015

**Notes:** One PTAC AC unit is located in the office area of the gym. It is beyond its expected service life. The main gym area does not have air conditioning and it should be provided. SPLOST project 102-422 to install a 20-ton HVAC package in the gym.

#### System: D5030 - Communications and Security - Fire Alarm



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 5,478.00

**Unit of Measure:** S.F.

**Estimate:** \$12,835.00

Assessor Name: Ben Nixon

**Date Created:** 05/27/2015

**Notes:** The fire alarm system is beyond its expected service life and should be scheduled for replacement.

### System: D5030 - Communications and Security - Security & CCTV



**Location:** Throughout Building

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 5,478.00

**Unit of Measure:** S.F.

**Estimate:** \$5,303.00

Assessor Name: Ben Nixon

**Date Created:** 05/27/2015

**Notes:** The security and CCTV systems are beyond their expected service life and should be scheduled for replacement.

### **Executive Summary**

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The Repair Cost (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. Facility Condition Index ( FCI) is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term FCA Score is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	70,126
Year Built:	1967
Last Renovation:	
Replacement Value:	\$1,640,516
Repair Cost:	\$894,878.00
Total FCI:	54.55 %
Total RSLI:	5.76 %
FCA Score:	45.45



#### **Description:**

The Canby Lane Elementary School site was originally constructed in 1967, has a total area of 11.6 acres, and is occupied by approximately 70,126 square feet of permanent building space. Campus site features include paved driveways and parking lots, pedestrian pavement, covered walkways, flag pole, landscaping, open fields, playgrounds and fencing. Site mechanical and electrical features include water, sewer, natural gas, and site lighting. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report for the site features.

#### **Attributes:**

Attributes:

Site Code: 1095

## **Condition Summary**

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
G20 - Site Improvements	8.15 %	79.82 %	\$694,318.00
G30 - Site Mechanical Utilities	3.57 %	11.74 %	\$60,168.00
G40 - Site Electrical Utilities	2.02 %	54.40 %	\$140,392.00
Totals:	5.76 %	54.55 %	\$894,878.00

# **Photo Album**

The photo album consists of the various cardinal directions of the building.

1). Aerial Image of Canby Lane Elementary School - Oct 20, 2015



#### **Condition Detail**

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

- 1. System Code: A code that identifies the system.
- 2. System Description: A brief description of a system present in the building.
- 3. Unit Price \$: The unit price of the system.
- 4. UoM: The unit of measure of the system.
- 5. Qty: The quantity for the system.
- 6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
- 7. Year Installed: The date of system installation.
- 8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
- 9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
- 10. RSLI: The Remaining Service Life Index of the system.
- 11. FCI: The Facility Condition Index of the system.
- 12. RSL: Remaining Service Life in years.
- 13. eCR: eCOMET Condition Rating (not used in this assessment).
- 14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
- 15. Replacement Value \$: The replacement cost of the system.

# **System Listing**

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

							Calc Next	Next						
System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Renewal Year	Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
G2010	Roadways	\$5.17	S.F.	28,848	25	1967	1992		0.00 %	110.00 %	-23		\$164,059.00	\$149,144
G2020	Parking Lots	\$4.56	S.F.	7,834	25	1967	1992		0.00 %	110.00 %	-23		\$39,295.00	\$35,723
G2030	Pedestrian Paving	\$1.50	S.F.	70,126	30	1967	1997	2020	16.67 %	0.00 %	5			\$105,189
G2040	Baseball Field	\$8.35	S.F.		0				0.00 %	0.00 %				\$0
G2040	Canopies	\$0.29	S.F.		0				0.00 %	0.00 %				\$0
G2040	Covered Walkways	\$48.72	S.F.	2,739	25	2000	2025		40.00 %	0.00 %	10			\$133,444
G2040	Fencing & Guardrails	\$0.91	S.F.	70,126	30	1967	1997		0.00 %	110.00 %	-18		\$70,196.00	\$63,815
G2040	Football Field	\$5.85	S.F.		0				0.00 %	0.00 %				\$0
G2040	Hard Surface Play Area	\$6.26	S.F.	7,626	20	1967	1987		0.00 %	110.00 %	-28		\$52,513.00	\$47,739
G2040	Playing Field	\$3.92	S.F.	59,463	20	1967	1987		0.00 %	110.00 %	-28		\$256,404.00	\$233,095
G2040	Soccer/Lacross Field	\$5.00	S.F.		0				0.00 %	0.00 %				\$0
G2040	Softball Field	\$8.86	S.F.		0				0.00 %	0.00 %				\$0
G2040	Tennis Courts	\$18.47	S.F.		0				0.00 %	0.00 %				\$0
G2040	Track	\$7.04	S.F.		0				0.00 %	0.00 %				\$0
G2050	Landscaping	\$1.45	S.F.	70,126	15	1967	1982		0.00 %	110.00 %	-33		\$111,851.00	\$101,683
G3010	Water Supply	\$1.83	S.F.	70,126	50	1967	2017		4.00 %	0.00 %	2			\$128,331
G3020	Sanitary Sewer	\$1.15	S.F.	70,126	50	1967	2017		4.00 %	0.00 %	2			\$80,645
G3030	Storm Sewer	\$3.55	S.F.	70,126	50	1967	2017		4.00 %	0.00 %	2			\$248,947
G3060	Fuel Distribution	\$0.78	S.F.	70,126	40	1967	2007		0.00 %	110.00 %	-8		\$60,168.00	\$54,698
G4010	Electrical Distribution	\$1.86	S.F.	70,126	50	1967	2017		4.00 %	0.00 %	2		·	\$130,434
G4020	Site Lighting	\$1.15	S.F.	70,126	30	1967	1997		0.00 %	110.00 %	-18		\$88,709.00	\$80,645
G4030	Site Communications & Security	\$0.67	S.F.	70,126	10	1967	1977		0.00 %	110.00 %	-38		\$51,683.00	\$46,984
								Total	5.76 %	54.55 %			\$894,878.00	\$1,640,516

# **Renewal Schedule**

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.


Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$894,878	\$0	\$686,607	\$0	\$0	\$134,137	\$0	\$0	\$0	\$0	\$266,728	\$1,982,351
G - Building Sitework	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G20 - Site Improvements	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2010 - Roadways	\$164,059	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$164,059
G2020 - Parking Lots	\$39,295	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$39,295
G2030 - Pedestrian Paving	\$0	\$0	\$0	\$0	\$0	\$134,137	\$0	\$0	\$0	\$0	\$0	\$134,137
G2040 - Baseball Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Canopies	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Covered Walkways	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$197,271	\$197,271
G2040 - Fencing & Guardrails	\$70,196	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$70,196
G2040 - Football Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Hard Surface Play Area	\$52,513	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$52,513
G2040 - Playing Field	\$256,404	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$256,404
G2040 - Soccer/Lacross Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Softball Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Tennis Courts	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Track	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2050 - Landscaping	\$111,851	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$111,851
G30 - Site Mechanical Utilities	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G3010 - Water Supply	\$0	\$0	\$149,761	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$149,761
G3020 - Sanitary Sewer	\$0	\$0	\$94,111	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$94,111
G3030 - Storm Sewer	\$0	\$0	\$290,519	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$290,519
G3060 - Fuel Distribution	\$60,168	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$60,168
G40 - Site Electrical Utilities	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G4010 - Electrical Distribution	\$0	\$0	\$152,216	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$152,216
G4020 - Site Lighting	\$88,709	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$88,709
G4030 - Site Communications & Security	\$51,683	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$69,458	\$121,141

<sup>\*</sup> Indicates non-renewable system


# **Forecasted Capital Renewal Requirement**

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

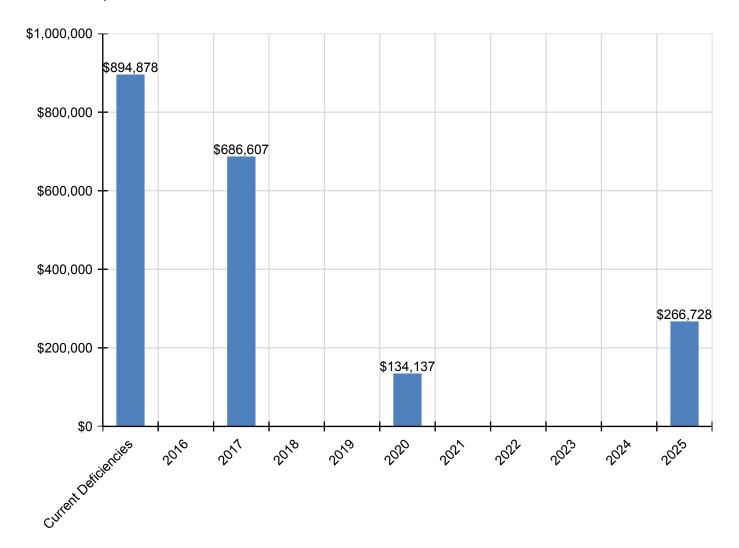

### **Deficiency Summary by System**


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

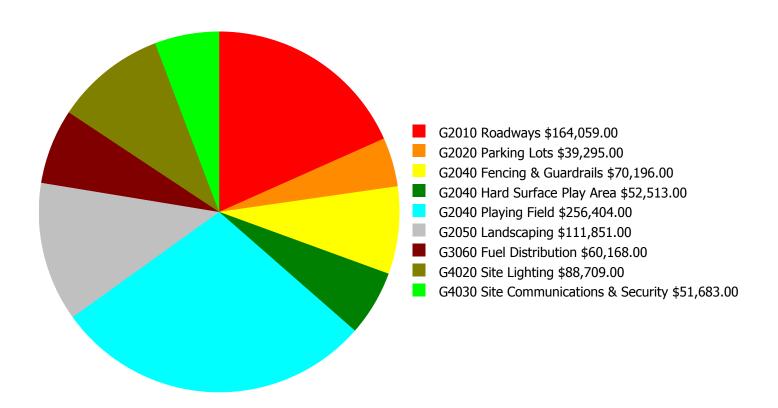

**Budget Estimate Total: \$894,878.00** 

# **Deficiency Summary by Priority**

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

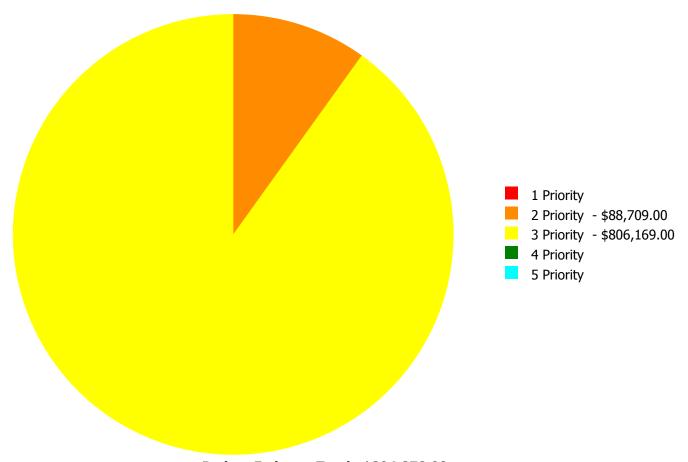

### **Deficiency By Priority Investment Table**


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards..
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
G2010	Roadways	\$0.00	\$0.00	\$164,059.00	\$0.00	\$0.00	\$164,059.00
G2020	Parking Lots	\$0.00	\$0.00	\$39,295.00	\$0.00	\$0.00	\$39,295.00
G2040	Fencing & Guardrails	\$0.00	\$0.00	\$70,196.00	\$0.00	\$0.00	\$70,196.00
G2040	Hard Surface Play Area	\$0.00	\$0.00	\$52,513.00	\$0.00	\$0.00	\$52,513.00
G2040	Playing Field	\$0.00	\$0.00	\$256,404.00	\$0.00	\$0.00	\$256,404.00
G2050	Landscaping	\$0.00	\$0.00	\$111,851.00	\$0.00	\$0.00	\$111,851.00
G3060	Fuel Distribution	\$0.00	\$0.00	\$60,168.00	\$0.00	\$0.00	\$60,168.00
G4020	Site Lighting	\$0.00	\$88,709.00	\$0.00	\$0.00	\$0.00	\$88,709.00
G4030	Site Communications & Security	\$0.00	\$0.00	\$51,683.00	\$0.00	\$0.00	\$51,683.00
	Total:	\$0.00	\$88,709.00	\$806,169.00	\$0.00	\$0.00	\$894,878.00

## **Deficiency Summary by Category**

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

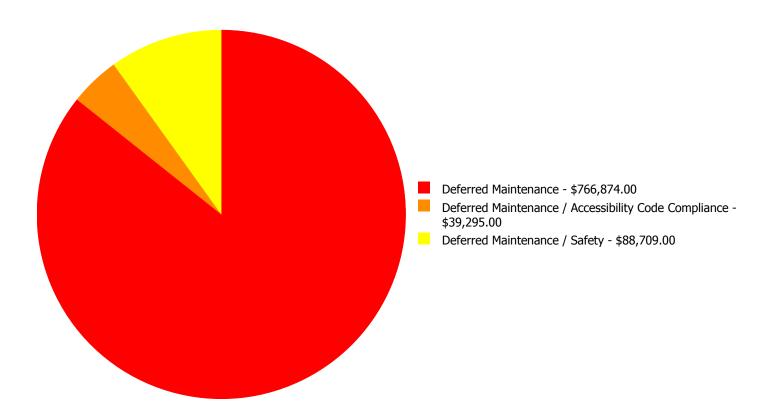

**Budget Estimate Total: \$894,878.00** 

### **Deficiency Details by Priority**

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

### **Priority 2 Priority:**

System: G4020 - Site Lighting



Location: Site

**Distress:** Beyond Service Life

**Category:** Deferred Maintenance / Safety

**Priority:** 2 Priority

**Correction:** Renew System

**Qty:** 70,126.00

**Unit of Measure:** S.F.

**Estimate:** \$88,709.00

**Assessor Name:** Eduardo Lopez

**Date Created:** 05/26/2015

**Notes:** Site lighting is beyond its expected service life, inadequate/non-functional, and should be scheduled for replacement.

#### **Priority 3 Priority:**

#### System: G2010 - Roadways



Location: Site

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 28,848.00

**Unit of Measure:** S.F.

**Estimate:** \$164,059.00

Assessor Name: Eduardo Lopez

**Date Created:** 05/26/2015

Notes: Roadways are beyond their expected service life, damaged with many cracks and road cuts, and should be replaced.

#### System: G2020 - Parking Lots



Location: Site

**Distress:** Beyond Service Life

**Category:** Deferred Maintenance / Accessibility Code

Compliance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 7,834.00

Unit of Measure: S.F.

**Estimate:** \$39,295.00

Assessor Name: Sam Mandola

**Date Created:** 05/26/2015

**Notes:** The parking lot is deteriorating, inadequate, not ADA compliant, and should be replaced. The back parking lot near the gym/trailer floods when it rains. SPLOST project 102-422 to provide three additional disabled parking spaces and an accessible route to the building.

### System: G2040 - Fencing & Guardrails



Location: Site

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 70,126.00

**Unit of Measure:** S.F.

**Estimate:** \$70,196.00

Assessor Name: Eduardo Lopez

**Date Created:** 05/26/2015

**Notes:** Fencing is beyond its expected service life, has some deterioration due to age, weather and use, and should be replaced.

#### System: G2040 - Hard Surface Play Area



Location: Site

**Distress:** Beyond Service Life

**Category:** Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 7,626.00

**Unit of Measure:** S.F.

**Estimate:** \$52,513.00

Assessor Name: Eduardo Lopez

**Date Created:** 05/26/2015

**Notes:** The hard surface play area is beyond its expected service life, damaged with cracks, and should be replaced. Basketball goals are also damaged and should be replaced.

#### System: G2040 - Playing Field



Location: Site

**Distress:** Damaged

Category: Deferred Maintenance

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 59,463.00

**Unit of Measure:** S.F.

**Estimate:** \$256,404.00

**Assessor Name:** Eduardo Lopez

**Date Created:** 05/26/2015

**Notes:** The playing fields are beyond their expected service life, in poor condition with many bare areas, and should be re-sodded to prevent erosion.

#### System: G2050 - Landscaping



Location: Site

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 70,126.00

**Unit of Measure:** S.F.

**Estimate:** \$111,851.00

**Assessor Name:** Eduardo Lopez

**Date Created:** 05/26/2015

**Notes:** Landscaping is beyond its expected service life, deteriorated, inadequate, and should be replaced.

#### System: G3060 - Fuel Distribution



**Location:** Site

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

Correction: Renew System

**Qty:** 70,126.00

**Unit of Measure:** S.F.

**Estimate:** \$60,168.00

Assessor Name: Sam Mandola

**Date Created:** 03/07/2016

**Notes:** Fuel distribution system is beyond its expected service life and should be replaced.

#### System: G4030 - Site Communications & Security



Location: Site

**Distress:** Beyond Service Life

Category: Deferred Maintenance

**Priority:** 3 Priority

**Correction:** Renew System

**Qty:** 70,126.00

**Unit of Measure:** S.F.

**Estimate:** \$51,683.00

Assessor Name: Eduardo Lopez

**Date Created:** 05/26/2015

**Notes:** The site communications and security systems are beyond their expected service life and should be scheduled for replacement.

Glossary
----------

Abandoned A facility owned by a district that is not occupied and not maintained. See Vacant.

Additional Cost Total project cost is composed of hard and soft costs. Additional costs or soft expenses are costs

that are necessary to accomplish the corrective work but are not directly attributable to the deficient systems direct construction cost, which are often referred to as hard cost. The components included in the soft costs vary by owner but usually include architect and contractor fees, contingencies and other owner-incurred costs necessary to fully develop and build a facility. These soft cost factors can be adjusted anytime within the eCOMET® database at the owner's

discretion.

Assessment Visual survey of a facility to determine its condition. It involves looking at the age of systems,

reviewing information from local sources and visual evidence of potential problems to assign a condition rating. It does not include destructive testing of materials or testing of systems or

equipment for functionality.

ASTM ASTM International (ASTM): Originally known as the American Society for Testing and Materials,

ASTM is an international standards organization that develops and publishes voluntary consensus

technical standards for a wide range of materials, products, systems, and services.

BOMA Building Owners Managers of America (BOMA): National organization of public and private facility

owners focused on building management tools and maintenance techniques. eCOMET®

reference: Building and component system effective economic life expectancies.

Building A fully enclosed and roofed structure that can be traversed internally without exiting to the

exterior.

Building Addition An area, space or component of a building added to a building after the original building's year

built date. NOTE: As a convention in the database, "Main" was used to designate the original building. Additions built prior to 1983 (30 years) were included in the main building area calculations to reflect their predicted system depreciation characteristics and remaining service

life.

Building Systems eCOMET® uses UNIFORMAT II to organize building data. UNIFORMAT II was originally developed

by the federal General Services Administration to delineate building costs by systems rather than by material. UNIFORMAT II was formalized by an NIST standard, NISTIR 6389 in 1999. It has been further quantified and updated by ASTM standard 2005, E1557-05. The Construction Specifications Institute, CSI, has taken over the standard as part of their MasterFormat /

MasterSpec system.

Calculated Next Renewal The year a system or building element would be expected to expire based solely on the date it

was installed and the expected useful lifetime for that kind of system.

Capital Renewal Capital renewal refers to the cyclical replacement of building systems or elements as they become

obsolete or beyond their useful life. It is not normally included in an annual operating/maintenance budget. See calculated next renewal and next renewal.

City Cost Index (CCI)

RS Means provides building system, equipment, and construction costs at a national level. The

City Cost Index (also provided by RS Means) localizes those costs to a geographic region of the United States. In eCOMET®, each building or site is assigned a City Cost Index, which adjusts all

of the associated costs for systems, deficiencies and inventory to the local value.

Condition Condition refers to the state of physical fitness or readiness of a facility system or system element

for its intended use.

Condition Budget The Condition Budget, also known as Condition Needs, represents the budgeted contractor

installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might

also be associated with the corrective actions due to packaging the work.

#### School Assessment Report - Canby Lane Elementary

Condition Index (CI) %

The Condition Index (CI) also known as the Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) Value divided by the sum of a system's Replacement Value (both values exclude soft cost to simplify calculation updates) expressed as a percentage ranging from 100.00% (new) to 0.00% (expired - no remaining life).

Construction

Specifications Institute

Construction Specifications Institute: Primary national organization specializing in construction materials data and data location in construction documents. eCOMET® reference: UNIFORMAT II materials classification.

Correction

Correction refers to an assessor's recommended deficiency repair or replacement action. For any system or element deficiency, there can be multiple and alternative solutions for its repair or replacement. A Correction is user defined and tied to a UNIFORMAT II element, or system it is intended to address. It excludes other peripheral costs that may also be included in the packaging of repair, replacement or renewal improvements that may also be triggered by the deficiency correction.

Cost Model

A cost model is a list of facility systems which could represent the installed systems a given facility. Included in the cost model are standard unit cost estimates, gross areas, life cycles and installed dates. Also represented is the repair cost for deficient systems, replacement values. See eCOMET® cost models.

Criteria

Criteria refer to the set of requirements, guidelines or standards that are assessed and rated to develop a score.

Current Period

The Current Period is the current year plus a user defined number of forward years.

Current Replacement Value (CRV)

The Current Replacement Value (CRV) of a facility, building or system represents the hypothetical cost of rebuilding or replacing an existing facility under today's codes and construction standards, using its current configuration. It is calculated by multiplying the gross area of the facility by a square foot cost developed in that facility's cost model. Replacement cost includes construction costs and owner's additional or soft costs for fees, permits and other expenses to reflect a total project cost.

**Deferred Maintenance** 

Deferred maintenance is condition work deferred on a planned or unplanned basis to a future budget cycle or postponed until funds are available.

Deficiency

A deficiency is a repair item that is damaged, missing, inadequate or insufficient for an intended purpose.

**Deficiency Category** 

Deficiency Category refers to the type or class of a user defined deficiency grouping with shared or similar characteristics. Category descriptions include, but are not limited to: Accessibility Code Compliance, Appearance, Building Code Compliance, Deferred Maintenance, Energy, Environmental, Life Safety Code Compliance, and Safety.

**Deficiency Distress** 

Deficiency Distress refers to a user-defined root cause of a deficiency. Distress descriptions are: Beyond Service Life, Damaged, Inadequate, Needs Remediation, and Missing.

**Deficiency Priority** 

Deficiency Priority refers to a deficiency's urgency for repair as determined by the assessment team. Deficiencies were assigned a priority of 1 through 5, with Priority 1 deficiencies being the most urgent.

eCOMET®

Energy and Condition Management Estimation Technology (eCOMET®) is Parsons proprietary facility asset management software developed to provide facility managers with a state of the art, web-based tool to develop and maintain a comprehensive database of FCA data and information used for facility asset management, maintenance and repair, and capital renewal planning. eCOMET® is used by Parsons and its clients as the primary tool for collecting FCA data, preparing cost estimates, generating individual facility reports and cost estimates, and developing the overall capital renewal program.

eCOMET® Cost Models eCOMET® cost models are derived from RS Means Square Foot Cost Data cost models and these

models are used to develop the current replacement value (CRV) and assign life cycle costs to the various systems within a building. Cost models are assigned current costs-per-square-foot to establish replacement values. The Cost models are designed to represent a client specific facility

that meets local standards cost trends.

Element Elements are the major components that comprise building systems as defined by UNIFORMAT II.

Expected Life Also referred to as Useful Life. See Useful Life definition.

Facility A facility refers to site(s), building(s), or building addition(s), or combinations thereof that provide

a particular service or support of an educational purpose.

Facility Attributes Customizable eCOMET® fields to identify attributes specific to a facility. These fields are part of

the eCOMET® database set-up with the owner.

Facility Condition A facility condition assessment (FCA) is a visual inspection of buildings and grounds at a facility to identify and estimate current and future needed repairs or replacements of major systems for

identify and estimate current and future needed repairs or replacements of major systems for planning and budgeting purposes. It is typically performed for organizations that are tasked with the day to day maintenance, operation, and capital renewal (replacement) of building systems and components of a large inventory of facilities. The primary goal of an FCA is to objectively and quantifiably identify, inspect, and prioritize the repair and replacement needs of the building and ground systems (e.g., roofs, windows, doors, floor finishes, plumbing fixtures, parking lot, and sidewalks) within facilities that have either failed or have surpassed their service life, and to identify and forecast future capital replacement needs for systems that have not yet failed, but planned replacement of those systems is needed to ensure that the facilities will continue to meet

the mission of the organization.

Facility Condition Index

(FCI)

FCI is an industry-standard measurement of a facility's condition expressed as a percentage from 0.00% to 100.00% that is derived by dividing the cost to correct a facility's deficiencies by its Current Replacement Value (CRV). The higher the FCI the poorer the condition of a facility. After an FCI is established for all buildings within a portfolio, a building's condition can be ranked relative to other buildings. The FCI may also represent the condition of a portfolio based on the cumulative FCIs of the portfolio's facilities.

Forecast Period The Forecast Period refers to a user defined number of years forward of the Current Period.

Gen (Generate) The Cost Model has a Gen box for each system line item. By checking the box, eCOMET® will

generate life cycle deficiencies based on the Year Installed and the Life for that system. Systems that typically do not re-generate (foundations, floor construction, roof construction, basement walls, etc.) would not have the Gen box checked as those systems would not re-generate at the end of a life cycle. In those instances, it would be more practical and cost effective to demolish

the entire facility than renew those systems.

Gross Square Feet (GSF) The area of the enclosed floor space of a building or building addition in square feet measured to

the outside face of the enclosing wall.

Life cycle Life cycle refers to the period of time that a building or site system or element can be expected to

adequately serve its intended function. Parsons assigns expected life cycles to all building systems based on Building Operators and Managers of America (BOMA) recommended life cycles,

manufacturers suggested life, and RS Means cost data, and client-provided historical data. BOMA standards are a nationally recognized source of life cycle data for various components and/or systems associated with facilities. RS Means is a national company specializing in construction

estimating and costs.

Next Renewal Next Renewal refers to a manually-adjusted expected useful life of a system or element based on

on-site inspection either by reducing or extending the Calculated Next Renewal to more accurately

reflect current conditions.

#### School Assessment Report - Canby Lane Elementary

Order of Magnitude Order of Magnitude refers to a rough approximation made with a degree of knowledge and

confidence that the budgeted, projected or estimated cost falls within a reasonable range of cost

values.

Remaining Service Life

(RSL)

RSL is the number of years of service remaining for a system or equipment item. It is automatically calculated based on the difference between the current year and the Calculated

Next Renewal date or the Next Renewal date whichever one is the later date.

Renewal Factors Renewal factors represent the difference in cost of renovating or replacing an existing system,

rather than new construction of a building system. For example, installing a new built-up roof on an existing building would include removing and disposing of the old roof, a cost not associated with new construction. Using a renewal premium to account for demolition and other difficulty

costs, Parsons typically assigns a renewal factor of 110%.

Renewal Schedule A timeline by year that indicates when the systems will need to be renewed and the estimated

price of the renewal.

Repair Cost Repair cost is the sum of all the deficiencies associated with a building or multiple

buildings/facilities. It will include any applied soft costs or City Cost Indexes.

Replacement Value See Current Replacement Value.

Site A facility's grounds and its utilities, roadways, landscaping, fencing and other typical land

improvements needed to support a facility.

Soft Costs Soft Costs are a construction industry term that refers to expense items that are not considered

direct construction costs. Soft costs are user-defined and include architectural, engineering, management, testing, and mitigation fees, and other owner pre- and post-construction expenses.

Sustainability Sustainability refers to the collection of policies and strategies that meet society's present needs

without compromising the ability of future generations to meet their own needs.

System System refers to building and related site work elements as described by ASTM UNIFORMAT II

Classification for Building Elements (E1557-97), a format for classifying major facility elements common to most buildings. Elements usually perform a given function regardless of the design

specification construction method or materials used. See also UNIFORMAT II.

System Generated

Deficiency

eCOMET® automatically generates system deficiencies based on system life cycles using the systems installation dates as the base year. By adjusting the Next Renewal date ahead or behind the predicted or stated life cycle date, a system cost will come due earlier or later than the originally installed life cycle date. This utility accounts for good maintenance conditions and a longer life, or early expiration of a system life due to any number of adverse factors such as poor installation, acts of god, material defects, poor design applications and other factors that may shorten the life of a material or system. It is important to mention that the condition of the systems is not necessarily a reflection of maintenance practices, but a combination of system usage and age.

UNIFORMAT II, Classification for Building Elements (E1557-97), a publication of the

Construction Specification Institute (CSI), is a format used to classify major facility components common to most buildings. The format is based on functional elements or parts of a facility characterized by their functions without regard to the materials and methods used to accomplish

them. These elements are often referred to as systems or assemblies.

Unit Price The Unit Price (Raw) x (100% + the Additional Cost Template percentage).

Unit Price (Raw) The actual \$/sq. ft cost being used for the building and systems. It will include adjustments for

the City Cost Index applied to the facility.

### School Assessment Report - Canby Lane Elementary

Useful Life Also known as Expected Life, Useful Life refers to the intrinsic period of time a system or element

is expected to perform as intended. Useful life is generally provided by manufacturers of materials, systems and elements through their literature, testing and experience. Useful Lives in the

database are derived from the Building Owners and Managers (BOMA) organization's guidelines,

RSMeans cost data, and from client- defined historical experience.

Vacant refers to a facility that is not occupied but is a maintained facility by a district. See

Abandoned.

Year Built The year that a building or addition was originally built based on its date of substantial completion

or occupancy.

minimum of 70% of the system's Current Replacement Value (CRV) was replaced.