DeKalb County School District/High Schools

Druid Hills High

School Assessment Report
May 19, 2016



Table of Contents

School Executive Summary	Ę
School Condition Summary	7
1927 Main, 1965 Gym Addition	ć
Executive Summary	ę
Condition Summary	10
Photo Album	11
Condition Detail	12
System Listing	13
Renewal Schedule	15
Forecasted Sustainment Requirement	18
Deficiency Summary By System	19
Deficiency Summary By Priority	20
Deficiency By Priority Investment	21
Deficiency Summary By Category	22
Deficiency Details By Priority	23
<u>1950 Bldg, 1953, 1961 Additions</u>	30
Executive Summary	30
Condition Summary	31
Photo Album	32
Condition Detail	33
System Listing	34
Renewal Schedule	36
Forecasted Sustainment Requirement	39
Deficiency Summary By System	40
Deficiency Summary By Priority	41
Deficiency By Priority Investment	42
Deficiency Summary By Category	43
Deficiency Details By Priority	44
1965 Football Storage	53

School Assessment Report

	Executive Summary	53
	Condition Summary	54
	Photo Album	55
	Condition Detail	56
	System Listing	57
	Renewal Schedule	58
	Forecasted Sustainment Requirement	61
	Deficiency Summary By System	62
	Deficiency Summary By Priority	63
	Deficiency By Priority Investment	64
	Deficiency Summary By Category	65
	Deficiency Details By Priority	66
19	85 Softball Storage	67
	Executive Summary	67
	Condition Summary	68
	Photo Album	69
	Condition Detail	70
	System Listing	71
	Renewal Schedule	72
	Forecasted Sustainment Requirement	75
	Deficiency Summary By System	76
	Deficiency Summary By Priority	77
	Deficiency By Priority Investment	78
	Deficiency Summary By Category	79
	Deficiency Details By Priority	80
<u>20</u>	10 Addition	81
	Executive Summary	81
	Condition Summary	82
	Photo Album	83
	Condition Detail	84
	System Listing	85

School Assessment Report

Renewal Schedule	87
Forecasted Sustainment Requirement	90
Deficiency Summary By System	91
Deficiency Summary By Priority	92
Deficiency By Priority Investment	93
Deficiency Summary By Category	94
Deficiency Details By Priority	95
	96
Executive Summary	96
Condition Summary	97
Photo Album	98
Condition Detail	99
System Listing	100
Renewal Schedule	101
Forecasted Sustainment Requirement	103
Deficiency Summary By System	104
Deficiency Summary By Priority	105
Deficiency By Priority Investment	106
Deficiency Summary By Category	107
Deficiency Details By Priority	108
Glossary	116
	Forecasted Sustainment Requirement Deficiency Summary By System Deficiency Summary By Priority Deficiency By Priority Investment Deficiency Summary By Category Deficiency Details By Priority Executive Summary Condition Summary Photo Album Condition Detail System Listing Renewal Schedule Forecasted Sustainment Requirement Deficiency Summary By System Deficiency Summary By Priority Deficiency Summary By Priority Deficiency Summary By Category Deficiency Details By Priority Deficiency Details By Priority

School Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. Facility Condition Index (FCI) is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term FCA Score is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Gross Area (SF):	171,358
Year Built:	1927
Last Renovation:	2010
Replacement Value:	\$43,304,033
Repair Cost:	\$12,054,627.97
Total FCI:	27.84 %
Total RSLI:	40.99 %
FCA Score:	72.16



Description:

The Druid Hills High School campus consists of one main school building located at 1798 Haywood Drive NE in Atlanta, Georgia. The original campus was constructed in 1927 and additions to the main school building were constructed in 1950, 1953, 1961, 1965, and 2010. In addition to the main school building, the campus contains a covered walkway, storage buildings, dugouts, baseball field, football field, tennis courts, and track. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). The detailed condition and deficiency statements are contained in this report for each building and site improvement on the campus.

School Assessment Report - Druid Hills High

Attributes:

General Attributes:

Assigned Region: Region 2 Board District: District 2 DOE Facility: 2055 Geographic Region: Region 2

HS Attendance Area: Druid Hills HS Jurisdictional City: DeKalb County (Unincorporated)

Site Acreage: 11.3

School Condition Summary

The Table below shows the RSLI and FCI for each major system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.


Current Investment Requirement and Condition by Uniformat Classification

UNIFORMAT Classification	RSLI%	FCI %	Current Repair
A10 - Foundations	27.89 %	0.00 %	\$0.00
A20 - Basement Construction	18.57 %	2.98 %	\$9,759.36
B10 - Superstructure	35.49 %	0.00 %	\$0.00
B20 - Exterior Enclosure	41.21 %	13.25 %	\$668,725.97
B30 - Roofing	35.73 %	57.67 %	\$1,164,284.00
C10 - Interior Construction	64.79 %	15.49 %	\$685,451.00
C20 - Stairs	57.78 %	0.00 %	\$0.00
C30 - Interior Finishes	50.81 %	3.68 %	\$145,936.00
D10 - Conveying	38.99 %	57.22 %	\$84,108.00
D20 - Plumbing	19.40 %	82.81 %	\$3,103,798.00
D30 - HVAC	53.36 %	22.35 %	\$1,200,895.00
D40 - Fire Protection	83.33 %	1.37 %	\$9,726.24
D50 - Electrical	57.46 %	11.26 %	\$408,079.00
E10 - Equipment	46.71 %	20.15 %	\$277,959.00
E20 - Furnishings	32.14 %	62.86 %	\$680,137.00
F10 - Special Construction	0.00 %	0.00 %	\$0.00
G20 - Site Improvements	7.53 %	76.89 %	\$1,760,990.41
G30 - Site Mechanical Utilities	0.00 %	110.00 %	\$1,377,889.67
G40 - Site Electrical Utilities	15.62 %	75.62 %	\$476,889.32
Totals:	40.99 %	27.84 %	\$12,054,627.97

Condition Deficiency Priority

Facility Name	Gross Area (S.F.)	FCI %	1 Priority	2 Priority	3 Priority	4 Priority	5 Priority
1927 Main, 1965 Gym Addition	88,909	16.14	\$9,726.24	\$0.00	\$2,963,495.33	\$0.00	\$0.00
1950 Bldg, 1953, 1961 Additions	50,889	40.95	\$0.00	\$36,945.00	\$5,421,294.00	\$0.00	\$0.00
1965 Football Storage	300	26.58	\$0.00	\$0.00	\$7,023.00	\$0.00	\$0.00
1985 Softball Storage	120	4.49	\$0.00	\$0.00	\$375.00	\$0.00	\$0.00
2010 Addition	31,140	0.00	\$0.00	\$0.00	\$0.00	\$0.00	\$0.00
Site	171,358	86.63	\$0.00	\$1,455,998.19	\$2,159,771.21	\$0.00	\$0.00
Total:		27.84	\$9,726.24	\$1,492,943.19	\$10,551,958.54	\$0.00	\$0.00

Deficiencies By Priority

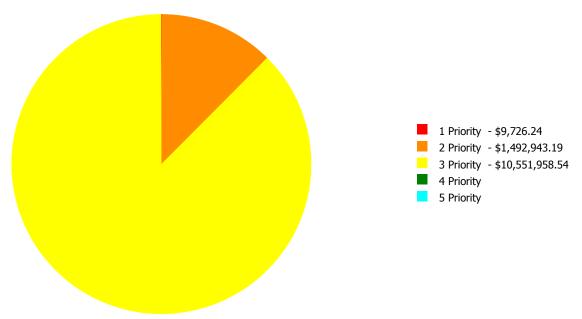

Budget Estimate Total: \$12,054,627.97

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The Repair Cost (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. Facility Condition Index (FCI) is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term FCA Score is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

High Cabaal

Function:	High School
Gross Area (SF):	88,909
Year Built:	1927
Last Renovation:	2010
Replacement Value:	\$18,421,016
Repair Cost:	\$2,973,221.57
Total FCI:	16.14 %
Total RSLI:	43.12 %



FCA Score: **Description:**

C. . notion.

The main building at Druid Hills High School is a two-story building plus basement located at 1798 Haywood Drive NE in Atlanta, Georgia. Originally built in 1927, there has been one adjacent gym addition in 1965, and major renovations in 2009 and 2010. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

83.86

Attributes:

General	Attributes:
oenerar	ALLI IDULES.

Building Codes: 5010, 5030 Fire Sprinkler System: Yes

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.


UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	12.00 %	0.00 %	\$0.00
A20 - Basement Construction	12.00 %	4.14 %	\$9,759.36
B10 - Superstructure	12.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	36.80 %	0.15 %	\$4,090.97
B30 - Roofing	72.59 %	0.00 %	\$0.00
C10 - Interior Construction	76.53 %	18.58 %	\$338,388.00
C20 - Stairs	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	53.32 %	0.00 %	\$0.00
D10 - Conveying	0.00 %	110.00 %	\$84,108.00
D20 - Plumbing	0.00 %	110.00 %	\$1,633,258.00
D30 - HVAC	56.38 %	24.90 %	\$575,063.00
D40 - Fire Protection	83.33 %	1.71 %	\$9,726.24
D50 - Electrical	70.32 %	0.00 %	\$0.00
E10 - Equipment	62.62 %	18.16 %	\$152,568.00
E20 - Furnishings	40.54 %	50.54 %	\$166,260.00
F10 - Special Construction	0.00 %	0.00 %	\$0.00
Totals:	43.12 %	16.14 %	\$2,973,221.57

Photo Album

The photo album consists of the various cardinal directions of the building.

1). South Elevation - Jun 15, 2015



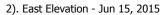



3). North Elevation - Jun 15, 2015



4). West Elevation - Jun 15, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

- 1. System Code: A code that identifies the system.
- 2. System Description: A brief description of a system present in the building.
- 3. Unit Price \$: The unit price of the system.
- 4. UoM: The unit of measure of the system.
- 5. Qty: The quantity for the system.
- 6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
- 7. Year Installed: The date of system installation.
- 8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
- 9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
- 10. RSLI: The Remaining Service Life Index of the system.
- 11. FCI: The Facility Condition Index of the system.
- 12. RSL: Remaining Service Life in years.
- 13. eCR: eCOMET Condition Rating (not used in this assessment).
- 14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
- 15. Replacement Value \$: The replacement cost of the system.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$9.34	S.F.	88,909	100	1927	2027		12.00 %	0.00 %	12			\$830,410
A1020	Special Foundations	\$4.36	S.F.	88,909	100	1927	2027		12.00 %	0.00 %	12			\$387,643
A1030	Slab on Grade	\$6.21	S.F.	88,909	100	1927	2027		12.00 %	0.00 %	12			\$552,125
A2010	Basement Excavation	\$0.18	S.F.	88,909	100	1927	2027		12.00 %	0.00 %	12			\$16,004
A2020	Basement Walls	\$2.47	S.F.	88,909	100	1927	2027		12.00 %	4.44 %	12		\$9,759.36	\$219,605
B1010	Floor Construction	\$2.65	S.F.	88,909	100	1927	2027		12.00 %	0.00 %	12			\$235,609
B1020	Roof Construction	\$21.36	S.F.	88,909	100	1927	2027		12.00 %	0.00 %	12			\$1,899,096
B2010	Exterior Walls	\$19.80	S.F.	88,909	100	1927	2027		12.00 %	0.23 %	12		\$4,090.97	\$1,760,398
B2020	Exterior Windows	\$9.36	S.F.	88,909	30	2009	2039		80.00 %	0.00 %	24			\$832,188
B2030	Exterior Doors	\$2.01	S.F.	88,909	30	2009	2039		80.00 %	0.00 %	24			\$178,707
B3010	Roof Coverings - Asphal Shingles	\$4.32	S.F.	4,600	10	2010	2020		50.00 %	0.00 %	5			\$19,872
B3010	Roof Coverings - BUR	\$20.70	S.F.	25,500	25	2010	2035		80.00 %	0.00 %	20			\$527,850
B3010	Roof Coverings - EPDM	\$0.00	S.F.		15	1927	1942		0.00 %	0.00 %	-73			\$0
B3010	Roof Coverings - Preformed Metal	\$0.00	S.F.		30	1927	1957		0.00 %	0.00 %	-58			\$0
B3010	Roof Coverings - Standing Seam Metal	\$11.91	S.F.	7,400	75	1965	2040		33.33 %	0.00 %	25			\$88,134
B3020	Roof Openings	\$0.54	S.F.		30	1927	1957		0.00 %	0.00 %	-58			\$0
C1010	Partitions	\$12.78	S.F.	88,909	100	2010	2110		95.00 %	0.00 %	95			\$1,136,257
C1020	Interior Doors	\$4.24	S.F.	88,909	30	2010	2040		83.33 %	0.00 %	25			\$376,974
C1030	Fittings	\$3.46	S.F.	88,909	20	1980	2000		0.00 %	110.00 %	-15		\$338,388.00	\$307,625
C2010	Stair Construction	\$0.00	S.F.	88,909	100	1927	2027		12.00 %	0.00 %	12			\$0
C3010	Wall Finishes - Ceramic & Glazed	\$10.27	S.F.	24,522	30	2010	2040		83.33 %	0.00 %	25			\$251,841
C3010	Wall Finishes - Paint	\$1.41	S.F.	64,387	10	2010	2020		50.00 %	0.00 %	5			\$90,786
C3010	Wall Finishes - Wall Coverings	\$0.00	S.F.	0	10	1927	1937		0.00 %	0.00 %	-78			\$0
C3020	Floor Finishes - Carpet	\$8.50	S.F.	3,065	8	2010	2018		37.50 %	0.00 %	3			\$26,053
C3020	Floor Finishes - Ceramic & Quarry Tile	\$14.49	S.F.	6,131	50	2010	2060		90.00 %	0.00 %	45			\$88,838
C3020	Floor Finishes - Terrazzo	\$53.01	S.F.	9,196	50	1927	1977		0.00 %	0.00 %	-38			\$487,480
C3020	Floor Finishes - VCT	\$5.01	S.F.	36,783	20	2010	2030		75.00 %	0.00 %	15			\$184,283
C3020	Floor Finishes - Wood	\$10.68	S.F.	15,453	20	2010	2030		75.00 %	0.00 %	15			\$165,038
C3030	Ceiling Finishes	\$4.31	S.F.	88,909	20	2010	2030		75.00 %	0.00 %	15			\$383,198
D1010	Elevators and Lifts	\$0.86	S.F.	88,909	30	1995	2025	2015	0.00 %	110.00 %	0		\$84,108.00	\$76,462
D2010	Plumbing Fixtures	\$9.66	S.F.	88,909	30	1965	1995		0.00 %	110.00 %	-20		\$944,747.00	\$858,861
D2020	Domestic Water Distribution	\$5.85	S.F.	88,909	30	1965	1995		0.00 %	110.00 %	-20		\$572,129.00	\$520,118
D2030	Sanitary Waste	\$0.87	S.F.	88,909	30	1965	1995		0.00 %	110.00 %	-20		\$85,086.00	\$77,351
D2040	Rain Water Drainage	\$0.22	S.F.	0	30				0.00 %	0.00 %				\$0

School Assessment Report - 1927 Main, 1965 Gym Addition

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
D2090	Other Plumbing Systems - Acid Waste	\$0.00	S.F.	0	30				0.00 %	0.00 %				\$0
D2090	Other Plumbing Systems - Natural Gas	\$0.32	S.F.	88,909	40	1965	2005		0.00 %	110.00 %	-10		\$31,296.00	\$28,451
D3020	Heat Generating Systems	\$4.02	S.F.	88,909	30	2010	2040		83.33 %	0.00 %	25			\$357,414
D3030	Cooling Generating Systems	\$4.17	S.F.	88,909	25	2010	2035		80.00 %	0.00 %	20			\$370,751
D3040	Distribution Systems & Exhaust Systems	\$5.88	S.F.	88,909	30	2010	2040	2015	0.00 %	110.00 %	0		\$575,063.00	\$522,785
D3050	Terminal & Package Units	\$11.65	S.F.	88,909	15	2010	2025		66.67 %	0.00 %	10			\$1,035,790
D3060	Controls & Instrumentation	\$0.26	S.F.	88,909	20	2010	2030		75.00 %	0.00 %	15			\$23,116
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$0.00	S.F.	0	30				0.00 %	0.00 %				\$0
D4010	Sprinklers	\$3.84	S.F.	88,909	30	2010	2040		83.33 %	2.85 %	25		\$9,726.24	\$341,411
D4020	Standpipes	\$2.55	S.F.	88,909	30	2010	2040		83.33 %	0.00 %	25			\$226,718
D5010	Electrical Service/Distribution	\$1.24	S.F.	88,909	40	2010	2050		87.50 %	0.00 %	35			\$110,247
D5020	Branch Wiring	\$5.24	S.F.	88,909	30	2010	2040		83.33 %	0.00 %	25			\$465,883
D5020	Lighting	\$5.24	S.F.	88,909	30	2010	2040		83.33 %	0.00 %	25			\$465,883
D5030	Communications and Security - Fire Alarm	\$2.13	S.F.	88,909	10	2010	2020		50.00 %	0.00 %	5			\$189,376
D5030	Communications and Security - PA & Clock Systems	\$4.82	S.F.	88,909	10	2010	2020		50.00 %	0.00 %	5			\$428,541
D5030	Communications and Security - Security & CCTV	\$0.88	S.F.	88,909	10	2010	2020		50.00 %	0.00 %	5			\$78,240
D5090	Other Electrical Systems - Emergency Generator	\$0.32	S.F.	88,909	20	2010	2030		75.00 %	0.00 %	15			\$28,451
E1010	Commercial Equipment	\$6.54	S.F.	0	20				0.00 %	0.00 %				\$0
E1020	Institutional Equipment	\$7.89	S.F.	88,909	20	2010	2030		75.00 %	0.00 %	15			\$701,492
E1090	Other Equipment - Kitchen Equipment	\$2.24	S.F.		0				0.00 %	0.00 %				\$0
E1090	Other Equipment - Sports Equipment	\$1.56	S.F.	88,909	15	1965	1980		0.00 %	110.00 %	-35		\$152,568.00	\$138,698
E2010	Fixed Furnishings	\$2.00	S.F.	88,909	20	2010	2030		75.00 %	0.00 %	15			\$177,818
E2020	Moveable Furnishings	\$1.70	S.F.	88,909	30	1965	1995		0.00 %	110.00 %	-20		\$166,260.00	\$151,145
F1010	Special Structures - Canopies	\$0.00	S.F.	0	20				0.00 %	0.00 %				\$0
								Total	43.12 %	16.14 %			\$2,973,221.57	\$18,421,016

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$2,973,222	\$0	\$0	\$31,315	\$0	\$1,028,852	\$0	\$0	\$0	\$0	\$1,531,217	\$5,564,606
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1020 - Special Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$9,759	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$9,759
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1010 - Floor Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$4,091	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$4,091
B2020 - Exterior Windows	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Asphal Shingles	\$0	\$0	\$0	\$0	\$0	\$25,341	\$0	\$0	\$0	\$0	\$0	\$25,341
B3010 - Roof Coverings - BUR	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - EPDM	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Preformed Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3020 - Roof Openings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

School Assessment Report - 1927 Main, 1965 Gym Addition

C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$338,388	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$338,388
C20 - Stairs	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* C2010 - Stair Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic & Glazed	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Paint	\$0	\$0	\$0	\$0	\$0	\$115,770	\$0	\$0	\$0	\$0	\$0	\$115,770
C3010 - Wall Finishes - Wall Coverings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Carpet	\$0	\$0	\$0	\$31,315	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$31,315
C3020 - Floor Finishes - Ceramic & Quarry Tile	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Terrazzo	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - VCT	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Wood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D10 - Conveying	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D1010 - Elevators and Lifts	\$84,108	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$84,108
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$944,747	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$944,747
D2020 - Domestic Water Distribution	\$572,129	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$572,129
D2030 - Sanitary Waste	\$85,086	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$85,086
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2090 - Other Plumbing Systems - Acid Waste	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2090 - Other Plumbing Systems - Natural Gas	\$31,296	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$31,296
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3020 - Heat Generating Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3030 - Cooling Generating Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3040 - Distribution Systems & Exhaust Systems	\$575,063	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$575,063
D3050 - Terminal & Package Units	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,531,217	\$1,531,217
D3060 - Controls & Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3090 - Other HVAC Systems/Equip - Kitchen Hood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


School Assessment Report - 1927 Main, 1965 Gym Addition

D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D4010 - Sprinklers	\$9,726	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$9,726
D4020 - Standpipes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5030 - Communications and Security - Fire Alarm	\$0	\$0	\$0	\$0	\$0	\$241,493	\$0	\$0	\$0	\$0	\$0	\$241,493
D5030 - Communications and Security - PA & Clock Systems	\$0	\$0	\$0	\$0	\$0	\$546,477	\$0	\$0	\$0	\$0	\$0	\$546,477
D5030 - Communications and Security - Security & CCTV	\$0	\$0	\$0	\$0	\$0	\$99,772	\$0	\$0	\$0	\$0	\$0	\$99,772
D5090 - Other Electrical Systems - Emergency Generator	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E - Equipment & Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E10 - Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1010 - Commercial Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1020 - Institutional Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1090 - Other Equipment - Kitchen Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1090 - Other Equipment - Sports Equipment	\$152,568	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$152,568
E20 - Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E2010 - Fixed Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E2020 - Moveable Furnishings	\$166,260	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$166,260
F - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F10 - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F1010 - Special Structures - Canopies	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

^{*} Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

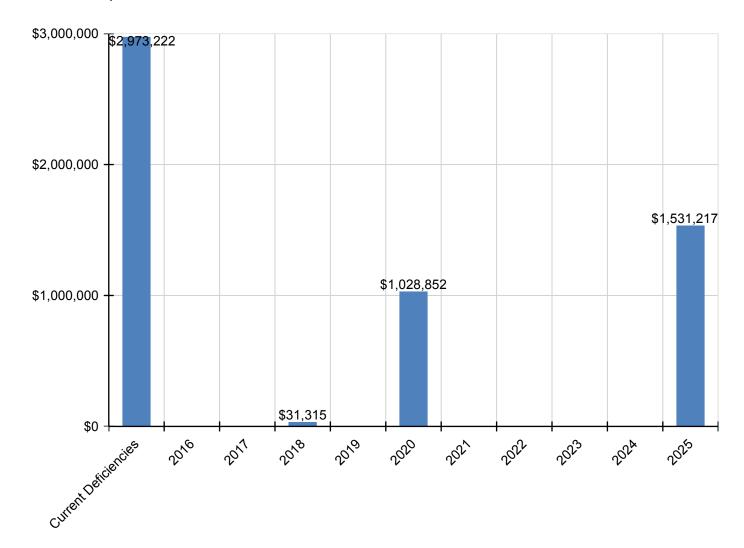

Deficiency Summary by System


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

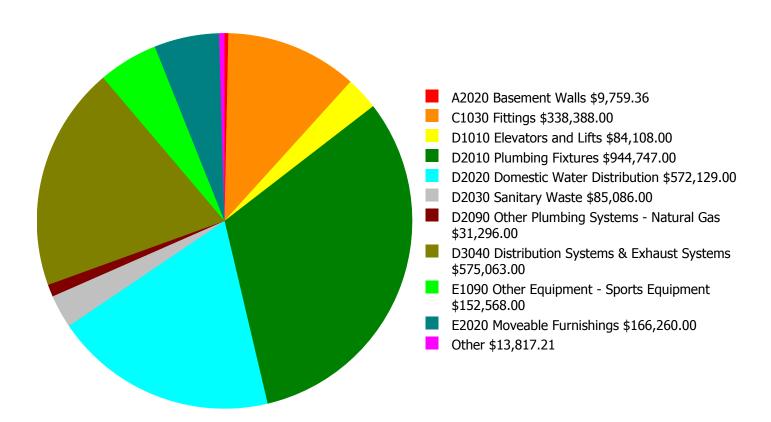

Budget Estimate Total: \$2,973,221.57

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

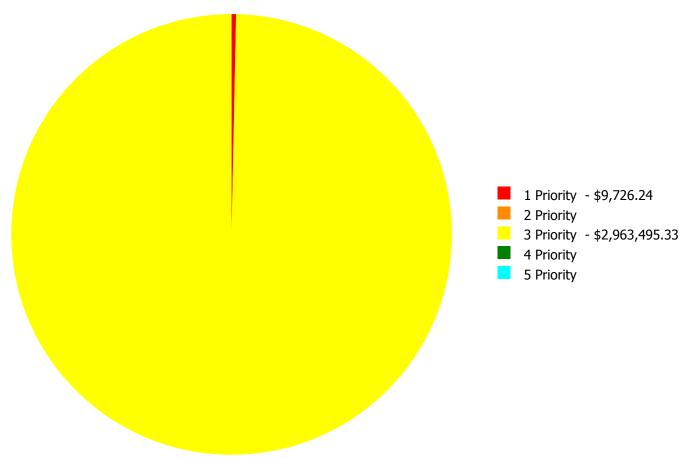

Budget Estimate Total: \$2,973,221.57

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards..
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System							
Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
A2020	Basement Walls	\$0.00	\$0.00	\$9,759.36	\$0.00	\$0.00	\$9,759.36
B2010	Exterior Walls	\$0.00	\$0.00	\$4,090.97	\$0.00	\$0.00	\$4,090.97
C1030	Fittings	\$0.00	\$0.00	\$338,388.00	\$0.00	\$0.00	\$338,388.00
D1010	Elevators and Lifts	\$0.00	\$0.00	\$84,108.00	\$0.00	\$0.00	\$84,108.00
D2010	Plumbing Fixtures	\$0.00	\$0.00	\$944,747.00	\$0.00	\$0.00	\$944,747.00
D2020	Domestic Water Distribution	\$0.00	\$0.00	\$572,129.00	\$0.00	\$0.00	\$572,129.00
D2030	Sanitary Waste	\$0.00	\$0.00	\$85,086.00	\$0.00	\$0.00	\$85,086.00
D2090	Other Plumbing Systems - Natural Gas	\$0.00	\$0.00	\$31,296.00	\$0.00	\$0.00	\$31,296.00
D3040	Distribution Systems & Exhaust Systems	\$0.00	\$0.00	\$575,063.00	\$0.00	\$0.00	\$575,063.00
D4010	Sprinklers	\$9,726.24	\$0.00	\$0.00	\$0.00	\$0.00	\$9,726.24
E1090	Other Equipment - Sports Equipment	\$0.00	\$0.00	\$152,568.00	\$0.00	\$0.00	\$152,568.00
E2020	Moveable Furnishings	\$0.00	\$0.00	\$166,260.00	\$0.00	\$0.00	\$166,260.00
	Total:	\$9,726.24	\$0.00	\$2,963,495.33	\$0.00	\$0.00	\$2,973,221.57

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

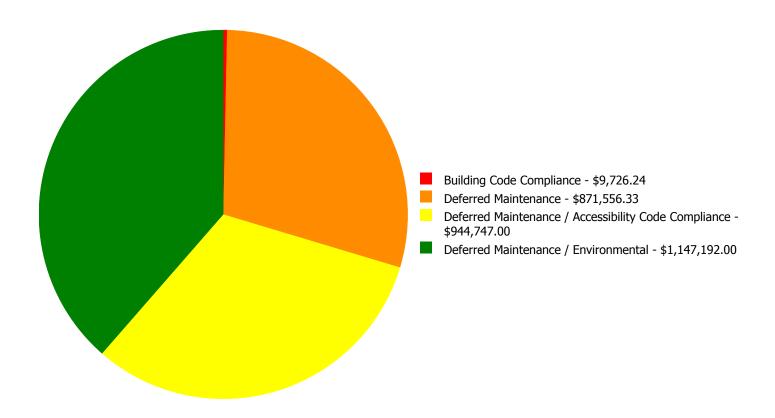

Budget Estimate Total: \$2,973,221.57

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 1 Priority:

System: D4010 - Sprinklers



Location: Hallway Near Room 303

Distress: Damaged

Category: Building Code Compliance

Priority: 1 Priority

Correction: Replace sprinkler head

Qty: 1.00

Unit of Measure: Ea.

Estimate: \$9,726.24

Assessor Name: Sam Mandola

Date Created: 06/16/2015

Notes: The sprinkler system has reportedly leaked for an extended period in the hallway near room 303. Estimate is for repairs.

Priority 3 Priority:

System: A2020 - Basement Walls



Location: Gym Basement, Multiple Locations

Distress: Damaged

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Repair Seepage

Qty: 1.00

Unit of Measure: Job

Estimate: \$9,759.36

Assessor Name: Sam Mandola

Date Created: 06/15/2015

Notes: Repair seepage in basement walls at multiple locations.

System: B2010 - Exterior Walls



Location: Exterior Walls in Rooms 307 and Chorus 105

Distress: Damaged

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Replace clay brick wall, 3rd floor

Qty: 1.00

Unit of Measure: C.S.F.

Estimate: \$4,090.97

Assessor Name: Sam Mandola

Date Created: 06/15/2015

Notes: Water leaks through the exterior walls/parapets into the rooms. Estimate to repair the exterior wall and interior damage. Repairs will require a truck with a boom lift.

System: C1030 - Fittings



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 88,909.00

Unit of Measure: S.F.

Estimate: \$338,388.00

Assessor Name: Sam Mandola

Date Created: 06/18/2015

Notes: Fittings, such as toilet partitions, handrails, signage and lockers, are beyond their expected service life and should be replaced. Handrails not code compliant at stairwells.

System: D1010 - Elevators and Lifts



Location: Northwest Side of Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 88,909.00

Unit of Measure: S.F.

Estimate: \$84,108.00

Assessor Name: Sam Mandola

Date Created: 05/06/2016

Notes: The elevator is reported as unreliable and should be repaired or replaced.

System: D2010 - Plumbing Fixtures



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code

Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 88,909.00

Unit of Measure: S.F.

Estimate: \$944,747.00

Assessor Name: Sam Mandola

Date Created: 06/15/2015

Notes: The plumbing fixtures are beyond their expected service life and should be scheduled for replacement. SPLOST project 410-422 to replace plumbing fixtures as needed throughout the building.

System: D2020 - Domestic Water Distribution



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Environmental

Priority: 3 Priority

Correction: Renew System

Qty: 88,909.00

Unit of Measure: S.F.

Estimate: \$572,129.00

Assessor Name: Sam Mandola

Date Created: 06/15/2015

Notes: The domestic water distribution system is beyond its expected service life, has water quality issues, and should be scheduled for replacement. SPLOST project 410-422 to replace the interior building domestic water piping mains in the 1950, 1953, 1961 and 1965 buildings.

System: D2030 - Sanitary Waste



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 88,909.00

Unit of Measure: S.F.

Estimate: \$85,086.00

Assessor Name: Sam Mandola

Date Created: 06/15/2015

Notes: The sanitary waste system is beyond its expected service life and should be scheduled for replacement. SPLOST project 410-422 to replace grease trap and backflow preventer.

System: D2090 - Other Plumbing Systems - Natural Gas



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 88,909.00

Unit of Measure: S.F.

Estimate: \$31,296.00

Assessor Name: Sam Mandola

Date Created: 04/11/2015

Notes: The natural gas system is beyond its expected service life and should be scheduled for replacement.

System: D3040 - Distribution Systems & Exhaust Systems



Location: Throughout Building

Distress: Inadequate

Category: Deferred Maintenance / Environmental

Priority: 3 Priority

Correction: Renew System

Qty: 88,909.00

Unit of Measure: S.F.

Estimate: \$575,063.00

Assessor Name: Sam Mandola

Date Created: 06/23/2015

Notes: The distribution and exhaust systems are inadequate and should be scheduled for replacement.

System: E1090 - Other Equipment - Sports Equipment



Location: Gym

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 88,909.00

Unit of Measure: S.F.

Estimate: \$152,568.00

Assessor Name: Sam Mandola

Date Created: 12/11/2015

Notes: Sports equipment is beyond its expected service life and should be scheduled for replacement.

System: E2020 - Moveable Furnishings



Location: Gym

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 88,909.00

Unit of Measure: S.F.

Estimate: \$166,260.00

Assessor Name: Sam Mandola

Date Created: 06/15/2015

Notes: The movable bleacher seating system is beyond its expected service life and should be scheduled for replacement.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The Repair Cost (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. Facility Condition Index (FCI) is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term FCA Score is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	High School
Gross Area (SF):	50,889
Year Built:	1950
Last Renovation:	2010
Replacement Value:	\$13,329,726
Repair Cost:	\$5,458,239.00
Total FCI:	40.95 %
Total RSLI:	26.19 %
FCA Score:	59.05



Description:

The 1950 classroom building at Druid Hills High School is a one-story building located at 1798 Haygood Drive NE in Atlanta, Georgia. There have been two additions in 1953 (classrooms) and 1961 (cafeteria), and some renovation to these additions. The 1950 section of the building, media center and classrooms was renovated in 2010, and a sprinkler system was added in this section as well. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:				
Building Codes:	5020 5021	Fire Sprinkler System:	Nο	

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	35.00 %	0.00 %	\$0.00
A20 - Basement Construction	35.00 %	0.00 %	\$0.00
B10 - Superstructure	35.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	19.95 %	47.31 %	\$662,778.00
B30 - Roofing	0.00 %	110.00 %	\$1,158,743.00
C10 - Interior Construction	36.83 %	21.48 %	\$347,063.00
C20 - Stairs	35.00 %	0.00 %	\$0.00
C30 - Interior Finishes	38.90 %	9.05 %	\$145,936.00
D10 - Conveying	80.00 %	0.00 %	\$0.00
D20 - Plumbing	2.42 %	106.87 %	\$1,470,540.00
D30 - HVAC	38.41 %	32.69 %	\$625,832.00
D40 - Fire Protection	0.00 %	0.00 %	\$0.00
D50 - Electrical	28.05 %	35.39 %	\$408,079.00
E10 - Equipment	19.47 %	24.32 %	\$125,391.00
E20 - Furnishings	0.00 %	110.00 %	\$513,877.00
F10 - Special Construction	0.00 %	0.00 %	\$0.00
Totals:	26.19 %	40.95 %	\$5,458,239.00

Photo Album

The photo album consists of the various cardinal directions of the building.

1). West Elevation - Jun 15, 2015



2). North Elevation - Jun 15, 2015



3). East Elevation - Jun 15, 2015



4). Southeast Elevation - Jun 15, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

- 1. System Code: A code that identifies the system.
- 2. System Description: A brief description of a system present in the building.
- 3. Unit Price \$: The unit price of the system.
- 4. UoM: The unit of measure of the system.
- 5. Qty: The quantity for the system.
- 6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
- 7. Year Installed: The date of system installation.
- 8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
- 9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
- 10. RSLI: The Remaining Service Life Index of the system.
- 11. FCI: The Facility Condition Index of the system.
- 12. RSL: Remaining Service Life in years.
- 13. eCR: eCOMET Condition Rating (not used in this assessment).
- 14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
- 15. Replacement Value \$: The replacement cost of the system.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System						Year	Calc Next Renewal	Next Renewal						Replacement
Code	System Description	Unit Price \$	UoM	Qty	Life	Installed	Year	Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Value \$
A1010	Standard Foundations	\$3.51		50,889	100	1950	2050		35.00 %	0.00 %	35			\$178,620
A1020	Special Foundations	\$4.36	S.F.	50,889	100	1950	2050		35.00 %	0.00 %	35			\$221,876
A1030	Slab on Grade	\$3.56	S.F.	50,889	100	1950	2050		35.00 %	0.00 %	35			\$181,165
A2010	Basement Excavation	\$0.14	S.F.	50,889	100	1950	2050		35.00 %	0.00 %	35			\$7,124
A2020	Basement Walls	\$1.64	S.F.	50,889	100	1950	2050		35.00 %	0.00 %	35			\$83,458
B1010	Floor Construction	\$15.61	S.F.	50,889	100	1950	2050		35.00 %	0.00 %	35			\$794,377
B1020	Roof Construction	\$11.74	S.F.	50,889	100	1950	2050		35.00 %	0.00 %	35			\$597,437
B2010	Exterior Walls	\$15.69	S.F.	50,889	100	1950	2050		35.00 %	0.00 %	35			\$798,448
B2020	Exterior Windows	\$11.18	S.F.	50,889	30	1950	1980		0.00 %	110.00 %	-35		\$625,833.00	\$568,939
B2030	Exterior Doors	\$0.66	S.F.	50,889	30	1950	1980		0.00 %	110.00 %	-35		\$36,945.00	\$33,587
B3010	Roof Coverings - Asphal Shingles	\$0.00	S.F.	0	10				0.00 %	0.00 %				\$0
B3010	Roof Coverings - BUR	\$20.70	S.F.	50,889	25	1990	2015		0.00 %	110.00 %	0		\$1,158,743.00	\$1,053,402
B3010	Roof Coverings - EPDM	\$0.00	S.F.	0	15	1950	1965		0.00 %	0.00 %	-50			\$0
B3010	Roof Coverings - Preformed Metal	\$0.00	S.F.	0	30	1950	1980		0.00 %	0.00 %	-35			\$0
B3010	Roof Coverings - Standing Seam Metal	\$0.00	S.F.	0	75	1950	2025		13.33 %	0.00 %	10			\$0
B3020	Roof Openings	\$0.00	S.F.	0	30	1950	1980		0.00 %	0.00 %	-35			\$0
C1010	Partitions	\$19.44	S.F.	50,889	100	1950	2050		35.00 %	0.00 %	35			\$989,282
C1020	Interior Doors	\$6.11	S.F.	50,889	30	2009	2039		80.00 %	0.00 %	24			\$310,932
C1030	Fittings	\$6.20	S.F.	50,889	20	1950	1970		0.00 %	110.00 %	-45		\$347,063.00	\$315,512
C2010	Stair Construction	\$2.21	S.F.	50,889	100	1950	2050		35.00 %	0.00 %	35			\$112,465
C3010	Wall Finishes - Ceramic & Glazed	\$10.27	S.F.	20,356	30	1965	1995	2020	16.67 %	0.00 %	5			\$209,056
C3010	Wall Finishes - Paint	\$1.93	S.F.	30,533	10	1995	2005		0.00 %	110.00 %	-10		\$64,822.00	\$58,929
C3010	Wall Finishes - Wall Coverings	\$0.00	S.F.	0	10	1950	1960		0.00 %	0.00 %	-55			\$0
C3020	Floor Finishes - Carpet	\$8.50	S.F.	5,089	8	2010	2018		37.50 %	0.00 %	3			\$43,257
C3020	Floor Finishes - Ceramic & Quarry Tile	\$14.49	S.F.	5,089	50	1950	2000		0.00 %	110.00 %	-15		\$81,114.00	\$73,740
C3020	Floor Finishes - Terrazzo	\$53.01	S.F.	7,633	50	1950	2000		0.00 %	0.00 %	-15			\$404,625
C3020	Floor Finishes - VCT	\$9.54	S.F.	33,078	20	2009	2029		70.00 %	0.00 %	14			\$315,564
C3020	Floor Finishes - Wood	\$0.00	S.F.	0	20	1950	1970		0.00 %	0.00 %	-45			\$0
C3030	Ceiling Finishes	\$9.98	S.F.	50,889	20	2009	2029		70.00 %	0.00 %	14			\$507,872
D1010	Elevators and Lifts	\$0.86	S.F.	50,889	30	2009	2039		80.00 %	0.00 %	24			\$43,765
D2010	Plumbing Fixtures	\$17.66	S.F.	50,889	30	1950	1980		0.00 %	110.00 %	-35		\$988,570.00	\$898,700
D2020	Domestic Water Distribution	\$3.81	S.F.	50,889	30	1950	1980		0.00 %	110.00 %	-35		\$213,276.00	\$193,887
D2030	Sanitary Waste	\$4.80	S.F.	50,889	30	1950	1980		0.00 %	110.00 %	-35		\$268,694.00	\$244,267
D2040	Rain Water Drainage	\$0.00	S.F.	0	30	1950	1980		0.00 %	0.00 %	-35			\$0

School Assessment Report - 1950 Bldg, 1953, 1961 Additions

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
D2090	Other Plumbing Systems - Acid Waste	\$0.54	S.F.	0	30	1950	1980		0.00 %	0.00 %	-35			\$0
D2090	Other Plumbing Systems - Natural Gas	\$0.77	S.F.	50,889	40	2009	2049		85.00 %	0.00 %	34			\$39,185
D3020	Heat Generating Systems	\$4.55	S.F.	50,889	30	1950	1980		0.00 %	110.00 %	-35		\$254,699.00	\$231,545
D3030	Cooling Generating Systems	\$4.73	S.F.	50,889	25	1995	2020		20.00 %	0.00 %	5			\$240,705
D3040	Distribution Systems & Exhaust Systems	\$5.88	S.F.	50,889	30	1961	1991		0.00 %	110.00 %	-24		\$329,150.00	\$299,227
D3050	Terminal & Package Units	\$18.52	S.F.	50,889	15	2009	2024		60.00 %	0.00 %	9			\$942,464
D3060	Controls & Instrumentation	\$3.19	S.F.	50,889	20	2010	2030		75.00 %	0.00 %	15			\$162,336
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$0.75	S.F.	50,889	30	1950	1980		0.00 %	110.00 %	-35		\$41,983.00	\$38,167
D4010	Sprinklers	\$4.13	S.F.		0				0.00 %	0.00 %				\$0
D4020	Standpipes	\$0.00	S.F.	0	30				0.00 %	0.00 %				\$0
D5010	Electrical Service/Distribution	\$1.73	S.F.	50,889	40	1961	2001		0.00 %	110.00 %	-14		\$96,842.00	\$88,038
D5020	Branch Wiring	\$5.56	S.F.	50,889	30	1950	1980		0.00 %	110.00 %	-35		\$311,237.00	\$282,943
D5020	Lighting	\$8.36	S.F.	50,889	30	1995	2025		33.33 %	0.00 %	10			\$425,432
D5030	Communications and Security - Fire Alarm	\$0.77	S.F.	50,889	10	2010	2020		50.00 %	0.00 %	5			\$39,185
D5030	Communications and Security - PA & Clock Systems	\$4.82	S.F.	50,889	10	2010	2020		50.00 %	0.00 %	5			\$245,285
D5030	Communications and Security - Security & CCTV	\$1.16	S.F.	50,889	10	2010	2020		50.00 %	0.00 %	5			\$59,031
D5090	Other Electrical Systems - Emergency Generator	\$0.26	S.F.	50,889	20	2010	2030		75.00 %	0.00 %	15			\$13,231
E1010	Commercial Equipment	\$0.00	S.F.	0	20	1950	1970		0.00 %	0.00 %	-45			\$0
E1020	Institutional Equipment	\$7.89	S.F.	50,889	20	2000	2020		25.00 %	0.00 %	5			\$401,514
E1090	Other Equipment - Kitchen Equipment	\$2.24	S.F.	50,889	20	1961	1981		0.00 %	110.00 %	-34		\$125,391.00	\$113,991
E2010	Fixed Furnishings	\$9.18	S.F.	50,889	20	1950	1970		0.00 %	110.00 %	-45		\$513,877.00	\$467,161
F1010	Special Structures - Canopies	\$0.00	S.F.	0	20	1950	1970		0.00 %	0.00 %	-45			\$0
								Total	26.19 %	40.95 %			\$5,458,239.00	\$13,329,726

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$5,458,239	\$0	\$0	\$51,994	\$0	\$1,523,579	\$0	\$0	\$0	\$1,352,673	\$716,035	\$9,102,520
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1020 - Special Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1010 - Floor Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2020 - Exterior Windows	\$625,833	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$625,833
B2030 - Exterior Doors	\$36,945	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$36,945
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Asphal Shingles	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - BUR	\$1,158,743	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,158,743
B3010 - Roof Coverings - EPDM	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Preformed Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3020 - Roof Openings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

School Assessment Report - 1950 Bldg, 1953, 1961 Additions

C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$347,063	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$347,063
C20 - Stairs	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* C2010 - Stair Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic & Glazed	\$0	\$0	\$0	\$0	\$0	\$266,589	\$0	\$0	\$0	\$0	\$0	\$266,589
C3010 - Wall Finishes - Paint	\$64,822	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$87,115	\$151,937
C3010 - Wall Finishes - Wall Coverings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Carpet	\$0	\$0	\$0	\$51,994	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$51,994
C3020 - Floor Finishes - Ceramic & Quarry Tile	\$81,114	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$81,114
C3020 - Floor Finishes - Terrazzo	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - VCT	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Wood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D10 - Conveying	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D1010 - Elevators and Lifts	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$988,570	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$988,570
D2020 - Domestic Water Distribution	\$213,276	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$213,276
D2030 - Sanitary Waste	\$268,694	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$268,694
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2090 - Other Plumbing Systems - Acid Waste	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2090 - Other Plumbing Systems - Natural Gas	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3020 - Heat Generating Systems	\$254,699	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$254,699
D3030 - Cooling Generating Systems	\$0	\$0	\$0	\$0	\$0	\$306,947	\$0	\$0	\$0	\$0	\$0	\$306,947
D3040 - Distribution Systems & Exhaust Systems	\$329,150	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$329,150
D3050 - Terminal & Package Units	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,352,673	\$0	\$1,352,673
D3060 - Controls & Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3090 - Other HVAC Systems/Equip - Kitchen Hood	\$41,983	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$41,983


School Assessment Report - 1950 Bldg, 1953, 1961 Additions

			امم	اء	20			ا م			ا م	20
D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D4010 - Sprinklers	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D4020 - Standpipes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$96,842	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$96,842
D5020 - Branch Wiring	\$311,237	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$311,237
D5020 - Lighting	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$628,919	\$628,919
D5030 - Communications and Security - Fire Alarm	\$0	\$0	\$0	\$0	\$0	\$49,968	\$0	\$0	\$0	\$0	\$0	\$49,968
D5030 - Communications and Security - PA & Clock Systems	\$0	\$0	\$0	\$0	\$0	\$312,787	\$0	\$0	\$0	\$0	\$0	\$312,787
D5030 - Communications and Security - Security & CCTV	\$0	\$0	\$0	\$0	\$0	\$75,276	\$0	\$0	\$0	\$0	\$0	\$75,276
D5090 - Other Electrical Systems - Emergency Generator	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E - Equipment & Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E10 - Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1010 - Commercial Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1020 - Institutional Equipment	\$0	\$0	\$0	\$0	\$0	\$512,012	\$0	\$0	\$0	\$0	\$0	\$512,012
E1090 - Other Equipment - Kitchen Equipment	\$125,391	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$125,391
E20 - Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E2010 - Fixed Furnishings	\$513,877	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$513,877
F - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F10 - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F1010 - Special Structures - Canopies	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

^{*} Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

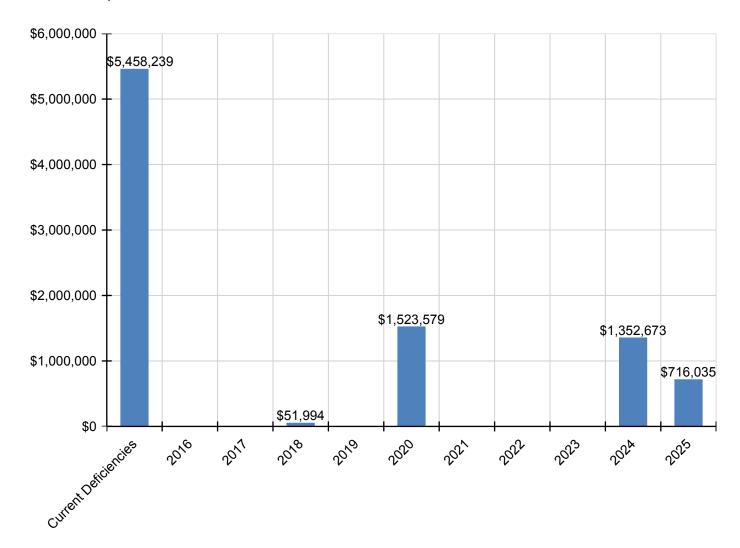

Deficiency Summary by System


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

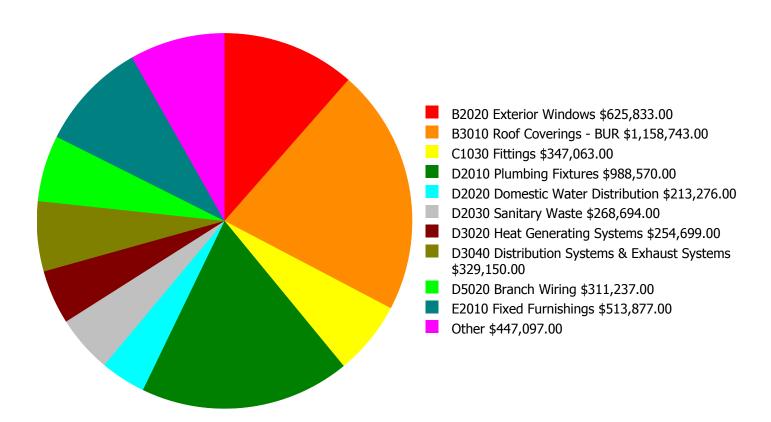

Budget Estimate Total: \$5,458,239.00

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

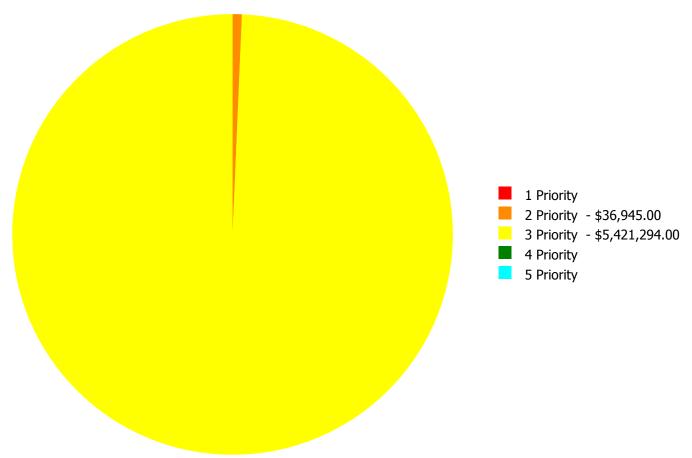

Budget Estimate Total: \$5,458,239.00

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards..
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System							
Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
B2020	Exterior Windows	\$0.00	\$0.00	\$625,833.00	\$0.00	\$0.00	\$625,833.00
B2030	Exterior Doors	\$0.00	\$36,945.00	\$0.00	\$0.00	\$0.00	\$36,945.00
B3010	Roof Coverings - BUR	\$0.00	\$0.00	\$1,158,743.00	\$0.00	\$0.00	\$1,158,743.00
C1030	Fittings	\$0.00	\$0.00	\$347,063.00	\$0.00	\$0.00	\$347,063.00
C3010	Wall Finishes - Paint	\$0.00	\$0.00	\$64,822.00	\$0.00	\$0.00	\$64,822.00
C3020	Floor Finishes - Ceramic & Quarry Tile	\$0.00	\$0.00	\$81,114.00	\$0.00	\$0.00	\$81,114.00
D2010	Plumbing Fixtures	\$0.00	\$0.00	\$988,570.00	\$0.00	\$0.00	\$988,570.00
D2020	Domestic Water Distribution	\$0.00	\$0.00	\$213,276.00	\$0.00	\$0.00	\$213,276.00
D2030	Sanitary Waste	\$0.00	\$0.00	\$268,694.00	\$0.00	\$0.00	\$268,694.00
D3020	Heat Generating Systems	\$0.00	\$0.00	\$254,699.00	\$0.00	\$0.00	\$254,699.00
D3040	Distribution Systems & Exhaust Systems	\$0.00	\$0.00	\$329,150.00	\$0.00	\$0.00	\$329,150.00
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$0.00	\$0.00	\$41,983.00	\$0.00	\$0.00	\$41,983.00
D5010	Electrical Service/Distribution	\$0.00	\$0.00	\$96,842.00	\$0.00	\$0.00	\$96,842.00
D5020	Branch Wiring	\$0.00	\$0.00	\$311,237.00	\$0.00	\$0.00	\$311,237.00
E1090	Other Equipment - Kitchen Equipment	\$0.00	\$0.00	\$125,391.00	\$0.00	\$0.00	\$125,391.00
E2010	Fixed Furnishings	\$0.00	\$0.00	\$513,877.00	\$0.00	\$0.00	\$513,877.00
	Total:	\$0.00	\$36,945.00	\$5,421,294.00	\$0.00	\$0.00	\$5,458,239.00

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

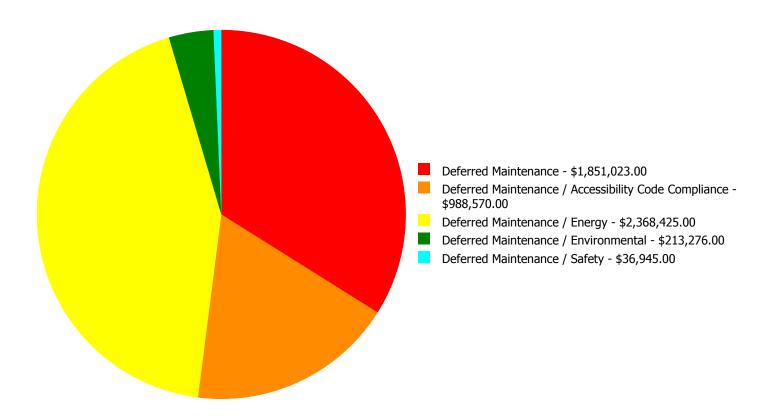

Budget Estimate Total: \$5,458,239.00

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 2 Priority:

System: B2030 - Exterior Doors



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Safety

Priority: 2 Priority

Correction: Renew System

Qty: 50,889.00

Unit of Measure: S.F.

Estimate: \$36,945.00

Assessor Name: Sam Mandola

Date Created: 04/11/2015

Notes: Exterior doors are beyond their expected service life, do not lock/seal properly, and should be replaced.

Priority 3 Priority:

System: B2020 - Exterior Windows



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 50,889.00

Unit of Measure: S.F.

Estimate: \$625,833.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The exterior window system is beyond its expected service life, not energy efficient, and should be replaced. Windows in classroom 401 leak when it rains.

System: B3010 - Roof Coverings - BUR



Location: Roof

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 50,889.00

Unit of Measure: S.F.

Estimate: \$1,158,743.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The roof covering and rainwater systems are beyond their expected service life and should be replaced.

System: C1030 - Fittings



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 50,889.00

Unit of Measure: S.F.


Estimate: \$347,063.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Fittings, such as toilet partitions, handrails, signage and lockers, are beyond their expected service life and should be replaced.

System: C3010 - Wall Finishes - Paint

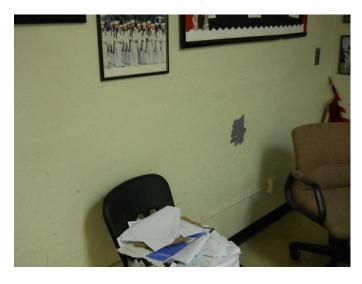

Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 30,533.00

Unit of Measure: S.F.

Estimate: \$64,822.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The painted wall finishes are beyond their expected service life and should be replaced.

System: C3020 - Floor Finishes - Ceramic & Quarry Tile



Location: Kitchen and Restrooms

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 5,089.00

Unit of Measure: S.F.

Estimate: \$81,114.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The tile floor covering is beyond its expected service life and should be replaced.

System: D2010 - Plumbing Fixtures



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code

Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 50,889.00

Unit of Measure: S.F.

Estimate: \$988,570.00

Assessor Name: Sam Mandola

Date Created: 04/11/2015

Notes: The plumbing fixtures are beyond their expected service life and should be replaced to improve ADA accessibility. SPLOST IV project 410-422 to replace plumbing fixtures as needed throughout the building.

System: D2020 - Domestic Water Distribution



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Environmental

Priority: 3 Priority

Correction: Renew System

Qty: 50,889.00

Unit of Measure: S.F.

Estimate: \$213,276.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The domestic water distribution system is beyond its expected service life, has water quality issues, and should be scheduled for replacement. SPLOST project 410-422 to replace the interior building domestic water piping mains in the 1950, 1953, 1961 and 1965 buildings.

System: D2030 - Sanitary Waste



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 50,889.00

Unit of Measure: S.F.

Estimate: \$268,694.00

Assessor Name: Sam Mandola

Date Created: 04/11/2015

Notes: The sanitary waste system is beyond its expected service life and should be scheduled for replacement. The cafeteria has issues with ventilation (foul smells) that should be addressed.

System: D3020 - Heat Generating Systems



Location: Mechanical Room

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 50,889.00

Unit of Measure: S.F.

Estimate: \$254,699.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The heat generating system is beyond its expected service life, inefficient, and should be scheduled for replacement.

System: D3040 - Distribution Systems & Exhaust Systems



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 50,889.00

Unit of Measure: S.F.

Estimate: \$329,150.00

Assessor Name: Sam Mandola

Date Created: 04/11/2015

Notes: The distribution and exhaust systems are beyond their expected service life and should be scheduled for replacement. The cafeteria has issues with ventilation that should be addressed.

System: D3090 - Other HVAC Systems/Equip - Kitchen Hood



Location: Kitchen

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 50,889.00

Unit of Measure: S.F.

Estimate: \$41,983.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The kitchen hood system is beyond its expected service life and should be scheduled for replacement.

System: D5010 - Electrical Service/Distribution



Location: Main Switch Room/Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 50,889.00

Unit of Measure: S.F.

Estimate: \$96,842.00

Assessor Name: Ben Nixon

Date Created: 06/15/2015

Notes: The electrical service/distribution system is beyond its expected service life and should be scheduled for replacement.

System: D5020 - Branch Wiring



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 50,889.00

Unit of Measure: S.F.

Estimate: \$311,237.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The branch wiring system is beyond its expected service life and should be scheduled for replacement.

System: E1090 - Other Equipment - Kitchen Equipment



Location: Kitchen

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 50,889.00

Unit of Measure: S.F.

Estimate: \$125,391.00

Assessor Name: Ben Nixon

Date Created: 12/16/2015

Notes: Kitchen equipment is beyond its expected service life and should be scheduled for replacement.

System: E2010 - Fixed Furnishings



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 50,889.00

Unit of Measure: S.F.

Estimate: \$513,877.00

Assessor Name: Ben Nixon

Date Created: 06/15/2015

Notes: Fixed furnishings are beyond their expected service life and should be scheduled for replacement.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The Repair Cost (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. Facility Condition Index (FCI) is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term FCA Score is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	High School
Gross Area (SF):	300
Year Built:	1965
Last Renovation:	
Replacement Value:	\$26,427
Repair Cost:	\$7,023.00
Total FCI:	26.58 %
Total RSLI:	37.92 %
FCA Score:	73.42



Description:

The football storage building at Druid Hills High School is located at 1798 Haywood Drive NE in Atlanta, Georgia. Originally built in 1965, there have been no additions and no major renovations. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:		
Building Codes:	Fire Sprinkler System:	No

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	50.00 %	0.00 %	\$0.00
A20 - Basement Construction	50.00 %	0.00 %	\$0.00
B10 - Superstructure	50.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	44.80 %	11.45 %	\$1,482.00
B30 - Roofing	0.00 %	110.01 %	\$5,541.00
C10 - Interior Construction	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	0.00 %	0.00 %	\$0.00
D20 - Plumbing	0.00 %	0.00 %	\$0.00
D50 - Electrical	0.00 %	0.00 %	\$0.00
Totals:	37.92 %	26.58 %	\$7,023.00

Photo Album

The photo album consists of the various cardinal directions of the building.

1). South Elevation - Jun 15, 2015







3). North Elevation - Jun 15, 2015



4). West Elevation - Jun 15, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

- 1. System Code: A code that identifies the system.
- 2. System Description: A brief description of a system present in the building.
- 3. Unit Price \$: The unit price of the system.
- 4. UoM: The unit of measure of the system.
- 5. Qty: The quantity for the system.
- 6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
- 7. Year Installed: The date of system installation.
- 8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
- 9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
- 10. RSLI: The Remaining Service Life Index of the system.
- 11. FCI: The Facility Condition Index of the system.
- 12. RSL: Remaining Service Life in years.
- 13. eCR: eCOMET Condition Rating (not used in this assessment).
- 14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
- 15. Replacement Value \$: The replacement cost of the system.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$4.49	S.F.	300	100	1965	2065		50.00 %	0.00 %	50			\$1,347
A1030	Slab on Grade	\$3.60	S.F.	300	100	1965	2065		50.00 %	0.00 %	50			\$1,080
A2010	Basement Excavation	\$0.22	S.F.	300	100	1965	2065		50.00 %	0.00 %	50			\$66
A2020	Basement Walls	\$3.52	S.F.	300	100	1965	2065		50.00 %	0.00 %	50			\$1,056
B1020	Roof Construction	\$16.33	S.F.	300	100	1965	2065		50.00 %	0.00 %	50			\$4,899
B2010	Exterior Walls	\$38.65	S.F.	300	100	1965	2065		50.00 %	0.00 %	50			\$11,595
B2020	Exterior Windows	\$0.00	S.F.	300	30	1965	1995		0.00 %	0.00 %	-20			\$0
B2030	Exterior Doors	\$4.49	S.F.	300	30	1965	1995		0.00 %	110.02 %	-20		\$1,482.00	\$1,347
B3010	Roof Coverings	\$16.79	S.F.	300	20	1965	1985		0.00 %	110.01 %	-30		\$5,541.00	\$5,037
C1010	Partitions	\$0.00	S.F.	300	40	1965	2005		0.00 %	0.00 %	-10			\$0
C1020	Interior Doors	\$0.00	S.F.	300	30	1965	1995		0.00 %	0.00 %	-20			\$0
C1030	Fittings	\$0.00	S.F.	300	20	1965	1985		0.00 %	0.00 %	-30			\$0
C3010	Wall Finishes	\$0.00	S.F.	300	20	1965	1985		0.00 %	0.00 %	-30			\$0
C3020	Floor Finishes	\$0.00	S.F.	300	20	1965	1985		0.00 %	0.00 %	-30			\$0
C3030	Ceiling Finishes	\$0.00	S.F.	300	20	1965	1985		0.00 %	0.00 %	-30			\$0
D2040	Rain Water Drainage	\$0.00	S.F.	300	30	1965	1995		0.00 %	0.00 %	-20			\$0
D5010	Electrical Service/Distribution	\$0.00	S.F.	300	30	1965	1995		0.00 %	0.00 %	-20			\$0
D5020	Lighting and Branch Wiring	\$0.00	S.F.	300	30	1965	1995		0.00 %	0.00 %	-20			\$0
								Total	37.92 %	26.58 %			\$7,023.00	\$26,427

School Assessment Report - 1965 Football Storage

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.


Inflation Rate: 3%

School Assessment Report - 1965 Football Storage

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$7,023	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$7,023
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2020 - Exterior Windows	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$1,482	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,482
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings	\$5,541	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$5,541
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting and Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

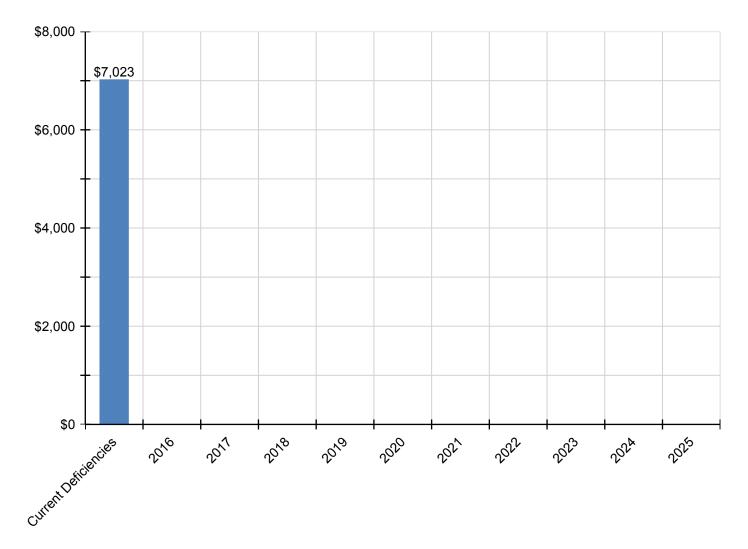


Deficiency Summary by System

Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

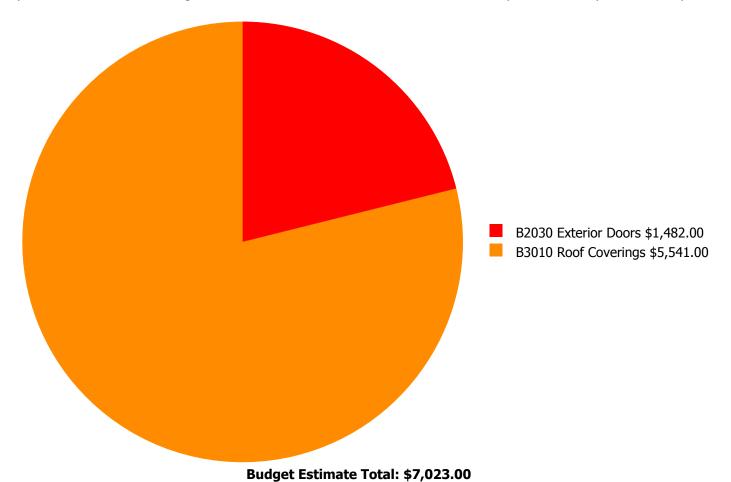

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

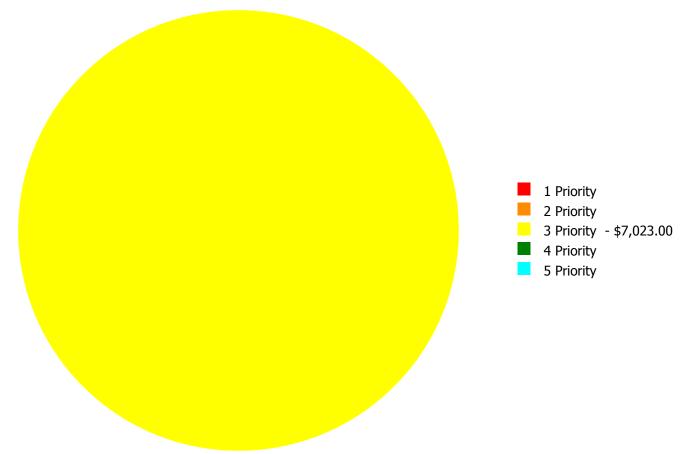

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards..
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
B2030	Exterior Doors	\$0.00	\$0.00	\$1,482.00	\$0.00	\$0.00	\$1,482.00
B3010	Roof Coverings	\$0.00	\$0.00	\$5,541.00	\$0.00	\$0.00	\$5,541.00
	Total:	\$0.00	\$0.00	\$7,023.00	\$0.00	\$0.00	\$7,023.00

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

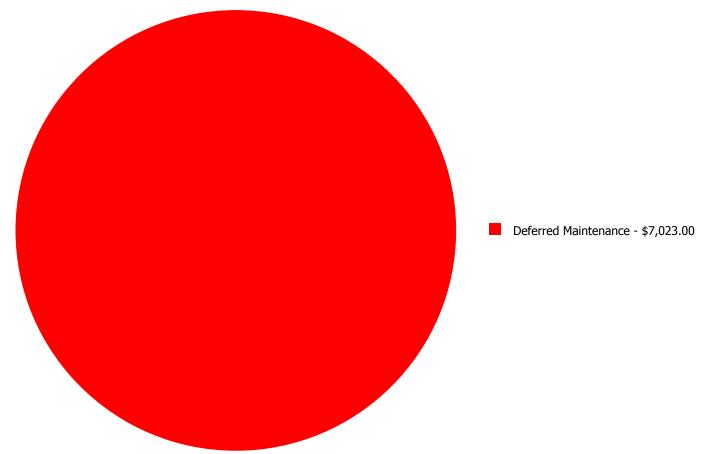

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 3 Priority:

System: B2030 - Exterior Doors



Location: Exterior Walls

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 300.00

Unit of Measure: S.F.

Estimate: \$1,482.00

Assessor Name: Dave Cunningham

Date Created: 04/11/2015

Notes: The exterior doors are beyond their expected service life and should be replaced.

System: B3010 - Roof Coverings



Location: Roof

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 300.00

Unit of Measure: S.F.

Estimate: \$5,541.00

Assessor Name: Dave Cunningham

Date Created: 04/11/2015

Notes: The roof covering is beyond expected service life and should be replaced.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The Repair Cost (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. Facility Condition Index (FCI) is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term FCA Score is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	High School
Gross Area (SF):	120
Year Built:	1985
Last Renovation:	
Replacement Value:	\$8,358
Repair Cost:	\$375.00
Total FCI:	4.49 %
Total RSLI:	67.15 %
FCA Score:	95.51



Description:

The softball storage building at Druid Hills High School is located at 1798 Haywood Drive NE in Atlanta, Georgia. Originally built in 1965, there have been no additions and no major renovations. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

Accidacco		
General Attributes:		
Building Codes:	Fire Sprinkler System:	No

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	70.00 %	0.00 %	\$0.00
A20 - Basement Construction	70.00 %	0.00 %	\$0.00
B10 - Superstructure	70.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	65.21 %	7.53 %	\$375.00
B30 - Roofing	0.00 %	0.00 %	\$0.00
C10 - Interior Construction	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	0.00 %	0.00 %	\$0.00
D20 - Plumbing	0.00 %	0.00 %	\$0.00
D50 - Electrical	0.00 %	0.00 %	\$0.00
Totals:	67.14 %	4.49 %	\$375.00

Photo Album

The photo album consists of the various cardinal directions of the building.

1). East Elevation - Jun 15, 2015



2). North Elevation - Jun 15, 2015



3). West Elevation - Jun 15, 2015



4). South Elevation - Jun 15, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

- 1. System Code: A code that identifies the system.
- 2. System Description: A brief description of a system present in the building.
- 3. Unit Price \$: The unit price of the system.
- 4. UoM: The unit of measure of the system.
- 5. Qty: The quantity for the system.
- 6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
- 7. Year Installed: The date of system installation.
- 8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
- 9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
- 10. RSLI: The Remaining Service Life Index of the system.
- 11. FCI: The Facility Condition Index of the system.
- 12. RSL: Remaining Service Life in years.
- 13. eCR: eCOMET Condition Rating (not used in this assessment).
- 14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
- 15. Replacement Value \$: The replacement cost of the system.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$4.49	S.F.	120	100	1985	2085		70.00 %	0.00 %	70			\$539
A1030	Slab on Grade	\$3.60	S.F.	120	100	1985	2085		70.00 %	0.00 %	70			\$432
A2010	Basement Excavation	\$0.22	S.F.	120	100	1985	2085		70.00 %	0.00 %	70			\$26
A2020	Basement Walls	\$3.52	S.F.	120	100	1985	2085		70.00 %	0.00 %	70			\$422
B1020	Roof Construction	\$16.33	S.F.	120	100	1985	2085		70.00 %	0.00 %	70			\$1,960
B2010	Exterior Walls	\$38.65	S.F.	120	100	1985	2085		70.00 %	0.00 %	70			\$4,638
B2020	Exterior Windows	\$0.00	S.F.		0				0.00 %	0.00 %				\$0
B2030	Exterior Doors	\$2.84	S.F.	120	30	1985	2015		0.00 %	109.97 %	0		\$375.00	\$341
B3010	Roof Coverings	\$16.79	S.F.	0	20	1985	2005		0.00 %	0.00 %	-10			\$0
C1010	Partitions	\$0.00	S.F.	120	40	1985	2025		25.00 %	0.00 %	10			\$0
C1020	Interior Doors	\$0.00	S.F.	120	30	1985	2015		0.00 %	0.00 %	0			\$0
C1030	Fittings	\$0.00	S.F.	120	20	1985	2005		0.00 %	0.00 %	-10			\$0
C3010	Wall Finishes	\$0.00	S.F.	120	20	1985	2005		0.00 %	0.00 %	-10			\$0
C3020	Floor Finishes	\$0.00	S.F.	120	20	1985	2005		0.00 %	0.00 %	-10			\$0
C3030	Ceiling Finishes	\$0.00	S.F.	120	20	1985	2005		0.00 %	0.00 %	-10			\$0
D2040	Rain Water Drainage	\$0.00	S.F.	120	30	1985	2015		0.00 %	0.00 %	0			\$0
D5010	Electrical Service/Distribution	\$0.00	S.F.		0				0.00 %	0.00 %				\$0
D5020	Lighting and Branch Wiring	\$0.00	S.F.		0				0.00 %	0.00 %				\$0
Total									67.14 %	4.49 %		·	\$375.00	\$8,358

School Assessment Report - 1985 Softball Storage

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.


Inflation Rate: 3%

School Assessment Report - 1985 Softball Storage

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$375	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$375
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2020 - Exterior Windows	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$375	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$375
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting and Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

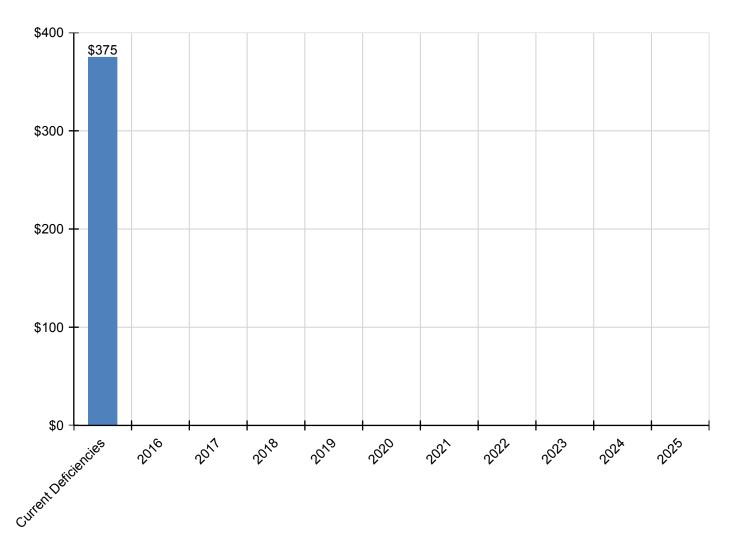


Deficiency Summary by System

Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

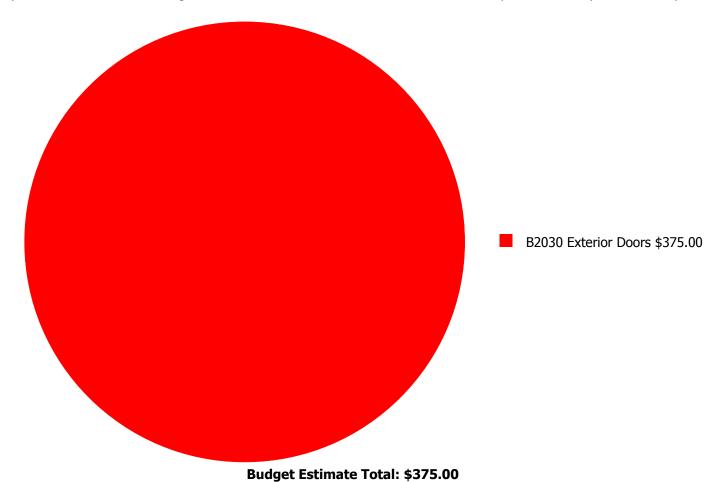

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

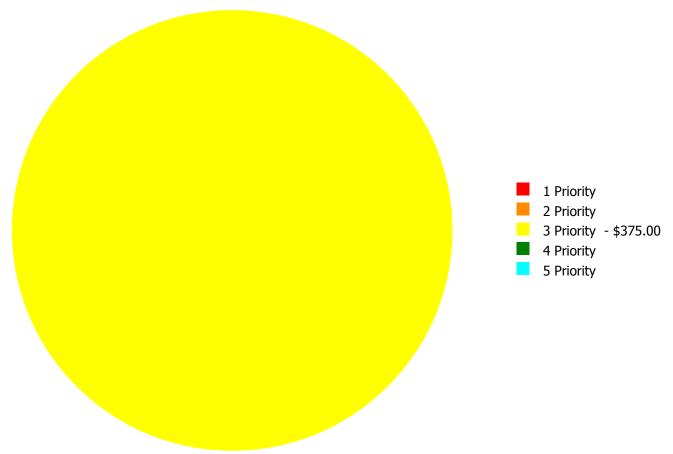

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards..
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

	System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
	B2030	Exterior Doors	\$0.00	\$0.00	\$375.00	\$0.00	\$0.00	\$375.00
ĺ		Total:	\$0.00	\$0.00	\$375.00	\$0.00	\$0.00	\$375.00

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

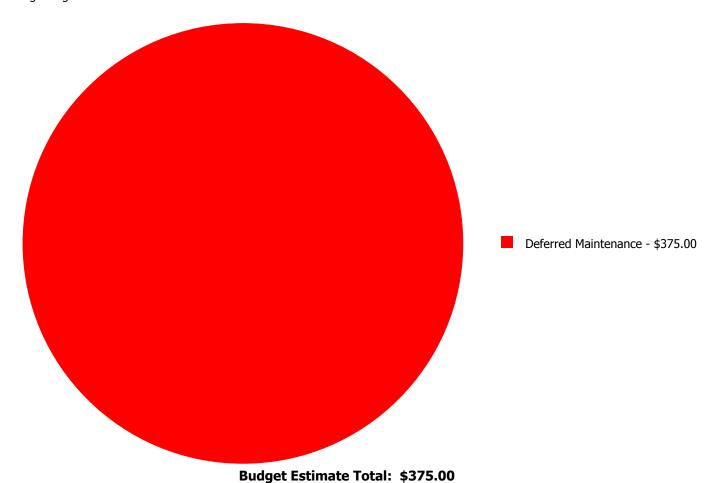

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 3 Priority:

System: B2030 - Exterior Doors



Location: Exterior Wall

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 120.00

Unit of Measure: S.F.

Estimate: \$375.00

Assessor Name: Sam Mandola

Date Created: 04/11/2015

Notes: The exterior doors are beyond their expected service life and should be scheduled for replacement.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The Repair Cost (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. Facility Condition Index (FCI) is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term FCA Score is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	High School
Gross Area (SF):	31,140
Year Built:	2010
Last Renovation:	
Replacement Value:	\$7,344,901
Repair Cost:	\$0.00
Total FCI:	0.00 %
Total RSLI:	82.10 %



Description:

FCA Score:

The 2010 classroom addition at Druid Hills High School is a two-story building located at 1798 Haygood Drive NE in Atlanta, Georgia. There have been no additions and no major renovations. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

100.00

Attributes:

General Attributes:			
Building Codes:	5040	Fire Sprinkler System:	Yes

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	95.00 %	0.00 %	\$0.00
A20 - Basement Construction	0.00 %	0.00 %	\$0.00
B10 - Superstructure	95.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	89.98 %	0.00 %	\$0.00
B30 - Roofing	80.02 %	0.00 %	\$0.00
C10 - Interior Construction	88.85 %	0.00 %	\$0.00
C20 - Stairs	95.00 %	0.00 %	\$0.00
C30 - Interior Finishes	72.98 %	0.00 %	\$0.00
D10 - Conveying	83.33 %	0.00 %	\$0.00
D20 - Plumbing	78.17 %	0.00 %	\$0.00
D30 - HVAC	72.18 %	0.00 %	\$0.00
D40 - Fire Protection	83.33 %	0.00 %	\$0.00
D50 - Electrical	73.31 %	0.00 %	\$0.00
E10 - Equipment	75.00 %	0.00 %	\$0.00
E20 - Furnishings	75.00 %	0.00 %	\$0.00
F10 - Special Construction	0.00 %	0.00 %	\$0.00
Totals:	82.10 %	0.00 %	\$0.00

Photo Album

The photo album consists of the various cardinal directions of the building.

1). South Elevation - Jun 15, 2015



2). West Elevation - Jun 15, 2015



3). East Elevation - Jun 15, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

- 1. System Code: A code that identifies the system.
- 2. System Description: A brief description of a system present in the building.
- 3. Unit Price \$: The unit price of the system.
- 4. UoM: The unit of measure of the system.
- 5. Qty: The quantity for the system.
- 6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
- 7. Year Installed: The date of system installation.
- 8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
- 9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
- 10. RSLI: The Remaining Service Life Index of the system.
- 11. FCI: The Facility Condition Index of the system.
- 12. RSL: Remaining Service Life in years.
- 13. eCR: eCOMET Condition Rating (not used in this assessment).
- 14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
- 15. Replacement Value \$: The replacement cost of the system.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System						Year	Calc Next Renewal	Next Renewal						Replacement
Code	System Description	Unit Price \$	UoM	Qty	Life	Installed	Year	Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Value \$
A1010	Standard Foundations	\$3.51	S.F.	31,140	100	2010	2110		95.00 %	0.00 %	95			\$109,301
A1020	Special Foundations	\$4.36	S.F.	31,140	100	2010	2110		95.00 %	0.00 %	95			\$135,770
A1030	Slab on Grade	\$3.56	S.F.	31,140	100	2010	2110		95.00 %	0.00 %	95			\$110,858
A2010	Basement Excavation	\$0.14	S.F.		100				0.00 %	0.00 %				\$0
A2020	Basement Walls	\$1.64	S.F.		100				0.00 %	0.00 %				\$0
B1010	Floor Construction	\$15.61	S.F.	31,140	100	2010	2110		95.00 %	0.00 %	95			\$486,095
B1020	Roof Construction	\$11.74	S.F.	31,140	100	2010	2110		95.00 %	0.00 %	95			\$365,584
B2010	Exterior Walls	\$15.69	S.F.	31,140	100	2010	2110		95.00 %	0.00 %	95			\$488,587
B2020	Exterior Windows	\$11.18	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$348,145
B2030	Exterior Doors	\$0.66	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$20,552
B3010	Roof Coverings - Asphal Shingles	\$0.00	S.F.		10				0.00 %	0.00 %				\$0
B3010	Roof Coverings - BUR	\$20.70	S.F.	15,570	25	2010	2035		80.00 %	0.00 %	20			\$322,299
B3010	Roof Coverings - EPDM	\$0.00	S.F.		15				0.00 %	0.00 %				\$0
B3010	Roof Coverings - Preformed Metal	\$0.00	S.F.		30				0.00 %	0.00 %				\$0
B3010	Roof Coverings - Standing Seam Metal	\$0.00	S.F.		75				0.00 %	0.00 %				\$0
B3020	Roof Openings	\$0.07	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$2,180
C1010	Partitions	\$19.44	S.F.	31,140	100	2010	2110		95.00 %	0.00 %	95			\$605,362
C1020	Interior Doors	\$6.11	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$190,265
C1030	Fittings	\$6.20	S.F.	31,140	20	2010	2030		75.00 %	0.00 %	15			\$193,068
C2010	Stair Construction	\$2.21	S.F.	31,140	100	2010	2110		95.00 %	0.00 %	95			\$68,819
C3010	Wall Finishes - Ceramic & Glazed	\$10.27	S.F.	1,000	30	2010	2040		83.33 %	0.00 %	25			\$10,270
C3010	Wall Finishes - Paint	\$1.93	S.F.	30,140	10	2010	2020		50.00 %	0.00 %	5			\$58,170
C3010	Wall Finishes - Wall Coverings	\$0.00	S.F.		10				0.00 %	0.00 %				\$0
C3020	Floor Finishes - Carpet	\$0.00	S.F.		8				0.00 %	0.00 %				\$0
C3020	Floor Finishes - Ceramic & Quarry Tile	\$0.00	S.F.		50				0.00 %	0.00 %				\$0
C3020	Floor Finishes - Terrazzo	\$0.00	S.F.		50				0.00 %	0.00 %				\$0
C3020	Floor Finishes - VCT	\$9.54	S.F.	31,140	20	2010	2030		75.00 %	0.00 %	15			\$297,076
C3020	Floor Finishes - Wood	\$0.00	S.F.		0				0.00 %	0.00 %				\$0
C3030	Ceiling Finishes	\$9.98	S.F.	31,140	20	2010	2030		75.00 %	0.00 %	15			\$310,777
D1010	Elevators and Lifts	\$0.86	S.F.	31,117	30	2010	2040		83.33 %	0.00 %	25			\$26,761
D2010	Plumbing Fixtures	\$17.66	S.F.	31,140	20	2010	2030		75.00 %	0.00 %	15			\$549,932
D2020	Domestic Water Distribution	\$3.81	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$118,643
D2030	Sanitary Waste	\$4.80	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$149,472
D2040	Rain Water Drainage	\$0.92	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$28,649

School Assessment Report - 2010 Addition

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed		Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
D2090	Other Plumbing Systems - Acid Waste	\$0.54	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$16,816
D2090	Other Plumbing Systems - Natural Gas	\$0.77	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$23,978
D3020	Heat Generating Systems	\$0.00	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$0
D3030	Cooling Generating Systems	\$4.73	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$147,292
D3040	Distribution Systems & Exhaust Systems	\$5.88	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$183,103
D3050	Terminal & Package Units	\$23.10	S.F.	31,140	15	2010	2025		66.67 %	0.00 %	10			\$719,334
D3060	Controls & Instrumentation	\$3.19	S.F.	31,140	20	2010	2030		75.00 %	0.00 %	15			\$99,337
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$0.00	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$0
D4010	Sprinklers	\$4.13	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$128,608
D4020	Standpipes	\$0.47	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$14,636
D5010	Electrical Service/Distribution	\$1.73	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$53,872
D5020	Branch Wiring	\$5.56	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$173,138
D5020	Lighting	\$8.36	S.F.	31,140	30	2010	2040		83.33 %	0.00 %	25			\$260,330
D5030	Communications and Security - Fire Alarm	\$0.77	S.F.	31,140	10	2010	2020		50.00 %	0.00 %	5			\$23,978
D5030	Communications and Security - PA & Clock Systems	\$4.82	S.F.	31,140	10	2010	2020		50.00 %	0.00 %	5			\$150,095
D5030	Communications and Security - Security & CCTV	\$1.16	S.F.	31,140	10	2010	2020		50.00 %	0.00 %	5			\$36,122
D5090	Other Electrical Systems - Wall Packs	\$0.26	S.F.	31,140	20	2010	2030		75.00 %	0.00 %	15			\$8,096
E1010	Commercial Equipment	\$0.00	S.F.	31,140	20				0.00 %	0.00 %				\$0
E1020	Institutional Equipment	\$0.76	S.F.	31,140	20	2010	2030		75.00 %	0.00 %	15			\$23,666
E1090	Other Equipment (Sports Equipment)	\$0.00	S.F.		0				0.00 %	0.00 %				\$0
E2010	Fixed Furnishings	\$9.18	S.F.	31,140	20	2010	2030		75.00 %	0.00 %	15			\$285,865
F1010	Special Structures - Canopies	\$2.62	S.F.		0				0.00 %	0.00 %				\$0
	•	•				•	-	Total	82.10 %					\$7,344,901

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$0	\$0	\$0	\$0	\$0	\$342,220	\$0	\$0	\$0	\$0	\$1,063,397	\$1,405,617
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1020 - Special Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1010 - Floor Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2020 - Exterior Windows	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Asphal Shingles	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - BUR	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - EPDM	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Preformed Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3020 - Roof Openings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

School Assessment Report - 2010 Addition

C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C20 - Stairs	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* C2010 - Stair Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic & Glazed	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Paint	\$0	\$0	\$0	\$0	\$0	\$74,178	\$0	\$0	\$0	\$0	\$0	\$74,178
C3010 - Wall Finishes - Wall Coverings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Carpet	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Ceramic & Quarry Tile	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Terrazzo	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - VCT	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Wood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D10 - Conveying	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D1010 - Elevators and Lifts	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2020 - Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2030 - Sanitary Waste	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2090 - Other Plumbing Systems - Acid Waste	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2090 - Other Plumbing Systems - Natural Gas	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3020 - Heat Generating Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3030 - Cooling Generating Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3040 - Distribution Systems & Exhaust Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3050 - Terminal & Package Units	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,063,397	\$1,063,397
D3060 - Controls & Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3090 - Other HVAC Systems/Equip - Kitchen Hood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


School Assessment Report - 2010 Addition

D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D4010 - Sprinklers	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D4020 - Standpipes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5030 - Communications and Security - Fire Alarm	\$0	\$0	\$0	\$0	\$0	\$30,577	\$0	\$0	\$0	\$0	\$0	\$30,577
D5030 - Communications and Security - PA & Clock Systems	\$0	\$0	\$0	\$0	\$0	\$191,401	\$0	\$0	\$0	\$0	\$0	\$191,401
D5030 - Communications and Security - Security & CCTV	\$0	\$0	\$0	\$0	\$0	\$46,064	\$0	\$0	\$0	\$0	\$0	\$46,064
D5090 - Other Electrical Systems - Wall Packs	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E - Equipment & Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E10 - Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1010 - Commercial Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1020 - Institutional Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1090 - Other Equipment (Sports Equipment)	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E20 - Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E2010 - Fixed Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F10 - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F1010 - Special Structures - Canopies	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

^{*} Indicates non-renewable system

Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

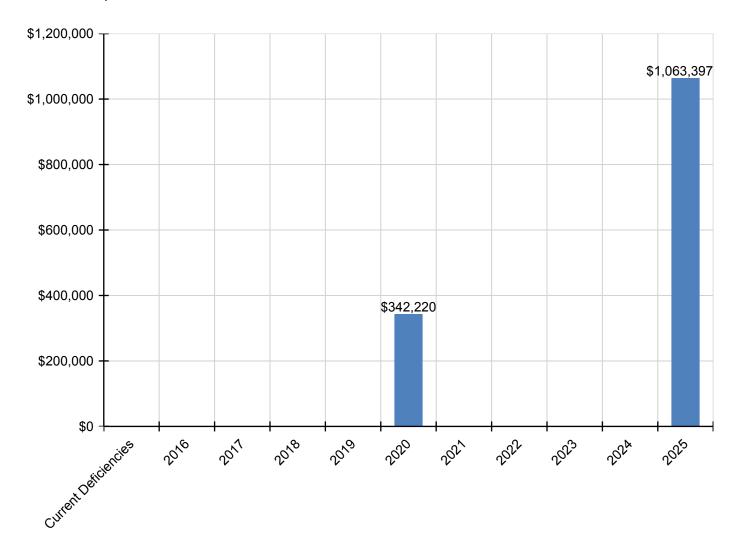

Deficiency Summary by System

Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

Deficiency By Priority Investment Table

The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards..
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The Repair Cost (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. Facility Condition Index (FCI) is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term FCA Score is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

High School

Tunction.	riigii Scriooi
Gross Area (SF):	171,358
Year Built:	1927
Last Renovation:	
Replacement Value:	\$4,173,605
Repair Cost:	\$3,615,769.40
Total FCI:	86.63 %
Total RSLI:	6.49 %
FCA Score:	13.37



Description:

Function:

The Druid Hills High School site was originally constructed in 1927, has a total area of 11.3 acres, and is occupied by approximately 171,358 square feet of permanent building space. Campus site features include paved driveways and parking lots, pedestrian payement, flag pole, landscaping, and fencing. Site mechanical and electrical features include water, sewer, natural gas, and site lighting. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report for the site features.

Attributes:

General Attributes:

1190 Site Code:

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
G20 - Site Improvements	7.53 %	76.89 %	\$1,760,990.41
G30 - Site Mechanical Utilities	0.00 %	110.00 %	\$1,377,889.67
G40 - Site Electrical Utilities	15.63 %	75.62 %	\$476,889.32
Totals:	6.49 %	86.63 %	\$3,615,769.40

Photo Album

The photo album consists of the various cardinal directions of the building.

1). Aerial Image of Druid Hills High School - Oct 22, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

- 1. System Code: A code that identifies the system.
- 2. System Description: A brief description of a system present in the building.
- 3. Unit Price \$: The unit price of the system.
- 4. UoM: The unit of measure of the system.
- 5. Qty: The quantity for the system.
- 6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
- 7. Year Installed: The date of system installation.
- 8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
- 9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
- 10. RSLI: The Remaining Service Life Index of the system.
- 11. FCI: The Facility Condition Index of the system.
- 12. RSL: Remaining Service Life in years.
- 13. eCR: eCOMET Condition Rating (not used in this assessment).
- 14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
- 15. Replacement Value \$: The replacement cost of the system.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
G2010	Roadways	\$5.17	S.F.	43,856	25	1965	1990		0.00 %	110.00 %	-25		\$249,409.07	\$226,736
G2020	Parking Lots	\$4.56	S.F.	25,599	25	1965	1990		0.00 %	110.00 %	-25		\$128,404.58	\$116,731
G2030	Pedestrian Paving	\$1.50	S.F.	171,358	30	1965	1995		0.00 %	110.00 %	-20		\$282,740.70	\$257,037
G2040	Baseball Field	\$8.35	S.F.		20				0.00 %	0.00 %				\$0
G2040	Canopies	\$0.29	S.F.		25	1927	1952		0.00 %	0.00 %	-63			\$0
G2040	Covered Walkways	\$48.72	S.F.	2,600	25	1965	1990		0.00 %	110.00 %	-25		\$139,339.20	\$126,672
G2040	Fencing & Guardrails	\$0.91	S.F.	171,358	30	1927	1957		0.00 %	110.00 %	-58		\$171,529.36	\$155,936
G2040	Football Field	\$5.85	S.F.	72,698	20	1965	1985	2020	25.00 %	0.00 %	5			\$425,283
G2040	Hard Surface Play Area	\$6.26	S.F.		20	1927	1947		0.00 %	0.00 %	-68			\$0
G2040	Playing Field	\$3.92	S.F.		20	1927	1947		0.00 %	0.00 %	-68			\$0
G2040	Soccer/Lacross Field	\$5.00	S.F.		20	1927	1947		0.00 %	0.00 %	-68			\$0
G2040	Softball Field	\$8.86	S.F.	29,819	20	1965	1985	2020	25.00 %	0.00 %	5			\$264,196
G2040	Tennis Courts	\$18.47	S.F.	12,702	20	1965	1985		0.00 %	110.00 %	-30		\$258,066.53	\$234,606
G2040	Track	\$7.04	S.F.	33,340	10	1965	1975		0.00 %	110.00 %	-40		\$258,184.96	\$234,714
G2050	Landscaping	\$1.45	S.F.	171,358	15	2000	2015		0.00 %	110.00 %	0		\$273,316.01	\$248,469
G3010	Water Supply	\$1.83	S.F.	171,358	50	1927	1977		0.00 %	110.00 %	-38		\$344,943.65	\$313,585
G3020	Sanitary Sewer	\$1.15	S.F.	171,358	50	1927	1977		0.00 %	110.00 %	-38		\$216,767.87	\$197,062
G3030	Storm Sewer	\$3.55	S.F.	171,358	50	1927	1977		0.00 %	110.00 %	-38		\$669,152.99	\$608,321
G3060	Fuel Distribution	\$0.78	S.F.	171,358	50	1927	1977		0.00 %	110.00 %	-38		\$147,025.16	\$133,659
G4010	Electrical Distribution	\$1.86	S.F.	171,358	30	1927	1957		0.00 %	110.00 %	-58		\$350,598.47	\$318,726
G4020	Site Lighting	\$1.15	S.F.	171,358	30	2000	2030		50.00 %	0.00 %	15			\$197,062
G4030	Site Communications & Security	\$0.67	S.F.	171,358	30	1927	1957		0.00 %	110.00 %	-58		\$126,290.85	\$114,810
								Total	6.49 %	86.63 %			\$3,615,769.40	\$4,173,605

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.


Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$3,615,769	\$0	\$0	\$0	\$0	\$879,226	\$0	\$0	\$0	\$0	\$346,979	\$4,841,974
G - Building Sitework	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G20 - Site Improvements	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2010 - Roadways	\$249,409	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$249,409
G2020 - Parking Lots	\$128,405	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$128,405
G2030 - Pedestrian Paving	\$282,741	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$282,741
G2040 - Baseball Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Canopies	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Covered Walkways	\$139,339	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$139,339
G2040 - Fencing & Guardrails	\$171,529	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$171,529
G2040 - Football Field	\$0	\$0	\$0	\$0	\$0	\$542,322	\$0	\$0	\$0	\$0	\$0	\$542,322
G2040 - Hard Surface Play Area	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Playing Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Soccer/Lacross Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Softball Field	\$0	\$0	\$0	\$0	\$0	\$336,904	\$0	\$0	\$0	\$0	\$0	\$336,904
G2040 - Tennis Courts	\$258,067	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$258,067
G2040 - Track	\$258,185	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$346,979	\$605,164
G2050 - Landscaping	\$273,316	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$273,316
G30 - Site Mechanical Utilities	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G3010 - Water Supply	\$344,944	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$344,944
G3020 - Sanitary Sewer	\$216,768	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$216,768
G3030 - Storm Sewer	\$669,153	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$669,153
G3060 - Fuel Distribution	\$147,025	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$147,025
G40 - Site Electrical Utilities	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G4010 - Electrical Distribution	\$350,598	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$350,598
G4020 - Site Lighting	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G4030 - Site Communications & Security	\$126,291	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$126,291

^{*} Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

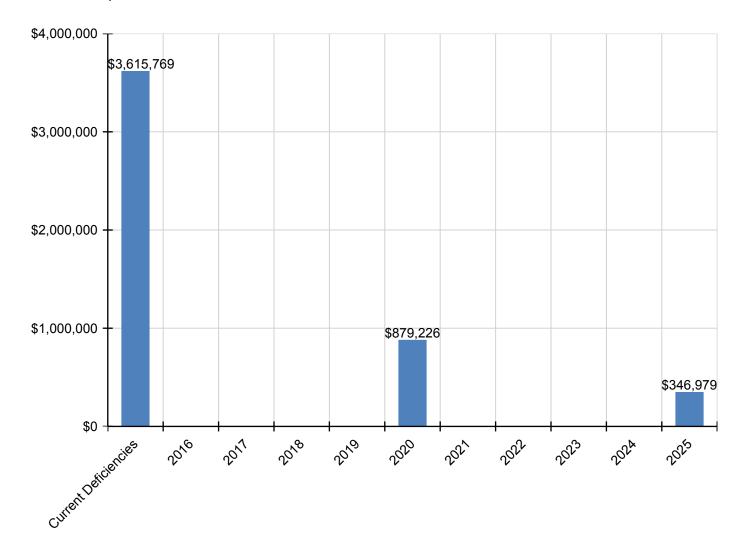

Deficiency Summary by System


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

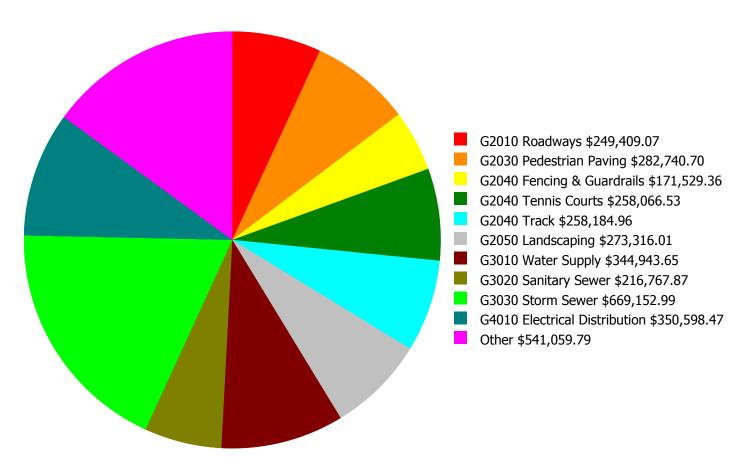

Budget Estimate Total: \$3,615,769.40

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

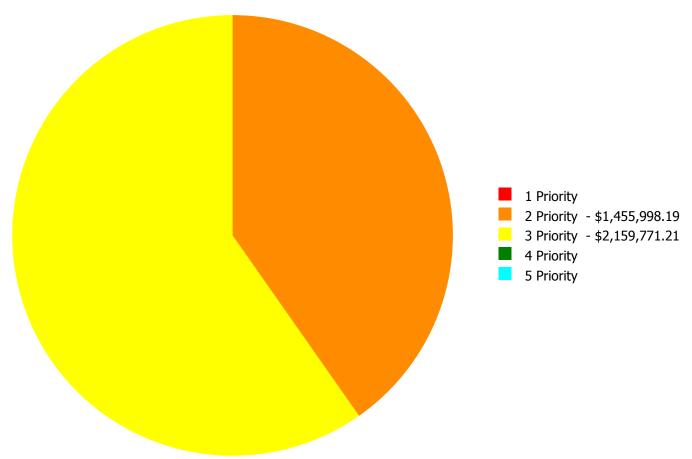

Budget Estimate Total: \$3,615,769.40

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards..
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System							
Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
G2010	Roadways	\$0.00	\$249,409.07	\$0.00	\$0.00	\$0.00	\$249,409.07
G2020	Parking Lots	\$0.00	\$128,404.58	\$0.00	\$0.00	\$0.00	\$128,404.58
G2030	Pedestrian Paving	\$0.00	\$282,740.70	\$0.00	\$0.00	\$0.00	\$282,740.70
G2040	Covered Walkways	\$0.00	\$0.00	\$139,339.20	\$0.00	\$0.00	\$139,339.20
G2040	Fencing & Guardrails	\$0.00	\$0.00	\$171,529.36	\$0.00	\$0.00	\$171,529.36
G2040	Tennis Courts	\$0.00	\$0.00	\$258,066.53	\$0.00	\$0.00	\$258,066.53
G2040	Track	\$0.00	\$0.00	\$258,184.96	\$0.00	\$0.00	\$258,184.96
G2050	Landscaping	\$0.00	\$0.00	\$273,316.01	\$0.00	\$0.00	\$273,316.01
G3010	Water Supply	\$0.00	\$0.00	\$344,943.65	\$0.00	\$0.00	\$344,943.65
G3020	Sanitary Sewer	\$0.00	\$0.00	\$216,767.87	\$0.00	\$0.00	\$216,767.87
G3030	Storm Sewer	\$0.00	\$669,152.99	\$0.00	\$0.00	\$0.00	\$669,152.99
G3060	Fuel Distribution	\$0.00	\$0.00	\$147,025.16	\$0.00	\$0.00	\$147,025.16
G4010	Electrical Distribution	\$0.00	\$0.00	\$350,598.47	\$0.00	\$0.00	\$350,598.47
G4030	Site Communications & Security	\$0.00	\$126,290.85	\$0.00	\$0.00	\$0.00	\$126,290.85
	Total:	\$0.00	\$1,455,998.19	\$2,159,771.21	\$0.00	\$0.00	\$3,615,769.40

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

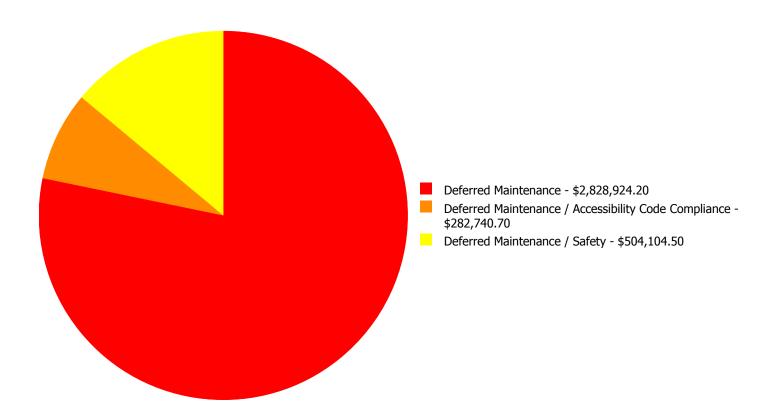

Budget Estimate Total: \$3,615,769.40

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 2 Priority:

System: G2010 - Roadways



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance / Safety

Priority: 2 Priority

Correction: Renew System

Qty: 43,856.00

Unit of Measure: S.F.

Estimate: \$249,409.07

Assessor Name: Sam Mandola

Date Created: 06/08/2015

Notes: Roadways are beyond their expected service life, inadequate, and should be scheduled for replacement. The lack of suitable roadways reportedly creates a significant risk to safety, access to building, and ADA compliance.

System: G2020 - Parking Lots



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance / Safety

Priority: 2 Priority

Correction: Renew System

Qty: 25,599.00

Unit of Measure: S.F.

Estimate: \$128,404.58

Assessor Name: Sam Mandola

Date Created: 06/08/2015

Notes: The parking lot is beyond its expected service life, deteriorating, inadequate, and should be replaced. The parking lot is not large enough, creating a significant risk to safety, and it floods when it rains due to poor erosion control. Markings and signage are also in need of improvement.

System: G2030 - Pedestrian Paving



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code

Compliance

Priority: 2 Priority

Correction: Renew System

Qty: 171,358.00

Unit of Measure: S.F.

Estimate: \$282,740.70

Assessor Name: Sam Mandola

Date Created: 06/08/2015

Notes: Pedestrian paving is beyond its expected service life, damaged, not ADA compliant, and should be scheduled for replacement.

System: G3030 - Storm Sewer



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 2 Priority

Correction: Renew System

Qty: 171,358.00

Unit of Measure: S.F.

Estimate: \$669,152.99

Assessor Name: Sam Mandola

Date Created: 06/08/2015

Notes: The storm sewer system is beyond its expected service life, inadequate, and should be replaced, as the site floods when it rains.

System: G4030 - Site Communications & Security



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance / Safety

Priority: 2 Priority

Correction: Renew System

Qty: 171,358.00

Unit of Measure: S.F.

Estimate: \$126,290.85

Assessor Name: Sam Mandola

Date Created: 06/08/2015

Notes: The site communications and security systems are beyond their expected, inadequate, service life and should be scheduled for replacement.

Priority 3 Priority:

System: G2040 - Covered Walkways



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 2,600.00

Unit of Measure: S.F.

Estimate: \$139,339.20

Assessor Name: Eduardo Lopez

Date Created: 12/07/2015

Notes: The original covered walkways are aged and worn and should be renovated/replaced.

System: G2040 - Fencing & Guardrails



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 171,358.00

Unit of Measure: S.F.

Estimate: \$171,529.36

Assessor Name: Eduardo Lopez

Date Created: 06/08/2015

Notes: Fencing is beyond its expected service life, damaged, and should be scheduled for replacement.

System: G2040 - Tennis Courts



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 12,702.00

Unit of Measure: S.F.

Estimate: \$258,066.53

Assessor Name: Eduardo Lopez

Date Created: 06/15/2015

Notes: The tennis courts are beyond their expected service life, have completely failed, and should be replaced.

System: G2040 - Track



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 33,340.00

Unit of Measure: S.F.

Estimate: \$258,184.96

Assessor Name: Eduardo Lopez

Date Created: 06/15/2015

Notes: The track is beyond its expected service life, damaged with cracks, and should be scheduled for replacement.

System: G2050 - Landscaping



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 171,358.00

Unit of Measure: S.F.

Estimate: \$273,316.01

Assessor Name: Eduardo Lopez

Date Created: 06/08/2015

Notes: Landscaping is beyond its expected service life, overgrown in many areas, missing in others, and should be replaced. The site has issues with erosion caused by poor landscaping.

System: G3010 - Water Supply



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 171,358.00

Unit of Measure: S.F.

Estimate: \$344,943.65

Assessor Name: Eduardo Lopez

Date Created: 06/08/2015

Notes: The site water supply system is beyond its expected service life and should be scheduled for replacement. SPLOST project 410-422 to replace the backflow preventer.

System: G3020 - Sanitary Sewer



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 171,358.00

Unit of Measure: S.F.

Estimate: \$216,767.87

Assessor Name: Eduardo Lopez

Date Created: 06/08/2015

Notes: The site sanitary sewer system is beyond its expected service life and should be scheduled for replacement. SPLOST project 410-422 to replace the grease trap and backflow preventer.

System: G3060 - Fuel Distribution



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 171,358.00

Unit of Measure: S.F.

Estimate: \$147,025.16

Assessor Name: Eduardo Lopez

Date Created: 06/08/2015

Notes: The site fuel distribution system is beyond its expected service life and should be scheduled for replacement.

System: G4010 - Electrical Distribution



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 171,358.00

Unit of Measure: S.F.

Estimate: \$350,598.47

Assessor Name: Eduardo Lopez

Date Created: 06/08/2015

Notes: The site electrical distribution system is beyond its expected service life and should be scheduled for replacement.

Glossary

Abandoned A facility owned by a district that is not occupied and not maintained. See Vacant.

Additional Cost Total project cost is composed of hard and soft costs. Additional costs or soft expenses are costs

that are necessary to accomplish the corrective work but are not directly attributable to the deficient systems direct construction cost, which are often referred to as hard cost. The components included in the soft costs vary by owner but usually include architect and contractor fees, contingencies and other owner-incurred costs necessary to fully develop and build a facility. These soft cost factors can be adjusted anytime within the eCOMET® database at the owner's

discretion.

Assessment Visual survey of a facility to determine its condition. It involves looking at the age of systems,

reviewing information from local sources and visual evidence of potential problems to assign a condition rating. It does not include destructive testing of materials or testing of systems or

equipment for functionality.

ASTM ASTM International (ASTM): Originally known as the American Society for Testing and Materials,

ASTM is an international standards organization that develops and publishes voluntary consensus

technical standards for a wide range of materials, products, systems, and services.

BOMA Building Owners Managers of America (BOMA): National organization of public and private facility

owners focused on building management tools and maintenance techniques. eCOMET®

reference: Building and component system effective economic life expectancies.

Building A fully enclosed and roofed structure that can be traversed internally without exiting to the

exterior.

Building Addition An area, space or component of a building added to a building after the original building's year

built date. NOTE: As a convention in the database, "Main" was used to designate the original building. Additions built prior to 1983 (30 years) were included in the main building area calculations to reflect their predicted system depreciation characteristics and remaining service

life.

Building Systems eCOMET® uses UNIFORMAT II to organize building data. UNIFORMAT II was originally developed

by the federal General Services Administration to delineate building costs by systems rather than by material. UNIFORMAT II was formalized by an NIST standard, NISTIR 6389 in 1999. It has been further quantified and updated by ASTM standard 2005, E1557-05. The Construction Specifications Institute, CSI, has taken over the standard as part of their MasterFormat /

MasterSpec system.

Calculated Next Renewal The year a system or building element would be expected to expire based solely on the date it

was installed and the expected useful lifetime for that kind of system.

Capital Renewal Capital renewal refers to the cyclical replacement of building systems or elements as they become

obsolete or beyond their useful life. It is not normally included in an annual operating/maintenance budget. See calculated next renewal and next renewal.

City Cost Index (CCI) RS Means provides building system, equipment, and construction costs at a national level. The

City Cost Index (also provided by RS Means) localizes those costs to a geographic region of the United States. In eCOMET®, each building or site is assigned a City Cost Index, which adjusts all

of the associated costs for systems, deficiencies and inventory to the local value.

Condition Condition refers to the state of physical fitness or readiness of a facility system or system element

for its intended use.

Condition Budget The Condition Budget, also known as Condition Needs, represents the budgeted contractor

installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might

also be associated with the corrective actions due to packaging the work.

Condition Index (CI) %

The Condition Index (CI) also known as the Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) Value divided by the sum of a system's Replacement Value (both values exclude soft cost to simplify calculation updates) expressed as a percentage ranging from 100.00% (new) to 0.00% (expired - no remaining life).

Construction

Specifications Institute

Construction Specifications Institute: Primary national organization specializing in construction materials data and data location in construction documents. eCOMET® reference: UNIFORMAT II materials classification.

Correction

Correction refers to an assessor's recommended deficiency repair or replacement action. For any system or element deficiency, there can be multiple and alternative solutions for its repair or replacement. A Correction is user defined and tied to a UNIFORMAT II element, or system it is intended to address. It excludes other peripheral costs that may also be included in the packaging of repair, replacement or renewal improvements that may also be triggered by the deficiency correction.

Cost Model

A cost model is a list of facility systems which could represent the installed systems a given facility. Included in the cost model are standard unit cost estimates, gross areas, life cycles and installed dates. Also represented is the repair cost for deficient systems, replacement values. See eCOMET® cost models.

Criteria

Criteria refer to the set of requirements, guidelines or standards that are assessed and rated to develop a score.

Current Period

The Current Period is the current year plus a user defined number of forward years.

Current Replacement Value (CRV)

The Current Replacement Value (CRV) of a facility, building or system represents the hypothetical cost of rebuilding or replacing an existing facility under today's codes and construction standards, using its current configuration. It is calculated by multiplying the gross area of the facility by a square foot cost developed in that facility's cost model. Replacement cost includes construction costs and owner's additional or soft costs for fees, permits and other expenses to reflect a total project cost.

Deferred Maintenance

Deferred maintenance is condition work deferred on a planned or unplanned basis to a future budget cycle or postponed until funds are available.

Deficiency

A deficiency is a repair item that is damaged, missing, inadequate or insufficient for an intended purpose.

Deficiency Category

Deficiency Category refers to the type or class of a user defined deficiency grouping with shared or similar characteristics. Category descriptions include, but are not limited to: Accessibility Code Compliance, Appearance, Building Code Compliance, Deferred Maintenance, Energy, Environmental, Life Safety Code Compliance, and Safety.

Deficiency Distress

Deficiency Distress refers to a user-defined root cause of a deficiency. Distress descriptions are: Beyond Service Life, Damaged, Inadequate, Needs Remediation, and Missing.

Deficiency Priority

Deficiency Priority refers to a deficiency's urgency for repair as determined by the assessment team. Deficiencies were assigned a priority of 1 through 5, with Priority 1 deficiencies being the most urgent.

eCOMET(R)

Energy and Condition Management Estimation Technology (eCOMET®) is Parsons proprietary facility asset management software developed to provide facility managers with a state of the art, web-based tool to develop and maintain a comprehensive database of FCA data and information used for facility asset management, maintenance and repair, and capital renewal planning. eCOMET® is used by Parsons and its clients as the primary tool for collecting FCA data, preparing cost estimates, generating individual facility reports and cost estimates, and developing the overall capital renewal program.

eCOMET® Cost Models eCOMET® cost models are derived from RS Means Square Foot Cost Data cost models and these

models are used to develop the current replacement value (CRV) and assign life cycle costs to the various systems within a building. Cost models are assigned current costs-per-square-foot to establish replacement values. The Cost models are designed to represent a client specific facility

that meets local standards cost trends.

Element Elements are the major components that comprise building systems as defined by UNIFORMAT II.

Expected Life Also referred to as Useful Life. See Useful Life definition.

Facility A facility refers to site(s), building(s), or building addition(s), or combinations thereof that provide

a particular service or support of an educational purpose.

Facility Attributes Customizable eCOMET® fields to identify attributes specific to a facility. These fields are part of

the eCOMET® database set-up with the owner.

Facility Condition A facility condition assessment (FCA) is a visual inspection of buildings and grounds at a facility to identify and estimate current and future needed repairs or replacements of major systems for

identify and estimate current and future needed repairs or replacements of major systems for planning and budgeting purposes. It is typically performed for organizations that are tasked with the day to day maintenance, operation, and capital renewal (replacement) of building systems and components of a large inventory of facilities. The primary goal of an FCA is to objectively and quantifiably identify, inspect, and prioritize the repair and replacement needs of the building and ground systems (e.g., roofs, windows, doors, floor finishes, plumbing fixtures, parking lot, and sidewalks) within facilities that have either failed or have surpassed their service life, and to identify and forecast future capital replacement needs for systems that have not yet failed, but planned replacement of those systems is needed to ensure that the facilities will continue to meet

the mission of the organization.

Facility Condition Index

(FCI)

FCI is an industry-standard measurement of a facility's condition expressed as a percentage from 0.00% to 100.00% that is derived by dividing the cost to correct a facility's deficiencies by its Current Replacement Value (CRV). The higher the FCI the poorer the condition of a facility. After an FCI is established for all buildings within a portfolio, a building's condition can be ranked relative to other buildings. The FCI may also represent the condition of a portfolio based on the cumulative FCIs of the portfolio's facilities.

Forecast Period The Forecast Period refers to a user defined number of years forward of the Current Period.

Gen (Generate) The Cost Model has a Gen box for each system line item. By checking the box, eCOMET® will

generate life cycle deficiencies based on the Year Installed and the Life for that system. Systems that typically do not re-generate (foundations, floor construction, roof construction, basement walls, etc.) would not have the Gen box checked as those systems would not re-generate at the end of a life cycle. In those instances, it would be more practical and cost effective to demolish

the entire facility than renew those systems.

Gross Square Feet (GSF) The area of the enclosed floor space of a building or building addition in square feet measured to

the outside face of the enclosing wall.

Life cycle Life cycle refers to the period of time that a building or site system or element can be expected to

adequately serve its intended function. Parsons assigns expected life cycles to all building systems based on Building Operators and Managers of America (BOMA) recommended life cycles,

manufacturers suggested life, and RS Means cost data, and client-provided historical data. BOMA standards are a nationally recognized source of life cycle data for various components and/or systems associated with facilities. RS Means is a national company specializing in construction

estimating and costs.

Next Renewal Next Renewal refers to a manually-adjusted expected useful life of a system or element based on

on-site inspection either by reducing or extending the Calculated Next Renewal to more accurately

reflect current conditions.

School Assessment Report - Druid Hills High

Order of Magnitude Order of Magnitude refers to a rough approximation made with a degree of knowledge and

confidence that the budgeted, projected or estimated cost falls within a reasonable range of cost

values.

Remaining Service Life

(RSL)

RSL is the number of years of service remaining for a system or equipment item. It is automatically calculated based on the difference between the current year and the Calculated

Next Renewal date or the Next Renewal date whichever one is the later date.

Renewal Factors Renewal factors represent the difference in cost of renovating or replacing an existing system,

rather than new construction of a building system. For example, installing a new built-up roof on an existing building would include removing and disposing of the old roof, a cost not associated with new construction. Using a renewal premium to account for demolition and other difficulty

costs, Parsons typically assigns a renewal factor of 110%.

Renewal Schedule A timeline by year that indicates when the systems will need to be renewed and the estimated

price of the renewal.

Repair Cost Repair cost is the sum of all the deficiencies associated with a building or multiple

buildings/facilities. It will include any applied soft costs or City Cost Indexes.

Replacement Value See Current Replacement Value.

Site A facility's grounds and its utilities, roadways, landscaping, fencing and other typical land

improvements needed to support a facility.

Soft Costs Soft Costs are a construction industry term that refers to expense items that are not considered

direct construction costs. Soft costs are user-defined and include architectural, engineering, management, testing, and mitigation fees, and other owner pre- and post-construction expenses.

Sustainability Sustainability refers to the collection of policies and strategies that meet society's present needs

without compromising the ability of future generations to meet their own needs.

System System refers to building and related site work elements as described by ASTM UNIFORMAT II

Classification for Building Elements (E1557-97), a format for classifying major facility elements common to most buildings. Elements usually perform a given function regardless of the design

specification construction method or materials used. See also UNIFORMAT II.

System Generated

Deficiency

eCOMET® automatically generates system deficiencies based on system life cycles using the systems installation dates as the base year. By adjusting the Next Renewal date ahead or behind the predicted or stated life cycle date, a system cost will come due earlier or later than the originally installed life cycle date. This utility accounts for good maintenance conditions and a longer life, or early expiration of a system life due to any number of adverse factors such as poor installation, acts of god, material defects, poor design applications and other factors that may shorten the life of a material or system. It is important to mention that the condition of the systems is not necessarily a reflection of maintenance practices, but a combination of system usage and age.

UNIFORMAT II, Classification for Building Elements (E1557-97), a publication of the

Construction Specification Institute (CSI), is a format used to classify major facility components common to most buildings. The format is based on functional elements or parts of a facility characterized by their functions without regard to the materials and methods used to accomplish

them. These elements are often referred to as systems or assemblies.

Unit Price The Unit Price (Raw) x (100% + the Additional Cost Template percentage).

Unit Price (Raw) The actual \$/sq. ft cost being used for the building and systems. It will include adjustments for

the City Cost Index applied to the facility.

School Assessment Report - Druid Hills High

Useful Life Also known as Expected Life, Useful Life refers to the intrinsic period of time a system or element

is expected to perform as intended. Useful life is generally provided by manufacturers of materials,

systems and elements through their literature, testing and experience. Useful Lives in the database are derived from the Building Owners and Managers (BOMA) organization's guidelines,

RSMeans cost data, and from client- defined historical experience.

Vacant Vacant refers to a facility that is not occupied but is a maintained facility by a district. See

Abandoned.

Year Built The year that a building or addition was originally built based on its date of substantial completion

or occupancy.

minimum of 70% of the system's Current Replacement Value (CRV) was replaced.