

DeKalb County School District/Elementary Schools

McLendon Elementary

Final

School Assessment Report

May 19, 2016



Table of Contents

School Executive Summary	4
School Condition Summary	6
<u>1958, 1960, 1963, 1969 Building</u>	8
Executive Summary	8
Condition Summary	9
Photo Album	10
Condition Detail	11
System Listing	12
Renewal Schedule	14
Forecasted Sustainment Requirement	17
Deficiency Summary By System	18
Deficiency Summary By Priority	19
Deficiency By Priority Investment	20
Deficiency Summary By Category	21
Deficiency Details By Priority	22
<u>1980 Storage Building</u>	29
Executive Summary	29
Condition Summary	30
Photo Album	31
Condition Detail	32
System Listing	33
Renewal Schedule	34
Forecasted Sustainment Requirement	37
Deficiency Summary By System	38
Deficiency Summary By Priority	39
Deficiency By Priority Investment	40
Deficiency Summary By Category	41
Deficiency Details By Priority	42
<u>2003 Gym</u>	44

School Assessment Report

Executive Summary	44
Condition Summary	45
Photo Album	46
Condition Detail	47
System Listing	48
Renewal Schedule	49
Forecasted Sustainment Requirement	51
Deficiency Summary By System	52
Deficiency Summary By Priority	53
Deficiency By Priority Investment	54
Deficiency Summary By Category	55
Deficiency Details By Priority	56
<u>Site</u>	59
Executive Summary	59
Condition Summary	60
Photo Album	61
Condition Detail	62
System Listing	63
Renewal Schedule	64
Forecasted Sustainment Requirement	66
Deficiency Summary By System	67
Deficiency Summary By Priority	68
Deficiency By Priority Investment	69
Deficiency Summary By Category	70
Deficiency Details By Priority	71
Glossary	78

School Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as $100 - \text{Total FCI}$ (without the %) where 100 is best and 0 is worst condition.

Gross Area (SF):	58,963
Year Built:	1958
Last Renovation:	2010
Replacement Value:	\$13,968,855
Repair Cost:	\$3,070,865.81
Total FCI:	21.98 %
Total RSLI:	47.14 %
FCA Score:	78.02



Description:

The McLendon Elementary School campus consists of two buildings located at 3169 Hollywood Drive in Decatur, Georgia. The original campus was constructed in 1958, additions to the main school building were constructed in 1960, 1963, and 1969, and a gymnasium building was constructed in 2003. In addition to these buildings, the campus contains a covered walkway, storage building, playground, and playing field. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report for each building and site improvement on the campus.

School Assessment Report - McLendon Elementary

Attributes:

General Attributes:

Assigned Region:	Region 2	Board District:	District 2
DOE Facility:	2061	Geographic Region:	Region 2
HS Attendance Area:	Druid Hills HS	Jurisdictional City:	DeKalb County (Unincorporated)
Site Acreage:	8.3		

School Condition Summary

The Table below shows the RSLI and FCI for each major system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.


Current Investment Requirement and Condition by Unifomat Classification

UNIFORMAT Classification	RSLI%	FCI %	Current Repair
A10 - Foundations	47.74 %	0.00 %	\$0.00
A20 - Basement Construction	0.00 %	0.00 %	\$0.00
B10 - Superstructure	56.14 %	0.54 %	\$2,175.42
B20 - Exterior Enclosure	50.48 %	3.93 %	\$54,686.00
B30 - Roofing	48.77 %	2.77 %	\$33,220.96
C10 - Interior Construction	46.93 %	17.14 %	\$130,755.04
C20 - Stairs	43.00 %	0.00 %	\$0.00
C30 - Interior Finishes	34.54 %	11.67 %	\$228,899.00
D10 - Conveying	0.00 %	0.00 %	\$0.00
D20 - Plumbing	68.92 %	21.93 %	\$329,555.63
D30 - HVAC	67.98 %	3.24 %	\$70,201.00
D40 - Fire Protection	0.00 %	0.00 %	\$0.00
D50 - Electrical	71.21 %	1.63 %	\$23,441.00
E10 - Equipment	3.34 %	105.10 %	\$503,659.00
E20 - Furnishings	0.00 %	110.00 %	\$315,227.00
F10 - Special Construction	12.00 %	0.00 %	\$0.00
G20 - Site Improvements	6.71 %	90.36 %	\$666,242.04
G30 - Site Mechanical Utilities	0.00 %	110.00 %	\$474,121.49
G40 - Site Electrical Utilities	0.00 %	110.00 %	\$238,682.23
Totals:	47.14 %	21.98 %	\$3,070,865.81

Condition Deficiency Priority

Facility Name	Gross Area (S.F.)	FCI %	1 Priority	2 Priority	3 Priority	4 Priority	5 Priority
1958, 1960, 1963, 1969 Building	53,365	12.97	\$0.00	\$260,627.95	\$1,252,404.68	\$0.00	\$0.00
1980 Storage Building	120	52.49	\$0.00	\$2,175.42	\$2,897.00	\$0.00	\$0.00
2003 Gym	5,478	19.08	\$0.00	\$0.00	\$173,715.00	\$0.00	\$0.00
Site	58,963	99.55	\$0.00	\$0.00	\$1,379,045.76	\$0.00	\$0.00
Total:		21.98	\$0.00	\$262,803.37	\$2,808,062.44	\$0.00	\$0.00

Deficiencies By Priority

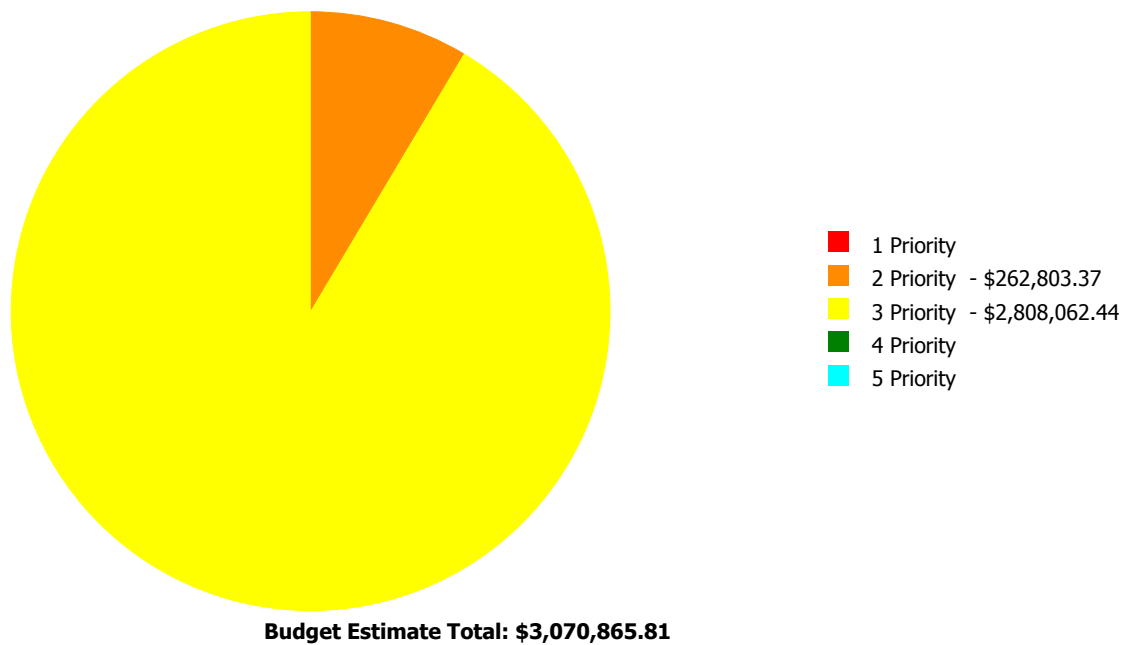

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	53,365
Year Built:	1958
Last Renovation:	2010
Replacement Value:	\$11,663,248
Repair Cost:	\$1,513,032.63
Total FCI:	12.97 %
Total RSLI:	51.19 %
FCA Score:	87.03



Description:

The main building at McLendon Elementary School is a one-story building located at 3169 Hollywood Drive in Decatur, Georgia. Originally built in 1958, there have been additions in 1960, 1963, and 1969, and a major renovation in 2010. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:

Building Codes:	2010, 2011, 2012, 2013	Fire Sprinkler System:	No
-----------------	------------------------	------------------------	----

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	43.00 %	0.00 %	\$0.00
A20 - Basement Construction	0.00 %	0.00 %	\$0.00
B10 - Superstructure	43.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	47.15 %	4.26 %	\$54,005.00
B30 - Roofing	46.82 %	2.74 %	\$31,004.96
C10 - Interior Construction	41.89 %	20.10 %	\$130,755.04
C20 - Stairs	43.00 %	0.00 %	\$0.00
C30 - Interior Finishes	35.76 %	8.00 %	\$148,826.00
D10 - Conveying	0.00 %	0.00 %	\$0.00
D20 - Plumbing	69.50 %	23.35 %	\$329,555.63
D30 - HVAC	70.40 %	0.00 %	\$0.00
D40 - Fire Protection	0.00 %	0.00 %	\$0.00
D50 - Electrical	73.29 %	0.00 %	\$0.00
E10 - Equipment	3.34 %	105.10 %	\$503,659.00
E20 - Furnishings	0.00 %	110.00 %	\$315,227.00
F10 - Special Construction	12.00 %	0.00 %	\$0.00
Totals:	51.19 %	12.97 %	\$1,513,032.63

Photo Album

The photo album consists of the various cardinal directions of the building.

1). North Elevation - Jun 24, 2015



2). West Elevation - Jun 24, 2015



3). South Elevation - Jun 24, 2015



4). East Elevation - Jun 24, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

School Assessment Report - 1958, 1960, 1963, 1969 Building

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$6.49	S.F.	53,365	100	1958	2058		43.00 %	0.00 %	43			\$346,339
A1020	Special Foundations	\$4.46	S.F.	0	100	1958	2058		43.00 %	0.00 %	43			\$0
A1030	Slab on Grade	\$7.09	S.F.	53,365	100	1958	2058		43.00 %	0.00 %	43			\$378,358
A2010	Basement Excavation	\$0.26	S.F.	0	100	1958	2058		43.00 %	0.00 %	43			\$0
A2020	Basement Walls	\$6.13	S.F.	0	100	1958	2058		43.00 %	0.00 %	43			\$0
B1010	Floor Construction	\$15.61	S.F.	0	100	1958	2058		43.00 %	0.00 %	43			\$0
B1020	Roof Construction	\$5.34	S.F.	53,365	100	1958	2058		43.00 %	0.00 %	43			\$284,969
B2010	Exterior Walls	\$16.02	S.F.	53,365	100	1958	2058		43.00 %	0.00 %	43			\$854,907
B2020	Exterior Windows	\$6.79	S.F.	53,365	30	2004	2034		63.33 %	0.00 %	19			\$362,348
B2030	Exterior Doors	\$0.92	S.F.	53,365	30	1958	1988		0.00 %	110.00 %	-27		\$54,005.00	\$49,096
B3010	Roof Coverings - Asphal Shingles	\$0.00	S.F.	0	10	1958	1968		0.00 %	0.00 %	-47			\$0
B3010	Roof Coverings - BUR	\$20.70	S.F.	53,365	25	2002	2027		48.00 %	0.04 %	12		\$479.96	\$1,104,656
B3010	Roof Coverings - EPDM	\$0.00	S.F.	0	15	1958	1973		0.00 %	0.00 %	-42			\$0
B3010	Roof Coverings - Preformed Metal	\$0.00	S.F.	0	30	1958	1988		0.00 %	0.00 %	-27			\$0
B3010	Roof Coverings - Standing Seam Metal	\$0.00	S.F.	0	75	1958	2033		24.00 %	0.00 %	18			\$0
B3020	Roof Openings	\$0.52	S.F.	53,365	30	1958	1988	2015	0.00 %	110.00 %	0		\$30,525.00	\$27,750
C1010	Partitions	\$7.01	S.F.	53,365	100	1958	2058		43.00 %	0.00 %	43			\$374,089
C1020	Interior Doors	\$2.39	S.F.	53,365	30	1958	1988		0.00 %	80.00 %	-27		\$102,034.00	\$127,542
C1030	Fittings	\$2.79	S.F.	53,365	20	2010	2030		75.00 %	19.29 %	15		\$28,721.04	\$148,888
C2010	Stair Construction	\$1.81	S.F.	53,365	100	1958	2058		43.00 %	0.00 %	43			\$96,591
C3010	Wall Finishes - Ceramic & Glazed	\$10.27	S.F.	29,421	30	1958	1988		0.00 %	0.00 %	-27			\$302,154
C3010	Wall Finishes - Paint	\$1.93	S.F.	29,422	10	2010	2020		50.00 %	0.00 %	5			\$56,784
C3010	Wall Finishes - Wall Coverings	\$0.00	S.F.	53,365	10	1958	1968		0.00 %	0.00 %	-47			\$0
C3020	Floor Finishes - Carpet	\$8.50	S.F.	5,885	8	2000	2008		0.00 %	110.00 %	-7		\$55,025.00	\$50,023
C3020	Floor Finishes - Ceramic & Quarry Tile	\$14.49	S.F.	5,885	50	1958	2008		0.00 %	110.00 %	-7		\$93,801.00	\$85,274
C3020	Floor Finishes - Terrazzo	\$53.01	S.F.	8,826	50	1958	2008		0.00 %	0.00 %	-7			\$467,866
C3020	Floor Finishes - VCT	\$9.54	S.F.	38,247	20	2008	2028		65.00 %	0.00 %	13			\$364,876
C3020	Floor Finishes - Wood	\$0.00	S.F.		20	1958	1978		0.00 %	0.00 %	-37			\$0
C3030	Ceiling Finishes	\$9.98	S.F.	53,365	20	2010	2030		75.00 %	0.00 %	15			\$532,583
D1010	Elevators and Lifts	\$1.17	S.F.	0	30	1958	1988		0.00 %	0.00 %	-27			\$0
D2010	Plumbing Fixtures	\$17.66	S.F.	53,365	30	2010	2040		83.33 %	7.62 %	25		\$71,856.63	\$942,426
D2020	Domestic Water Distribution	\$3.99	S.F.	53,365	30	2010	2040		83.33 %	0.00 %	25			\$212,926
D2030	Sanitary Waste	\$3.41	S.F.	53,365	30	1958	1988		0.00 %	110.00 %	-27		\$200,172.00	\$181,975
D2040	Rain Water Drainage	\$0.98	S.F.	53,365	30	1958	1988		0.00 %	110.00 %	-27		\$57,527.00	\$52,298

School Assessment Report - 1958, 1960, 1963, 1969 Building

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
D2090	Other Plumbing Systems - Natural Gas	\$0.41	S.F.	53,365	30	2010	2040		83.33 %	0.00 %	25			\$21,880
D3020	Heat Generating Systems	\$4.55	S.F.	0	30	1958	1988		0.00 %	0.00 %	-27			\$0
D3030	Cooling Generating Systems	\$4.73	S.F.	0	30	1958	1988		0.00 %	0.00 %	-27			\$0
D3040	Distribution & Exhaust Systems	\$5.51	S.F.	53,365	30	2010	2040		83.33 %	0.00 %	25			\$294,041
D3050	Terminal & Package Units	\$27.81	S.F.	53,365	15	2010	2025		66.67 %	0.00 %	10			\$1,484,081
D3060	Controls & Instrumentation	\$3.60	S.F.	53,365	20	2010	2030		75.00 %	0.00 %	15			\$192,114
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$1.23	S.F.	53,365	30	2010	2040		83.33 %	0.00 %	25			\$65,639
D4010	Sprinklers	\$4.75	S.F.	0	30	1958	1988		0.00 %	0.00 %	-27			\$0
D4020	Standpipes	\$0.51	S.F.	0	30	1958	1988		0.00 %	0.00 %	-27			\$0
D5010	Electrical Service/Distribution	\$1.81	S.F.	53,365	30	2010	2040		83.33 %	0.00 %	25			\$96,591
D5020	Branch Wiring	\$6.78	S.F.	53,365	30	2010	2040		83.33 %	0.00 %	25			\$361,815
D5020	Lighting	\$8.90	S.F.	53,365	30	2010	2040		83.33 %	0.00 %	25			\$474,949
D5030	Communications and Security - Clock & PA Systems	\$5.60	S.F.	53,365	10	2010	2020		50.00 %	0.00 %	5			\$298,844
D5030	Communications and Security - Fire Alarm	\$1.23	S.F.	53,365	10	2010	2020		50.00 %	0.00 %	5			\$65,639
D5030	Communications and Security - Security & CCTV	\$0.61	S.F.	53,365	10	2010	2020		50.00 %	0.00 %	5			\$32,553
D5090	Other Electrical Systems - Emergency Generator	\$0.35	S.F.	53,365	15	2010	2025		66.67 %	0.00 %	10			\$18,678
E1020	Institutional Equipment	\$0.40	S.F.	53,365	20	2010	2030		75.00 %	0.00 %	15			\$21,346
E1090	Other Equipment (Kitchen Equipment)	\$8.58	S.F.	53,365	20	1990	2010		0.00 %	110.00 %	-5		\$503,659.00	\$457,872
E2010	Fixed Furnishings	\$5.37	S.F.	53,365	20	1958	1978		0.00 %	110.00 %	-37		\$315,227.00	\$286,570
F1010	Special Structures - Canopies	\$1.61	S.F.	53,365	25	1958	1983		12.00 %	0.00 %	3			\$85,918
Total									51.19 %	12.97 %			\$1,513,032.63	\$11,663,248

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$1,513,033	\$0	\$0	\$93,885	\$0	\$578,712	\$0	\$0	\$69,704	\$0	\$2,221,541	\$4,476,874
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1020 - Special Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1010 - Floor Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2020 - Exterior Windows	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$54,005	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$54,005
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Asphal Shingles	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - BUR	\$480	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$480
B3010 - Roof Coverings - EPDM	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Preformed Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3020 - Roof Openings	\$30,525	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$30,525
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

School Assessment Report - 1958, 1960, 1963, 1969 Building

C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$102,034	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$102,034
C1030 - Fittings	\$28,721	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$28,721
C20 - Stairs	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* C2010 - Stair Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic & Glazed	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Paint	\$0	\$0	\$0	\$0	\$0	\$72,412	\$0	\$0	\$0	\$0	\$0	\$72,412
C3010 - Wall Finishes - Wall Coverings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Carpet	\$55,025	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$69,704	\$0	\$124,729
C3020 - Floor Finishes - Ceramic & Quarry Tile	\$93,801	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$93,801
C3020 - Floor Finishes - Terrazzo	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - VCT	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Wood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D10 - Conveying	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D1010 - Elevators and Lifts	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$71,857	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$71,857
D2020 - Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2030 - Sanitary Waste	\$200,172	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$200,172
D2040 - Rain Water Drainage	\$57,527	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$57,527
D2090 - Other Plumbing Systems - Natural Gas	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3020 - Heat Generating Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3030 - Cooling Generating Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3040 - Distribution & Exhaust Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3050 - Terminal & Package Units	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$2,193,929	\$2,193,929
D3060 - Controls & Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3090 - Other HVAC Systems/Equip - Kitchen Hood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


School Assessment Report - 1958, 1960, 1963, 1969 Building

D4010 - Sprinklers	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D4020 - Standpipes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5030 - Communications and Security - Clock & PA Systems	\$0	\$0	\$0	\$0	\$0	\$381,086	\$0	\$0	\$0	\$0	\$0	\$381,086
D5030 - Communications and Security - Fire Alarm	\$0	\$0	\$0	\$0	\$0	\$83,703	\$0	\$0	\$0	\$0	\$0	\$83,703
D5030 - Communications and Security - Security & CCTV	\$0	\$0	\$0	\$0	\$0	\$41,511	\$0	\$0	\$0	\$0	\$0	\$41,511
D5090 - Other Electrical Systems - Emergency Generator	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$27,612	\$27,612
E - Equipment & Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E10 - Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1020 - Institutional Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1090 - Other Equipment (Kitchen Equipment)	\$503,659	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$503,659
E20 - Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E2010 - Fixed Furnishings	\$315,227	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$315,227
F - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F10 - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F1010 - Special Structures - Canopies	\$0	\$0	\$0	\$93,885	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$93,885

* Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

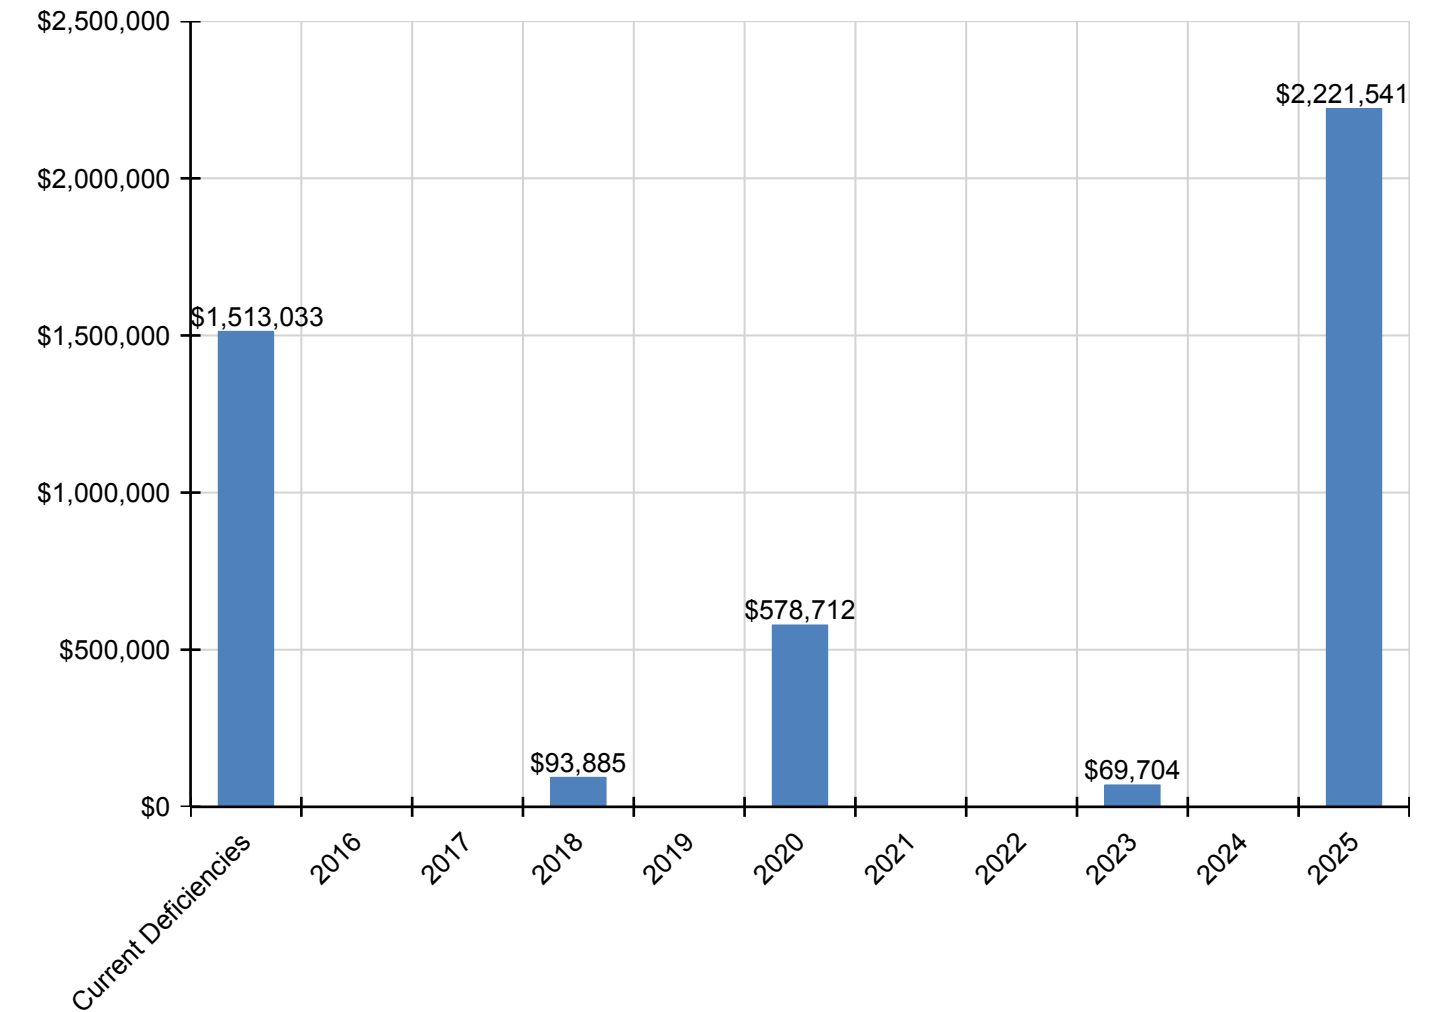

Deficiency Summary by System


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

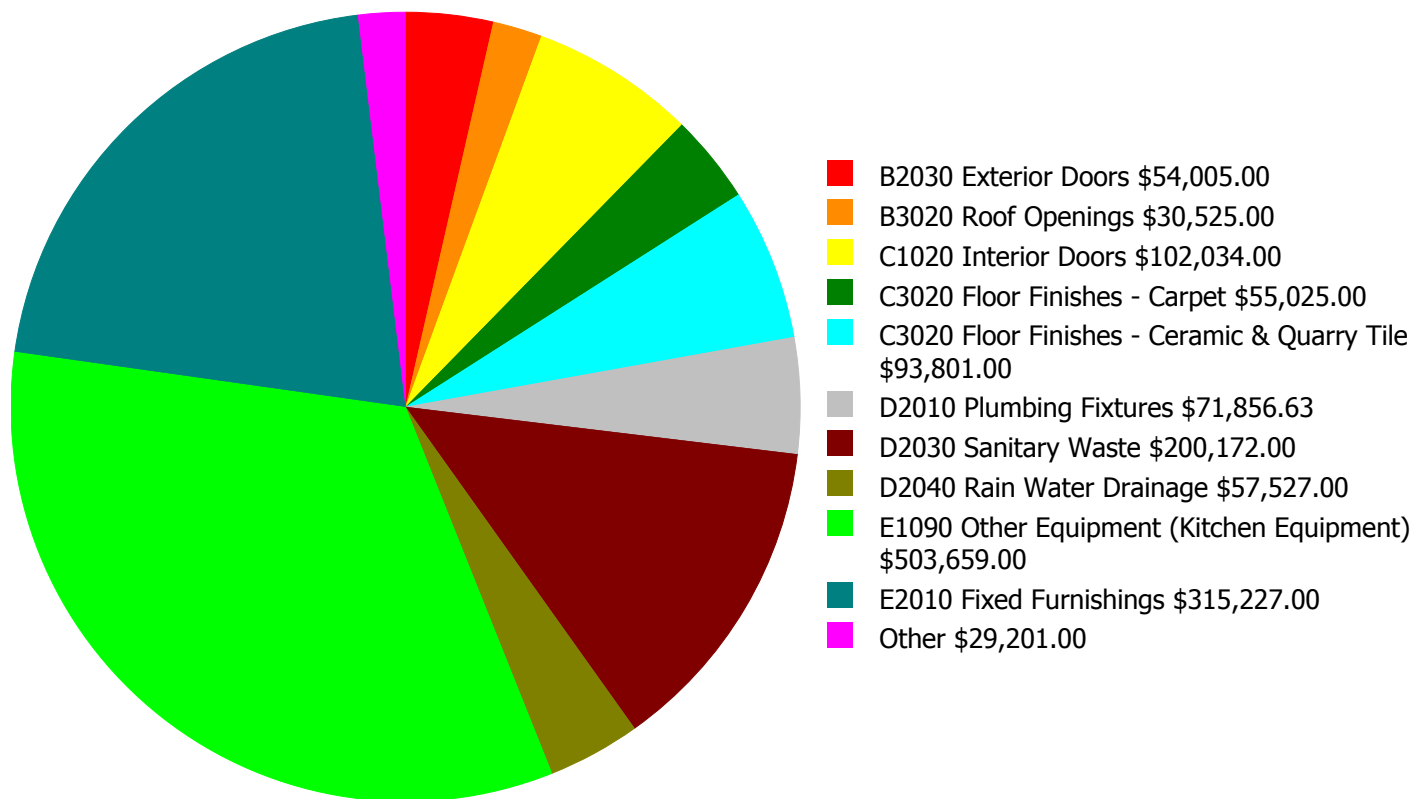

Budget Estimate Total: \$1,513,032.63

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

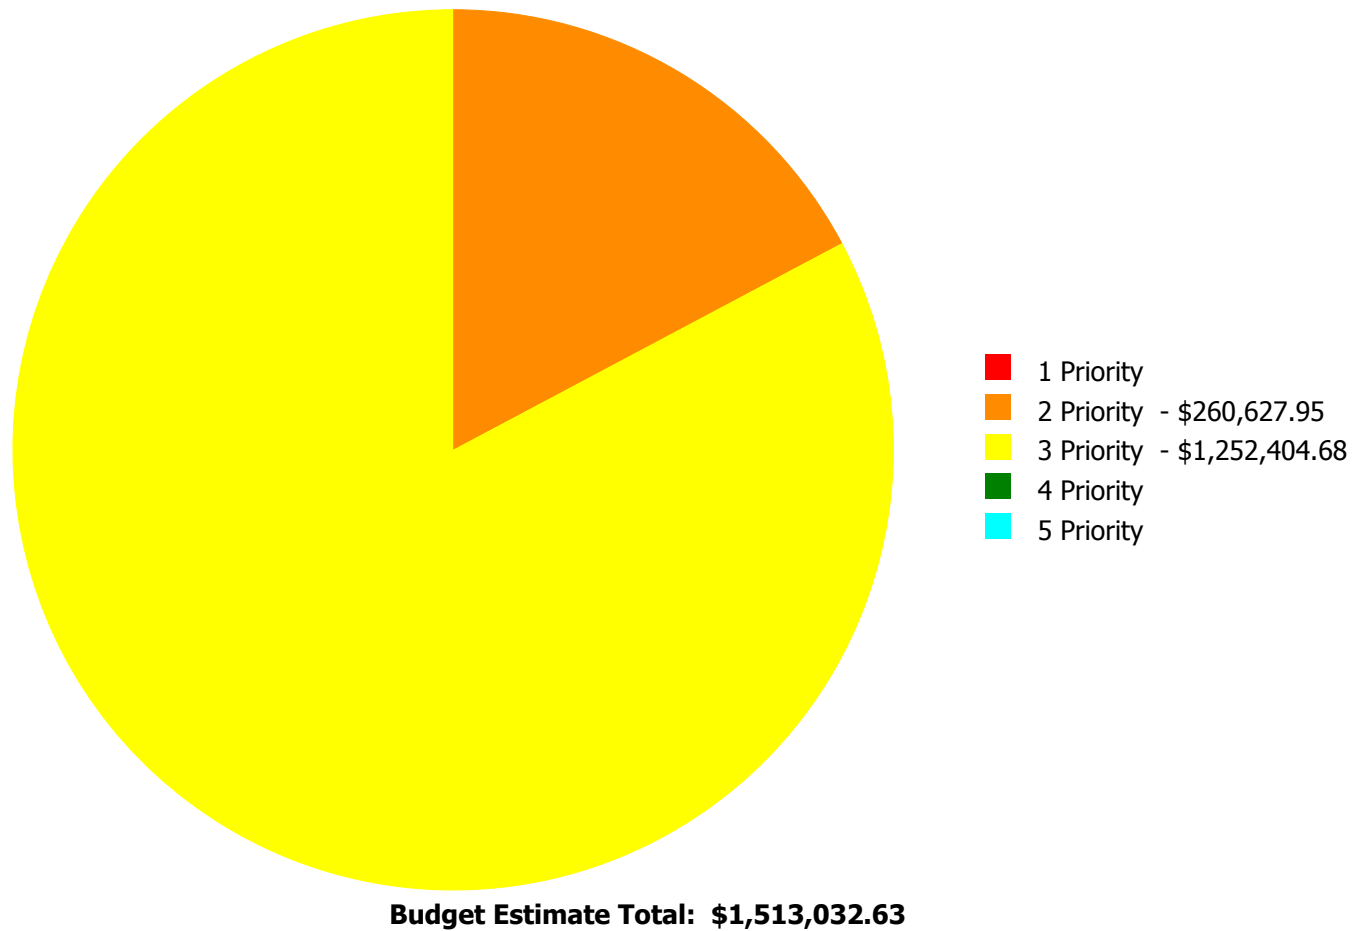

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards.
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
B2030	Exterior Doors	\$0.00	\$0.00	\$54,005.00	\$0.00	\$0.00	\$54,005.00
B3010	Roof Coverings - BUR	\$0.00	\$0.00	\$479.96	\$0.00	\$0.00	\$479.96
B3020	Roof Openings	\$0.00	\$0.00	\$30,525.00	\$0.00	\$0.00	\$30,525.00
C1020	Interior Doors	\$0.00	\$0.00	\$102,034.00	\$0.00	\$0.00	\$102,034.00
C1030	Fittings	\$0.00	\$0.00	\$28,721.04	\$0.00	\$0.00	\$28,721.04
C3020	Floor Finishes - Carpet	\$0.00	\$0.00	\$55,025.00	\$0.00	\$0.00	\$55,025.00
C3020	Floor Finishes - Ceramic & Quarry Tile	\$0.00	\$0.00	\$93,801.00	\$0.00	\$0.00	\$93,801.00
D2010	Plumbing Fixtures	\$0.00	\$60,455.95	\$11,400.68	\$0.00	\$0.00	\$71,856.63
D2030	Sanitary Waste	\$0.00	\$200,172.00	\$0.00	\$0.00	\$0.00	\$200,172.00
D2040	Rain Water Drainage	\$0.00	\$0.00	\$57,527.00	\$0.00	\$0.00	\$57,527.00
E1090	Other Equipment (Kitchen Equipment)	\$0.00	\$0.00	\$503,659.00	\$0.00	\$0.00	\$503,659.00
E2010	Fixed Furnishings	\$0.00	\$0.00	\$315,227.00	\$0.00	\$0.00	\$315,227.00
Total:		\$0.00	\$260,627.95	\$1,252,404.68	\$0.00	\$0.00	\$1,513,032.63

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

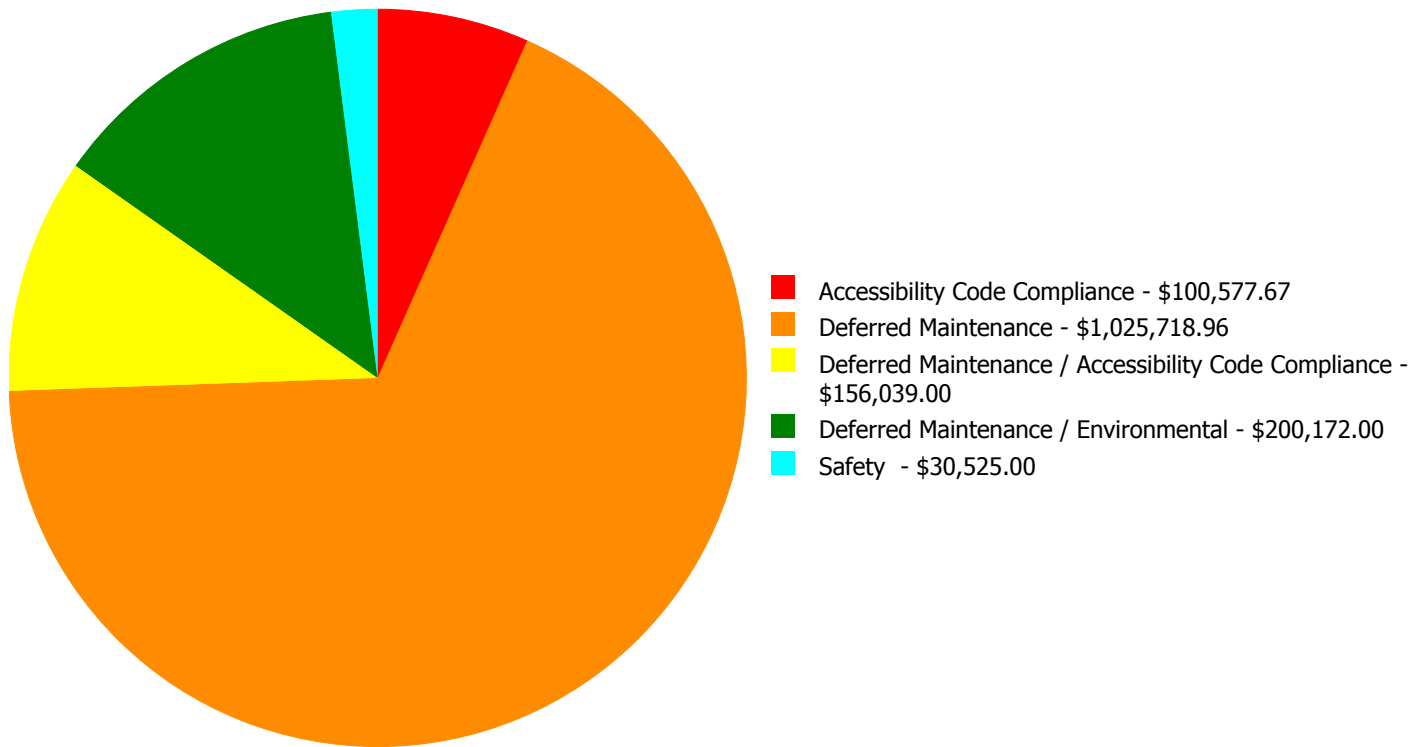

Budget Estimate Total: \$1,513,032.63

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 2 Priority:

System: D2010 - Plumbing Fixtures



Location: Hallways

Distress: Needs Remediation

Category: Accessibility Code Compliance

Priority: 2 Priority

Correction: Add ADA compliant rest room.

Qty: 2.00

Unit of Measure: Ea.

Estimate: \$60,455.95

Assessor Name: Sam Mandola

Date Created: 07/01/2015

Notes: Student restrooms should be modified to increase ADA accessibility.

System: D2030 - Sanitary Waste



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Environmental

Priority: 2 Priority

Correction: Renew System

Qty: 53,365.00

Unit of Measure: S.F.

Estimate: \$200,172.00

Assessor Name: Sam Mandola

Date Created: 04/11/2015

Notes: The sanitary waste system is beyond its expected service life, possibly a source of odors in the building, and should be replaced. SPLOST project 420-422 to replace grease trap and backflow preventer.

Priority 3 Priority:

System: B2030 - Exterior Doors



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 53,365.00

Unit of Measure: S.F.

Estimate: \$54,005.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The original exterior doors are beyond their expected service life, rusted and damaged, not ADA compliant, and should be replaced.

System: B3010 - Roof Coverings - BUR



Location: East Exterior Wall

Distress: Damaged

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Replace Gutters and downspouts

Qty: 1.00

Unit of Measure: L.F.

Estimate: \$479.96

Assessor Name: Ben Nixon

Date Created: 06/24/2015

Notes: The gutter and downspout are damaged and not functional, and need to be repaired/replaced.

System: B3020 - Roof Openings



Location: Roof
Distress: Missing
Category: Safety
Priority: 3 Priority
Correction: Renew System
Qty: 53,365.00
Unit of Measure: S.F.
Estimate: \$30,525.00
Assessor Name: Ben Nixon
Date Created: 06/23/2015

Notes: There is no safe roof access for maintenance personnel. Recommend installation of an OSHA-compliant roof hatch/ladder system for safe access.

System: C1020 - Interior Doors



Location: Throughout Building
Distress: Beyond Service Life
Category: Deferred Maintenance / Accessibility Code Compliance
Priority: 3 Priority
Correction: Renew System
Qty: 53,365.00
Unit of Measure: S.F.
Estimate: \$102,034.00
Assessor Name: Ben Nixon
Date Created: 04/11/2015

Notes: Interior doors are beyond their expected service life, worn, not ADA compliant, and should be replaced.

System: C1030 - Fittings



Location: Throughout Building

Distress: Inadequate

Category: Accessibility Code Compliance

Priority: 3 Priority

Correction: Remove and replace the signage w/ADA compliant signage.

Qty: 1.00

Unit of Measure: S.F.

Estimate: \$28,721.04

Assessor Name: Ben Nixon

Date Created: 06/24/2015

Notes: The signage throughout the building is inadequate, not ADA compliant, and should be replaced.

System: C3020 - Floor Finishes - Carpet



Location: Media Center, Offices

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 5,885.00

Unit of Measure: S.F.

Estimate: \$55,025.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The carpet is aged, stained and worn, and should be replaced.

System: C3020 - Floor Finishes - Ceramic & Quarry Tile



Location: Kitchen and Restrooms

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 5,885.00

Unit of Measure: S.F.

Estimate: \$93,801.00

Assessor Name: Ben Nixon

Date Created: 06/23/2015

Notes: The tile floor covering is beyond its expected service life and should be replaced.

System: D2010 - Plumbing Fixtures



Location: Hallways

Distress: Needs Remediation

Category: Accessibility Code Compliance

Priority: 3 Priority

Correction: Remove/replace drinking fountain w/recessed ADA compliant drinking fountain

Qty: 2.00

Unit of Measure: Ea.

Estimate: \$11,400.68

Assessor Name: Ben Nixon

Date Created: 07/01/2015

Notes: Water fountains protrude into the hallway more than four inches. Protrusion is not ADA compliant if more than four inches.

System: D2040 - Rain Water Drainage



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 53,365.00

Unit of Measure: S.F.

Estimate: \$57,527.00

Assessor Name: Ben Nixon

Date Created: 07/01/2015

Notes: The rainwater drainage system is beyond its expected service life and should be scheduled for replacement. The drains have tar in them that cause water to backup on the roof.

System: F1090 - Other Equipment (Kitchen Equipment)



Location: Kitchen

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 53,365.00

Unit of Measure: S.F.

Estimate: \$503,659.00

Assessor Name: Ben Nixon

Date Created: 06/23/2015

Notes: Kitchen equipment is beyond its expected service life and should be scheduled for replacement.

System: E2010 - Fixed Furnishings



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 53,365.00

Unit of Measure: S.F.

Estimate: \$315,227.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Fixed furnishings, such as built-in cabinets and window treatment, are beyond their expected service life, damaged and worn, and should be replaced.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	120
Year Built:	1980
Last Renovation:	
Replacement Value:	\$9,664
Repair Cost:	\$5,072.42
Total FCI:	52.49 %
Total RSLI:	47.28 %
FCA Score:	47.51



Description:

The storage building at McLendon Elementary School is located at 3169 Hollywood Drive in Decatur, Georgia. Originally built in 1980, there have been no additions or major renovations. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:

Building Codes:	Fire Sprinkler System:	No
-----------------	------------------------	----

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	65.00 %	0.00 %	\$0.00
A20 - Basement Construction	0.00 %	0.00 %	\$0.00
B10 - Superstructure	65.00 %	110.99 %	\$2,175.42
B20 - Exterior Enclosure	57.35 %	12.95 %	\$681.00
B30 - Roofing	0.00 %	109.98 %	\$2,216.00
C10 - Interior Construction	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	0.00 %	0.00 %	\$0.00
D20 - Plumbing	0.00 %	0.00 %	\$0.00
D50 - Electrical	0.00 %	0.00 %	\$0.00
Totals:	47.28 %	52.49 %	\$5,072.42

Photo Album

The photo album consists of the various cardinal directions of the building.

1). East Elevation - Jun 24, 2015



2). South Elevation - Jun 24, 2015



3). East Elevation - Jun 24, 2015



4). North Elevation - Jun 24, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

School Assessment Report - 1980 Storage Building

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$0.00	S.F.	120	100	1980	2080		65.00 %	0.00 %	65			\$0
A1030	Slab on Grade	\$3.60	S.F.	120	100	1980	2080		65.00 %	0.00 %	65			\$432
A2010	Basement Excavation	\$0.00	S.F.	120	100	1980	2080		65.00 %	0.00 %	65			\$0
A2020	Basement Walls	\$0.00	S.F.	120	100	1980	2080		65.00 %	0.00 %	65			\$0
B1020	Roof Construction	\$16.33	S.F.	120	100	1980	2080		65.00 %	110.99 %	65		\$2,175.42	\$1,960
B2010	Exterior Walls	\$38.65	S.F.	120	100	1980	2080		65.00 %	0.00 %	65			\$4,638
B2020	Exterior Windows	\$0.00	S.F.	120	30	1980	2010		0.00 %	0.00 %	-5			\$0
B2030	Exterior Doors	\$5.16	S.F.	120	30	1980	2010		0.00 %	110.02 %	-5		\$681.00	\$619
B3010	Roof Coverings	\$16.79	S.F.	120	20	1980	2000		0.00 %	109.98 %	-15		\$2,216.00	\$2,015
C1010	Partitions	\$0.00	S.F.	0	40	1980	2020		12.50 %	0.00 %	5			\$0
C1020	Interior Doors	\$0.00	S.F.	0	30	1980	2010		0.00 %	0.00 %	-5			\$0
C1030	Fittings	\$0.00	S.F.	0	20	1980	2000		0.00 %	0.00 %	-15			\$0
C3010	Wall Finishes	\$0.00	S.F.	0	20	1980	2000		0.00 %	0.00 %	-15			\$0
C3020	Floor Finishes	\$0.00	S.F.	0	20	1980	2000		0.00 %	0.00 %	-15			\$0
C3030	Ceiling Finishes	\$0.00	S.F.	0	20	1980	2000		0.00 %	0.00 %	-15			\$0
D2040	Rain Water Drainage	\$1.55	S.F.	0	30	1980	2010		0.00 %	0.00 %	-5			\$0
D5010	Electrical Service/Distribution	\$0.00	S.F.	0	30	1980	2010		0.00 %	0.00 %	-5			\$0
D5020	Lighting and Branch Wiring	\$0.00	S.F.	0	30	1980	2010		0.00 %	0.00 %	-5			\$0
Total									47.28 %	52.49 %			\$5,072.42	\$9,664

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%


School Assessment Report - 1980 Storage Building

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$5,072	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$5,072
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$2,175	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$2,175
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2020 - Exterior Windows	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$681	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$681
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings	\$2,216	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$2,216
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting and Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

** Indicates non-renewable system*


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

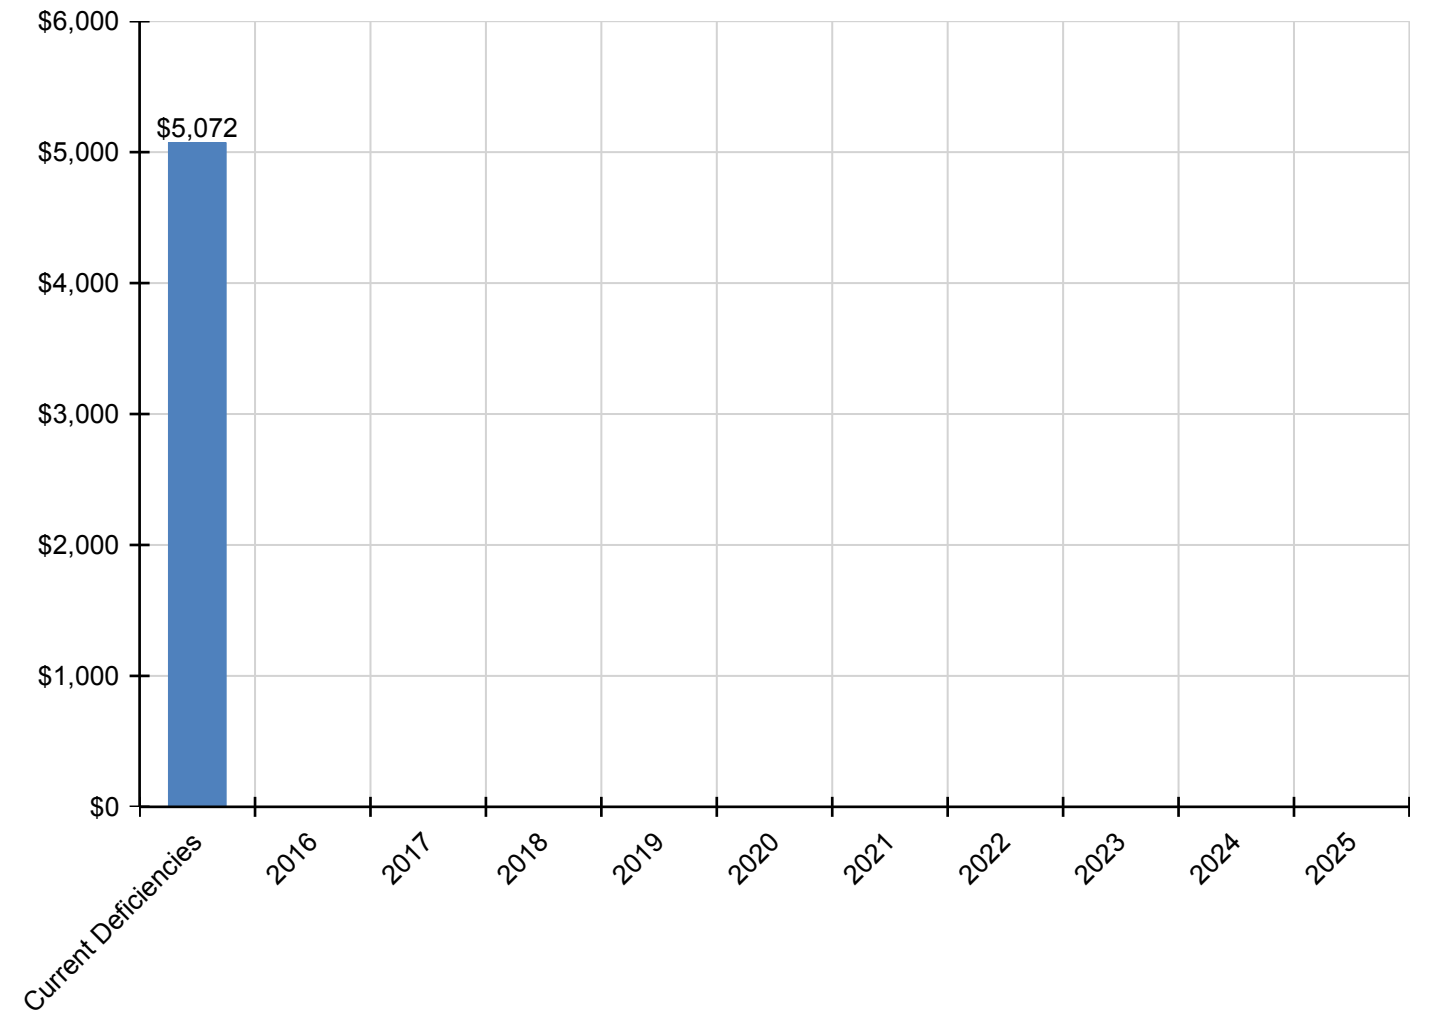


Deficiency Summary by System

Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

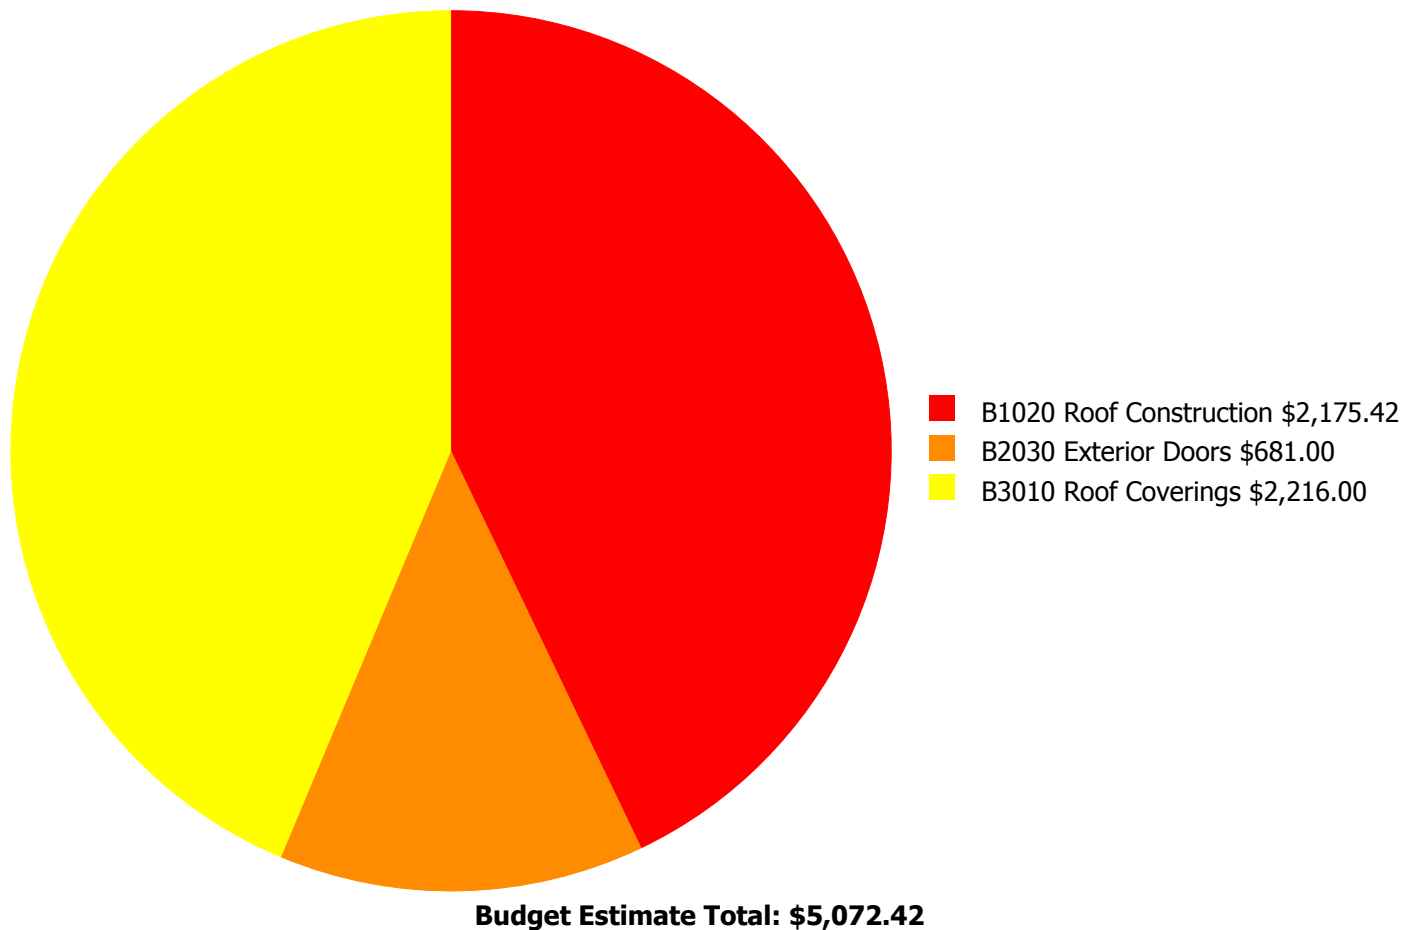

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

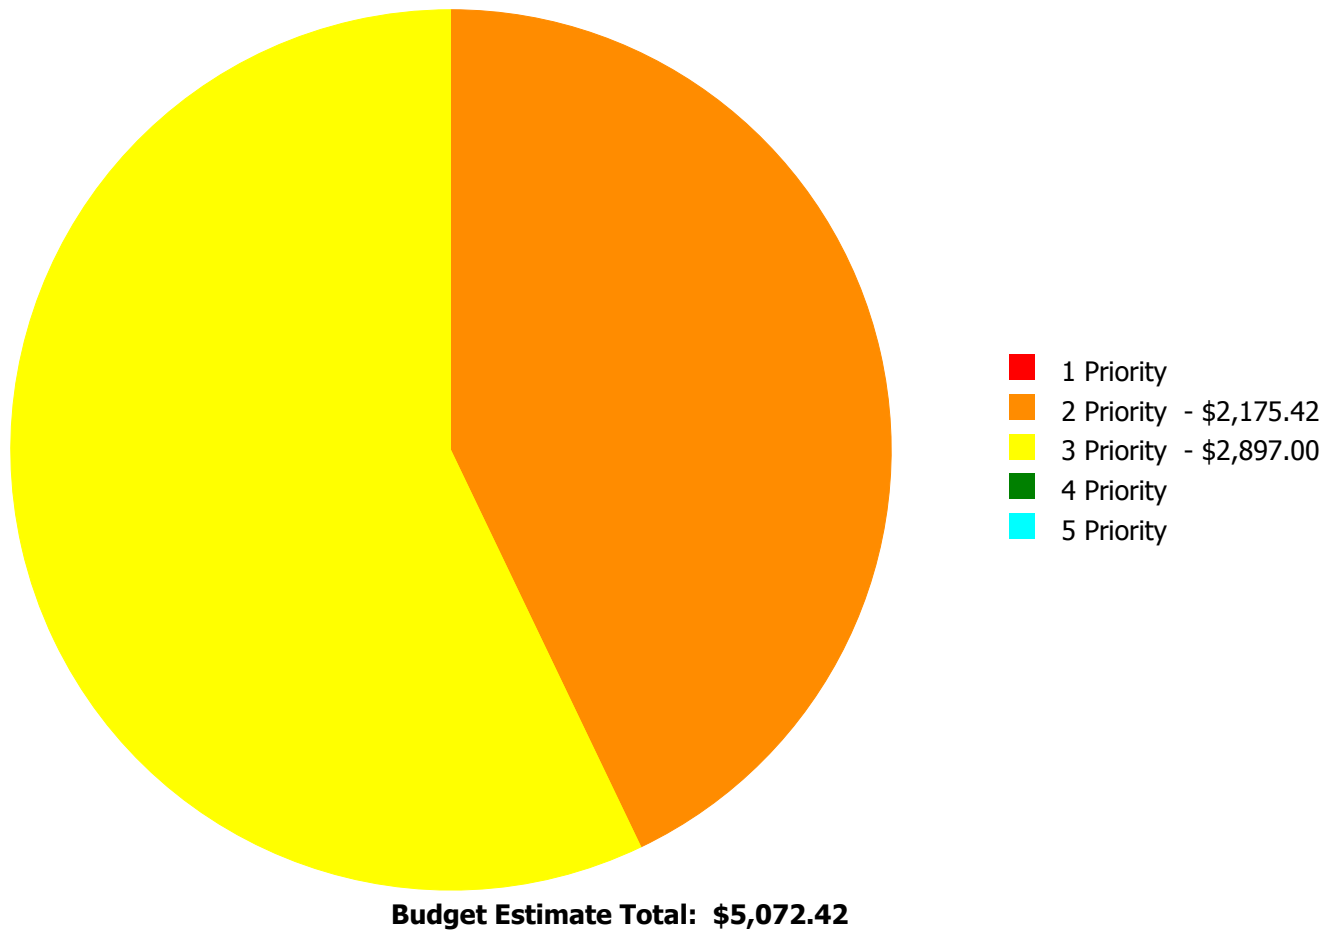

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards. .
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
B1020	Roof Construction	\$0.00	\$2,175.42	\$0.00	\$0.00	\$0.00	\$2,175.42
B2030	Exterior Doors	\$0.00	\$0.00	\$681.00	\$0.00	\$0.00	\$681.00
B3010	Roof Coverings	\$0.00	\$0.00	\$2,216.00	\$0.00	\$0.00	\$2,216.00
	Total:	\$0.00	\$2,175.42	\$2,897.00	\$0.00	\$0.00	\$5,072.42

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

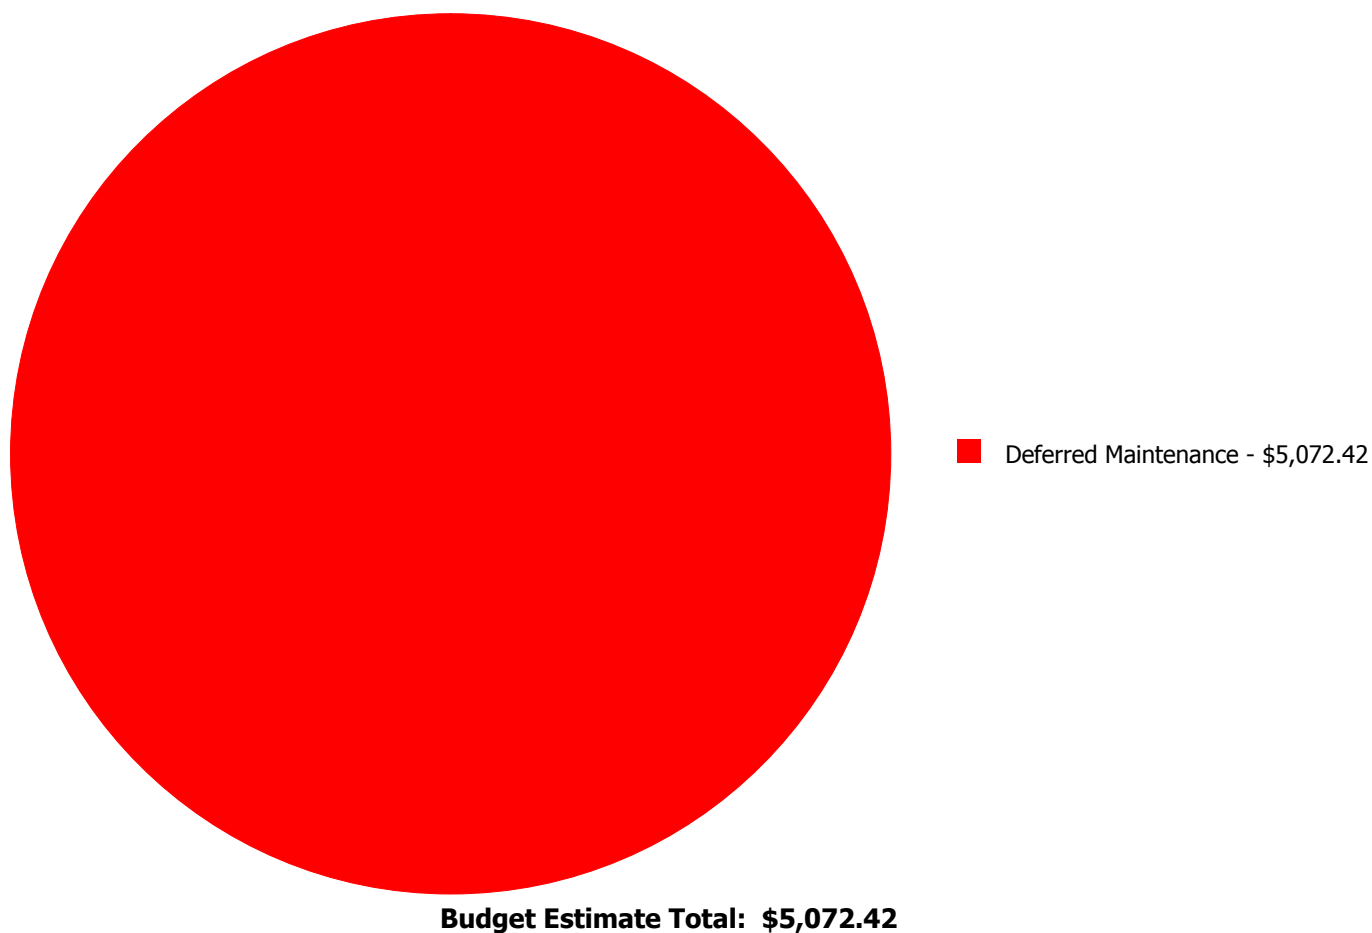

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 2 Priority:

System: B1020 - Roof Construction



Location: Roof

Distress: Damaged

Category: Deferred Maintenance

Priority: 2 Priority

Correction: Replace steel decking

Qty: 120.00

Unit of Measure: S.F.

Estimate: \$2,175.42

Assessor Name: Sam Mandola

Date Created: 07/31/2015

Notes: The steel decking is rusted and damaged, and should be replaced.

Priority 3 Priority:

System: B2030 - Exterior Doors



Location: Exterior Wall
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 120.00
Unit of Measure: S.F.
Estimate: \$681.00
Assessor Name: Dave Cunningham
Date Created: 04/11/2015

Notes: The exterior door is beyond its expected service life, rusted, and should be replaced.

System: B3010 - Roof Coverings



Location: Roof
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 120.00
Unit of Measure: S.F.
Estimate: \$2,216.00
Assessor Name: Dave Cunningham
Date Created: 04/11/2015

Notes: The roof is leaking, beyond its expected service life, and should be replaced.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	5,478
Year Built:	2003
Last Renovation:	
Replacement Value:	\$910,658
Repair Cost:	\$173,715.00
Total FCI:	19.08 %
Total RSLI:	61.65 %
FCA Score:	80.92



Description:

The 2003 gymnasium at McLendon Elementary School is a one-story building located at 3169 Hollywood Drive in Decatur Georgia. There have been no additions or major renovations to this building. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:

Building Codes:	2020	Fire Sprinkler System:	No
-----------------	------	------------------------	----

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	88.00 %	0.00 %	\$0.00
B10 - Superstructure	88.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	85.42 %	0.00 %	\$0.00
B30 - Roofing	84.00 %	0.00 %	\$0.00
C10 - Interior Construction	76.16 %	0.00 %	\$0.00
C30 - Interior Finishes	12.38 %	78.34 %	\$80,073.00
D20 - Plumbing	60.00 %	0.00 %	\$0.00
D30 - HVAC	30.85 %	53.04 %	\$70,201.00
D40 - Fire Protection	0.00 %	0.00 %	\$0.00
D50 - Electrical	38.33 %	27.41 %	\$23,441.00
Totals:	61.65 %	19.08 %	\$173,715.00

Photo Album

The photo album consists of the various cardinal directions of the building.

1). North Elevation - Jun 24, 2015



2). East Elevation - Jun 24, 2015



3). West Elevation - Jun 24, 2015



4). South Elevation - Jun 24, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$9.34	S.F.	5,478	100	2003	2103		88.00 %	0.00 %	88			\$51,165
A1030	Slab on Grade	\$6.21	S.F.	5,478	100	2003	2103		88.00 %	0.00 %	88			\$34,018
B1020	Roof Construction	\$21.36	S.F.	5,478	100	2003	2103		88.00 %	0.00 %	88			\$117,010
B2010	Exterior Walls	\$19.80	S.F.	5,478	100	2003	2103		88.00 %	0.00 %	88			\$108,464
B2030	Exterior Doors	\$2.01	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$11,011
B3010	Roof Coverings - Standing Seam Metal	\$11.91	S.F.	5,478	75	2003	2078		84.00 %	0.00 %	63			\$65,243
C1010	Partitions	\$12.78	S.F.	5,478	100	2003	2103		88.00 %	0.00 %	88			\$70,009
C1020	Interior Doors	\$4.24	S.F.	5,478	40	2003	2043		70.00 %	0.00 %	28			\$23,227
C1030	Fittings	\$3.46	S.F.	5,478	20	2003	2023		40.00 %	0.00 %	8			\$18,954
C3010	Wall Finishes - Ceramic	\$6.65	S.F.	0	30	2003	2033		60.00 %	0.00 %	18			\$0
C3010	Wall Finishes - Paint	\$1.41	S.F.	5,478	10	2003	2013		0.00 %	109.99 %	-2		\$8,496.00	\$7,724
C3020	Floor Finishes - Ceramic Tile	\$6.67	S.F.	548	50	2003	2053		76.00 %	0.00 %	38			\$3,655
C3020	Floor Finishes - Neoprene	\$14.46	S.F.	4,500	10	2003	2013		0.00 %	110.00 %	-2		\$71,577.00	\$65,070
C3020	Floor Finishes - VCT	\$5.01	S.F.	430	15	2003	2018		20.00 %	0.00 %	3			\$2,154
C3030	Ceiling Finishes	\$4.31	S.F.	5,478	20	2003	2023		40.00 %	0.00 %	8			\$23,610
D2010	Plumbing Fixtures	\$9.66	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$52,917
D2020	Domestic Water Distribution	\$5.85	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$32,046
D2030	Sanitary Waste	\$0.87	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$4,766
D2040	Rain Water Drainage	\$0.22	S.F.	0	30	2003	2033		60.00 %	0.00 %	18			\$0
D2090	Other Plumbing Systems - Natural Gas	\$0.32	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$1,753
D3040	Distribution Systems & Exhaust Systems	\$12.25	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$67,106
D3050	Terminal & Package Units	\$11.65	S.F.	5,478	15	2003	2018	2015	0.00 %	110.00 %	0		\$70,201.00	\$63,819
D3060	Controls & Instrumentation	\$0.26	S.F.	5,478	20	2003	2023		40.00 %	0.00 %	8			\$1,424
D4010	Sprinklers	\$3.84	S.F.	0	30	2003	2033		60.00 %	0.00 %	18			\$0
D5010	Electrical Service/Distribution	\$1.24	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$6,793
D5020	Branch Wiring	\$5.24	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$28,705
D5020	Lighting	\$5.24	S.F.	5,478	20	2003	2023		40.00 %	0.00 %	8			\$28,705
D5030	Communications and Security - Fire Alarm	\$2.13	S.F.	5,478	10	2003	2013		0.00 %	110.00 %	-2		\$12,835.00	\$11,668
D5030	Communications and Security - Public Address & Clock System	\$0.88	S.F.	5,478	10	2003	2013		0.00 %	110.00 %	-2		\$5,303.00	\$4,821
D5030	Communications and Security - Security & CCTV	\$0.88	S.F.	5,478	10	2003	2013		0.00 %	110.00 %	-2		\$5,303.00	\$4,821
Total									61.65 %	19.08 %			\$173,715.00	\$910,658

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$173,715	\$0	\$0	\$2,590	\$0	\$0	\$0	\$0	\$101,293	\$0	\$139,114	\$416,712
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$26,411	\$0	\$0	\$26,411
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Paint	\$8,496	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$11,418	\$19,914
C3020 - Floor Finishes - Ceramic Tile	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Neoprene	\$71,577	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$96,194	\$167,771
C3020 - Floor Finishes - VCT	\$0	\$0	\$0	\$2,590	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$2,590
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$32,899	\$0	\$0	\$32,899
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


School Assessment Report - 2003 Gym

D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2020 - Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2030 - Sanitary Waste	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2090 - Other Plumbing Systems - Natural Gas	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3040 - Distribution Systems & Exhaust Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3050 - Terminal & Package Units	\$70,201	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$70,201
D3060 - Controls & Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,985	\$0	\$0	\$1,985
D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D4010 - Sprinklers	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$39,998	\$0	\$0	\$39,998
D5030 - Communications and Security - Fire Alarm	\$12,835	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$17,249	\$30,084
D5030 - Communications and Security - Public Address & Clock System	\$5,303	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$7,127	\$12,430
D5030 - Communications and Security - Security & CCTV	\$5,303	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$7,127	\$12,430

* Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

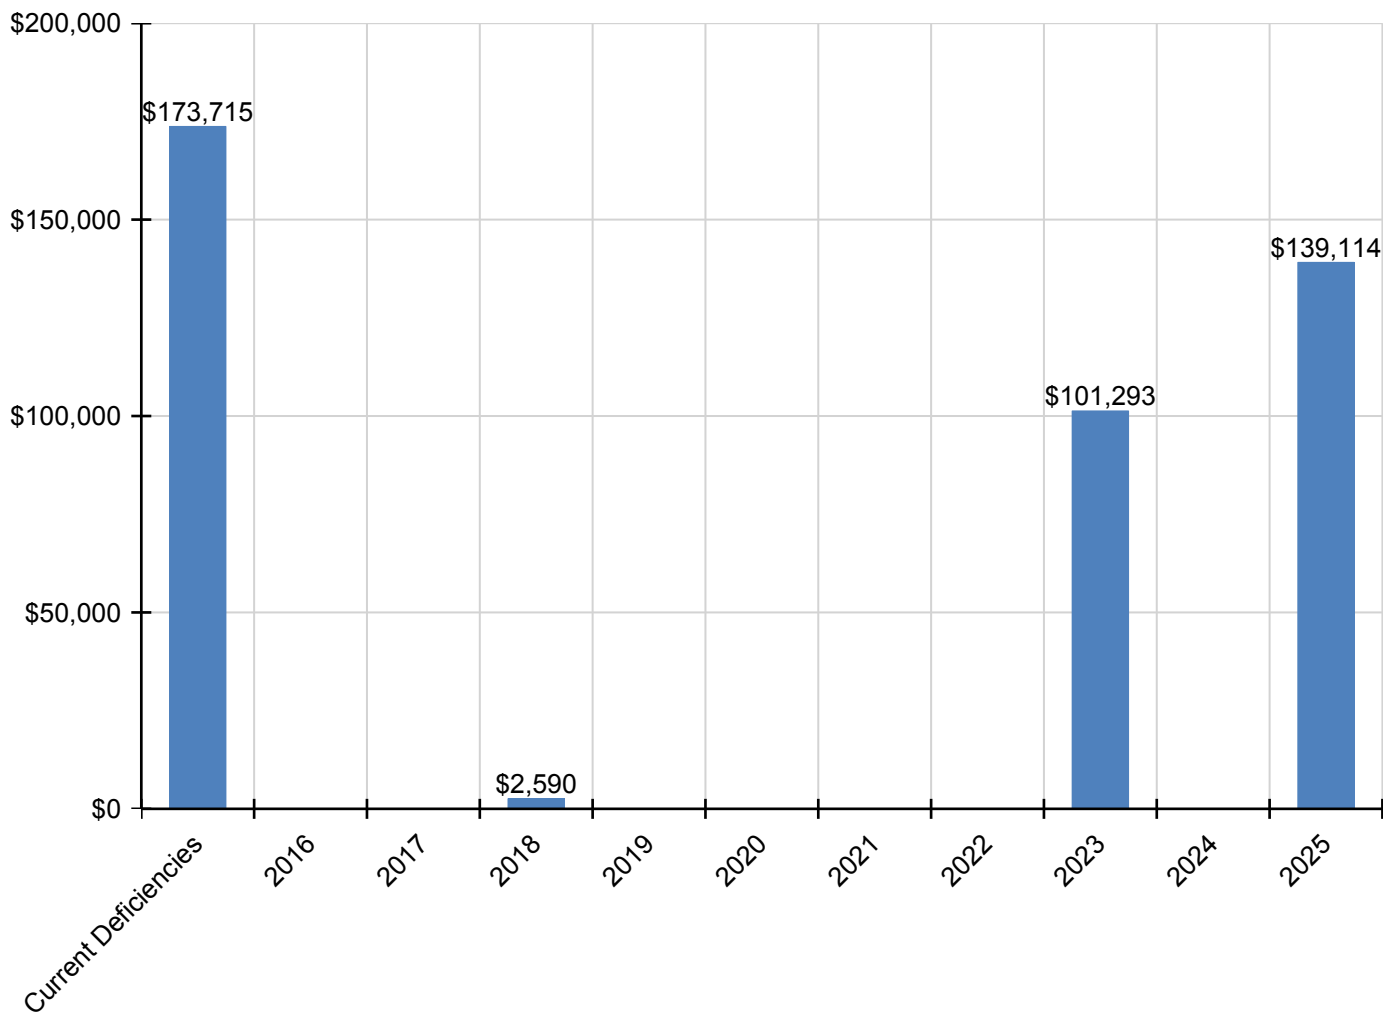

Deficiency Summary by System


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

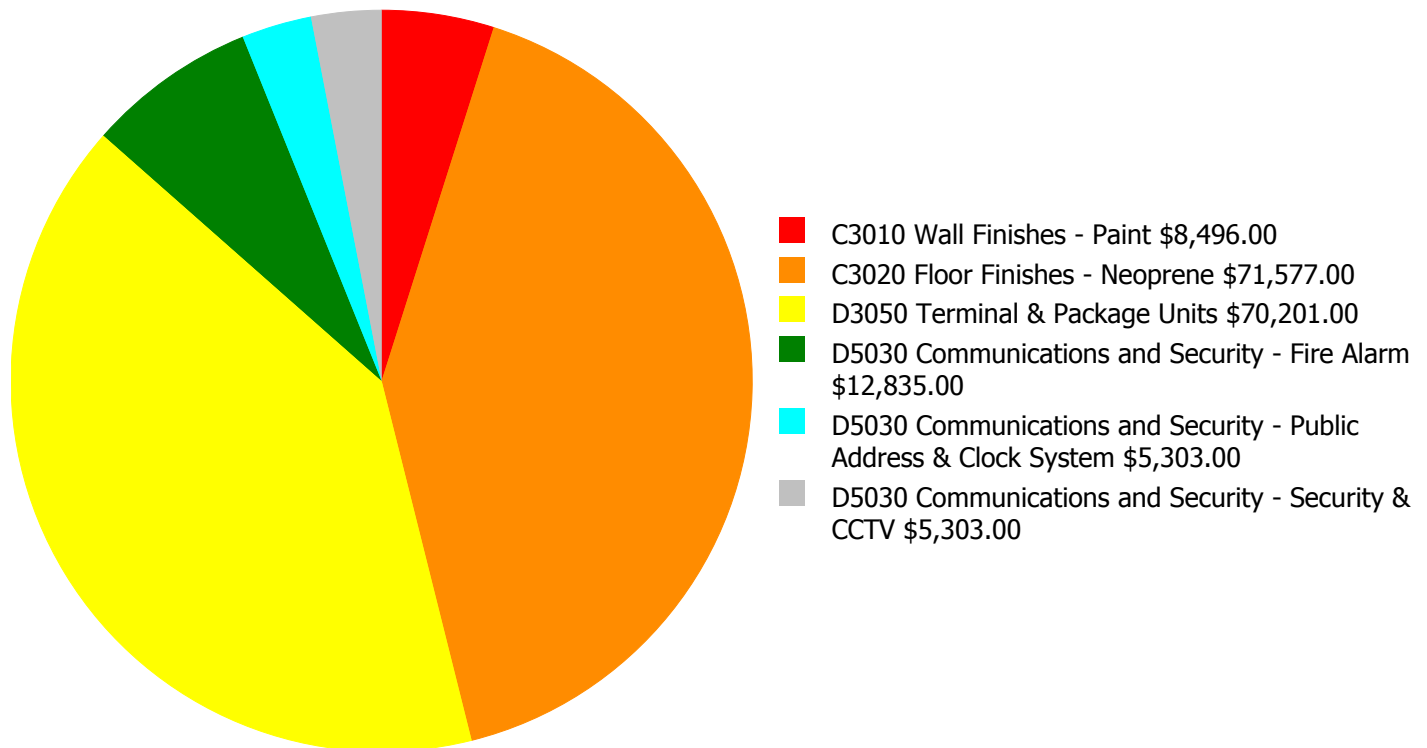

Budget Estimate Total: \$173,715.00

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

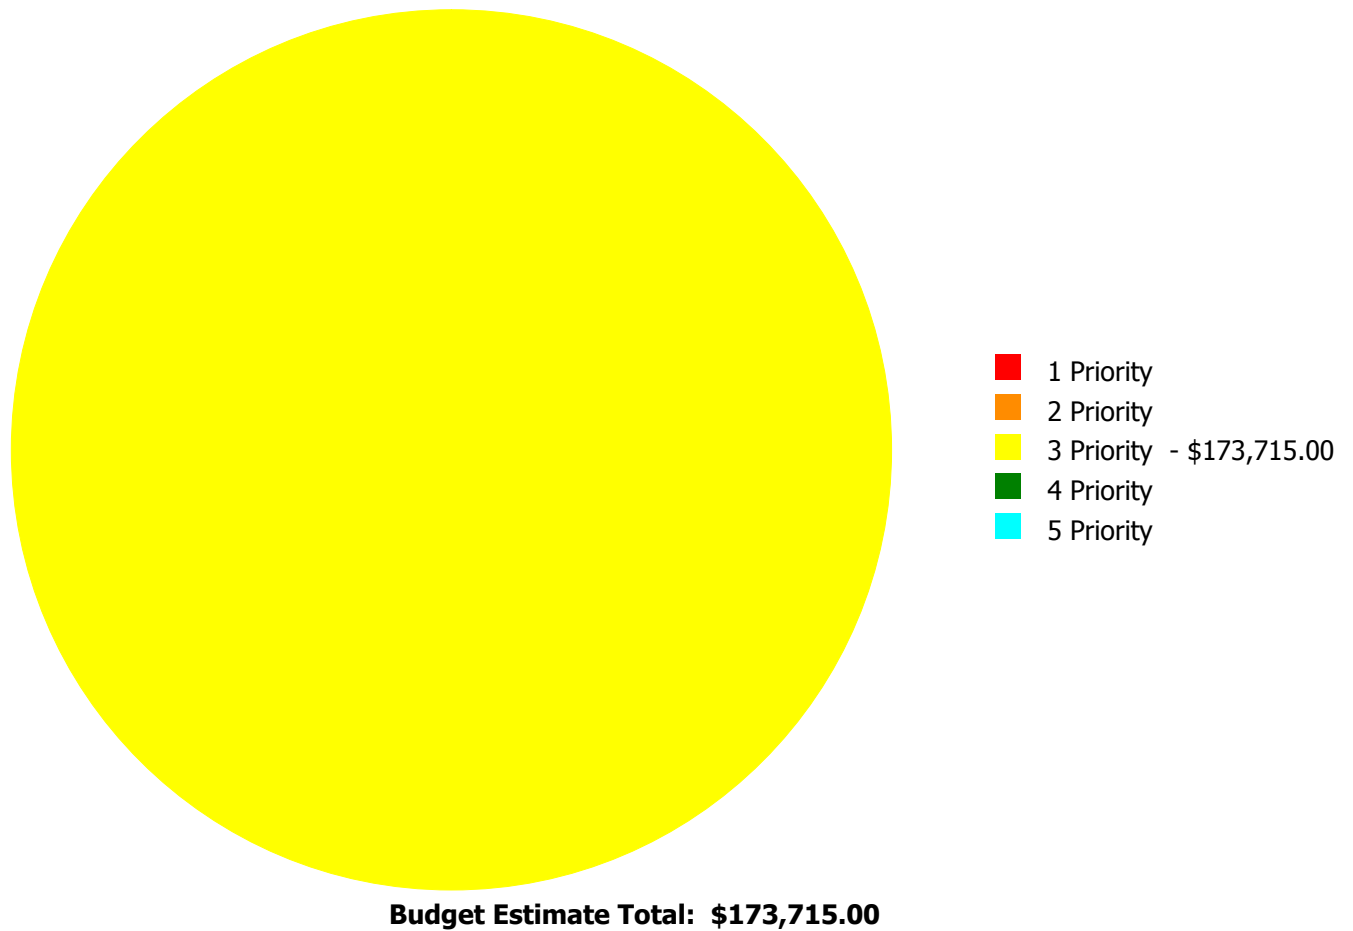

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards.
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
C3010	Wall Finishes - Paint	\$0.00	\$0.00	\$8,496.00	\$0.00	\$0.00	\$8,496.00
C3020	Floor Finishes - Neoprene	\$0.00	\$0.00	\$71,577.00	\$0.00	\$0.00	\$71,577.00
D3050	Terminal & Package Units	\$0.00	\$0.00	\$70,201.00	\$0.00	\$0.00	\$70,201.00
D5030	Communications and Security - Fire Alarm	\$0.00	\$0.00	\$12,835.00	\$0.00	\$0.00	\$12,835.00
D5030	Communications and Security - Public Address & Clock System	\$0.00	\$0.00	\$5,303.00	\$0.00	\$0.00	\$5,303.00
D5030	Communications and Security - Security & CCTV	\$0.00	\$0.00	\$5,303.00	\$0.00	\$0.00	\$5,303.00
	Total:	\$0.00	\$0.00	\$173,715.00	\$0.00	\$0.00	\$173,715.00

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

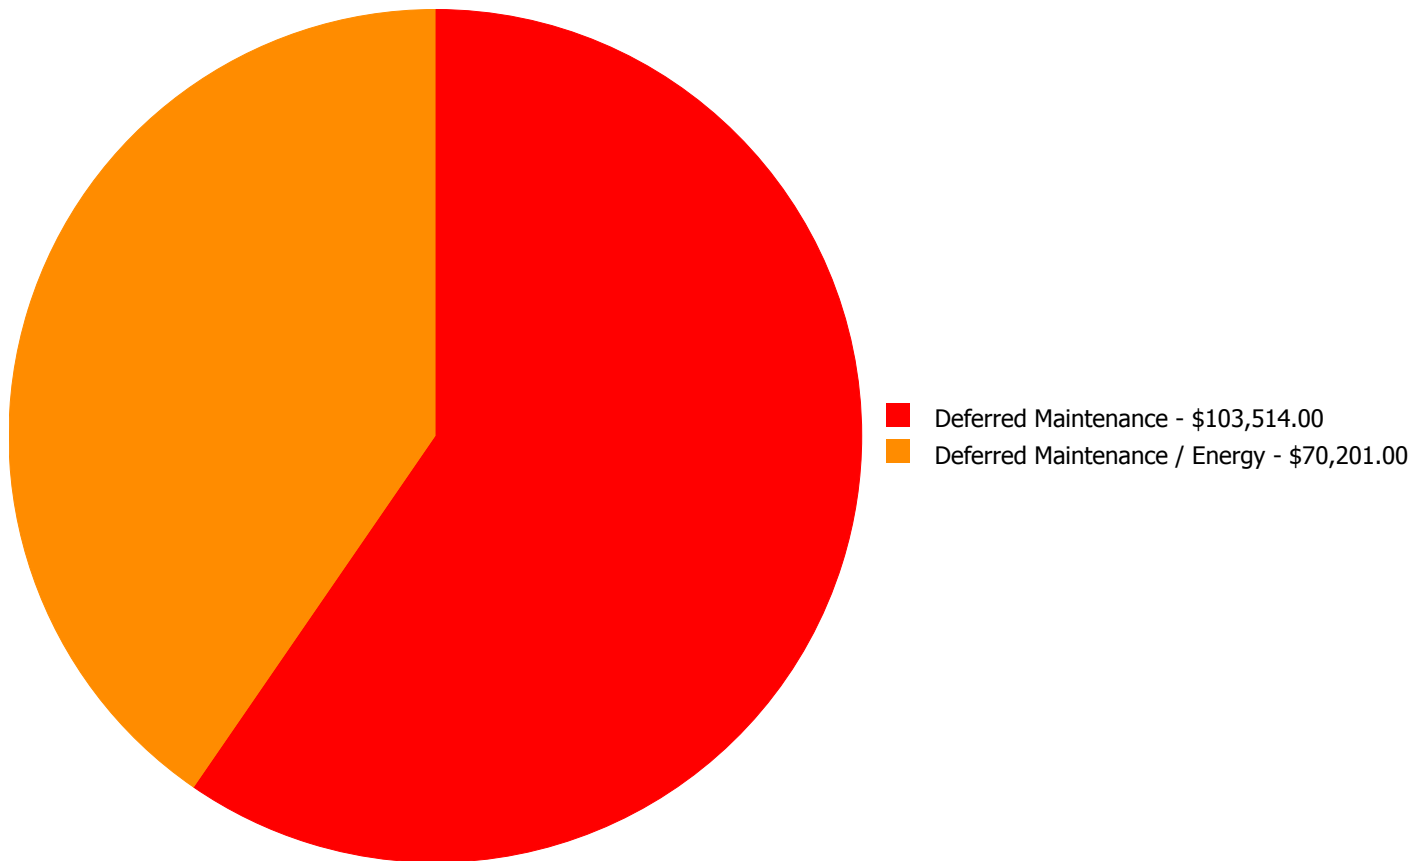

Budget Estimate Total: \$173,715.00

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 3 Priority:

System: C3010 - Wall Finishes - Paint



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$8,496.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The painted wall finishes are beyond their expected service life and should be replaced.

System: C3020 - Floor Finishes - Neoprene



Location: Basketball Court

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 4,500.00

Unit of Measure: S.F.

Estimate: \$71,577.00

Assessor Name: Ben Nixon

Date Created: 06/23/2015

Notes: The gym floor covering is beyond expected service life, torn and has some delamination, and should be replaced.

System: D3050 - Terminal & Package Units



Location: Throughout Building

Distress: Inadequate

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$70,201.00

Assessor Name: Sam Mandola

Date Created: 06/23/2015

Notes: The primary heating and cooling system consists of gas fire units heater, ventilation fans, and single PTAC unit in the office, which are inadequate and nearing the end of their expected life. These units should be replaced with a packaged system. SPLOST project 420-422 to install a 20 ton HVAC package in the gym.

System: D5030 - Communications and Security - Fire Alarm



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$12,835.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The fire alarm system is beyond its expected service life and should be scheduled for replacement.

System: D5030 - Communications and Security - Public Address & Clock System



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$5,303.00

Assessor Name: Ben Nixon

Date Created: 06/24/2015

Notes: The public address and clock system is beyond its expected service life and should be scheduled for replacement.

System: D5030 - Communications and Security - Security & CCTV



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$5,303.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The security and CCTV systems are beyond their expected service life and should be scheduled for replacement.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as $100 - \text{Total FCI}$ (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	58,963
Year Built:	1958
Last Renovation:	
Replacement Value:	\$1,385,285
Repair Cost:	\$1,379,045.76
Total FCI:	99.55 %
Total RSLI:	3.57 %
FCA Score:	0.45



Description:

The McLendon Elementary School site was originally constructed in 1958, has a total area of 8.3 acres, and is occupied by approximately 58,963 square feet of permanent building space. Campus site features include paved driveways and parking lots, pedestrian pavement, flag pole, landscaping, and fencing. Site mechanical and electrical features include water, sewer, natural gas, and site lighting. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report for the site features.

Attributes:

General Attributes:

Site Code: 1410

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
G20 - Site Improvements	6.71 %	90.36 %	\$666,242.04
G30 - Site Mechanical Utilities	0.00 %	110.00 %	\$474,121.49
G40 - Site Electrical Utilities	0.00 %	110.00 %	\$238,682.23
Totals:	3.57 %	99.55 %	\$1,379,045.76

Photo Album

The photo album consists of the various cardinal directions of the building.

1). Aerial Image of McLendon Elementary
School - Oct 21, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
G2010	Roadways	\$5.17	S.F.	21,359	25	1958	1983		0.00 %	110.00 %	-32		\$121,468.63	\$110,426
G2020	Parking Lots	\$4.56	S.F.	10,482	25	1958	1983		0.00 %	110.00 %	-32		\$52,577.71	\$47,798
G2030	Pedestrian Paving	\$1.50	S.F.	58,963	30	1958	1988		0.00 %	110.00 %	-27		\$97,288.95	\$88,445
G2040	Baseball Field	\$8.35	S.F.		20	1958	1978		0.00 %	0.00 %	-37			\$0
G2040	Canopies	\$0.29	S.F.		25	1958	1983		0.00 %	0.00 %	-32			\$0
G2040	Covered Walkways	\$48.72	S.F.	1,600	25	2003	2028		52.00 %	0.00 %	13			\$77,952
G2040	Fencing & Guardrails	\$0.91	S.F.	58,963	30	1990	2020		16.67 %	0.00 %	5			\$53,656
G2040	Football Field	\$5.85	S.F.		20	1958	1978		0.00 %	0.00 %	-37			\$0
G2040	Hard Surface Play Area	\$6.26	S.F.	7,741	20	1958	1978		0.00 %	110.00 %	-37		\$53,304.53	\$48,459
G2040	Playing Field	\$3.92	S.F.	57,411	20	1958	1978		0.00 %	110.00 %	-37		\$247,556.23	\$225,051
G2040	Soccer/Lacross Field	\$5.00	S.F.		20	1958	1978		0.00 %	0.00 %	-37			\$0
G2040	Softball Field	\$8.86	S.F.		20	1958	1978		0.00 %	0.00 %	-37			\$0
G2040	Tennis Courts	\$18.47	S.F.		20	1958	1978		0.00 %	0.00 %	-37			\$0
G2040	Track	\$7.04	S.F.		10	1958	1968		0.00 %	0.00 %	-47			\$0
G2050	Landscaping	\$1.45	S.F.	58,963	15	1958	1973		0.00 %	110.00 %	-42		\$94,045.99	\$85,496
G3010	Water Supply	\$1.83	S.F.	58,963	50	1958	2008		0.00 %	110.00 %	-7		\$118,692.52	\$107,902
G3020	Sanitary Sewer	\$1.15	S.F.	58,963	50	1958	2008		0.00 %	110.00 %	-7		\$74,588.20	\$67,807
G3030	Storm Sewer	\$3.55	S.F.	58,963	50	1958	2008		0.00 %	110.00 %	-7		\$230,250.52	\$209,319
G3060	Fuel Distribution	\$0.78	S.F.	58,963	40	1958	1998		0.00 %	110.00 %	-17		\$50,590.25	\$45,991
G4010	Electrical Distribution	\$1.86	S.F.	58,963	50	1958	2008		0.00 %	110.00 %	-7		\$120,638.30	\$109,671
G4020	Site Lighting	\$1.15	S.F.	58,963	30	1958	1988		0.00 %	110.00 %	-27		\$74,588.20	\$67,807
G4030	Site Communications & Security	\$0.67	S.F.	58,963	10	1958	1968		0.00 %	110.00 %	-47		\$43,455.73	\$39,505
Total									3.57 %	99.55 %			\$1,379,045.76	\$1,385,285

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

School Assessment Report - Site


Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$1,379,046	\$0	\$0	\$0	\$0	\$68,423	\$0	\$0	\$0	\$0	\$58,401	\$1,505,870
G - Building Sitework	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G20 - Site Improvements	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2010 - Roadways	\$121,469	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$121,469
G2020 - Parking Lots	\$52,578	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$52,578
G2030 - Pedestrian Paving	\$97,289	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$97,289
G2040 - Baseball Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Canopies	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Covered Walkways	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Fencing & Guardrails	\$0	\$0	\$0	\$0	\$0	\$68,423	\$0	\$0	\$0	\$0	\$0	\$68,423
G2040 - Football Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Hard Surface Play Area	\$53,305	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$53,305
G2040 - Playing Field	\$247,556	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$247,556
G2040 - Soccer/Lacross Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Softball Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Tennis Courts	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Track	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2050 - Landscaping	\$94,046	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$94,046
G30 - Site Mechanical Utilities	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G3010 - Water Supply	\$118,693	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$118,693
G3020 - Sanitary Sewer	\$74,588	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$74,588
G3030 - Storm Sewer	\$230,251	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$230,251
G3060 - Fuel Distribution	\$50,590	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$50,590
G40 - Site Electrical Utilities	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G4010 - Electrical Distribution	\$120,638	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$120,638
G4020 - Site Lighting	\$74,588	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$74,588
G4030 - Site Communications & Security	\$43,456	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$58,401	\$101,857

* Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

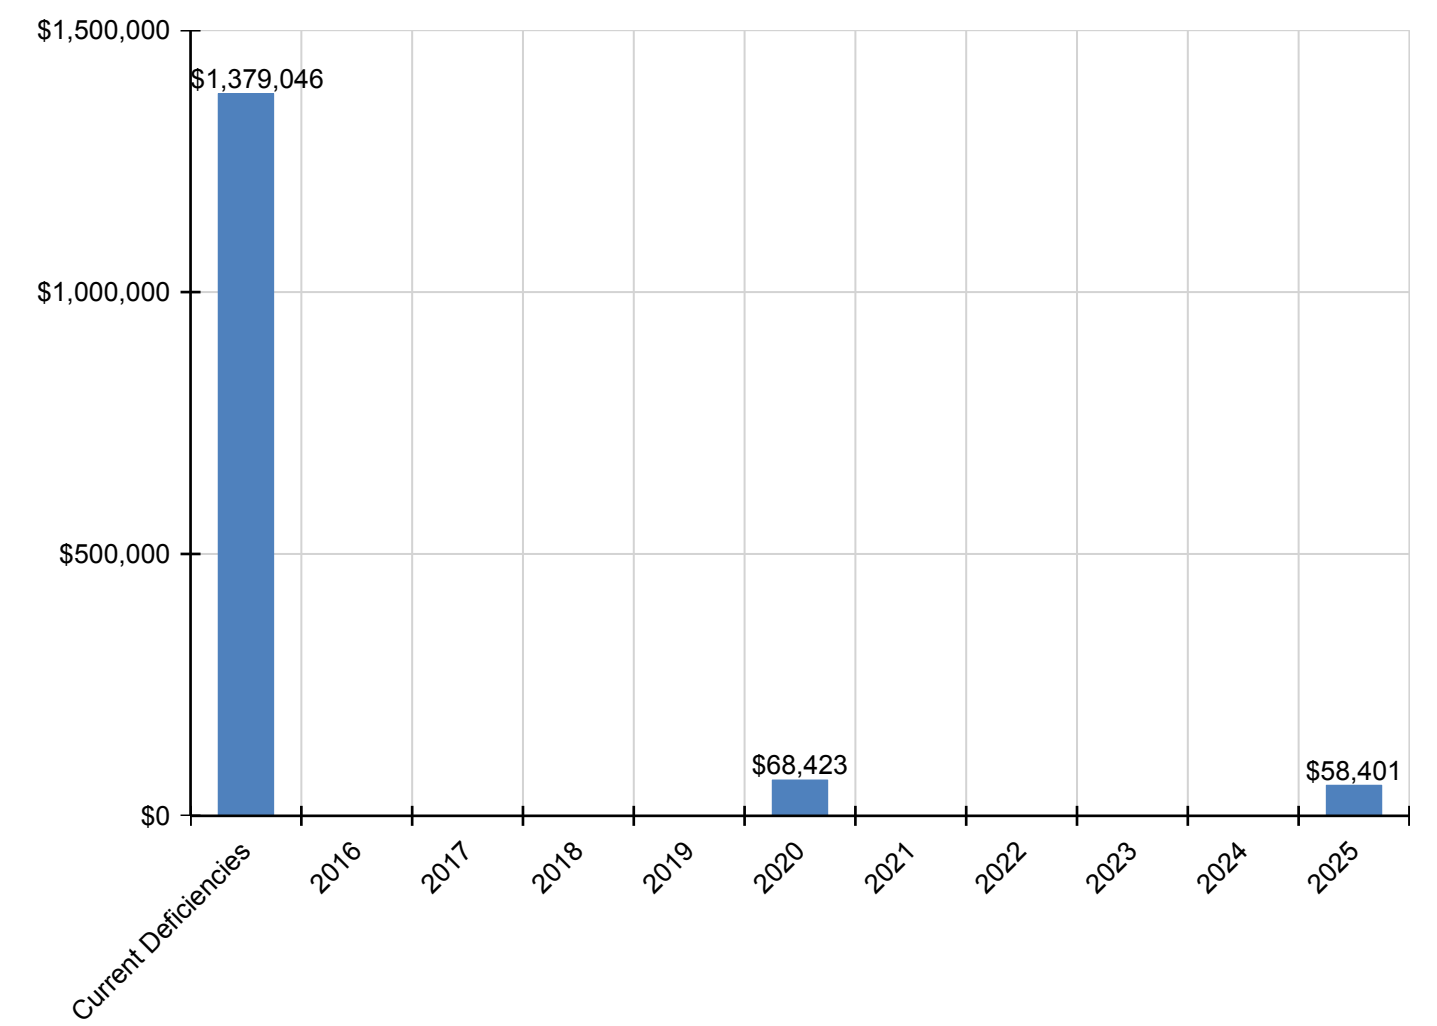

Deficiency Summary by System


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

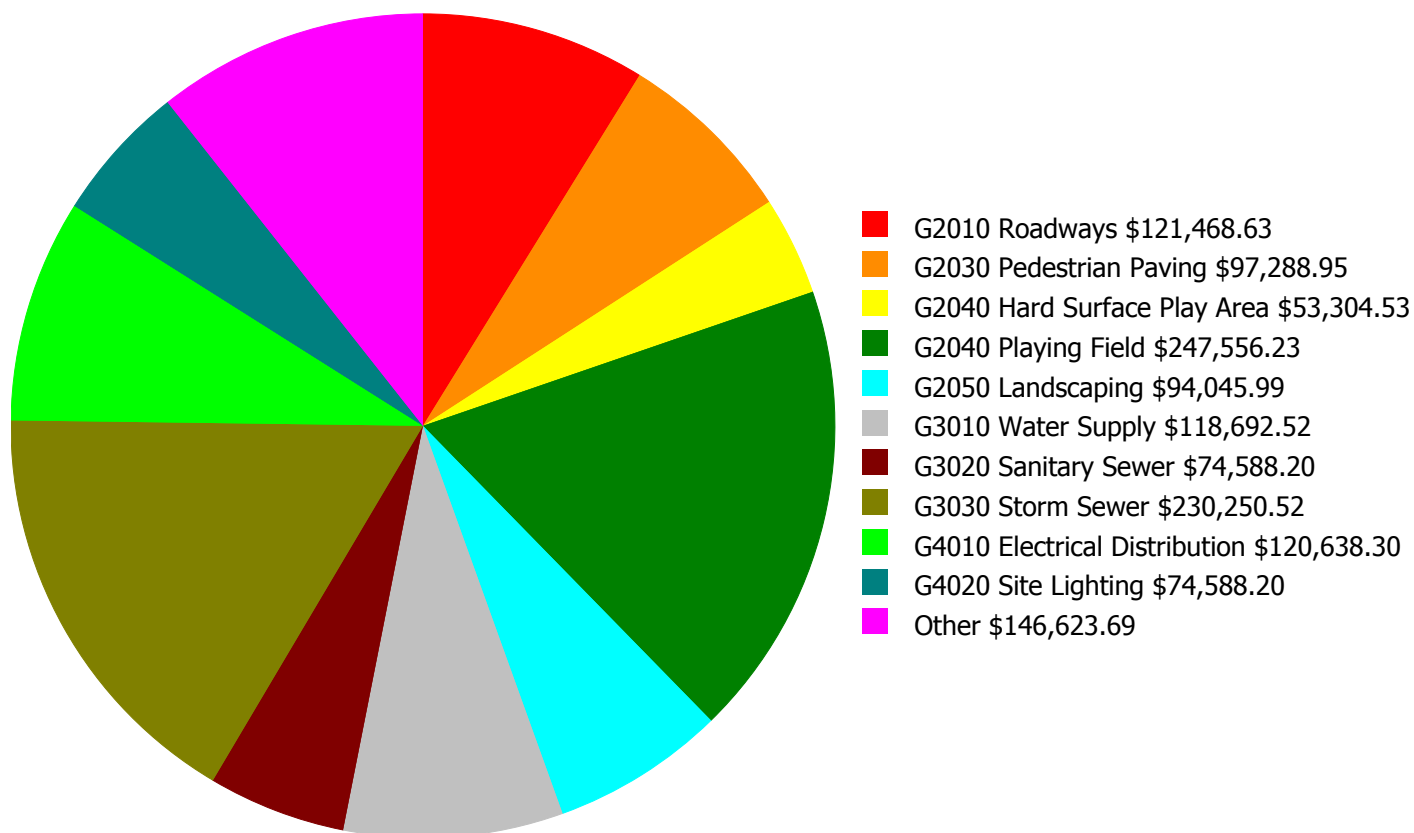

Budget Estimate Total: \$1,379,045.76

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

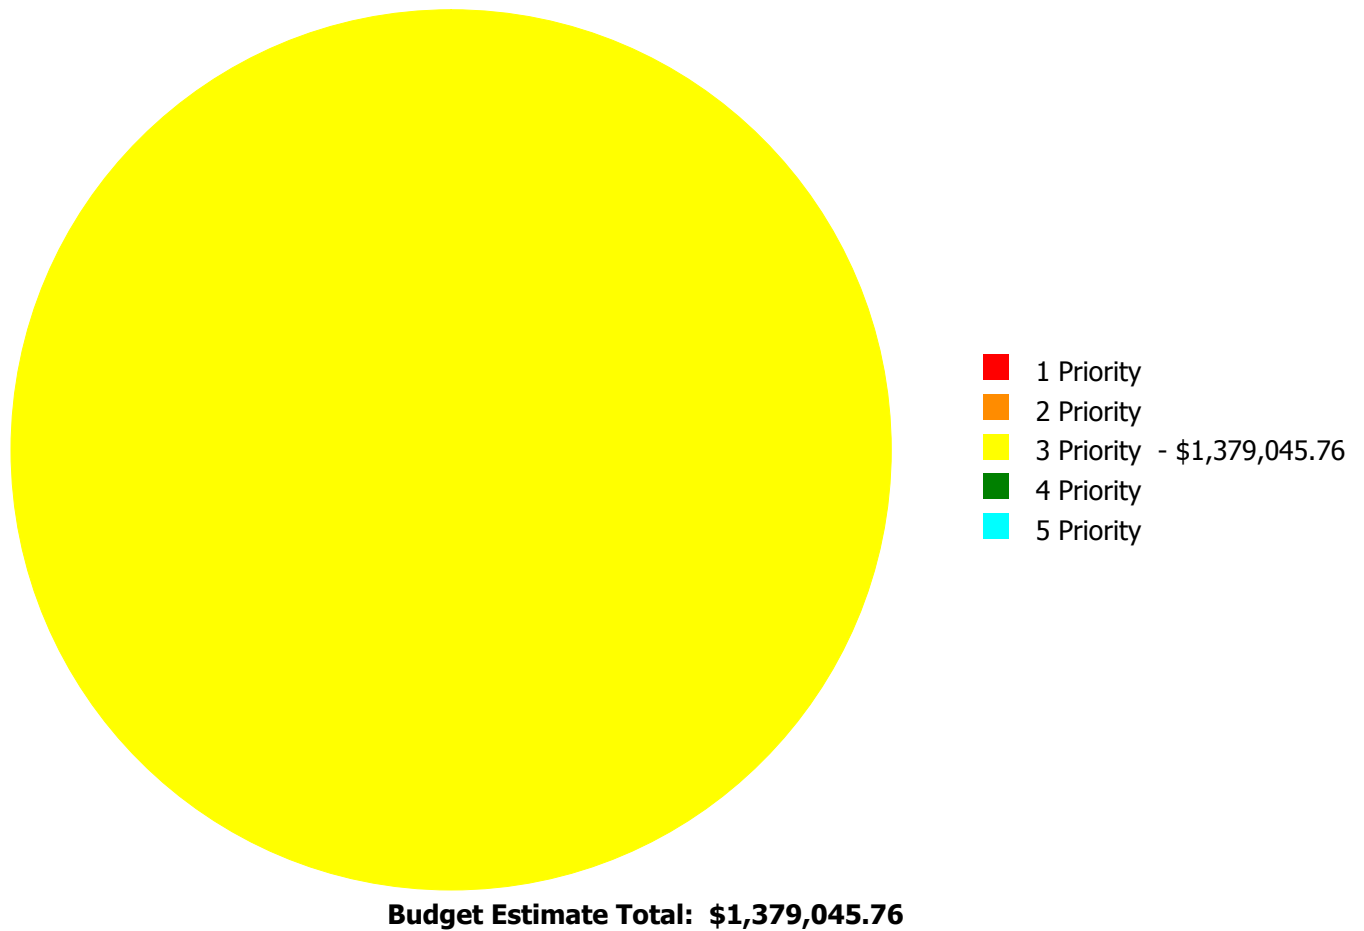

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards.
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
G2010	Roadways	\$0.00	\$0.00	\$121,468.63	\$0.00	\$0.00	\$121,468.63
G2020	Parking Lots	\$0.00	\$0.00	\$52,577.71	\$0.00	\$0.00	\$52,577.71
G2030	Pedestrian Paving	\$0.00	\$0.00	\$97,288.95	\$0.00	\$0.00	\$97,288.95
G2040	Hard Surface Play Area	\$0.00	\$0.00	\$53,304.53	\$0.00	\$0.00	\$53,304.53
G2040	Playing Field	\$0.00	\$0.00	\$247,556.23	\$0.00	\$0.00	\$247,556.23
G2050	Landscaping	\$0.00	\$0.00	\$94,045.99	\$0.00	\$0.00	\$94,045.99
G3010	Water Supply	\$0.00	\$0.00	\$118,692.52	\$0.00	\$0.00	\$118,692.52
G3020	Sanitary Sewer	\$0.00	\$0.00	\$74,588.20	\$0.00	\$0.00	\$74,588.20
G3030	Storm Sewer	\$0.00	\$0.00	\$230,250.52	\$0.00	\$0.00	\$230,250.52
G3060	Fuel Distribution	\$0.00	\$0.00	\$50,590.25	\$0.00	\$0.00	\$50,590.25
G4010	Electrical Distribution	\$0.00	\$0.00	\$120,638.30	\$0.00	\$0.00	\$120,638.30
G4020	Site Lighting	\$0.00	\$0.00	\$74,588.20	\$0.00	\$0.00	\$74,588.20
G4030	Site Communications & Security	\$0.00	\$0.00	\$43,455.73	\$0.00	\$0.00	\$43,455.73
	Total:	\$0.00	\$0.00	\$1,379,045.76	\$0.00	\$0.00	\$1,379,045.76

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

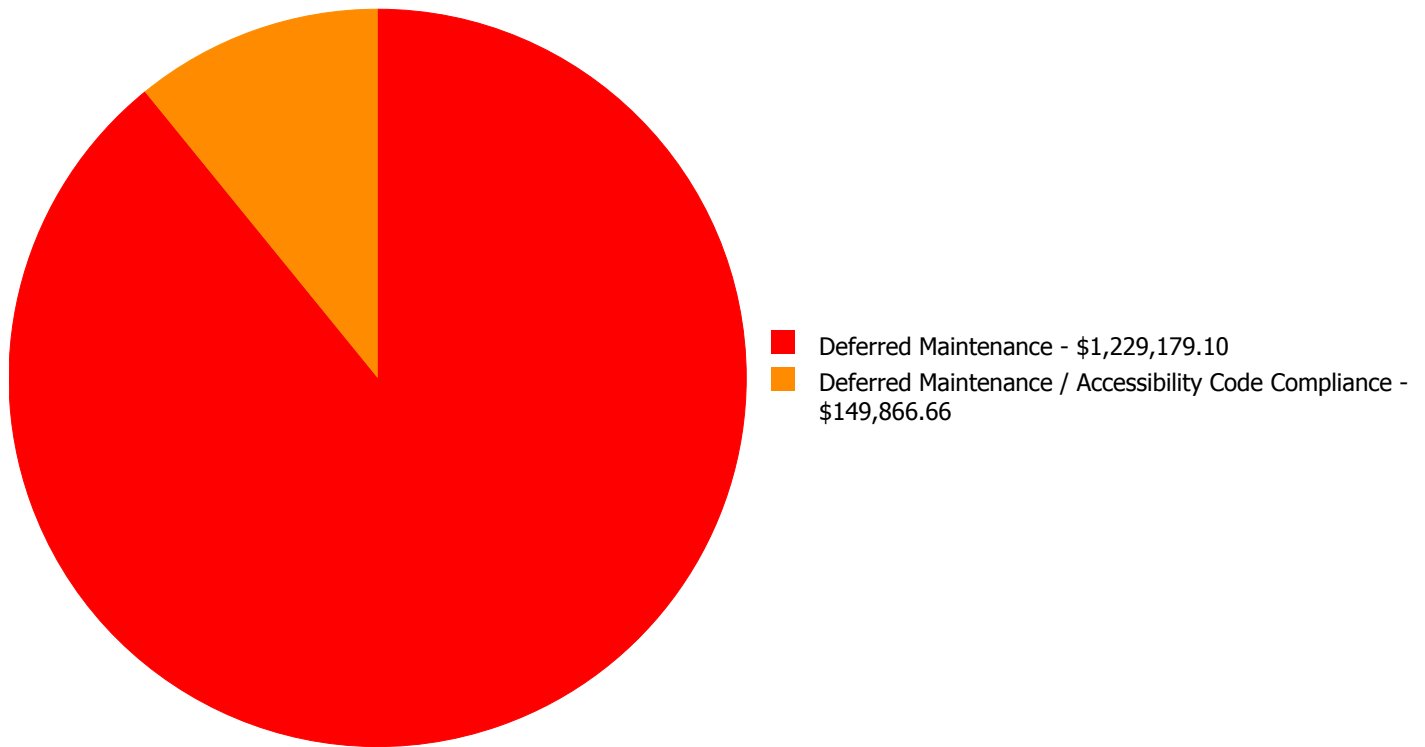

Budget Estimate Total: \$1,379,045.76

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 3 Priority:

System: G2010 - Roadways



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 21,359.00

Unit of Measure: S.F.

Estimate: \$121,468.63

Assessor Name: Eduardo Lopez

Date Created: 06/28/2015

Notes: Roadways are beyond their expected service life, damaged with cracks, worn, and should be replaced.

System: G2020 - Parking Lots



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 10,482.00

Unit of Measure: S.F.

Estimate: \$52,577.71

Assessor Name: Eduardo Lopez

Date Created: 06/28/2015

Notes: The parking lots are beyond their expected service life, worn, inadequate, not ADA compliant, and should be replaced. An unpaved area is used for parking because the parking lot is not adequately sized. Directional signage from the accessible parking to the accessible building entrance is missing.

System: G2030 - Pedestrian Paving



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 58,963.00

Unit of Measure: S.F.

Estimate: \$97,288.95

Assessor Name: Eduardo Lopez

Date Created: 06/28/2015

Notes: Pedestrian paving is beyond its expected service life, damaged, not ADA compliant, and should be replaced.

System: G2040 - Hard Surface Play Area



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 7,741.00

Unit of Measure: S.F.

Estimate: \$53,304.53

Assessor Name: Eduardo Lopez

Date Created: 06/28/2015

Notes: The hard surface play area is beyond its expected service life, damaged with cracks, and should be replaced.

System: G2040 - Playing Field



Location: Site
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 57,411.00
Unit of Measure: S.F.
Estimate: \$247,556.23
Assessor Name: Eduardo Lopez
Date Created: 07/31/2015

Notes: The playing fields are beyond their expected service life, have large bare spots, and should be re-sodded to prevent erosion.

System: G2050 - Landscaping



Location: Site
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 58,963.00
Unit of Measure: S.F.
Estimate: \$94,045.99
Assessor Name: Eduardo Lopez
Date Created: 06/23/2015

Notes: The landscape system is overgrown, damaging the building, and should be replaced.

System: G3010 - Water Supply



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 58,963.00

Unit of Measure: S.F.

Estimate: \$118,692.52

Assessor Name: Eduardo Lopez

Date Created: 06/23/2015

Notes: The site water supply system is beyond its expected service life and should be scheduled for replacement.

System: G3020 - Sanitary Sewer



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 58,963.00

Unit of Measure: S.F.

Estimate: \$74,588.20

Assessor Name: Eduardo Lopez

Date Created: 06/23/2015

Notes: The site sanitary sewer system is beyond its expected service life and should be scheduled for replacement.

System: G3030 - Storm Sewer



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 58,963.00

Unit of Measure: S.F.

Estimate: \$230,250.52

Assessor Name: Eduardo Lopez

Date Created: 06/23/2015

Notes: The site storm sewer system is beyond its expected service life and should be scheduled for replacement.

System: G3060 - Fuel Distribution



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 58,963.00

Unit of Measure: S.F.

Estimate: \$50,590.25

Assessor Name: Eduardo Lopez

Date Created: 06/23/2015

Notes: The site fuel distribution system is beyond its expected service life and should be scheduled for replacement.

System: G4010 - Electrical Distribution



Location: Site
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 58,963.00
Unit of Measure: S.F.
Estimate: \$120,638.30
Assessor Name: Eduardo Lopez
Date Created: 06/23/2015

Notes: The site electrical distribution system is beyond its expected service life and should be scheduled for replacement.

System: G4020 - Site Lighting



Location: Site
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 58,963.00
Unit of Measure: S.F.
Estimate: \$74,588.20
Assessor Name: Eduardo Lopez
Date Created: 06/23/2015

Notes: Site lighting is beyond its expected service life, inadequate on the south and west sides, and should be scheduled for replacement.

System: G4030 - Site Communications & Security



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 58,963.00

Unit of Measure: S.F.

Estimate: \$43,455.73

Assessor Name: Eduardo Lopez

Date Created: 06/23/2015

Notes: The site communications and security systems are beyond their expected service life and should be scheduled for replacement.

Glossary

Abandoned	A facility owned by a district that is not occupied and not maintained. See Vacant.
Additional Cost	Total project cost is composed of hard and soft costs. Additional costs or soft expenses are costs that are necessary to accomplish the corrective work but are not directly attributable to the deficient systems direct construction cost, which are often referred to as hard cost. The components included in the soft costs vary by owner but usually include architect and contractor fees, contingencies and other owner-incurred costs necessary to fully develop and build a facility. These soft cost factors can be adjusted anytime within the eCOMET® database at the owner's discretion.
Assessment	Visual survey of a facility to determine its condition. It involves looking at the age of systems, reviewing information from local sources and visual evidence of potential problems to assign a condition rating. It does not include destructive testing of materials or testing of systems or equipment for functionality.
ASTM	ASTM International (ASTM): Originally known as the American Society for Testing and Materials, ASTM is an international standards organization that develops and publishes voluntary consensus technical standards for a wide range of materials, products, systems, and services.
BOMA	Building Owners Managers of America (BOMA): National organization of public and private facility owners focused on building management tools and maintenance techniques. eCOMET® reference: Building and component system effective economic life expectancies.
Building	A fully enclosed and roofed structure that can be traversed internally without exiting to the exterior.
Building Addition	An area, space or component of a building added to a building after the original building's year built date. NOTE: As a convention in the database, "Main" was used to designate the original building. Additions built prior to 1983 (30 years) were included in the main building area calculations to reflect their predicted system depreciation characteristics and remaining service life.
Building Systems	eCOMET® uses UNIFORMAT II to organize building data. UNIFORMAT II was originally developed by the federal General Services Administration to delineate building costs by systems rather than by material. UNIFORMAT II was formalized by an NIST standard, NISTIR 6389 in 1999. It has been further quantified and updated by ASTM standard 2005, E1557-05. The Construction Specifications Institute, CSI, has taken over the standard as part of their MasterFormat / MasterSpec system.
Calculated Next Renewal	The year a system or building element would be expected to expire based solely on the date it was installed and the expected useful lifetime for that kind of system.
Capital Renewal	Capital renewal refers to the cyclical replacement of building systems or elements as they become obsolete or beyond their useful life. It is not normally included in an annual operating/maintenance budget. See calculated next renewal and next renewal.
City Cost Index (CCI)	RS Means provides building system, equipment, and construction costs at a national level. The City Cost Index (also provided by RS Means) localizes those costs to a geographic region of the United States. In eCOMET®, each building or site is assigned a City Cost Index, which adjusts all of the associated costs for systems, deficiencies and inventory to the local value.
Condition	Condition refers to the state of physical fitness or readiness of a facility system or system element for its intended use.
Condition Budget	The Condition Budget, also known as Condition Needs, represents the budgeted contractor installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging the work.

School Assessment Report - McLendon Elementary

Condition Index (CI) %	The Condition Index (CI) also known as the Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) Value divided by the sum of a system's Replacement Value (both values exclude soft cost to simplify calculation updates) expressed as a percentage ranging from 100.00% (new) to 0.00% (expired - no remaining life).
Construction Specifications Institute	Construction Specifications Institute: Primary national organization specializing in construction materials data and data location in construction documents. eCOMET® reference: UNIFORMAT II materials classification.
Correction	Correction refers to an assessor's recommended deficiency repair or replacement action. For any system or element deficiency, there can be multiple and alternative solutions for its repair or replacement. A Correction is user defined and tied to a UNIFORMAT II element, or system it is intended to address. It excludes other peripheral costs that may also be included in the packaging of repair, replacement or renewal improvements that may also be triggered by the deficiency correction.
Cost Model	A cost model is a list of facility systems which could represent the installed systems a given facility. Included in the cost model are standard unit cost estimates, gross areas, life cycles and installed dates. Also represented is the repair cost for deficient systems, replacement values. See eCOMET® cost models.
Criteria	Criteria refer to the set of requirements, guidelines or standards that are assessed and rated to develop a score.
Current Period	The Current Period is the current year plus a user defined number of forward years.
Current Replacement Value (CRV)	The Current Replacement Value (CRV) of a facility, building or system represents the hypothetical cost of rebuilding or replacing an existing facility under today's codes and construction standards, using its current configuration. It is calculated by multiplying the gross area of the facility by a square foot cost developed in that facility's cost model. Replacement cost includes construction costs and owner's additional or soft costs for fees, permits and other expenses to reflect a total project cost.
Deferred Maintenance	Deferred maintenance is condition work deferred on a planned or unplanned basis to a future budget cycle or postponed until funds are available.
Deficiency	A deficiency is a repair item that is damaged, missing, inadequate or insufficient for an intended purpose.
Deficiency Category	Deficiency Category refers to the type or class of a user defined deficiency grouping with shared or similar characteristics. Category descriptions include, but are not limited to: Accessibility Code Compliance, Appearance, Building Code Compliance, Deferred Maintenance, Energy, Environmental, Life Safety Code Compliance, and Safety.
Deficiency Distress	Deficiency Distress refers to a user-defined root cause of a deficiency. Distress descriptions are: Beyond Service Life, Damaged, Inadequate, Needs Remediation, and Missing.
Deficiency Priority	Deficiency Priority refers to a deficiency's urgency for repair as determined by the assessment team. Deficiencies were assigned a priority of 1 through 5, with Priority 1 deficiencies being the most urgent.
eCOMET®	Energy and Condition Management Estimation Technology (eCOMET®) is Parsons proprietary facility asset management software developed to provide facility managers with a state of the art, web-based tool to develop and maintain a comprehensive database of FCA data and information used for facility asset management, maintenance and repair, and capital renewal planning. eCOMET® is used by Parsons and its clients as the primary tool for collecting FCA data, preparing cost estimates, generating individual facility reports and cost estimates, and developing the overall capital renewal program.

School Assessment Report - McLendon Elementary

eCOMET® Cost Models	eCOMET® cost models are derived from RS Means Square Foot Cost Data cost models and these models are used to develop the current replacement value (CRV) and assign life cycle costs to the various systems within a building. Cost models are assigned current costs-per-square-foot to establish replacement values. The Cost models are designed to represent a client specific facility that meets local standards cost trends.
Element	Elements are the major components that comprise building systems as defined by UNIFORMAT II.
Expected Life	Also referred to as Useful Life. See Useful Life definition.
Facility	A facility refers to site(s), building(s), or building addition(s), or combinations thereof that provide a particular service or support of an educational purpose.
Facility Attributes	Customizable eCOMET® fields to identify attributes specific to a facility. These fields are part of the eCOMET® database set-up with the owner.
Facility Condition Assessment (FCA)	A facility condition assessment (FCA) is a visual inspection of buildings and grounds at a facility to identify and estimate current and future needed repairs or replacements of major systems for planning and budgeting purposes. It is typically performed for organizations that are tasked with the day to day maintenance, operation, and capital renewal (replacement) of building systems and components of a large inventory of facilities. The primary goal of an FCA is to objectively and quantifiably identify, inspect, and prioritize the repair and replacement needs of the building and ground systems (e.g., roofs, windows, doors, floor finishes, plumbing fixtures, parking lot, and sidewalks) within facilities that have either failed or have surpassed their service life, and to identify and forecast future capital replacement needs for systems that have not yet failed, but planned replacement of those systems is needed to ensure that the facilities will continue to meet the mission of the organization.
Facility Condition Index (FCI)	FCI is an industry-standard measurement of a facility's condition expressed as a percentage from 0.00% to 100.00% that is derived by dividing the cost to correct a facility's deficiencies by its Current Replacement Value (CRV). The higher the FCI the poorer the condition of a facility. After an FCI is established for all buildings within a portfolio, a building's condition can be ranked relative to other buildings. The FCI may also represent the condition of a portfolio based on the cumulative FCIs of the portfolio's facilities.
Forecast Period	The Forecast Period refers to a user defined number of years forward of the Current Period.
Gen (Generate)	The Cost Model has a Gen box for each system line item. By checking the box, eCOMET® will generate life cycle deficiencies based on the Year Installed and the Life for that system. Systems that typically do not re-generate (foundations, floor construction, roof construction, basement walls, etc.) would not have the Gen box checked as those systems would not re-generate at the end of a life cycle. In those instances, it would be more practical and cost effective to demolish the entire facility than renew those systems.
Gross Square Feet (GSF)	The area of the enclosed floor space of a building or building addition in square feet measured to the outside face of the enclosing wall.
Life cycle	Life cycle refers to the period of time that a building or site system or element can be expected to adequately serve its intended function. Parsons assigns expected life cycles to all building systems based on Building Operators and Managers of America (BOMA) recommended life cycles, manufacturers suggested life, and RS Means cost data, and client-provided historical data. BOMA standards are a nationally recognized source of life cycle data for various components and/or systems associated with facilities. RS Means is a national company specializing in construction estimating and costs.
Next Renewal	Next Renewal refers to a manually-adjusted expected useful life of a system or element based on on-site inspection either by reducing or extending the Calculated Next Renewal to more accurately reflect current conditions.

School Assessment Report - McLendon Elementary

Order of Magnitude	Order of Magnitude refers to a rough approximation made with a degree of knowledge and confidence that the budgeted, projected or estimated cost falls within a reasonable range of cost values.
Remaining Service Life (RSL)	RSL is the number of years of service remaining for a system or equipment item. It is automatically calculated based on the difference between the current year and the Calculated Next Renewal date or the Next Renewal date whichever one is the later date.
Renewal Factors	Renewal factors represent the difference in cost of renovating or replacing an existing system, rather than new construction of a building system. For example, installing a new built-up roof on an existing building would include removing and disposing of the old roof, a cost not associated with new construction. Using a renewal premium to account for demolition and other difficulty costs, Parsons typically assigns a renewal factor of 110%.
Renewal Schedule	A timeline by year that indicates when the systems will need to be renewed and the estimated price of the renewal.
Repair Cost	Repair cost is the sum of all the deficiencies associated with a building or multiple buildings/facilities. It will include any applied soft costs or City Cost Indexes.
Replacement Value	See Current Replacement Value.
Site	A facility's grounds and its utilities, roadways, landscaping, fencing and other typical land improvements needed to support a facility.
Soft Costs	Soft Costs are a construction industry term that refers to expense items that are not considered direct construction costs. Soft costs are user-defined and include architectural, engineering, management, testing, and mitigation fees, and other owner pre- and post-construction expenses.
Sustainability	Sustainability refers to the collection of policies and strategies that meet society's present needs without compromising the ability of future generations to meet their own needs.
System	System refers to building and related site work elements as described by ASTM UNIFORMAT II Classification for Building Elements (E1557-97), a format for classifying major facility elements common to most buildings. Elements usually perform a given function regardless of the design specification construction method or materials used. See also UNIFORMAT II.
System Generated Deficiency	eCOMET® automatically generates system deficiencies based on system life cycles using the systems installation dates as the base year. By adjusting the Next Renewal date ahead or behind the predicted or stated life cycle date, a system cost will come due earlier or later than the originally installed life cycle date. This utility accounts for good maintenance conditions and a longer life, or early expiration of a system life due to any number of adverse factors such as poor installation, acts of god, material defects, poor design applications and other factors that may shorten the life of a material or system. It is important to mention that the condition of the systems is not necessarily a reflection of maintenance practices, but a combination of system usage and age.
UNIFORMAT	ASTM UNIFORMAT II, Classification for Building Elements (E1557-97), a publication of the Construction Specification Institute (CSI), is a format used to classify major facility components common to most buildings. The format is based on functional elements or parts of a facility characterized by their functions without regard to the materials and methods used to accomplish them. These elements are often referred to as systems or assemblies.
Unit Price	The Unit Price (Raw) x (100% + the Additional Cost Template percentage).
Unit Price (Raw)	The actual \$/sq. ft cost being used for the building and systems. It will include adjustments for the City Cost Index applied to the facility.

School Assessment Report - McLendon Elementary

Useful Life	Also known as Expected Life, Useful Life refers to the intrinsic period of time a system or element is expected to perform as intended. Useful life is generally provided by manufacturers of materials, systems and elements through their literature, testing and experience. Useful Lives in the database are derived from the Building Owners and Managers (BOMA) organization's guidelines, RSMeans cost data, and from client- defined historical experience.
Vacant	Vacant refers to a facility that is not occupied but is a maintained facility by a district. See Abandoned.
Year Built	The year that a building or addition was originally built based on its date of substantial completion or occupancy.
Year Installed	The year a system or element was built or the most recent major renovation date where a minimum of 70% of the system's Current Replacement Value (CRV) was replaced.