

DeKalb County School District/Elementary Schools

Panola Way Elementary

Final

School Assessment Report

May 20, 2016



Table of Contents

School Executive Summary	4
School Condition Summary	6
<u>1987 Building</u>	8
Executive Summary	8
Condition Summary	9
Photo Album	10
Condition Detail	11
System Listing	12
Renewal Schedule	14
Forecasted Sustainment Requirement	17
Deficiency Summary By System	18
Deficiency Summary By Priority	19
Deficiency By Priority Investment	20
Deficiency Summary By Category	21
Deficiency Details By Priority	22
<u>2003 Gym</u>	30
Executive Summary	30
Condition Summary	31
Photo Album	32
Condition Detail	33
System Listing	34
Renewal Schedule	35
Forecasted Sustainment Requirement	37
Deficiency Summary By System	38
Deficiency Summary By Priority	39
Deficiency By Priority Investment	40
Deficiency Summary By Category	41
Deficiency Details By Priority	42
<u>2004 Addition</u>	43

School Assessment Report

Executive Summary	43
Condition Summary	44
Photo Album	45
Condition Detail	46
System Listing	47
Renewal Schedule	49
Forecasted Sustainment Requirement	52
Deficiency Summary By System	53
Deficiency Summary By Priority	54
Deficiency By Priority Investment	55
Deficiency Summary By Category	56
Deficiency Details By Priority	57
<u>Site</u>	58
Executive Summary	58
Condition Summary	59
Photo Album	60
Condition Detail	61
System Listing	62
Renewal Schedule	63
Forecasted Sustainment Requirement	65
Deficiency Summary By System	66
Deficiency Summary By Priority	67
Deficiency By Priority Investment	68
Deficiency Summary By Category	69
Deficiency Details By Priority	70
Glossary	74

School Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as $100 - \text{Total FCI}$ (without the %) where 100 is best and 0 is worst condition.

Gross Area (SF):	86,218
Year Built:	1987
Last Renovation:	
Replacement Value:	\$19,861,458
Repair Cost:	\$8,984,008.56
Total FCI:	45.23 %
Total RSLI:	24.98 %
FCA Score:	54.77



Description:

The Panola Way Elementary School campus consists of two buildings located at 2170 Panola Way Court in Lithonia, Georgia. The original campus was constructed in 1987, an addition to the main school building was constructed in 2004, and a gymnasium building was constructed in 2003. In addition to the buildings, the campus contains a covered walkway, playground, and playing field. Improvements are planned under a current SPLOST project by October 2016, including a new roof covering, cooling tower, fan coil units, heat pumps, grease trap, lighting in classrooms and restrooms, as well as minor ADA improvements, in the 1987 building, and a new HVAC system is planned for the gymnasium. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report for each building and site improvement on the campus.

School Assessment Report - Panola Way Elementary

Attributes:

General Attributes:

Assigned Region:	Region 4	Board District:	District 7
DOE Facility:	188	Geographic Region:	Region 4
HS Attendance Area:	Miller Grove HS	Jurisdictional City:	DeKalb County (Unincorporated)
Site Acreage:	14.6		

School Condition Summary

The Table below shows the RSLI and FCI for each major system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.


Current Investment Requirement and Condition by Uniformat Classification

UNIFORMAT Classification	RSLI%	FCI %	Current Repair
A10 - Foundations	75.84 %	0.00 %	\$0.00
A20 - Basement Construction	0.00 %	0.00 %	\$0.00
B10 - Superstructure	77.70 %	0.00 %	\$0.00
B20 - Exterior Enclosure	46.97 %	0.00 %	\$0.00
B30 - Roofing	12.35 %	87.81 %	\$1,524,793.00
C10 - Interior Construction	50.91 %	18.74 %	\$205,516.00
C20 - Stairs	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	20.99 %	53.26 %	\$1,254,048.00
D10 - Conveying	0.00 %	0.00 %	\$0.00
D20 - Plumbing	18.17 %	0.00 %	\$0.00
D30 - HVAC	6.68 %	90.13 %	\$2,879,651.00
D40 - Fire Protection	16.33 %	0.00 %	\$0.00
D50 - Electrical	14.71 %	50.90 %	\$1,068,091.00
E10 - Equipment	0.51 %	108.76 %	\$530,363.00
E20 - Furnishings	7.68 %	91.23 %	\$395,562.00
G20 - Site Improvements	4.73 %	82.94 %	\$953,376.12
G30 - Site Mechanical Utilities	42.51 %	0.00 %	\$0.00
G40 - Site Electrical Utilities	22.24 %	54.40 %	\$172,608.44
Totals:	24.98 %	45.23 %	\$8,984,008.56

Condition Deficiency Priority

Facility Name	Gross Area (S.F.)	FCI %	1 Priority	2 Priority	3 Priority	4 Priority	5 Priority
1987 Building	66,965	54.90	\$0.00	\$861,103.00	\$6,918,224.00	\$0.00	\$0.00
2003 Gym	5,478	8.66	\$0.00	\$0.00	\$78,697.00	\$0.00	\$0.00
2004 Addition	13,775	0.00	\$0.00	\$0.00	\$0.00	\$0.00	\$0.00
Site	86,218	53.69	\$0.00	\$112,318.08	\$1,013,666.48	\$0.00	\$0.00
Total:		45.23	\$0.00	\$973,421.08	\$8,010,587.48	\$0.00	\$0.00

Deficiencies By Priority

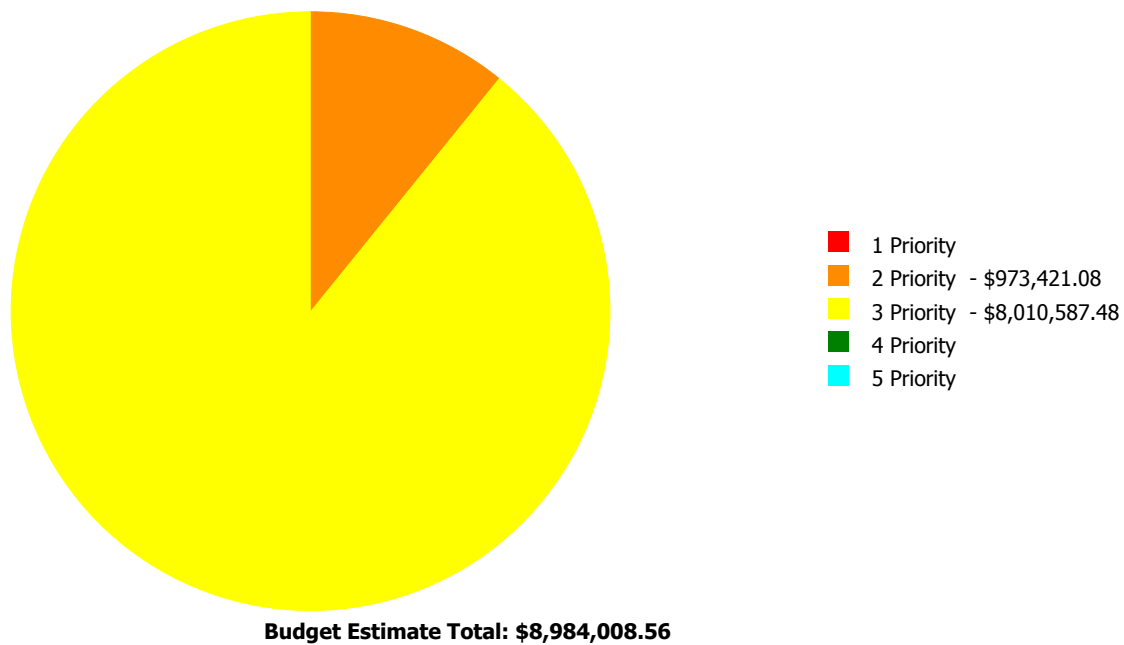

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	66,965
Year Built:	1987
Last Renovation:	
Replacement Value:	\$14,170,154
Repair Cost:	\$7,779,327.00
Total FCI:	54.90 %
Total RSLI:	17.17 %
FCA Score:	45.10



Description:

The main building at Panola Way Elementary School is a one-story building located at 2170 Panola Way Court in Lithonia, Georgia. Originally built in 1987, there has been one addition in 2004 and no major renovations. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:

Building Codes:	2010	Fire Sprinkler System:	Yes
-----------------	------	------------------------	-----

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	72.00 %	0.00 %	\$0.00
A20 - Basement Construction	0.00 %	0.00 %	\$0.00
B10 - Superstructure	72.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	38.17 %	0.00 %	\$0.00
B30 - Roofing	0.00 %	110.00 %	\$1,524,793.00
C10 - Interior Construction	42.71 %	25.18 %	\$205,516.00
C20 - Stairs	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	17.23 %	63.64 %	\$1,245,552.00
D10 - Conveying	0.00 %	0.00 %	\$0.00
D20 - Plumbing	7.03 %	0.00 %	\$0.00
D30 - HVAC	0.00 %	110.00 %	\$2,809,450.00
D40 - Fire Protection	6.67 %	0.00 %	\$0.00
D50 - Electrical	4.98 %	63.98 %	\$1,068,091.00
E10 - Equipment	0.00 %	110.00 %	\$530,363.00
E20 - Furnishings	0.00 %	110.00 %	\$395,562.00
Totals:	17.17 %	54.90 %	\$7,779,327.00

Photo Album

The photo album consists of the various cardinal directions of the building.

1). Main Entrance - Jun 03, 2015



2). West Elevation - Jun 03, 2015



3). South Elevation - Jun 03, 2015



4). Southeast Elevation - Jun 03, 2015



5). East Elevation - Jun 03, 2015



6). Northeast Elevation - Jun 03, 2015



7). North Elevation - Jun 03, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

School Assessment Report - 1987 Building

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$6.49	S.F.	66,965	100	1987	2087		72.00 %	0.00 %	72			\$434,603
A1020	Special Foundations	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
A1030	Slab on Grade	\$7.09	S.F.	66,965	100	1987	2087		72.00 %	0.00 %	72			\$474,782
A2010	Basement Excavation	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
A2020	Basement Walls	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B1010	Floor Construction	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B1020	Roof Construction	\$5.34	S.F.	66,965	100	1987	2087		72.00 %	0.00 %	72			\$357,593
B2010	Exterior Walls	\$16.02	S.F.	66,965	60	1987	2047		53.33 %	0.00 %	32			\$1,072,779
B2020	Exterior Windows	\$6.79	S.F.	66,965	30	1987	2017		6.67 %	0.00 %	2			\$454,692
B2030	Exterior Doors	\$0.92	S.F.	66,965	30	1987	2017		6.67 %	0.00 %	2			\$61,608
B3010	Roof Coverings - Asphal Shingles	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B3010	Roof Coverings - BUR	\$20.70	S.F.	66,965	25	1987	2012		0.00 %	110.00 %	-3		\$1,524,793.00	\$1,386,176
B3010	Roof Coverings - EPDM	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B3010	Roof Coverings - Preformed Metal	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B3010	Roof Coverings - Standing Seam Metal	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B3020	Roof Openings	\$0.00	S.F.		0				0.00 %	0.00 %				\$0
C1010	Partitions	\$7.01	S.F.	66,965	100	1987	2087		72.00 %	0.00 %	72			\$469,425
C1020	Interior Doors	\$2.39	S.F.	66,965	30	1987	2017		6.67 %	0.00 %	2			\$160,046
C1030	Fittings	\$2.79	S.F.	66,965	20	1987	2007		0.00 %	110.00 %	-8		\$205,516.00	\$186,832
C2010	Stair Construction	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3010	Wall Finishes - Ceramic & Glazed	\$10.27	S.F.	2,503	30	1987	2017		6.67 %	0.00 %	2			\$25,706
C3010	Wall Finishes - Paint	\$1.93	S.F.	61,114	10	2000	2010	2018	30.00 %	0.00 %	3			\$117,950
C3010	Wall Finishes - Wall Coverings	\$2.13	S.F.	3,348	10	1987	1997	2020	50.00 %	0.00 %	5			\$7,131
C3020	Floor Finishes - Carpet	\$8.50	S.F.	6,740	8	2000	2008		0.00 %	110.00 %	-7		\$63,019.00	\$57,290
C3020	Floor Finishes - Ceramic & Quarry Tile	\$14.49	S.F.	5,685	50	1987	2037		44.00 %	0.00 %	22			\$82,376
C3020	Floor Finishes - Terrazzo	\$53.01	S.F.	11,160	50	1987	2037		44.00 %	0.00 %	22			\$591,592
C3020	Floor Finishes - VCT	\$9.54	S.F.	42,633	20	1987	2007		0.00 %	110.00 %	-8		\$447,391.00	\$406,719
C3020	Floor Finishes - Wood	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3030	Ceiling Finishes	\$9.98	S.F.	66,965	20	1987	2007		0.00 %	110.00 %	-8		\$735,142.00	\$668,311
D1010	Elevators and Lifts	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
D2010	Plumbing Fixtures	\$17.66	S.F.	66,965	30	1987	2017		6.67 %	0.00 %	2			\$1,182,602
D2020	Domestic Water Distribution	\$3.99	S.F.	66,965	30	1987	2017		6.67 %	0.00 %	2			\$267,190
D2030	Sanitary Waste	\$3.41	S.F.	66,965	30	1987	2017		6.67 %	0.00 %	2			\$228,351
D2040	Rain Water Drainage	\$0.98	S.F.	66,965	30	1987	2017		6.67 %	0.00 %	2			\$65,626

School Assessment Report - 1987 Building

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
D2090	Other Plumbing Systems - Natural Gas	\$0.41	S.F.	66,965	40	1987	2027		30.00 %	0.00 %	12			\$27,456
D3020	Heat Generating Systems	\$4.55	S.F.	66,965	30	1987	2017	2015	0.00 %	110.00 %	0		\$335,160.00	\$304,691
D3030	Cooling Generating Systems	\$4.73	S.F.	66,965	25	1987	2012		0.00 %	110.00 %	-3		\$348,419.00	\$316,744
D3040	Distribution & Exhaust Systems	\$5.51	S.F.	66,965	30	1987	2017	2015	0.00 %	110.00 %	0		\$405,875.00	\$368,977
D3050	Terminal & Package Units	\$18.52	S.F.	66,965	15	1987	2002		0.00 %	110.00 %	-13		\$1,364,211.00	\$1,240,192
D3060	Controls & Instrumentation	\$3.60	S.F.	66,965	20	1987	2007		0.00 %	110.00 %	-8		\$265,181.00	\$241,074
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$1.23	S.F.	66,965	30	1987	2017	2015	0.00 %	110.00 %	0		\$90,604.00	\$82,367
D4010	Sprinklers	\$4.75	S.F.	66,965	30	1987	2017		6.67 %	0.00 %	2			\$318,084
D4020	Standpipes	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
D5010	Electrical Service/Distribution	\$1.81	S.F.	66,965	40	1987	2027		30.00 %	0.00 %	12			\$121,207
D5020	Branch Wiring	\$6.78	S.F.	66,965	30	1987	2017		6.67 %	0.00 %	2			\$454,023
D5020	Lighting	\$8.90	S.F.	66,965	30	1987	2017	2015	0.00 %	110.00 %	0		\$655,587.00	\$595,989
D5030	Communications and Security - Clock & PA Systems	\$5.60	S.F.	66,965	15	1987	2002		0.00 %	110.00 %	-13		\$412,504.00	\$375,004
D5030	Communications and Security - Fire Alarm	\$1.23	S.F.	66,965	15	2002	2017		13.33 %	0.00 %	2			\$82,367
D5030	Communications and Security - Security & CCTV	\$0.61	S.F.	66,965	15	2002	2017		13.33 %	0.00 %	2			\$40,849
D5090	Other Electrical Systems - Emergency Generator	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
E1010	Commercial Equipment	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
E1020	Institutional Equipment	\$0.40	S.F.	66,965	20	1987	2007		0.00 %	110.00 %	-8		\$29,465.00	\$26,786
E1090	Other Equipment (Kitchen Equipment)	\$6.80	S.F.	66,965	20	1987	2007		0.00 %	110.00 %	-8		\$500,898.00	\$455,362
E2010	Fixed Furnishings	\$5.37	S.F.	66,965	20	1987	2007		0.00 %	110.00 %	-8		\$395,562.00	\$359,602
Total									17.17 %	54.90 %			\$7,779,327.00	\$14,170,154

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$7,779,327	\$0	\$3,848,143	\$141,776	\$0	\$9,093	\$0	\$0	\$79,831	\$0	\$0	\$11,858,170
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1020 - Special Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1010 - Floor Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2020 - Exterior Windows	\$0	\$0	\$530,622	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$530,622
B2030 - Exterior Doors	\$0	\$0	\$71,896	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$71,896
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Asphal Shingles	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - BUR	\$1,524,793	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,524,793
B3010 - Roof Coverings - EPDM	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Preformed Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3020 - Roof Openings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

School Assessment Report - 1987 Building

C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$135,834	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$135,834
C1030 - Fittings	\$205,516	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$205,516
C20 - Stairs	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* C2010 - Stair Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic & Glazed	\$0	\$0	\$29,998	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$29,998
C3010 - Wall Finishes - Paint	\$0	\$0	\$0	\$141,776	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$141,776
C3010 - Wall Finishes - Wall Coverings	\$0	\$0	\$0	\$0	\$0	\$9,093	\$0	\$0	\$0	\$0	\$0	\$9,093
C3020 - Floor Finishes - Carpet	\$63,019	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$79,831	\$0	\$142,850
C3020 - Floor Finishes - Ceramic & Quarry Tile	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Terrazzo	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - VCT	\$447,391	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$447,391
C3020 - Floor Finishes - Wood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$735,142	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$735,142
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D10 - Conveying	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D1010 - Elevators and Lifts	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$0	\$0	\$1,380,084	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,380,084
D2020 - Domestic Water Distribution	\$0	\$0	\$311,808	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$311,808
D2030 - Sanitary Waste	\$0	\$0	\$266,483	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$266,483
D2040 - Rain Water Drainage	\$0	\$0	\$76,584	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$76,584
D2090 - Other Plumbing Systems - Natural Gas	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3020 - Heat Generating Systems	\$335,160	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$335,160
D3030 - Cooling Generating Systems	\$348,419	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$348,419
D3040 - Distribution & Exhaust Systems	\$405,875	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$405,875
D3050 - Terminal & Package Units	\$1,364,211	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,364,211
D3060 - Controls & Instrumentation	\$265,181	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$265,181
D3090 - Other HVAC Systems/Equip - Kitchen Hood	\$90,604	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$90,604
D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


School Assessment Report - 1987 Building

D4010 - Sprinklers	\$0	\$0	\$371,200	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$371,200
D4020 - Standpipes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Branch Wiring	\$0	\$0	\$529,840	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$529,840
D5020 - Lighting	\$655,587	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$655,587
D5030 - Communications and Security - Clock & PA Systems	\$412,504	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$412,504
D5030 - Communications and Security - Fire Alarm	\$0	\$0	\$96,122	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$96,122
D5030 - Communications and Security - Security & CCTV	\$0	\$0	\$47,670	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$47,670
D5090 - Other Electrical Systems - Emergency Generator	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E - Equipment & Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E10 - Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1010 - Commercial Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1020 - Institutional Equipment	\$29,465	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$29,465
E1090 - Other Equipment (Kitchen Equipment)	\$500,898	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$500,898
E20 - Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E2010 - Fixed Furnishings	\$395,562	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$395,562

* Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

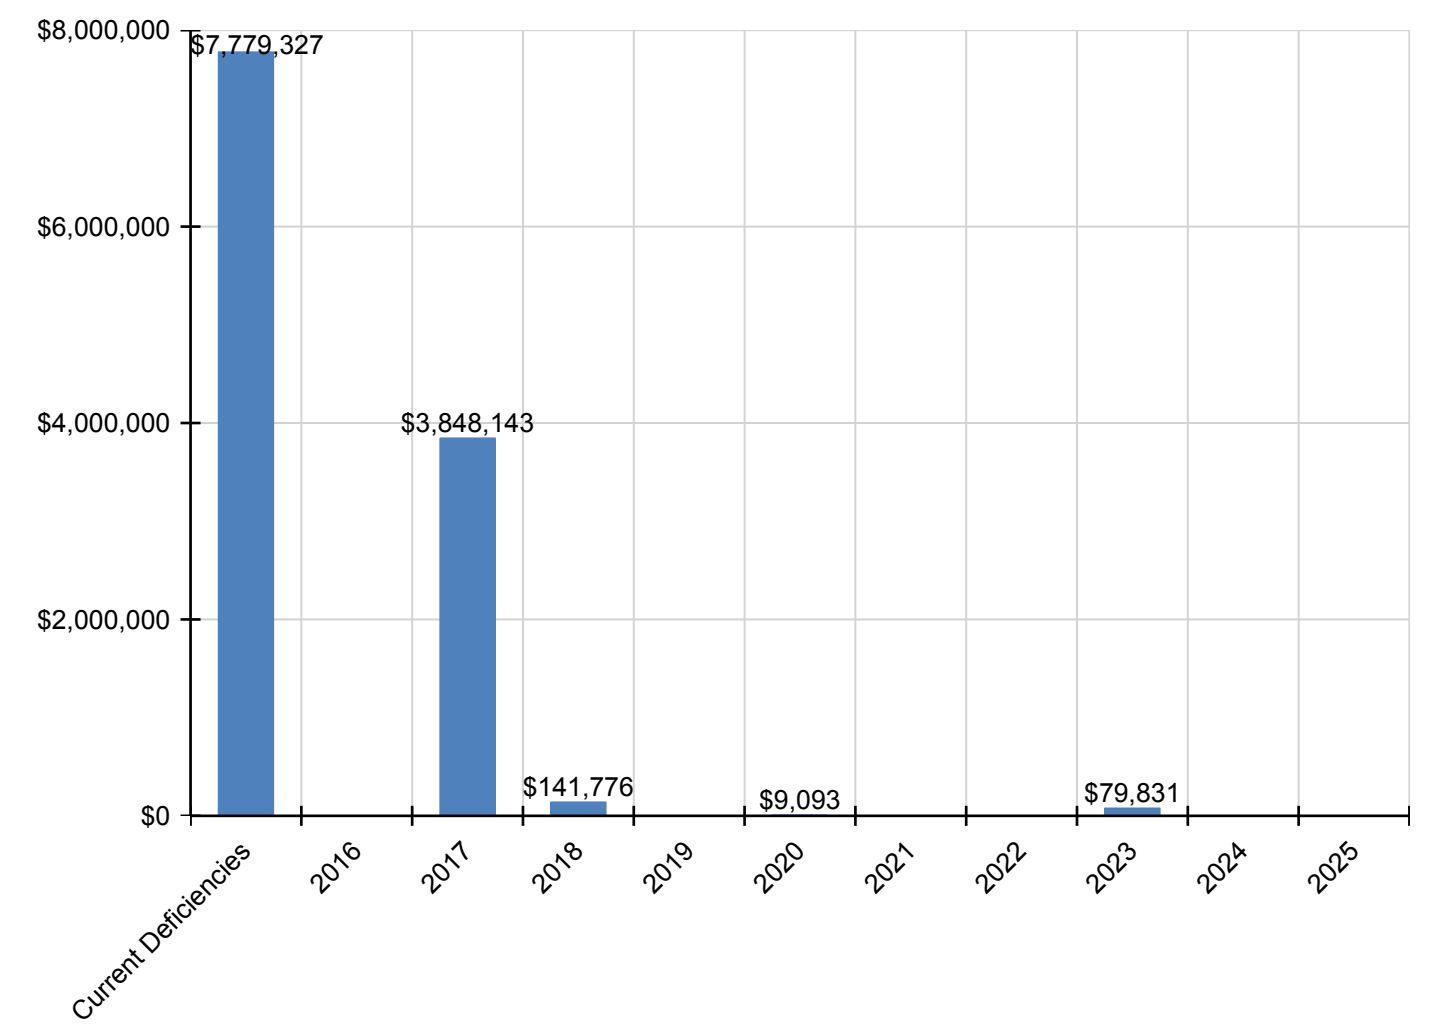

Deficiency Summary by System


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

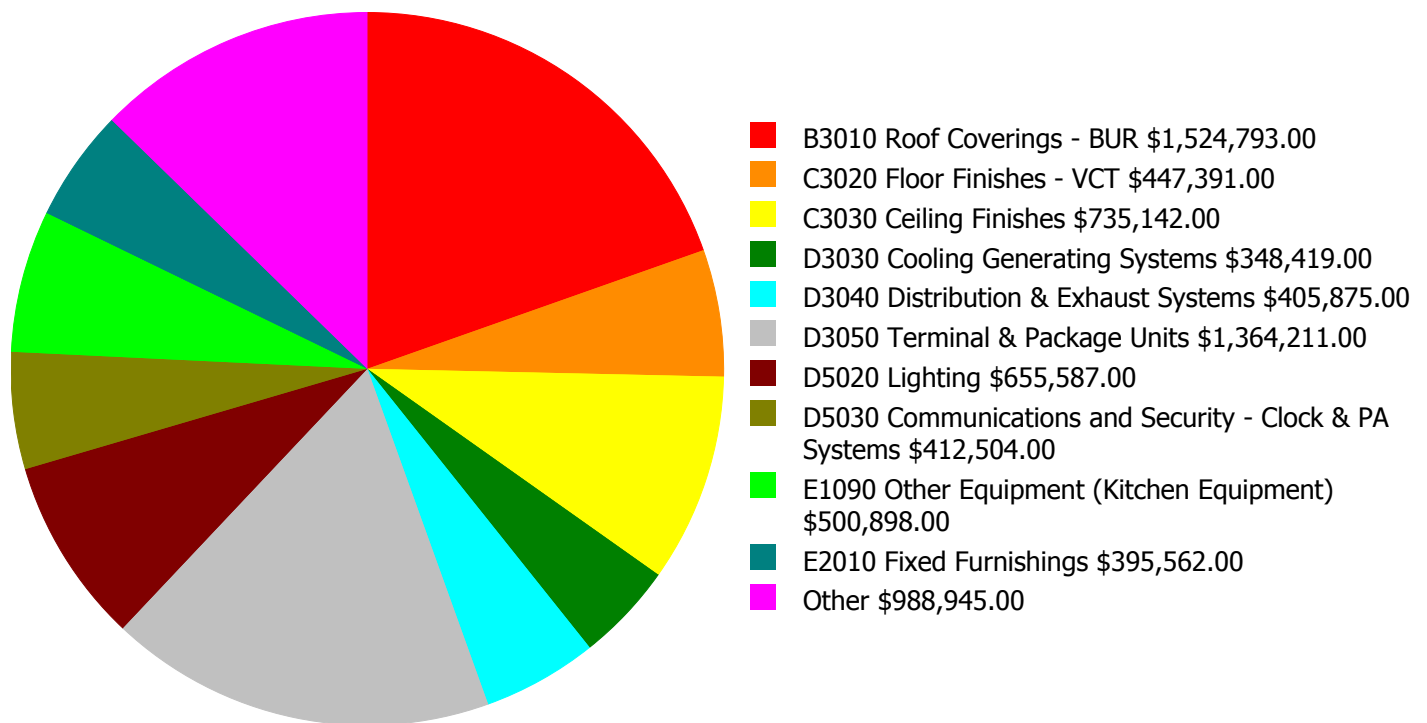

Budget Estimate Total: \$7,779,327.00

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

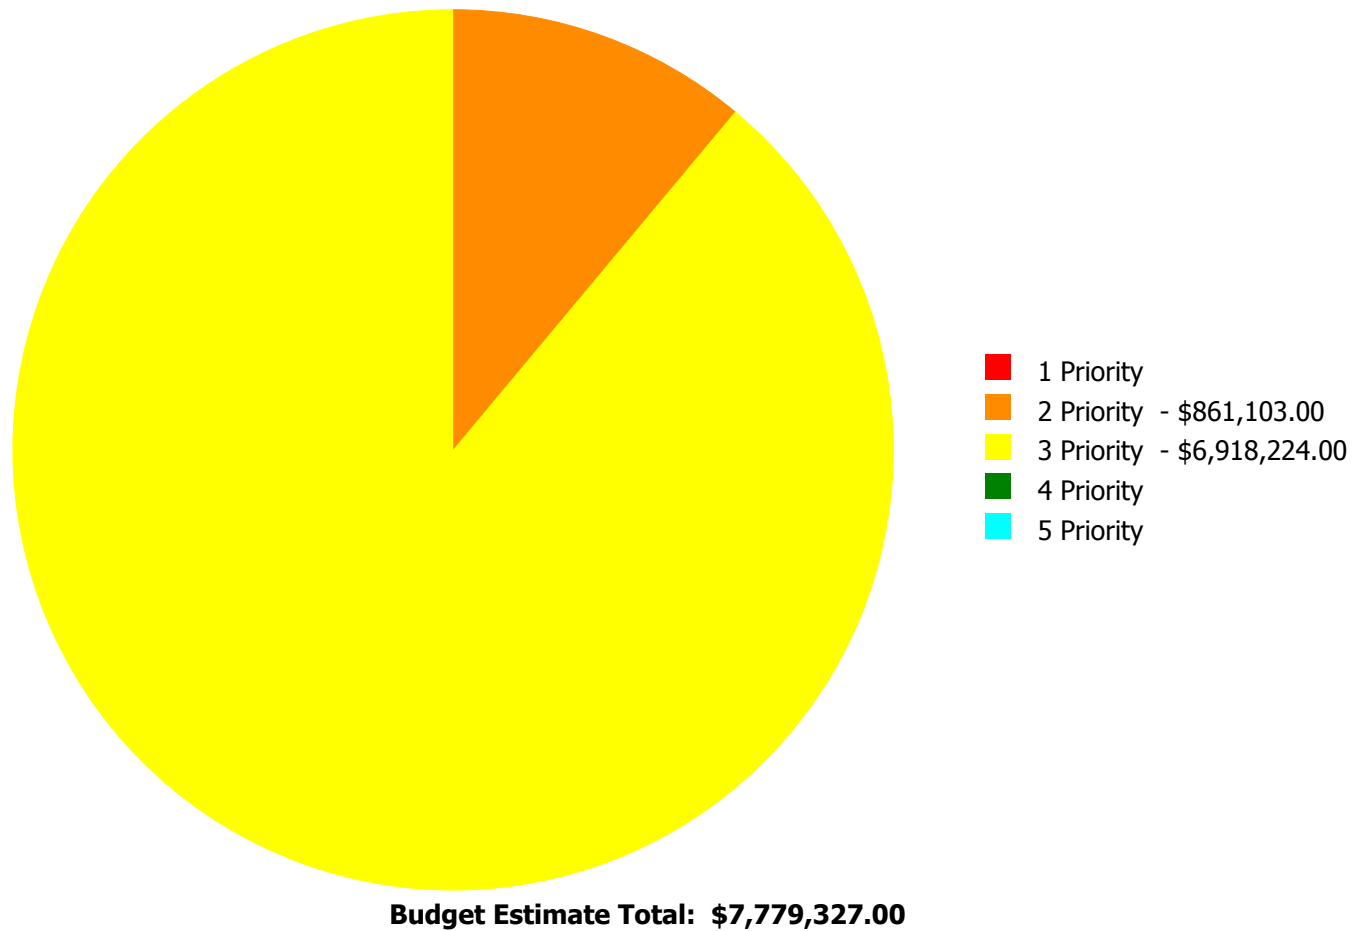

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards. .
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
B3010	Roof Coverings - BUR	\$0.00	\$0.00	\$1,524,793.00	\$0.00	\$0.00	\$1,524,793.00
C1030	Fittings	\$0.00	\$205,516.00	\$0.00	\$0.00	\$0.00	\$205,516.00
C3020	Floor Finishes - Carpet	\$0.00	\$0.00	\$63,019.00	\$0.00	\$0.00	\$63,019.00
C3020	Floor Finishes - VCT	\$0.00	\$0.00	\$447,391.00	\$0.00	\$0.00	\$447,391.00
C3030	Ceiling Finishes	\$0.00	\$0.00	\$735,142.00	\$0.00	\$0.00	\$735,142.00
D3020	Heat Generating Systems	\$0.00	\$0.00	\$335,160.00	\$0.00	\$0.00	\$335,160.00
D3030	Cooling Generating Systems	\$0.00	\$0.00	\$348,419.00	\$0.00	\$0.00	\$348,419.00
D3040	Distribution & Exhaust Systems	\$0.00	\$0.00	\$405,875.00	\$0.00	\$0.00	\$405,875.00
D3050	Terminal & Package Units	\$0.00	\$0.00	\$1,364,211.00	\$0.00	\$0.00	\$1,364,211.00
D3060	Controls & Instrumentation	\$0.00	\$0.00	\$265,181.00	\$0.00	\$0.00	\$265,181.00
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$0.00	\$0.00	\$90,604.00	\$0.00	\$0.00	\$90,604.00
D5020	Lighting	\$0.00	\$655,587.00	\$0.00	\$0.00	\$0.00	\$655,587.00
D5030	Communications and Security - Clock & PA Systems	\$0.00	\$0.00	\$412,504.00	\$0.00	\$0.00	\$412,504.00
E1020	Institutional Equipment	\$0.00	\$0.00	\$29,465.00	\$0.00	\$0.00	\$29,465.00
E1090	Other Equipment (Kitchen Equipment)	\$0.00	\$0.00	\$500,898.00	\$0.00	\$0.00	\$500,898.00
E2010	Fixed Furnishings	\$0.00	\$0.00	\$395,562.00	\$0.00	\$0.00	\$395,562.00
Total:		\$0.00	\$861,103.00	\$6,918,224.00	\$0.00	\$0.00	\$7,779,327.00

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

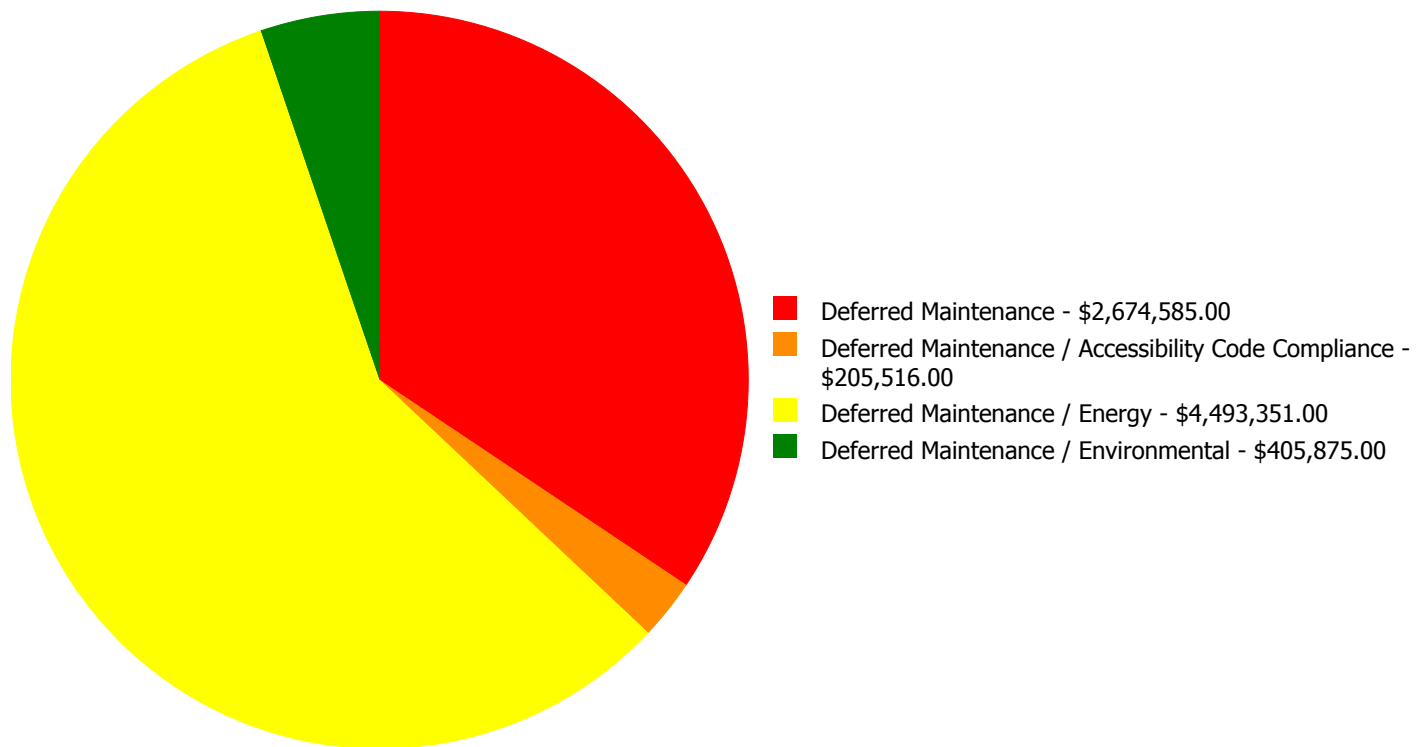

Budget Estimate Total: \$7,779,327.00

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 2 Priority:

System: C1030 - Fittings



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code Compliance

Priority: 2 Priority

Correction: Renew System

Qty: 66,965.00

Unit of Measure: S.F.

Estimate: \$205,516.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Fittings are aged, in marginal condition with rough carpentry repairs, including many plywood doors, and missing grab bars. Room signage is not ADA compliant. A couple of restrooms are scheduled for replacement to comply with ADA standards under a current SPLOST project by 2016; however, this does not include all the restrooms (approximately 16). SPLOST project 125-422 to renovate hall restrooms.

System: D5020 - Lighting



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 2 Priority

Correction: Renew System

Qty: 66,965.00

Unit of Measure: S.F.

Estimate: \$655,587.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The lighting system is beyond its expected service life, in poor condition, inefficient, and should be scheduled for replacement. SPLOST project 125-422 to replace the lighting system in the classrooms and restrooms by October 2016.

Priority 3 Priority:

System: B3010 - Roof Coverings - BUR



Location: Roof

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 66,965.00

Unit of Measure: S.F.

Estimate: \$1,524,793.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Roof covering is beyond its expected service life and has reported leaks throughout the building. SPLOST project 125-422 to replace the roof.

System: C3020 - Floor Finishes - Carpet



Location: Media Center and Offices

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 6,740.00

Unit of Measure: S.F.

Estimate: \$63,019.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The carpet is aged, stained and frayed, and should be replaced.

System: C3020 - Floor Finishes - VCT



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 42,633.00

Unit of Measure: S.F.

Estimate: \$447,391.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The VCT flooring is aged, cracked and worn, and should be replaced.

System: C3030 - Ceiling Finishes



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 66,965.00

Unit of Measure: S.F.

Estimate: \$735,142.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The ceiling finishes are beyond their expected service life, stained and damaged, and should be replaced.

System: D3020 - Heat Generating Systems



Location: Mechanical Room

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 66,965.00

Unit of Measure: S.F.

Estimate: \$335,160.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The heating generating system (boiler) is beyond its expected service life and should be scheduled for replacement.

System: D3030 - Cooling Generating Systems



Location: Roof and Side of Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 66,965.00

Unit of Measure: S.F.


Estimate: \$348,419.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The cooling generating system, including rooftop chiller and on-grade cooling tower, is beyond its expected service life, inefficient, and should be scheduled for replacement. Cooling tower, pumps, piping and valves to be replaced under SPLOST project 125-422 by October 2016.

System: D3040 - Distribution & Exhaust Systems

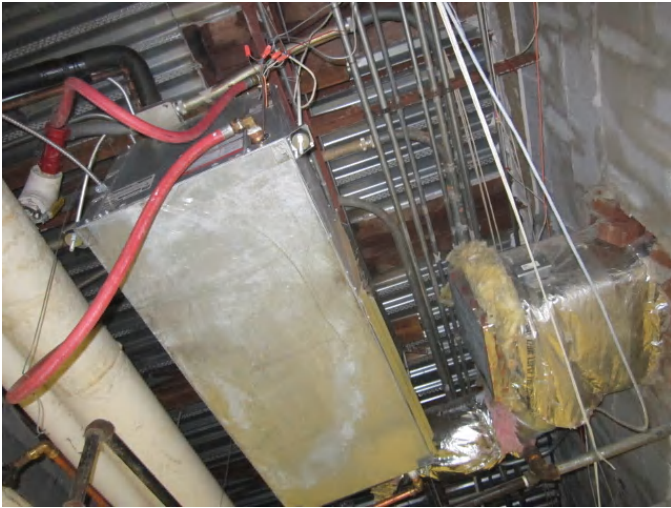

Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Environmental

Priority: 3 Priority

Correction: Renew System

Qty: 66,965.00

Unit of Measure: S.F.

Estimate: \$405,875.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The distribution and exhaust systems are beyond their expected service life, inadequate, and should be scheduled for replacement. School staff reports indoor air-quality problems.

System: D3050 - Terminal & Package Units



Location: Roof

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 66,965.00

Unit of Measure: S.F.

Estimate: \$1,364,211.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The terminal and package units are beyond their expected service life, inefficient, and should be scheduled for replacement. SPLOST project 125-422 to replace the roof top units, fan coil units, and water source heat pumps by October 2016.

System: D3060 - Controls & Instrumentation



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 66,965.00

Unit of Measure: S.F.

Estimate: \$265,181.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Controls and instrumentation are beyond their expected service life, inadequate, and should be scheduled for replacement.

System: D3090 - Other HVAC Systems/Equip - Kitchen Hood



Location: Kitchen

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 66,965.00

Unit of Measure: S.F.

Estimate: \$90,604.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The kitchen hood system is beyond its expected service life and should be scheduled for replacement.

System: D5030 - Communications and Security - Clock & PA Systems



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 66,965.00

Unit of Measure: S.F.

Estimate: \$412,504.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The public address and clock systems are beyond their expected service life, have reported outages, and should be scheduled for replacement.

System: E1020 - Institutional Equipment



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 66,965.00

Unit of Measure: S.F.

Estimate: \$29,465.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Institutional equipment, such as theater and stage equipment and library equipment, is beyond its expected service life and should be scheduled for replacement.

System: E1090 - Other Equipment (Kitchen Equipment)



Location: Kitchen

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 66,965.00

Unit of Measure: S.F.

Estimate: \$500,898.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Kitchen equipment is beyond its expected service life and should be scheduled for replacement.

System: E2010 - Fixed Furnishings



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 66,965.00

Unit of Measure: S.F.

Estimate: \$395,562.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Fixed furnishings are beyond their expected service life and should be scheduled for replacement.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	5,478
Year Built:	2003
Last Renovation:	
Replacement Value:	\$908,946
Repair Cost:	\$78,697.00
Total FCI:	8.66 %
Total RSLI:	64.23 %
FCA Score:	91.34



Description:

The 2003 gymnasium at Panola Way Elementary School is a one-story building located at 2170 Panola Way Court in Lithonia, Georgia. There have been no additions or major renovations to this building. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:

Building Codes:	2011	Fire Sprinkler System:	No
-----------------	------	------------------------	----

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	88.00 %	0.00 %	\$0.00
B10 - Superstructure	88.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	85.42 %	0.00 %	\$0.00
B30 - Roofing	84.00 %	0.00 %	\$0.00
C10 - Interior Construction	76.16 %	0.00 %	\$0.00
C30 - Interior Finishes	24.10 %	8.45 %	\$8,496.00
D20 - Plumbing	60.19 %	0.00 %	\$0.00
D30 - HVAC	30.85 %	53.04 %	\$70,201.00
D40 - Fire Protection	0.00 %	0.00 %	\$0.00
D50 - Electrical	50.83 %	0.00 %	\$0.00
Totals:	64.23 %	8.66 %	\$78,697.00

Photo Album

The photo album consists of the various cardinal directions of the building.

1). Northwest Elevation - May 26, 2015



2). Southwest Elevation - May 26, 2015



3). Southeast Elevation - May 26, 2015



4). Northeast Elevation - May 26, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$9.34	S.F.	5,478	100	2003	2103		88.00 %	0.00 %	88			\$51,165
A1030	Slab on Grade	\$6.21	S.F.	5,478	100	2003	2103		88.00 %	0.00 %	88			\$34,018
B1020	Roof Construction	\$21.36	S.F.	5,478	100	2003	2103		88.00 %	0.00 %	88			\$117,010
B2010	Exterior Walls	\$19.80	S.F.	5,478	100	2003	2103		88.00 %	0.00 %	88			\$108,464
B2030	Exterior Doors	\$2.01	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$11,011
B3010	Roof Coverings - Standing Seam Metal	\$11.91	S.F.	5,478	75	2003	2078		84.00 %	0.00 %	63			\$65,243
C1010	Partitions	\$12.78	S.F.	5,478	100	2003	2103		88.00 %	0.00 %	88			\$70,009
C1020	Interior Doors	\$4.24	S.F.	5,478	40	2003	2043		70.00 %	0.00 %	28			\$23,227
C1030	Fittings	\$3.46	S.F.	5,478	20	2003	2023		40.00 %	0.00 %	8			\$18,954
C3010	Wall Finishes - Ceramic	\$6.65	S.F.	0	0				0.00 %	0.00 %				\$0
C3010	Wall Finishes - Paint	\$1.41	S.F.	5,478	10	2003	2013		0.00 %	109.99 %	-2		\$8,496.00	\$7,724
C3020	Floor Finishes - Ceramic Tile	\$6.67	S.F.	253	50	2003	2053		76.00 %	0.00 %	38			\$1,688
C3020	Floor Finishes - Neoprene	\$14.46	S.F.	4,554	15	2003	2018		20.00 %	0.00 %	3			\$65,851
C3020	Floor Finishes - VCT	\$5.01	S.F.	325	15	2003	2018		20.00 %	0.00 %	3			\$1,628
C3030	Ceiling Finishes	\$4.31	S.F.	5,478	20	2003	2023		40.00 %	0.00 %	8			\$23,610
D2010	Plumbing Fixtures	\$9.66	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$52,917
D2020	Domestic Water Distribution	\$5.85	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$32,046
D2030	Sanitary Waste	\$0.87	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$4,766
D2040	Rain Water Drainage	\$0.22	S.F.		30				0.00 %	0.00 %				\$0
D2090	Other Plumbing Systems - Natural Gas	\$0.32	S.F.	5,478	40	2003	2043		70.00 %	0.00 %	28			\$1,753
D3040	Distribution Systems & Exhaust Systems	\$12.25	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$67,106
D3050	Terminal & Package Units	\$11.65	S.F.	5,478	15	2003	2018	2015	0.00 %	110.00 %	0		\$70,201.00	\$63,819
D3060	Controls & Instrumentation	\$0.26	S.F.	5,478	20	2003	2023		40.00 %	0.00 %	8			\$1,424
D4010	Sprinklers	\$3.84	S.F.	0	0				0.00 %	0.00 %				\$0
D5010	Electrical Service/Distribution	\$1.24	S.F.	5,478	40	2003	2043		70.00 %	0.00 %	28			\$6,793
D5020	Branch Wiring	\$5.24	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$28,705
D5020	Lighting	\$5.24	S.F.	5,478	30	2003	2033		60.00 %	0.00 %	18			\$28,705
D5030	Communications and Security - Fire Alarm	\$2.13	S.F.	5,478	15	2003	2018		20.00 %	0.00 %	3			\$11,668
D5030	Communications and Security - Public Address & Clock System	\$0.88	S.F.	5,478	15	2003	2018		20.00 %	0.00 %	3			\$4,821
D5030	Communications and Security - Security & CCTV	\$0.88	S.F.	5,478	15	2003	2018		20.00 %	0.00 %	3			\$4,821
Total									64.23 %	8.66 %			\$78,697.00	\$908,946

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$78,697	\$0	\$0	\$106,724	\$0	\$0	\$0	\$0	\$61,295	\$0	\$11,418	\$258,135
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$26,411	\$0	\$0	\$26,411
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Paint	\$8,496	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$11,418	\$19,914
C3020 - Floor Finishes - Ceramic Tile	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Neoprene	\$0	\$0	\$0	\$79,153	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$79,153
C3020 - Floor Finishes - VCT	\$0	\$0	\$0	\$1,957	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,957
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$32,899	\$0	\$0	\$32,899
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


School Assessment Report - 2003 Gym

D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2020 - Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2030 - Sanitary Waste	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2090 - Other Plumbing Systems - Natural Gas	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3040 - Distribution Systems & Exhaust Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3050 - Terminal & Package Units	\$70,201	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$70,201
D3060 - Controls & Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,985	\$0	\$0	\$1,985
D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D4010 - Sprinklers	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5030 - Communications and Security - Fire Alarm	\$0	\$0	\$0	\$14,025	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$14,025
D5030 - Communications and Security - Public Address & Clock System	\$0	\$0	\$0	\$5,795	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$5,795
D5030 - Communications and Security - Security & CCTV	\$0	\$0	\$0	\$5,795	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$5,795

* Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

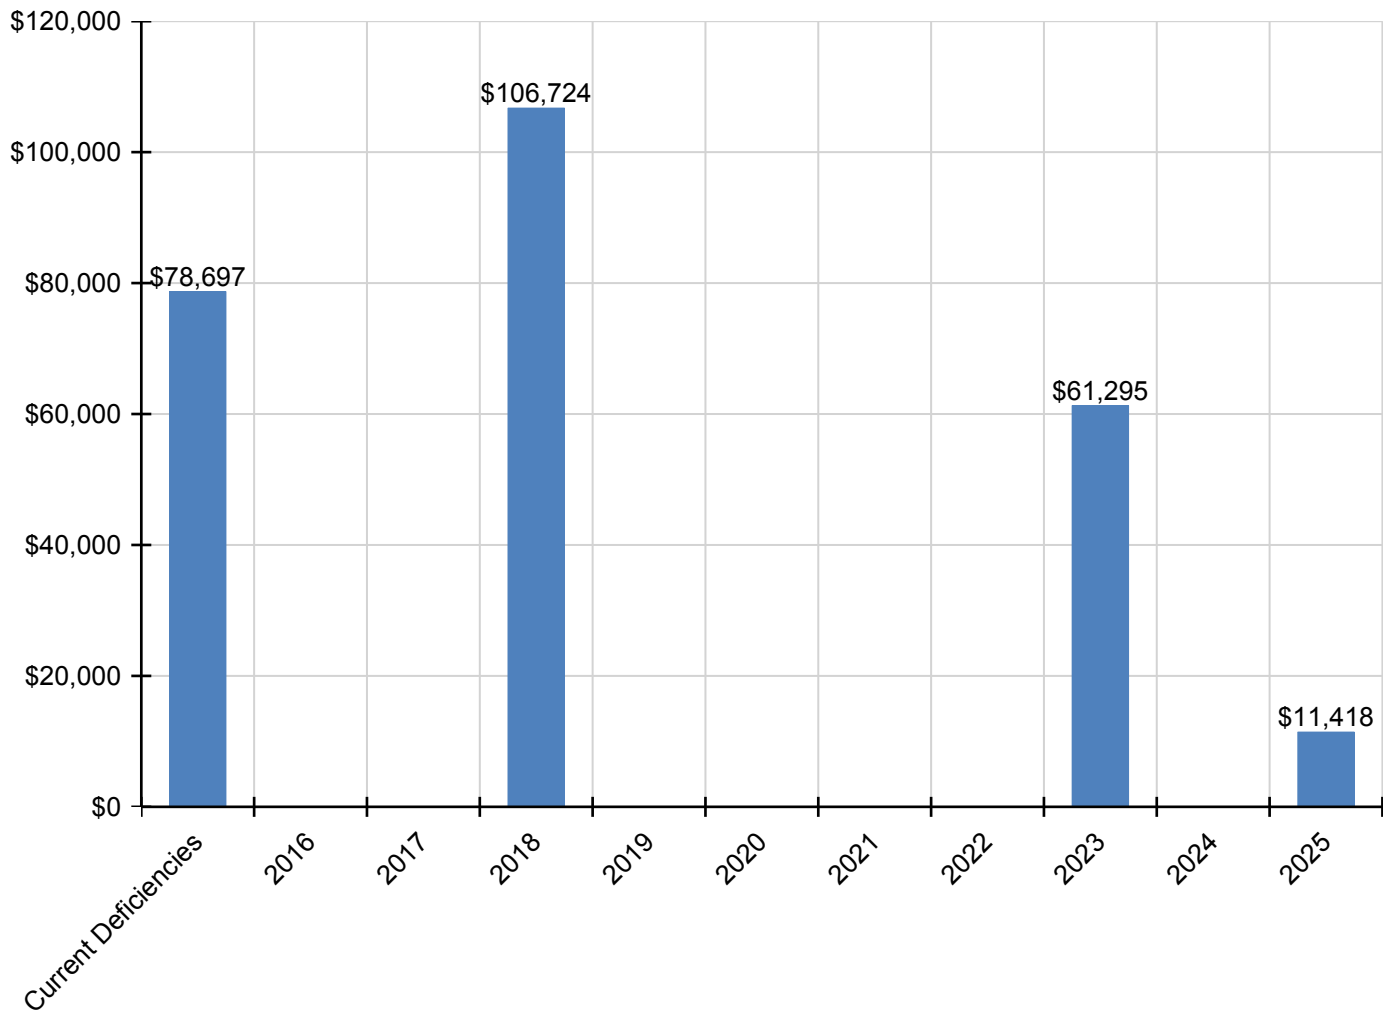

Deficiency Summary by System


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

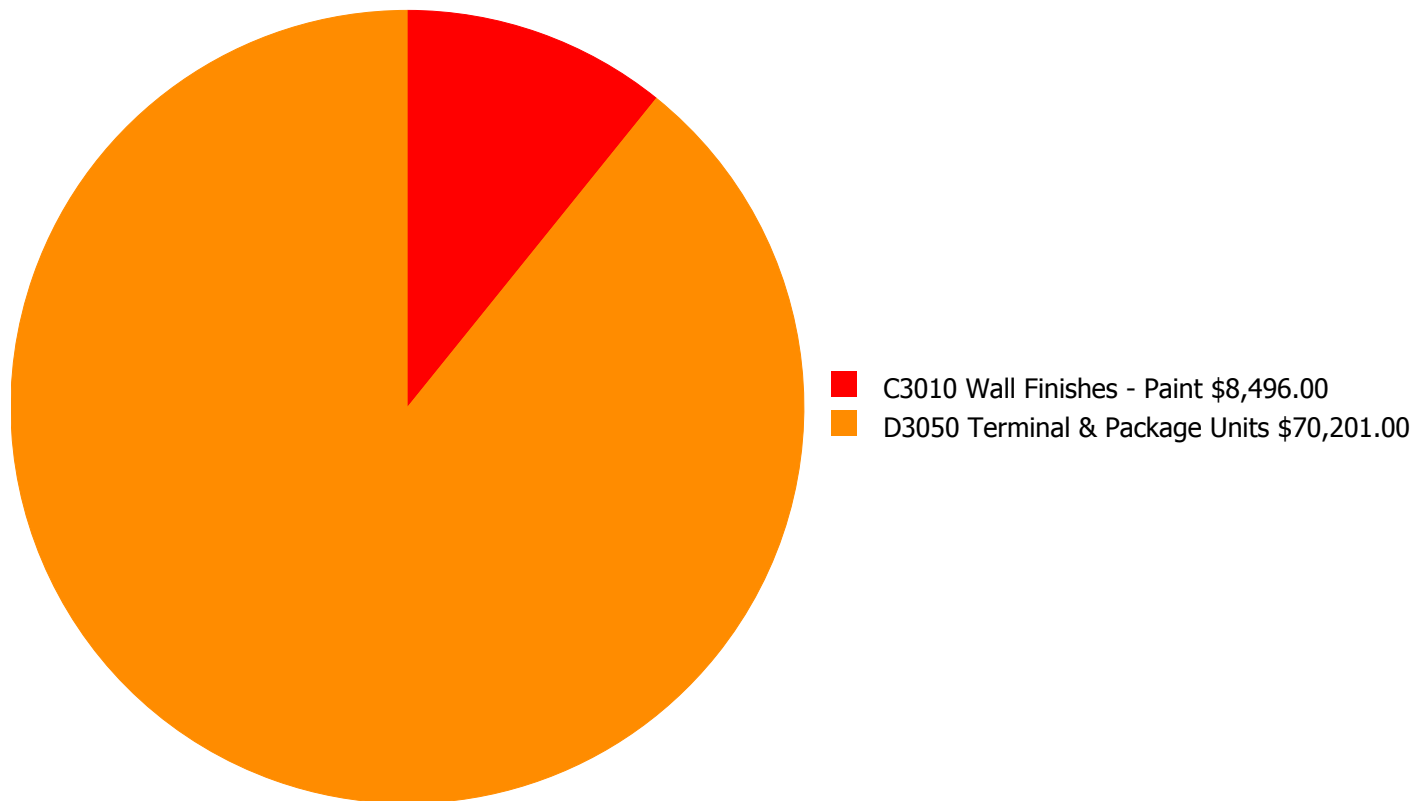

Budget Estimate Total: \$78,697.00

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

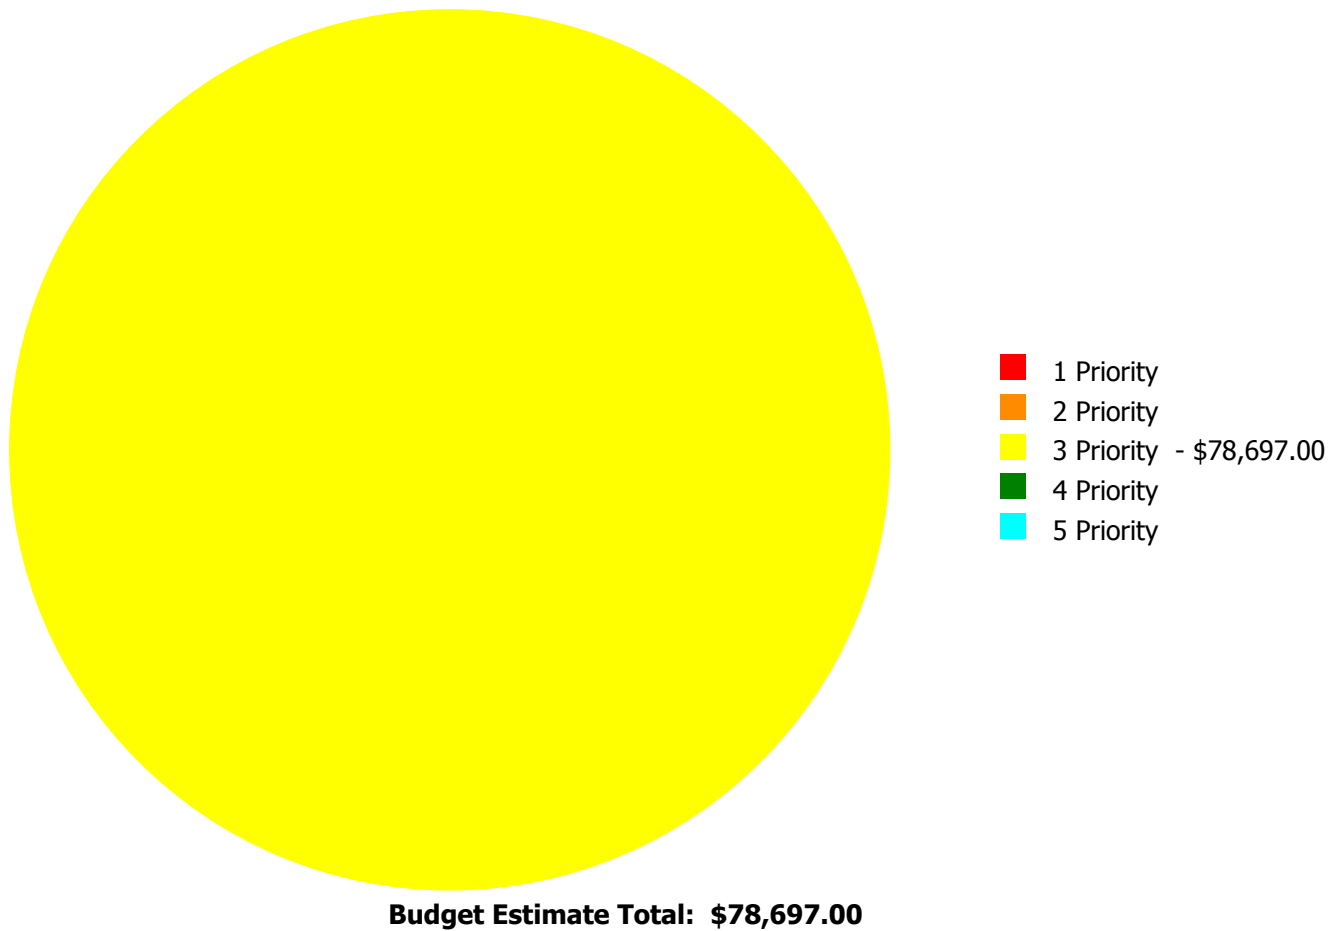

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards.
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
C3010	Wall Finishes - Paint	\$0.00	\$0.00	\$8,496.00	\$0.00	\$0.00	\$8,496.00
D3050	Terminal & Package Units	\$0.00	\$0.00	\$70,201.00	\$0.00	\$0.00	\$70,201.00
	Total:	\$0.00	\$0.00	\$78,697.00	\$0.00	\$0.00	\$78,697.00

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

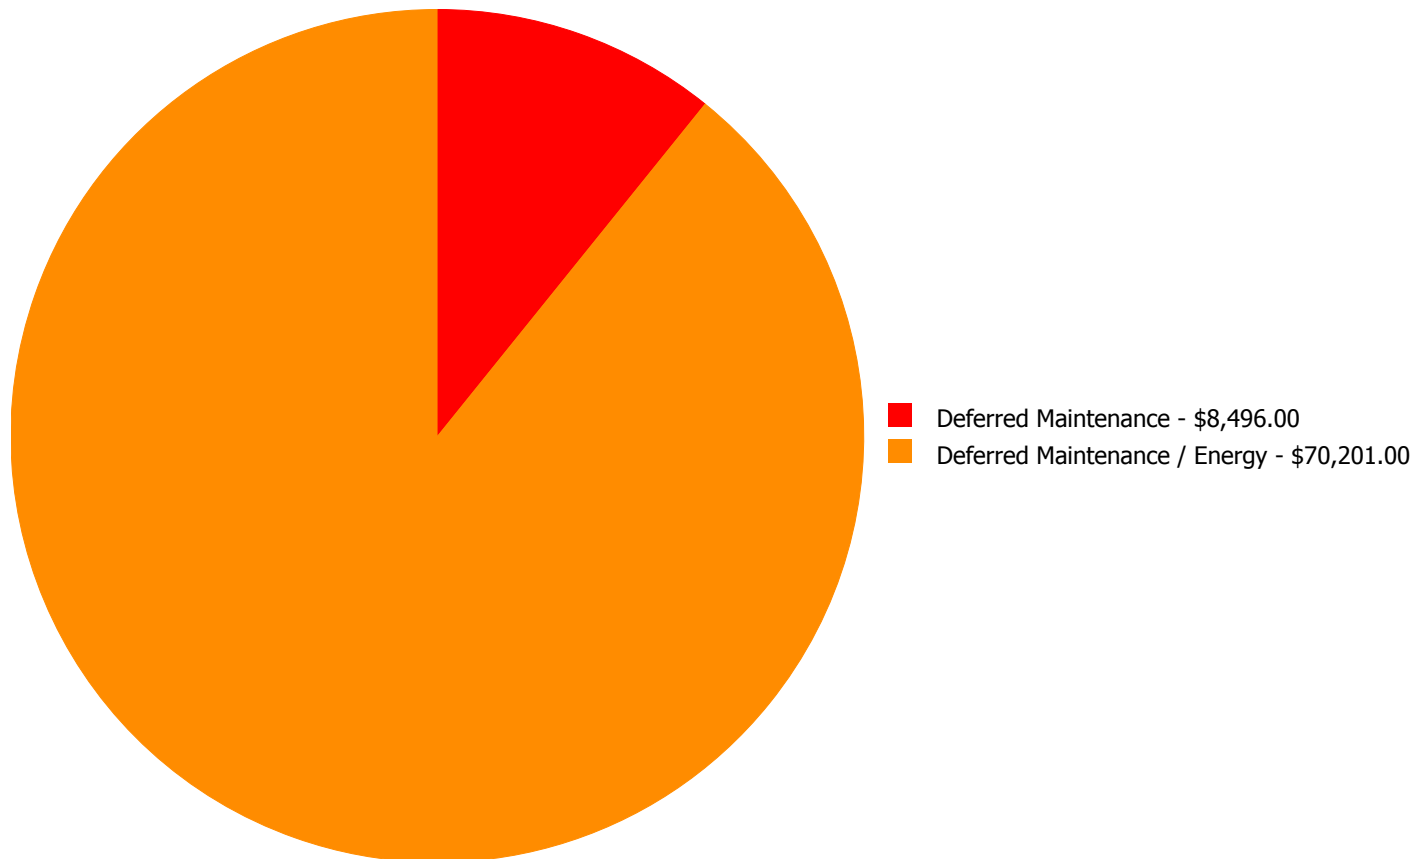

Budget Estimate Total: \$78,697.00

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 3 Priority:

System: C3010 - Wall Finishes - Paint



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$8,496.00

Assessor Name: Sam Mandola

Date Created: 06/03/2015

Notes: The painted wall finishes are beyond their expected service life, scuffed and stained, and should be replaced.

System: D3050 - Terminal & Package Units



Location: Throughout Building

Distress: Inadequate

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$70,201.00

Assessor Name: Sam Mandola

Date Created: 06/03/2015

Notes: One PTAC AC unit is located in the office area of the gym. It is nearing the end of its expected service life. The main gym area does not have air conditioning and it should be provided. SPLOST project 125-422 to install a 20-ton HVAC package in the gym.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	13,775
Year Built:	2004
Last Renovation:	
Replacement Value:	\$2,685,336
Repair Cost:	\$0.00
Total FCI:	0.00 %
Total RSLI:	57.75 %
FCA Score:	100.00



Description:

The 2004 classroom addition at Panola Way Elementary School is a one-story building located at 2170 Panola Way Court in Lithonia, Georgia. There have been no major renovations to this building. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:

Building Codes:	2020	Fire Sprinkler System:	Yes
-----------------	------	------------------------	-----

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	89.00 %	0.00 %	\$0.00
A20 - Basement Construction	0.00 %	0.00 %	\$0.00
B10 - Superstructure	89.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	75.71 %	0.00 %	\$0.00
B30 - Roofing	56.00 %	0.00 %	\$0.00
C10 - Interior Construction	73.90 %	0.00 %	\$0.00
C20 - Stairs	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	44.70 %	0.00 %	\$0.00
D10 - Conveying	0.00 %	0.00 %	\$0.00
D20 - Plumbing	63.48 %	0.00 %	\$0.00
D30 - HVAC	33.93 %	0.00 %	\$0.00
D40 - Fire Protection	63.33 %	0.00 %	\$0.00
D50 - Electrical	53.06 %	0.00 %	\$0.00
E10 - Equipment	45.00 %	0.00 %	\$0.00
E20 - Furnishings	45.00 %	0.00 %	\$0.00
Totals:	57.75 %	0.00 %	\$0.00

Photo Album

The photo album consists of the various cardinal directions of the building.

1). West Elevation - Jun 03, 2015



2). North Elevation - Jun 03, 2015



3). East Elevation - Jun 03, 2015



4). South Elevation - Jun 03, 2015



5). West Elevation - Courtyard - Jun 03, 2015



6). South Elevation - Courtyard - Jun 03, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$6.49	S.F.	13,775	100	2004	2104		89.00 %	0.00 %	89			\$89,400
A1020	Special Foundations	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
A1030	Slab on Grade	\$7.09	S.F.	13,775	100	2004	2104		89.00 %	0.00 %	89			\$97,665
A2010	Basement Excavation	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
A2020	Basement Walls	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B1010	Floor Construction	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B1020	Roof Construction	\$5.34	S.F.	13,775	100	2004	2104		89.00 %	0.00 %	89			\$73,559
B2010	Exterior Walls	\$16.02	S.F.	13,775	60	2004	2064		81.67 %	0.00 %	49			\$220,676
B2020	Exterior Windows	\$6.79	S.F.	13,775	30	2004	2034		63.33 %	0.00 %	19			\$93,532
B2030	Exterior Doors	\$0.92	S.F.	13,775	30	2004	2034		63.33 %	0.00 %	19			\$12,673
B3010	Roof Coverings - Asphal Shingles	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B3010	Roof Coverings - BUR	\$20.70	S.F.	13,775	25	2004	2029		56.00 %	0.00 %	14			\$285,143
B3010	Roof Coverings - EPDM	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B3010	Roof Coverings - Preformed Metal	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B3010	Roof Coverings - Standing Seam Metal	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B3020	Roof Openings	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C1010	Partitions	\$7.01	S.F.	13,775	100	2004	2104		89.00 %	0.00 %	89			\$96,563
C1020	Interior Doors	\$2.39	S.F.	13,775	30	2004	2034		63.33 %	0.00 %	19			\$32,922
C1030	Fittings	\$2.79	S.F.	13,775	20	2004	2024		45.00 %	0.00 %	9			\$38,432
C2010	Stair Construction	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3010	Wall Finishes - Ceramic & Glazed	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3010	Wall Finishes - Paint	\$1.93	S.F.	13,775	10	2004	2014	2018	30.00 %	0.00 %	3			\$26,586
C3010	Wall Finishes - Wall Coverings	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3020	Floor Finishes - Carpet	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3020	Floor Finishes - Ceramic & Quarry Tile	\$14.49	S.F.	650	50	2004	2054		78.00 %	0.00 %	39			\$9,419
C3020	Floor Finishes - Terrazzo	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3020	Floor Finishes - VCT	\$9.54	S.F.	12,950	20	2004	2024		45.00 %	0.00 %	9			\$123,543
C3020	Floor Finishes - Wood	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3030	Ceiling Finishes	\$9.98	S.F.	13,775	20	2004	2024		45.00 %	0.00 %	9			\$137,475
D1010	Elevators and Lifts	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
D2010	Plumbing Fixtures	\$17.66	S.F.	13,775	30	2004	2034		63.33 %	0.00 %	19			\$243,267
D2020	Domestic Water Distribution	\$3.99	S.F.	13,775	30	2004	2034		63.33 %	0.00 %	19			\$54,962
D2030	Sanitary Waste	\$3.41	S.F.	13,775	30	2004	2034		63.33 %	0.00 %	19			\$46,973
D2040	Rain Water Drainage	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0

School Assessment Report - 2004 Addition

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
D2090	Other Plumbing Systems - Natural Gas	\$0.41	S.F.	13,775	40	2004	2044		72.50 %	0.00 %	29			\$5,648
D3020	Heat Generating Systems	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
D3030	Cooling Generating Systems	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
D3040	Distribution & Exhaust Systems	\$5.51	S.F.	13,775	30	2004	2034		63.33 %	0.00 %	19			\$75,900
D3050	Terminal & Package Units	\$27.81	S.F.	13,775	15	2004	2019		26.67 %	0.00 %	4			\$383,083
D3060	Controls & Instrumentation	\$3.60	S.F.	13,775	20	2004	2024		45.00 %	0.00 %	9			\$49,590
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
D4010	Sprinklers	\$4.75	S.F.	13,775	30	2004	2034		63.33 %	0.00 %	19			\$65,431
D4020	Standpipes	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
D5010	Electrical Service/Distribution	\$1.81	S.F.	13,775	40	2004	2044		72.50 %	0.00 %	29			\$24,933
D5020	Branch Wiring	\$6.78	S.F.	13,775	30	2004	2034		63.33 %	0.00 %	19			\$93,395
D5020	Lighting	\$8.90	S.F.	13,775	30	2004	2034		63.33 %	0.00 %	19			\$122,598
D5030	Communications and Security - Clock & PA Systems	\$5.60	S.F.	13,775	15	2004	2019		26.67 %	0.00 %	4			\$77,140
D5030	Communications and Security - Fire Alarm	\$1.23	S.F.	13,775	15	2004	2019		26.67 %	0.00 %	4			\$16,943
D5030	Communications and Security - Security & CCTV	\$0.61	S.F.	13,775	15	2004	2019		26.67 %	0.00 %	4			\$8,403
D5090	Other Electrical Systems - Emergency Generator	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
E1010	Commercial Equipment	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
E1020	Institutional Equipment	\$0.40	S.F.	13,775	20	2004	2024		45.00 %	0.00 %	9			\$5,510
E1090	Other Equipment	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
E2010	Fixed Furnishings	\$5.37	S.F.	13,775	20	2004	2024		45.00 %	0.00 %	9			\$73,972
Total									57.75 %					\$2,685,336

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$0	\$0	\$0	\$31,956	\$601,164	\$0	\$0	\$0	\$0	\$615,035	\$0	\$1,248,154
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1020 - Special Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1010 - Floor Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2020 - Exterior Windows	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Asphal Shingles	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - BUR	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - EPDM	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Preformed Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3020 - Roof Openings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

School Assessment Report - 2004 Addition

C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$55,159	\$0	\$55,159
C20 - Stairs	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* C2010 - Stair Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic & Glazed	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Paint	\$0	\$0	\$0	\$31,956	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$31,956
C3010 - Wall Finishes - Wall Coverings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Carpet	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Ceramic & Quarry Tile	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Terrazzo	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - VCT	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$177,315	\$0	\$177,315
C3020 - Floor Finishes - Wood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$197,310	\$0	\$197,310
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D10 - Conveying	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D1010 - Elevators and Lifts	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2020 - Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2030 - Sanitary Waste	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2090 - Other Plumbing Systems - Natural Gas	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3020 - Heat Generating Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3030 - Cooling Generating Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3040 - Distribution & Exhaust Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3050 - Terminal & Package Units	\$0	\$0	\$0	\$0	\$474,279	\$0	\$0	\$0	\$0	\$0	\$0	\$474,279
D3060 - Controls & Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$71,174	\$0	\$71,174
D3090 - Other HVAC Systems/Equip - Kitchen Hood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


School Assessment Report - 2004 Addition

D4010 - Sprinklers	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D4020 - Standpipes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5030 - Communications and Security - Clock & PA Systems	\$0	\$0	\$0	\$0	\$95,504	\$0	\$0	\$0	\$0	\$0	\$0	\$95,504
D5030 - Communications and Security - Fire Alarm	\$0	\$0	\$0	\$0	\$20,977	\$0	\$0	\$0	\$0	\$0	\$0	\$20,977
D5030 - Communications and Security - Security & CCTV	\$0	\$0	\$0	\$0	\$10,403	\$0	\$0	\$0	\$0	\$0	\$0	\$10,403
D5090 - Other Electrical Systems - Emergency Generator	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E - Equipment & Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E10 - Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1010 - Commercial Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1020 - Institutional Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$7,908	\$0	\$7,908
E1090 - Other Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E20 - Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E2010 - Fixed Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$106,168	\$0	\$106,168

* Indicates non-renewable system

Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

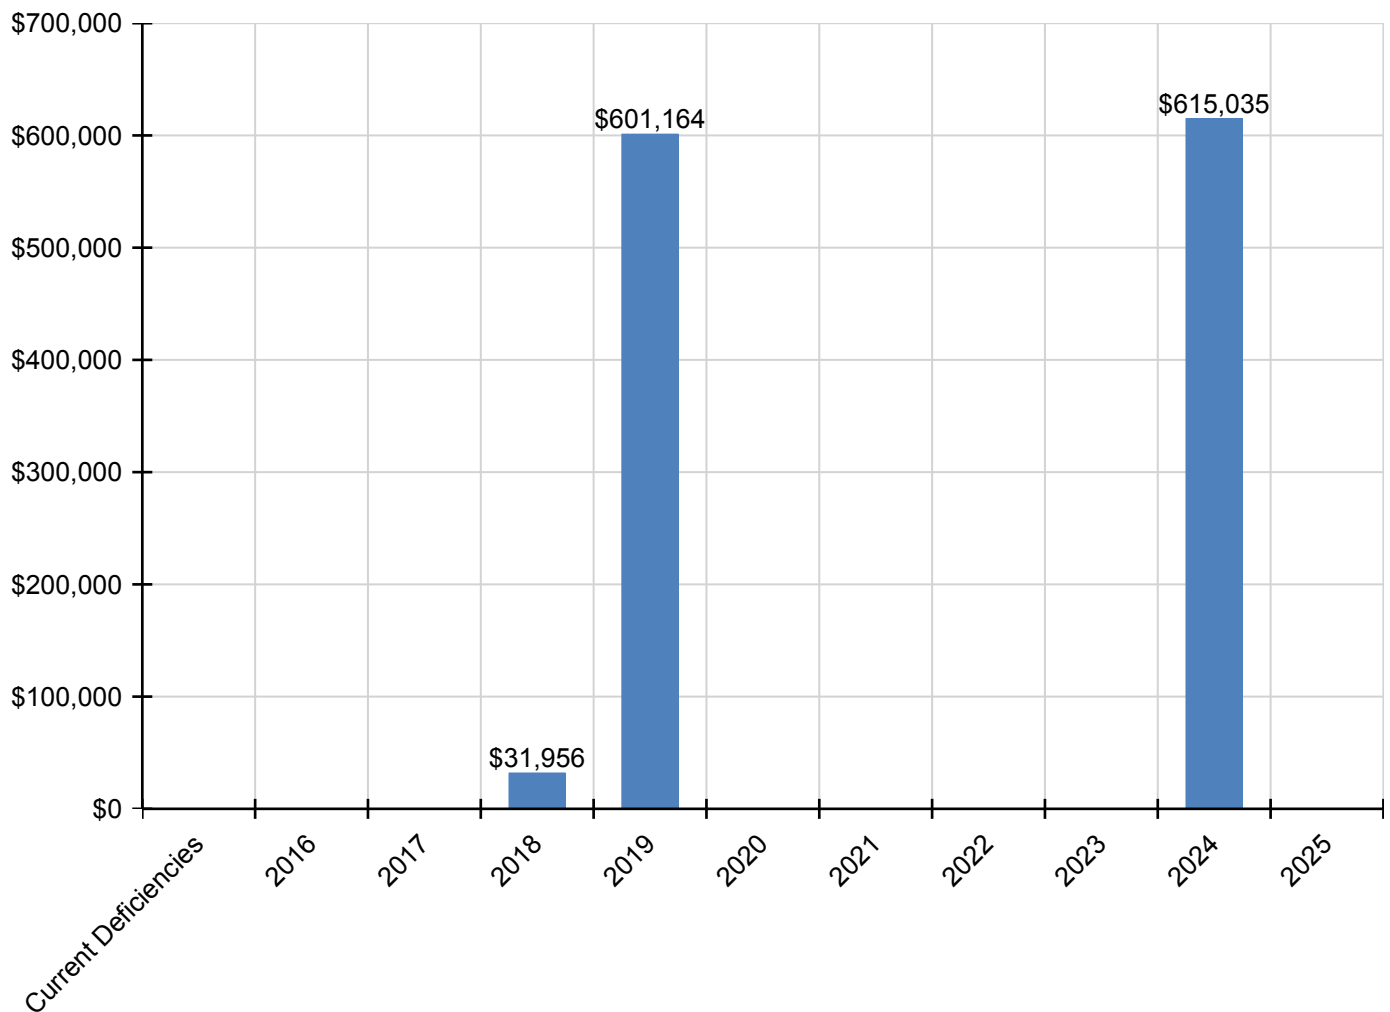

Deficiency Summary by System

Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

No data found for this asset

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

No data found for this asset

Deficiency By Priority Investment Table

The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards.
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

No data found for this asset

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

No data found for this asset

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

No data found for this asset

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	86,218
Year Built:	1987
Last Renovation:	
Replacement Value:	\$2,097,022
Repair Cost:	\$1,125,984.56
Total FCI:	53.69 %
Total RSLI:	18.73 %
FCA Score:	46.31



Description:

The Panola Way Elementary School site was originally constructed in 1987, has a total area of 14.6 acres, and is occupied by approximately 86,218 square feet of permanent building space. Campus site features include paved driveways and parking lots, pedestrian pavement, flag pole, landscaping, covered walkways and fencing. Site mechanical and electrical features include water, sewer, natural gas, and site lighting. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report for the site features.

Attributes:

General Attributes:

Site Code: 1760

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
G20 - Site Improvements	4.73 %	82.94 %	\$953,376.12
G30 - Site Mechanical Utilities	42.51 %	0.00 %	\$0.00
G40 - Site Electrical Utilities	22.24 %	54.40 %	\$172,608.44
Totals:	18.73 %	53.69 %	\$1,125,984.56

Photo Album

The photo album consists of the various cardinal directions of the building.

1). Aerial Image of Panola Way Elementary School - Jun 03, 2015



2). Covered Walkway - Jun 03, 2015



3). Playfield - Jun 03, 2015



4). Playground - Jun 03, 2015



5). Playground - Jun 03, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
G2010	Roadways	\$5.17	S.F.	44,621	25	1987	2012		0.00 %	110.00 %	-3		\$253,759.63	\$230,691
G2020	Parking Lots	\$4.56	S.F.	16,333	25	1987	2012		0.00 %	114.37 %	-3		\$85,178.64	\$74,478
G2030	Pedestrian Paving	\$1.50	S.F.	86,218	30	1987	2017		6.67 %	0.00 %	2			\$129,327
G2040	Baseball Field	\$8.35	S.F.		0				0.00 %	0.00 %				\$0
G2040	Canopies	\$0.29	S.F.		0				0.00 %	0.00 %				\$0
G2040	Covered Walkways	\$48.72	S.F.	1,600	25	2003	2028		52.00 %	0.00 %	13			\$77,952
G2040	Fencing & Guardrails	\$0.91	S.F.	86,218	30	1987	2017		6.67 %	0.00 %	2			\$78,458
G2040	Football Field	\$5.85	S.F.		0				0.00 %	0.00 %				\$0
G2040	Hard Surface Play Area	\$6.26	S.F.		0				0.00 %	0.00 %				\$0
G2040	Playing Field	\$3.92	S.F.	110,603	20	1987	2007		0.00 %	110.00 %	-8		\$476,920.14	\$433,564
G2040	Soccer/Lacross Field	\$5.00	S.F.		0				0.00 %	0.00 %				\$0
G2040	Softball Field	\$8.86	S.F.		0				0.00 %	0.00 %				\$0
G2040	Tennis Courts	\$18.47	S.F.		0				0.00 %	0.00 %				\$0
G2040	Track	\$7.04	S.F.		0				0.00 %	0.00 %				\$0
G2050	Landscaping	\$1.45	S.F.	86,218	15	1987	2002		0.00 %	110.00 %	-13		\$137,517.71	\$125,016
G3010	Water Supply	\$1.83	S.F.	86,218	50	1987	2037		44.00 %	0.00 %	22			\$157,779
G3020	Sanitary Sewer	\$1.15	S.F.	86,218	50	1987	2037		44.00 %	0.00 %	22			\$99,151
G3030	Storm Sewer	\$3.55	S.F.	86,218	50	1987	2037		44.00 %	0.00 %	22			\$306,074
G3060	Fuel Distribution	\$0.78	S.F.	86,218	40	1987	2027		30.00 %	0.00 %	12			\$67,250
G4010	Electrical Distribution	\$1.86	S.F.	86,218	50	1987	2037		44.00 %	0.00 %	22			\$160,365
G4020	Site Lighting	\$1.15	S.F.	86,218	30	1987	2017	2015	0.00 %	110.00 %	0		\$109,065.77	\$99,151
G4030	Site Communications & Security	\$0.67	S.F.	86,218	10	1987	1997		0.00 %	110.00 %	-18		\$63,542.67	\$57,766
Total									18.73 %	53.69 %			\$1,125,984.56	\$2,097,022

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

School Assessment Report - Site


Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$1,125,985	\$0	\$242,484	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$85,396	\$1,453,865
G - Building Sitework	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G20 - Site Improvements	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2010 - Roadways	\$253,760	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$253,760
G2020 - Parking Lots	\$85,179	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$85,179
G2030 - Pedestrian Paving	\$0	\$0	\$150,924	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$150,924
G2040 - Baseball Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Canopies	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Covered Walkways	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Fencing & Guardrails	\$0	\$0	\$91,560	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$91,560
G2040 - Football Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Hard Surface Play Area	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Playing Field	\$476,920	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$476,920
G2040 - Soccer/Lacross Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Softball Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Tennis Courts	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Track	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2050 - Landscaping	\$137,518	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$137,518
G30 - Site Mechanical Utilities	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G3010 - Water Supply	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G3020 - Sanitary Sewer	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G3030 - Storm Sewer	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G3060 - Fuel Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G40 - Site Electrical Utilities	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G4010 - Electrical Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G4020 - Site Lighting	\$109,066	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$109,066
G4030 - Site Communications & Security	\$63,543	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$85,396	\$148,939

* Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

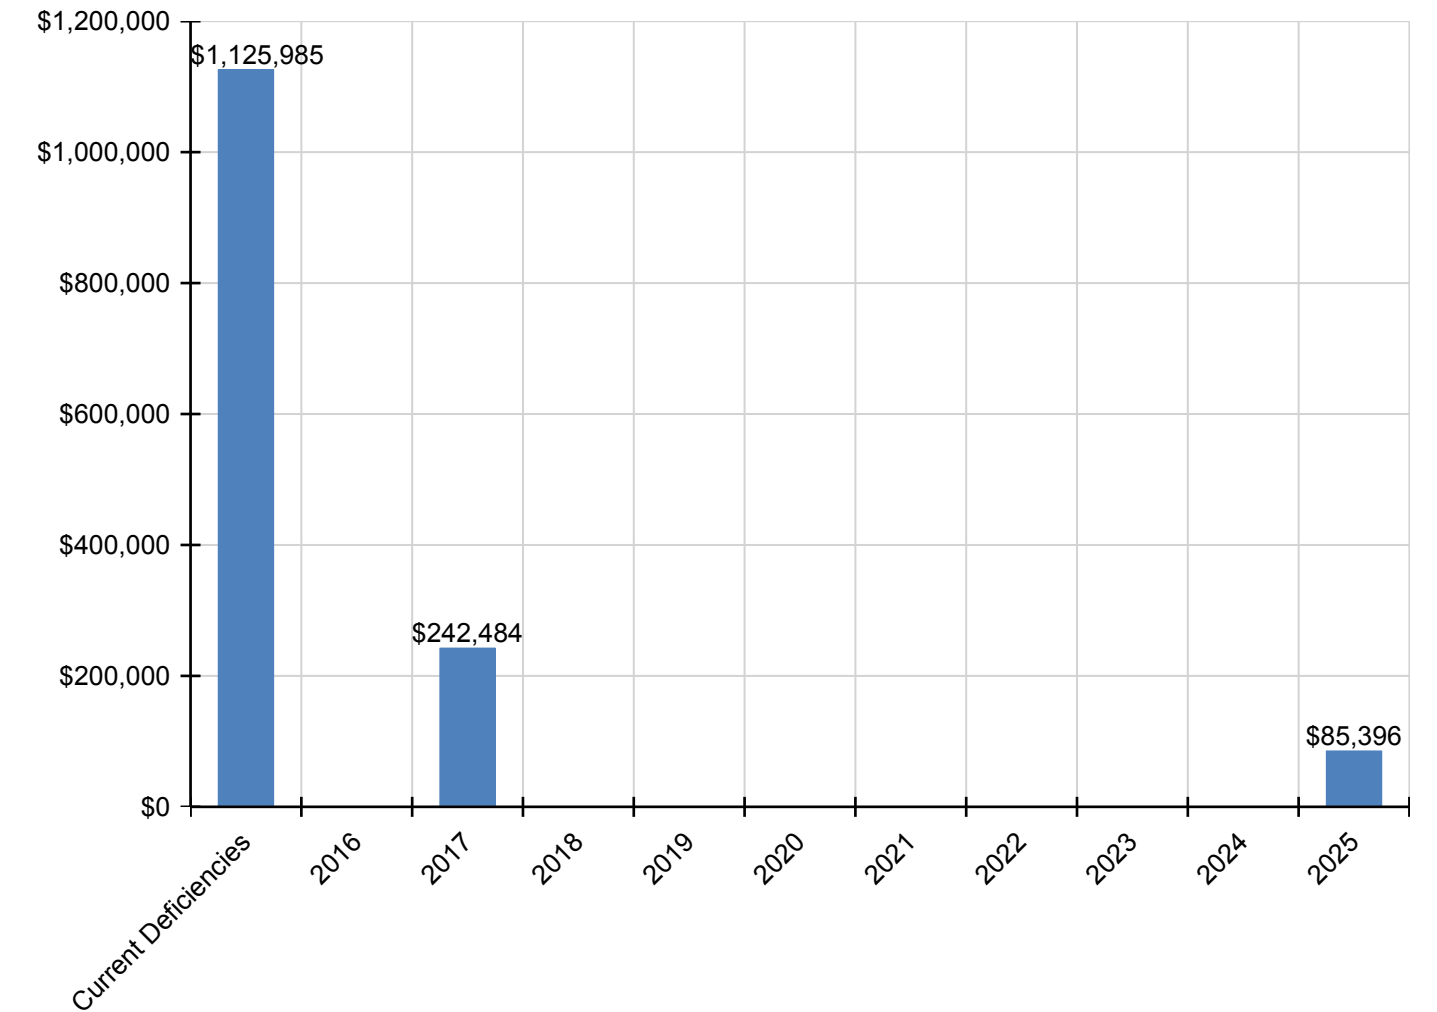

Deficiency Summary by System


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

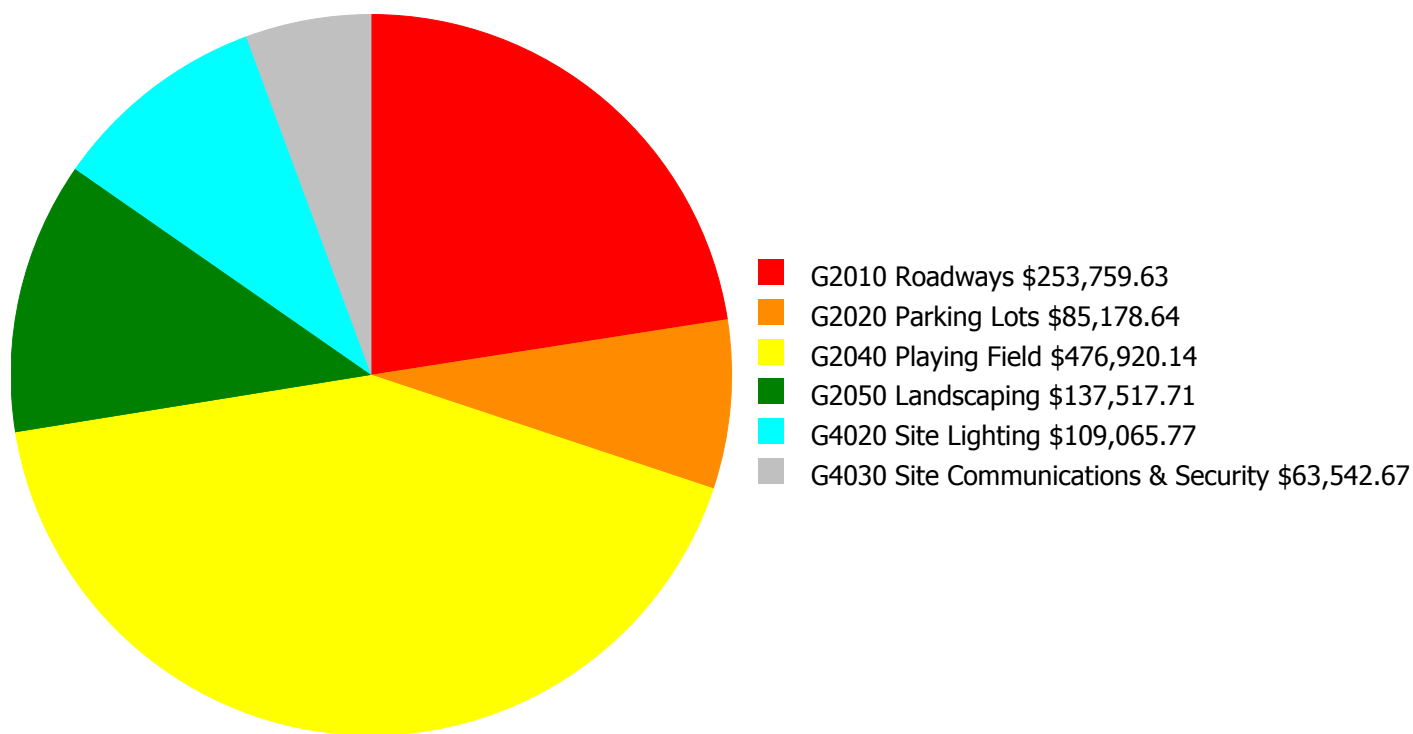

Budget Estimate Total: \$1,125,984.56

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

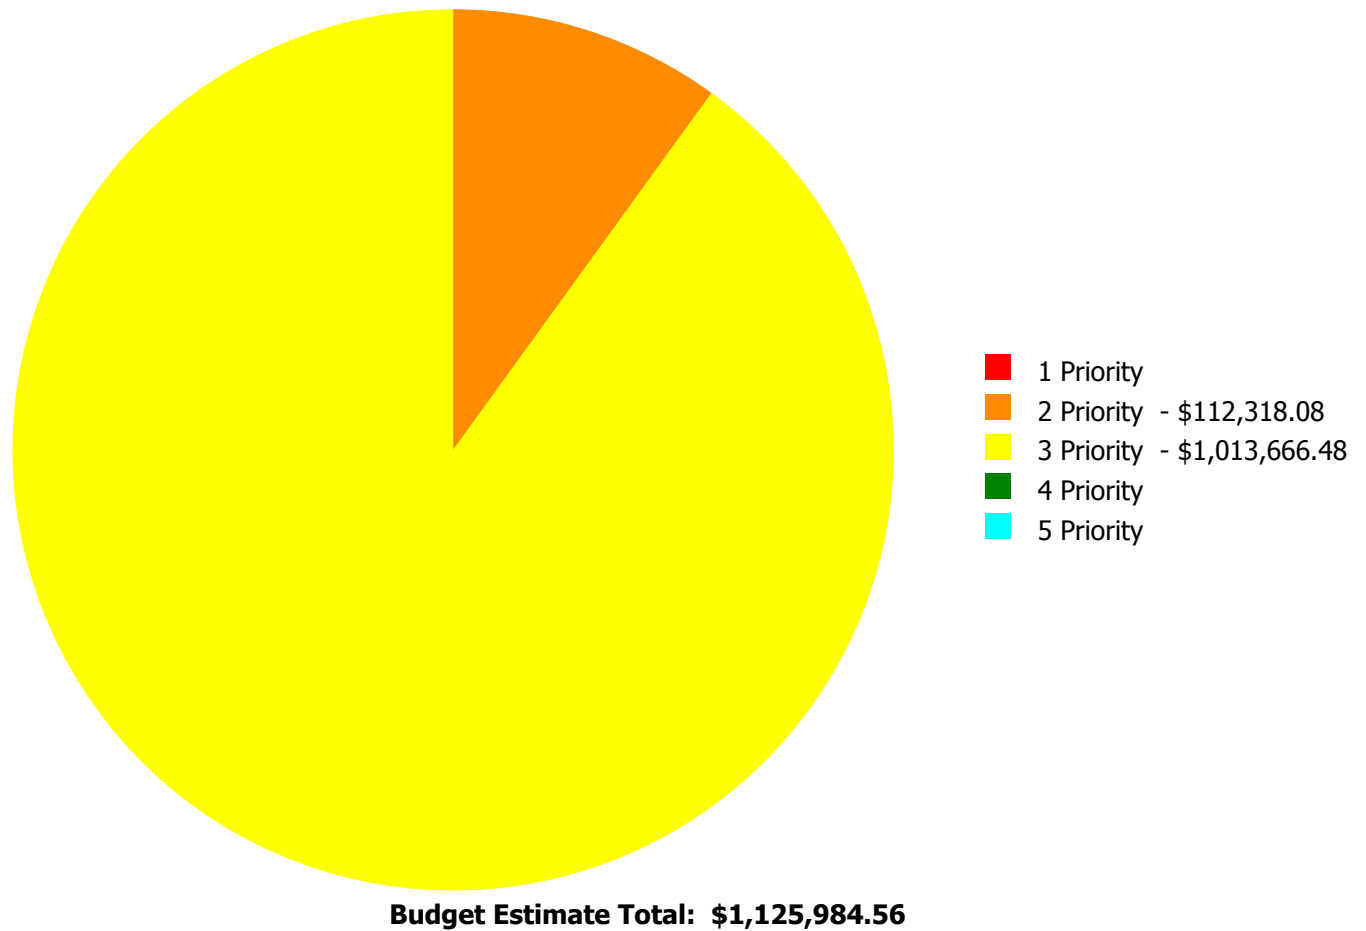

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards.
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
G2010	Roadways	\$0.00	\$0.00	\$253,759.63	\$0.00	\$0.00	\$253,759.63
G2020	Parking Lots	\$0.00	\$3,252.31	\$81,926.33	\$0.00	\$0.00	\$85,178.64
G2040	Playing Field	\$0.00	\$0.00	\$476,920.14	\$0.00	\$0.00	\$476,920.14
G2050	Landscaping	\$0.00	\$0.00	\$137,517.71	\$0.00	\$0.00	\$137,517.71
G4020	Site Lighting	\$0.00	\$109,065.77	\$0.00	\$0.00	\$0.00	\$109,065.77
G4030	Site Communications & Security	\$0.00	\$0.00	\$63,542.67	\$0.00	\$0.00	\$63,542.67
Total:		\$0.00	\$112,318.08	\$1,013,666.48	\$0.00	\$0.00	\$1,125,984.56

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

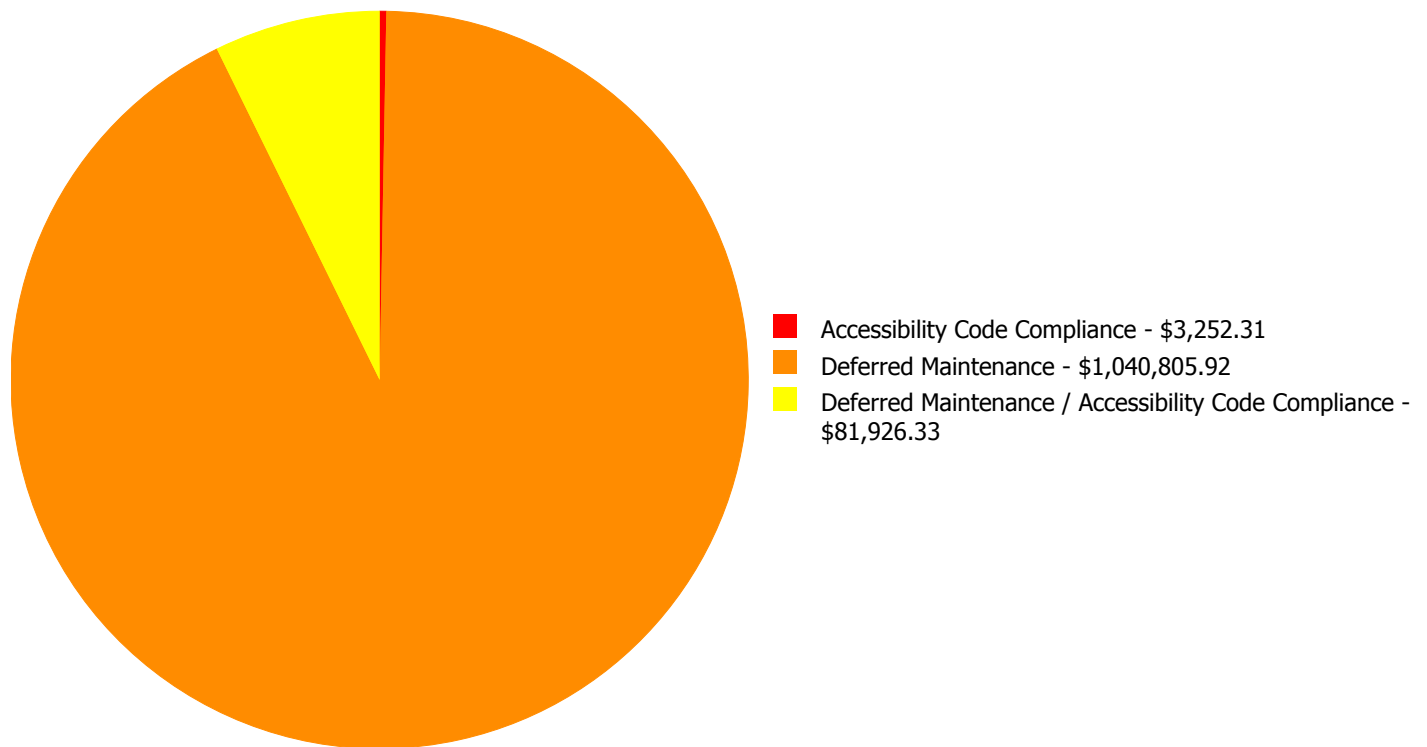

Budget Estimate Total: \$1,125,984.56

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 2 Priority:

System: G2020 - Parking Lots



Location: Site

Distress: Missing

Category: Accessibility Code Compliance

Priority: 2 Priority

Correction: Add handicap parking signage

Qty: 6.00

Unit of Measure: Ea.

Estimate: \$3,252.31

Assessor Name: Eduardo Lopez

Date Created: 06/03/2015

Notes: Handicap signage is missing, worn or below minimum height per ADA standards. Directional signage from the accessible parking to the building entrance is also missing.

System: G4020 - Site Lighting



Location: Site

Distress: Needs Remediation

Category: Deferred Maintenance

Priority: 2 Priority

Correction: Renew System

Qty: 86,218.00

Unit of Measure: S.F.

Estimate: \$109,065.77

Assessor Name: Sam Mandola

Date Created: 05/30/2015

Notes: Site lighting is nearing the end of its expected service life, may not provide sufficient site illumination, and should be scheduled for replacement immediately.

Priority 3 Priority:

System: G2010 - Roadways



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 44,621.00

Unit of Measure: S.F.

Estimate: \$253,759.63

Assessor Name: Eduardo Lopez

Date Created: 05/26/2015

Notes: Roadways are beyond their expected service life, damaged with many cracks, road cuts and repairs, and should be replaced.

System: G2020 - Parking Lots



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 16,333.00

Unit of Measure: S.F.

Estimate: \$81,926.33

Assessor Name: Eduardo Lopez

Date Created: 05/26/2015

Notes: The parking lot is beyond its expected service life, has many cracks and potholes, not ADA compliant, and should be re-surfaced and re-striped. South parking lot does not have accessible parking spaces. Also missing is a striped accessible route from the accessible parking to the sidewalk.

System: G2040 - Playing Field



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 110,603.00

Unit of Measure: S.F.

Estimate: \$476,920.14

Assessor Name: Sam Mandola

Date Created: 05/26/2015

Notes: The playing fields are beyond their expected service life, in poor condition with many bare areas, and should be re-sodded to prevent erosion.

System: G2050 - Landscaping



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 86,218.00

Unit of Measure: S.F.

Estimate: \$137,517.71

Assessor Name: Eduardo Lopez

Date Created: 06/03/2015

Notes: Landscaping is beyond its expected service life, deteriorated, and should be replaced.

System: G4030 - Site Communications & Security



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 86,218.00

Unit of Measure: S.F.

Estimate: \$63,542.67

Assessor Name: Eduardo Lopez

Date Created: 05/30/2015

Notes: The site communications and security systems are beyond their expected service life and should be scheduled for replacement.

Glossary

Abandoned	A facility owned by a district that is not occupied and not maintained. See Vacant.
Additional Cost	Total project cost is composed of hard and soft costs. Additional costs or soft expenses are costs that are necessary to accomplish the corrective work but are not directly attributable to the deficient systems direct construction cost, which are often referred to as hard cost. The components included in the soft costs vary by owner but usually include architect and contractor fees, contingencies and other owner-incurred costs necessary to fully develop and build a facility. These soft cost factors can be adjusted anytime within the eCOMET® database at the owner's discretion.
Assessment	Visual survey of a facility to determine its condition. It involves looking at the age of systems, reviewing information from local sources and visual evidence of potential problems to assign a condition rating. It does not include destructive testing of materials or testing of systems or equipment for functionality.
ASTM	ASTM International (ASTM): Originally known as the American Society for Testing and Materials, ASTM is an international standards organization that develops and publishes voluntary consensus technical standards for a wide range of materials, products, systems, and services.
BOMA	Building Owners Managers of America (BOMA): National organization of public and private facility owners focused on building management tools and maintenance techniques. eCOMET® reference: Building and component system effective economic life expectancies.
Building	A fully enclosed and roofed structure that can be traversed internally without exiting to the exterior.
Building Addition	An area, space or component of a building added to a building after the original building's year built date. NOTE: As a convention in the database, "Main" was used to designate the original building. Additions built prior to 1983 (30 years) were included in the main building area calculations to reflect their predicted system depreciation characteristics and remaining service life.
Building Systems	eCOMET® uses UNIFORMAT II to organize building data. UNIFORMAT II was originally developed by the federal General Services Administration to delineate building costs by systems rather than by material. UNIFORMAT II was formalized by an NIST standard, NISTIR 6389 in 1999. It has been further quantified and updated by ASTM standard 2005, E1557-05. The Construction Specifications Institute, CSI, has taken over the standard as part of their MasterFormat / MasterSpec system.
Calculated Next Renewal	The year a system or building element would be expected to expire based solely on the date it was installed and the expected useful lifetime for that kind of system.
Capital Renewal	Capital renewal refers to the cyclical replacement of building systems or elements as they become obsolete or beyond their useful life. It is not normally included in an annual operating/maintenance budget. See calculated next renewal and next renewal.
City Cost Index (CCI)	RS Means provides building system, equipment, and construction costs at a national level. The City Cost Index (also provided by RS Means) localizes those costs to a geographic region of the United States. In eCOMET®, each building or site is assigned a City Cost Index, which adjusts all of the associated costs for systems, deficiencies and inventory to the local value.
Condition	Condition refers to the state of physical fitness or readiness of a facility system or system element for its intended use.
Condition Budget	The Condition Budget, also known as Condition Needs, represents the budgeted contractor installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging the work.

School Assessment Report - Panola Way Elementary

Condition Index (CI) %	The Condition Index (CI) also known as the Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) Value divided by the sum of a system's Replacement Value (both values exclude soft cost to simplify calculation updates) expressed as a percentage ranging from 100.00% (new) to 0.00% (expired - no remaining life).
Construction Specifications Institute	Construction Specifications Institute: Primary national organization specializing in construction materials data and data location in construction documents. eCOMET® reference: UNIFORMAT II materials classification.
Correction	Correction refers to an assessor's recommended deficiency repair or replacement action. For any system or element deficiency, there can be multiple and alternative solutions for its repair or replacement. A Correction is user defined and tied to a UNIFORMAT II element, or system it is intended to address. It excludes other peripheral costs that may also be included in the packaging of repair, replacement or renewal improvements that may also be triggered by the deficiency correction.
Cost Model	A cost model is a list of facility systems which could represent the installed systems a given facility. Included in the cost model are standard unit cost estimates, gross areas, life cycles and installed dates. Also represented is the repair cost for deficient systems, replacement values. See eCOMET® cost models.
Criteria	Criteria refer to the set of requirements, guidelines or standards that are assessed and rated to develop a score.
Current Period	The Current Period is the current year plus a user defined number of forward years.
Current Replacement Value (CRV)	The Current Replacement Value (CRV) of a facility, building or system represents the hypothetical cost of rebuilding or replacing an existing facility under today's codes and construction standards, using its current configuration. It is calculated by multiplying the gross area of the facility by a square foot cost developed in that facility's cost model. Replacement cost includes construction costs and owner's additional or soft costs for fees, permits and other expenses to reflect a total project cost.
Deferred Maintenance	Deferred maintenance is condition work deferred on a planned or unplanned basis to a future budget cycle or postponed until funds are available.
Deficiency	A deficiency is a repair item that is damaged, missing, inadequate or insufficient for an intended purpose.
Deficiency Category	Deficiency Category refers to the type or class of a user defined deficiency grouping with shared or similar characteristics. Category descriptions include, but are not limited to: Accessibility Code Compliance, Appearance, Building Code Compliance, Deferred Maintenance, Energy, Environmental, Life Safety Code Compliance, and Safety.
Deficiency Distress	Deficiency Distress refers to a user-defined root cause of a deficiency. Distress descriptions are: Beyond Service Life, Damaged, Inadequate, Needs Remediation, and Missing.
Deficiency Priority	Deficiency Priority refers to a deficiency's urgency for repair as determined by the assessment team. Deficiencies were assigned a priority of 1 through 5, with Priority 1 deficiencies being the most urgent.
eCOMET®	Energy and Condition Management Estimation Technology (eCOMET®) is Parsons proprietary facility asset management software developed to provide facility managers with a state of the art, web-based tool to develop and maintain a comprehensive database of FCA data and information used for facility asset management, maintenance and repair, and capital renewal planning. eCOMET® is used by Parsons and its clients as the primary tool for collecting FCA data, preparing cost estimates, generating individual facility reports and cost estimates, and developing the overall capital renewal program.

School Assessment Report - Panola Way Elementary

eCOMET® Cost Models	eCOMET® cost models are derived from RS Means Square Foot Cost Data cost models and these models are used to develop the current replacement value (CRV) and assign life cycle costs to the various systems within a building. Cost models are assigned current costs-per-square-foot to establish replacement values. The Cost models are designed to represent a client specific facility that meets local standards cost trends.
Element	Elements are the major components that comprise building systems as defined by UNIFORMAT II.
Expected Life	Also referred to as Useful Life. See Useful Life definition.
Facility	A facility refers to site(s), building(s), or building addition(s), or combinations thereof that provide a particular service or support of an educational purpose.
Facility Attributes	Customizable eCOMET® fields to identify attributes specific to a facility. These fields are part of the eCOMET® database set-up with the owner.
Facility Condition Assessment (FCA)	A facility condition assessment (FCA) is a visual inspection of buildings and grounds at a facility to identify and estimate current and future needed repairs or replacements of major systems for planning and budgeting purposes. It is typically performed for organizations that are tasked with the day to day maintenance, operation, and capital renewal (replacement) of building systems and components of a large inventory of facilities. The primary goal of an FCA is to objectively and quantifiably identify, inspect, and prioritize the repair and replacement needs of the building and ground systems (e.g., roofs, windows, doors, floor finishes, plumbing fixtures, parking lot, and sidewalks) within facilities that have either failed or have surpassed their service life, and to identify and forecast future capital replacement needs for systems that have not yet failed, but planned replacement of those systems is needed to ensure that the facilities will continue to meet the mission of the organization.
Facility Condition Index (FCI)	FCI is an industry-standard measurement of a facility's condition expressed as a percentage from 0.00% to 100.00% that is derived by dividing the cost to correct a facility's deficiencies by its Current Replacement Value (CRV). The higher the FCI the poorer the condition of a facility. After an FCI is established for all buildings within a portfolio, a building's condition can be ranked relative to other buildings. The FCI may also represent the condition of a portfolio based on the cumulative FCIs of the portfolio's facilities.
Forecast Period	The Forecast Period refers to a user defined number of years forward of the Current Period.
Gen (Generate)	The Cost Model has a Gen box for each system line item. By checking the box, eCOMET® will generate life cycle deficiencies based on the Year Installed and the Life for that system. Systems that typically do not re-generate (foundations, floor construction, roof construction, basement walls, etc.) would not have the Gen box checked as those systems would not re-generate at the end of a life cycle. In those instances, it would be more practical and cost effective to demolish the entire facility than renew those systems.
Gross Square Feet (GSF)	The area of the enclosed floor space of a building or building addition in square feet measured to the outside face of the enclosing wall.
Life cycle	Life cycle refers to the period of time that a building or site system or element can be expected to adequately serve its intended function. Parsons assigns expected life cycles to all building systems based on Building Operators and Managers of America (BOMA) recommended life cycles, manufacturers suggested life, and RS Means cost data, and client-provided historical data. BOMA standards are a nationally recognized source of life cycle data for various components and/or systems associated with facilities. RS Means is a national company specializing in construction estimating and costs.
Next Renewal	Next Renewal refers to a manually-adjusted expected useful life of a system or element based on on-site inspection either by reducing or extending the Calculated Next Renewal to more accurately reflect current conditions.

School Assessment Report - Panola Way Elementary

Order of Magnitude	Order of Magnitude refers to a rough approximation made with a degree of knowledge and confidence that the budgeted, projected or estimated cost falls within a reasonable range of cost values.
Remaining Service Life (RSL)	RSL is the number of years of service remaining for a system or equipment item. It is automatically calculated based on the difference between the current year and the Calculated Next Renewal date or the Next Renewal date whichever one is the later date.
Renewal Factors	Renewal factors represent the difference in cost of renovating or replacing an existing system, rather than new construction of a building system. For example, installing a new built-up roof on an existing building would include removing and disposing of the old roof, a cost not associated with new construction. Using a renewal premium to account for demolition and other difficulty costs, Parsons typically assigns a renewal factor of 110%.
Renewal Schedule	A timeline by year that indicates when the systems will need to be renewed and the estimated price of the renewal.
Repair Cost	Repair cost is the sum of all the deficiencies associated with a building or multiple buildings/facilities. It will include any applied soft costs or City Cost Indexes.
Replacement Value	See Current Replacement Value.
Site	A facility's grounds and its utilities, roadways, landscaping, fencing and other typical land improvements needed to support a facility.
Soft Costs	Soft Costs are a construction industry term that refers to expense items that are not considered direct construction costs. Soft costs are user-defined and include architectural, engineering, management, testing, and mitigation fees, and other owner pre- and post-construction expenses.
Sustainability	Sustainability refers to the collection of policies and strategies that meet society's present needs without compromising the ability of future generations to meet their own needs.
System	System refers to building and related site work elements as described by ASTM UNIFORMAT II Classification for Building Elements (E1557-97), a format for classifying major facility elements common to most buildings. Elements usually perform a given function regardless of the design specification construction method or materials used. See also UNIFORMAT II.
System Generated Deficiency	eCOMET® automatically generates system deficiencies based on system life cycles using the systems installation dates as the base year. By adjusting the Next Renewal date ahead or behind the predicted or stated life cycle date, a system cost will come due earlier or later than the originally installed life cycle date. This utility accounts for good maintenance conditions and a longer life, or early expiration of a system life due to any number of adverse factors such as poor installation, acts of god, material defects, poor design applications and other factors that may shorten the life of a material or system. It is important to mention that the condition of the systems is not necessarily a reflection of maintenance practices, but a combination of system usage and age.
UNIFORMAT	ASTM UNIFORMAT II, Classification for Building Elements (E1557-97), a publication of the Construction Specification Institute (CSI), is a format used to classify major facility components common to most buildings. The format is based on functional elements or parts of a facility characterized by their functions without regard to the materials and methods used to accomplish them. These elements are often referred to as systems or assemblies.
Unit Price	The Unit Price (Raw) x (100% + the Additional Cost Template percentage).
Unit Price (Raw)	The actual \$/sq. ft cost being used for the building and systems. It will include adjustments for the City Cost Index applied to the facility.

School Assessment Report - Panola Way Elementary

Useful Life	Also known as Expected Life, Useful Life refers to the intrinsic period of time a system or element is expected to perform as intended. Useful life is generally provided by manufacturers of materials, systems and elements through their literature, testing and experience. Useful Lives in the database are derived from the Building Owners and Managers (BOMA) organization's guidelines, RSMeans cost data, and from client- defined historical experience.
Vacant	Vacant refers to a facility that is not occupied but is a maintained facility by a district. See Abandoned.
Year Built	The year that a building or addition was originally built based on its date of substantial completion or occupancy.
Year Installed	The year a system or element was built or the most recent major renovation date where a minimum of 70% of the system's Current Replacement Value (CRV) was replaced.