

DeKalb County School District/Elementary Schools

Pleasantdale Elementary

Final

School Assessment Report

May 20, 2016



Table of Contents

School Executive Summary	5
School Condition Summary	7
<u>1968 Building</u>	9
Executive Summary	9
Condition Summary	10
Photo Album	11
Condition Detail	12
System Listing	13
Renewal Schedule	15
Forecasted Sustainment Requirement	18
Deficiency Summary By System	19
Deficiency Summary By Priority	20
Deficiency By Priority Investment	21
Deficiency Summary By Category	22
Deficiency Details By Priority	23
<u>2000 Gym</u>	35
Executive Summary	35
Condition Summary	36
Photo Album	37
Condition Detail	38
System Listing	39
Renewal Schedule	40
Forecasted Sustainment Requirement	42
Deficiency Summary By System	43
Deficiency Summary By Priority	44
Deficiency By Priority Investment	45
Deficiency Summary By Category	46
Deficiency Details By Priority	47
<u>2004 Addition</u>	51

School Assessment Report

Executive Summary	51
Condition Summary	52
Photo Album	53
Condition Detail	54
System Listing	55
Renewal Schedule	57
Forecasted Sustainment Requirement	60
Deficiency Summary By System	61
Deficiency Summary By Priority	62
Deficiency By Priority Investment	63
Deficiency Summary By Category	64
Deficiency Details By Priority	65
<u>2004 Storage</u>	66
Executive Summary	66
Condition Summary	67
Photo Album	68
Condition Detail	69
System Listing	70
Renewal Schedule	71
Forecasted Sustainment Requirement	73
Deficiency Summary By System	74
Deficiency Summary By Priority	75
Deficiency By Priority Investment	76
Deficiency Summary By Category	77
Deficiency Details By Priority	78
<u>Site</u>	79
Executive Summary	79
Condition Summary	80
Photo Album	81
Condition Detail	82
System Listing	83

School Assessment Report

Renewal Schedule	84
Forecasted Sustainment Requirement	86
Deficiency Summary By System	87
Deficiency Summary By Priority	88
Deficiency By Priority Investment	89
Deficiency Summary By Category	90
Deficiency Details By Priority	91
Glossary	96

School Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Gross Area (SF):	65,109
Year Built:	1968
Last Renovation:	1998
Replacement Value:	\$15,321,741
Repair Cost:	\$7,186,695.12
Total FCI:	46.91 %
Total RSLI:	24.90 %
FCA Score:	53.09



Description:

The Pleasantdale Elementary School campus consists of two buildings located at 3695 Northlake Drive in Doraville, Georgia. The original campus was constructed in 1968, an addition to the main school building was constructed in 2004, and a gymnasium building was constructed in 2000. In addition to the buildings, the campus contains a storage building, covered walkway, playing field, and playground. The school is scheduled for replacement under SPLOST project 507-422 by September 2017. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report for each building and site improvement on the campus.

School Assessment Report - Pleasantdale Elementary

Attributes:

General Attributes:

Assigned Region:	Region 2	Board District:	District 4
DOE Facility:	3064	Geographic Region:	Region 2
HS Attendance Area:	Lakeside HS	Jurisdictional City:	DeKalb County (Unincorporated)
Site Acreage:	11		

School Condition Summary

The Table below shows the RSLI and FCI for each major system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.


Current Investment Requirement and Condition by Uniformat Classification

UNIFORMAT Classification	RSLI%	FCI %	Current Repair
A10 - Foundations	63.54 %	0.00 %	\$0.00
A20 - Basement Construction	53.00 %	0.00 %	\$0.00
B10 - Superstructure	65.63 %	0.00 %	\$0.00
B20 - Exterior Enclosure	32.30 %	25.28 %	\$388,566.00
B30 - Roofing	26.88 %	25.79 %	\$342,447.00
C10 - Interior Construction	44.08 %	27.32 %	\$228,664.61
C20 - Stairs	53.00 %	0.00 %	\$0.00
C30 - Interior Finishes	24.85 %	15.00 %	\$303,693.00
D10 - Conveying	0.00 %	0.00 %	\$0.00
D20 - Plumbing	17.01 %	79.21 %	\$1,283,627.00
D30 - HVAC	20.41 %	65.52 %	\$1,572,554.00
D40 - Fire Protection	63.33 %	0.00 %	\$0.00
D50 - Electrical	13.20 %	81.38 %	\$1,279,855.00
E10 - Equipment	0.00 %	110.00 %	\$540,262.00
E20 - Furnishings	10.33 %	84.76 %	\$270,635.00
F10 - Special Construction	0.00 %	0.00 %	\$0.00
G20 - Site Improvements	2.54 %	103.01 %	\$790,179.77
G30 - Site Mechanical Utilities	5.36 %	11.74 %	\$55,863.52
G40 - Site Electrical Utilities	3.03 %	54.40 %	\$130,348.22
Totals:	24.90 %	46.91 %	\$7,186,695.12

Condition Deficiency Priority

Facility Name	Gross Area (S.F.)	FCI %	1 Priority	2 Priority	3 Priority	4 Priority	5 Priority
1968 Building	45,816	56.33	\$0.00	\$0.00	\$5,766,254.00	\$0.00	\$0.00
2000 Gym	5,478	11.47	\$0.00	\$0.00	\$104,384.61	\$0.00	\$0.00
2004 Addition	13,645	12.67	\$0.00	\$0.00	\$339,665.00	\$0.00	\$0.00
2004 Storage	170	0.00	\$0.00	\$0.00	\$0.00	\$0.00	\$0.00
Site	65,109	65.86	\$0.00	\$0.00	\$976,391.51	\$0.00	\$0.00
Total:		46.91	\$0.00	\$0.00	\$7,186,695.12	\$0.00	\$0.00

Deficiencies By Priority

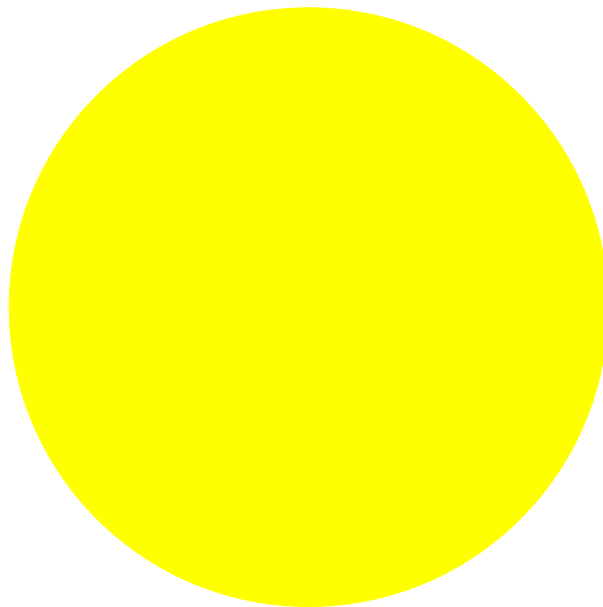

Budget Estimate Total: \$7,186,695.12

- 1 Priority
- 2 Priority
- 3 Priority - \$7,186,695.12
- 4 Priority
- 5 Priority

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	45,816
Year Built:	1968
Last Renovation:	
Replacement Value:	\$10,236,043
Repair Cost:	\$5,766,254.00
Total FCI:	56.33 %
Total RSLI:	17.68 %
FCA Score:	43.67



Description:

The main building at Pleasantdale Elementary is a one-story building located at 3695 Northlake Drive in Doraville, Georgia. Originally built in 1968, there has been one addition in 2005 and a major renovation in 1998. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:

Building Codes:	2010	Fire Sprinkler System:	No
-----------------	------	------------------------	----

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	53.00 %	0.00 %	\$0.00
A20 - Basement Construction	53.00 %	0.00 %	\$0.00
B10 - Superstructure	53.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	14.63 %	35.74 %	\$388,566.00
B30 - Roofing	31.05 %	3.25 %	\$31,750.00
C10 - Interior Construction	30.48 %	40.86 %	\$228,209.00
C20 - Stairs	53.00 %	0.00 %	\$0.00
C30 - Interior Finishes	21.81 %	16.13 %	\$264,438.00
D10 - Conveying	0.00 %	0.00 %	\$0.00
D20 - Plumbing	0.00 %	110.00 %	\$1,283,627.00
D30 - HVAC	13.32 %	85.98 %	\$1,502,353.00
D40 - Fire Protection	0.00 %	0.00 %	\$0.00
D50 - Electrical	0.00 %	110.00 %	\$1,256,414.00
E10 - Equipment	0.00 %	110.00 %	\$540,262.00
E20 - Furnishings	0.00 %	110.00 %	\$270,635.00
F10 - Special Construction	0.00 %	0.00 %	\$0.00
Totals:	17.68 %	56.33 %	\$5,766,254.00

Photo Album

The photo album consists of the various cardinal directions of the building.

1). North Elevation - Main Entrance - Jul 06, 2015



2). Northwest Elevation - Jul 06, 2015



3). South Elevation - Jul 06, 2015



4). Southeast Elevation - Jul 06, 2015



5). Northeast Elevation - Jul 06, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

School Assessment Report - 1968 Building

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$6.49	S.F.	45,816	100	1968	2068		53.00 %	0.00 %	53			\$297,346
A1020	Special Foundations	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
A1030	Slab on Grade	\$7.09	S.F.	45,816	100	1968	2068		53.00 %	0.00 %	53			\$324,835
A2010	Basement Excavation	\$0.14	S.F.	45,816	100	1968	2068		53.00 %	0.00 %	53			\$6,414
A2020	Basement Walls	\$1.64	S.F.	45,816	100	1968	2068		53.00 %	0.00 %	53			\$75,138
B1010	Floor Construction	\$1.63	S.F.	45,816	100	1968	2068		53.00 %	0.00 %	53			\$74,680
B1020	Roof Construction	\$5.34	S.F.	45,816	100	1968	2068		53.00 %	0.00 %	53			\$244,657
B2010	Exterior Walls	\$16.02	S.F.	45,816	60	1968	2028		21.67 %	0.00 %	13			\$733,972
B2020	Exterior Windows	\$6.79	S.F.	45,816	30	1968	1998		0.00 %	110.00 %	-17		\$342,200.00	\$311,091
B2030	Exterior Doors	\$0.92	S.F.	45,816	30	1968	1998		0.00 %	110.00 %	-17		\$46,366.00	\$42,151
B3010	Roof Coverings - Asphalt Shingles	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B3010	Roof Coverings - BUR	\$20.70	S.F.	45,816	25	1998	2023		32.00 %	0.00 %	8			\$948,391
B3010	Roof Coverings - EPDM	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B3010	Roof Coverings - Preformed Metal	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B3010	Roof Coverings - Standing Seam Metal	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B3020	Roof Openings	\$0.63	S.F.	45,816	30	1968	1998		0.00 %	110.00 %	-17		\$31,750.00	\$28,864
C1010	Partitions	\$7.01	S.F.	45,816	100	1968	2068		53.00 %	0.00 %	53			\$321,170
C1020	Interior Doors	\$2.39	S.F.	45,816	30	1968	1998		0.00 %	80.00 %	-17		\$87,600.00	\$109,500
C1030	Fittings	\$2.79	S.F.	45,816	20	1968	1988		0.00 %	110.00 %	-27		\$140,609.00	\$127,827
C2010	Stair Construction	\$1.81	S.F.	45,816	100	1968	2068		53.00 %	0.00 %	53			\$82,927
C3010	Wall Finishes - Ceramic & Glazed	\$10.27	S.F.	27,490	30	1968	1998		0.00 %	0.00 %	-17			\$282,322
C3010	Wall Finishes - Paint	\$1.93	S.F.	18,326	10	2004	2014	2018	30.00 %	0.00 %	3			\$35,369
C3010	Wall Finishes - Wall Coverings	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3020	Floor Finishes - Carpet	\$8.50	S.F.	4,582	8	2010	2018		37.50 %	0.00 %	3			\$38,947
C3020	Floor Finishes - Ceramic & Quarry Tile	\$14.49	S.F.	6,872	50	1968	2018		6.00 %	0.00 %	3			\$99,575
C3020	Floor Finishes - Terrazzo	\$53.01	S.F.	9,163	50	1968	2018		6.00 %	0.00 %	3			\$485,731
C3020	Floor Finishes - VCT	\$9.54	S.F.	25,199	15	1968	1983		0.00 %	110.00 %	-32		\$264,438.00	\$240,398
C3020	Floor Finishes - Wood	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3030	Ceiling Finishes	\$9.98	S.F.	45,816	20	2008	2028		65.00 %	0.00 %	13			\$457,244
D1010	Elevators and Lifts	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
D2010	Plumbing Fixtures	\$17.66	S.F.	45,816	30	1968	1998		0.00 %	110.00 %	-17		\$890,022.00	\$809,111
D2020	Domestic Water Distribution	\$3.99	S.F.	45,816	30	1968	1998		0.00 %	110.00 %	-17		\$201,086.00	\$182,806
D2030	Sanitary Waste	\$3.41	S.F.	45,816	30	1968	1998		0.00 %	110.00 %	-17		\$171,856.00	\$156,233
D2040	Rain Water Drainage	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0

School Assessment Report - 1968 Building

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
D2090	Other Plumbing Systems - Natural Gas	\$0.41	S.F.	45,816	40	1968	2008		0.00 %	110.00 %	-7		\$20,663.00	\$18,785
D3020	Heat Generating Systems	\$4.55	S.F.	45,816	30	1968	1998		0.00 %	110.00 %	-17		\$229,309.00	\$208,463
D3030	Cooling Generating Systems	\$4.73	S.F.	45,816	25	2014	2039		96.00 %	0.00 %	24			\$216,710
D3040	Distribution & Exhaust Systems	\$5.51	S.F.	45,816	30	1968	1998		0.00 %	110.00 %	-17		\$277,691.00	\$252,446
D3050	Terminal & Package Units	\$18.52	S.F.	45,816	15	1998	2013		0.00 %	110.00 %	-2		\$933,364.00	\$848,512
D3060	Controls & Instrumentation	\$3.60	S.F.	45,816	20	1998	2018		15.00 %	0.00 %	3			\$164,938
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$1.23	S.F.	45,816	30	1968	1998		0.00 %	110.00 %	-17		\$61,989.00	\$56,354
D4010	Sprinklers	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
D5010	Electrical Service/Distribution	\$1.81	S.F.	45,816	40	1968	2008		0.00 %	110.00 %	-7		\$91,220.00	\$82,927
D5020	Branch Wiring	\$6.78	S.F.	45,816	30	1968	1998		0.00 %	110.00 %	-17		\$341,696.00	\$310,632
D5020	Lighting	\$8.90	S.F.	45,816	30	1968	1998		0.00 %	110.00 %	-17		\$448,539.00	\$407,762
D5030	Communications and Security - Clock & PA Systems	\$5.60	S.F.	45,816	15	1998	2013		0.00 %	110.00 %	-2		\$282,227.00	\$256,570
D5030	Communications and Security - Fire Alarm	\$1.23	S.F.	45,816	15	1998	2013		0.00 %	110.00 %	-2		\$61,989.00	\$56,354
D5030	Communications and Security - Security & CCTV	\$0.61	S.F.	45,816	15	1998	2013		0.00 %	110.00 %	-2		\$30,743.00	\$27,948
D5090	Other Electrical Systems - Emergency Generator	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
E1010	Commercial Equipment	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
E1020	Institutional Equipment	\$0.40	S.F.	45,816	20	1968	1988		0.00 %	110.00 %	-27		\$20,159.00	\$18,326
E1090	Other Equipment - Kitchen Equipment	\$10.32	S.F.	45,816	20	1968	1988		0.00 %	110.00 %	-27		\$520,103.00	\$472,821
E2010	Fixed Furnishings	\$5.37	S.F.	45,816	20	1968	1988		0.00 %	110.00 %	-27		\$270,635.00	\$246,032
F1010	Special Structures - Canopies	\$1.61	S.F.	45,816	25	1968	1993		0.00 %	0.00 %	-22			\$73,764
Total									17.68 %	56.33 %			\$5,766,254.00	\$10,236,043

School Assessment Report - 1968 Building

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$5,766,254	\$0	\$0	\$991,121	\$0	\$0	\$0	\$0	\$1,321,533	\$0	\$0	\$8,078,907
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1020 - Special Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1010 - Floor Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2020 - Exterior Windows	\$342,200	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$342,200
B2030 - Exterior Doors	\$46,366	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$46,366
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Asphalt Shingles	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - BUR	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,321,533	\$0	\$0	\$1,321,533
B3010 - Roof Coverings - EPDM	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Preformed Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3020 - Roof Openings	\$31,750	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$31,750
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

School Assessment Report - 1968 Building

C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$87,600	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$87,600
C1030 - Fittings	\$140,609	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$140,609
C20 - Stairs	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* C2010 - Stair Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic & Glazed	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Paint	\$0	\$0	\$0	\$42,514	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$42,514
C3010 - Wall Finishes - Wall Coverings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Carpet	\$0	\$0	\$0	\$46,815	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$46,815
C3020 - Floor Finishes - Ceramic & Quarry Tile	\$0	\$0	\$0	\$119,690	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$119,690
C3020 - Floor Finishes - Terrazzo	\$0	\$0	\$0	\$583,848	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$583,848
C3020 - Floor Finishes - VCT	\$264,438	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$264,438
C3020 - Floor Finishes - Wood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D10 - Conveying	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D1010 - Elevators and Lifts	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$890,022	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$890,022
D2020 - Domestic Water Distribution	\$201,086	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$201,086
D2030 - Sanitary Waste	\$171,856	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$171,856
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2090 - Other Plumbing Systems - Natural Gas	\$20,663	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$20,663
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3020 - Heat Generating Systems	\$229,309	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$229,309
D3030 - Cooling Generating Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3040 - Distribution & Exhaust Systems	\$277,691	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$277,691
D3050 - Terminal & Package Units	\$933,364	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$933,364
D3060 - Controls & Instrumentation	\$0	\$0	\$0	\$198,255	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$198,255
D3090 - Other HVAC Systems/Equip - Kitchen Hood	\$61,989	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$61,989
D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


School Assessment Report - 1968 Building

D4010 - Sprinklers	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$91,220	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$91,220
D5020 - Branch Wiring	\$341,696	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$341,696
D5020 - Lighting	\$448,539	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$448,539
D5030 - Communications and Security - Clock & PA Systems	\$282,227	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$282,227
D5030 - Communications and Security - Fire Alarm	\$61,989	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$61,989
D5030 - Communications and Security - Security & CCTV	\$30,743	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$30,743
D5090 - Other Electrical Systems - Emergency Generator	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E - Equipment & Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E10 - Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1010 - Commercial Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1020 - Institutional Equipment	\$20,159	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$20,159
E1090 - Other Equipment - Kitchen Equipment	\$520,103	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$520,103
E20 - Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E2010 - Fixed Furnishings	\$270,635	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$270,635
F - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F10 - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F1010 - Special Structures - Canopies	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

* Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

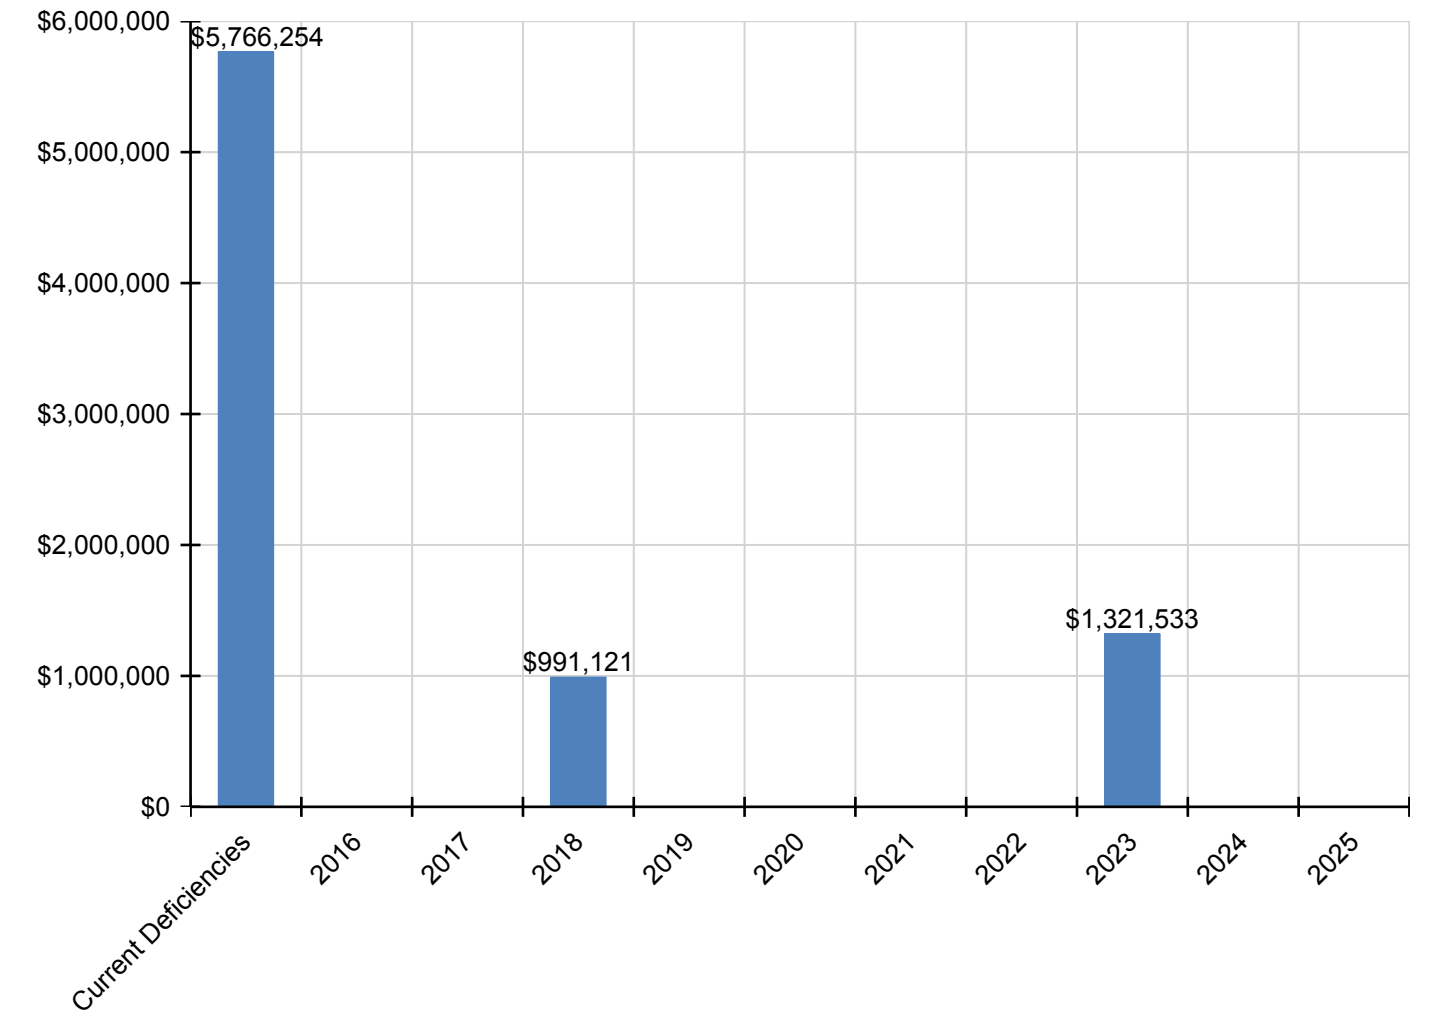

Deficiency Summary by System


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

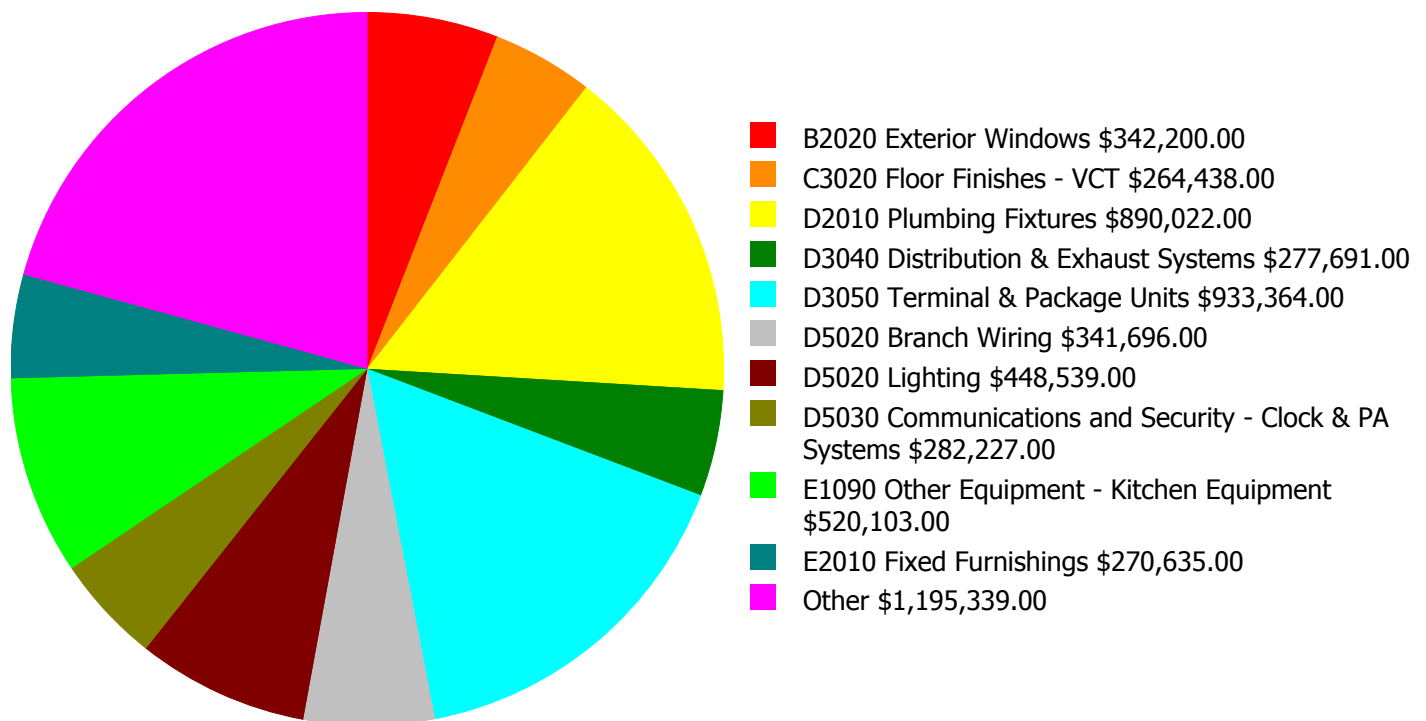

Budget Estimate Total: \$5,766,254.00

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

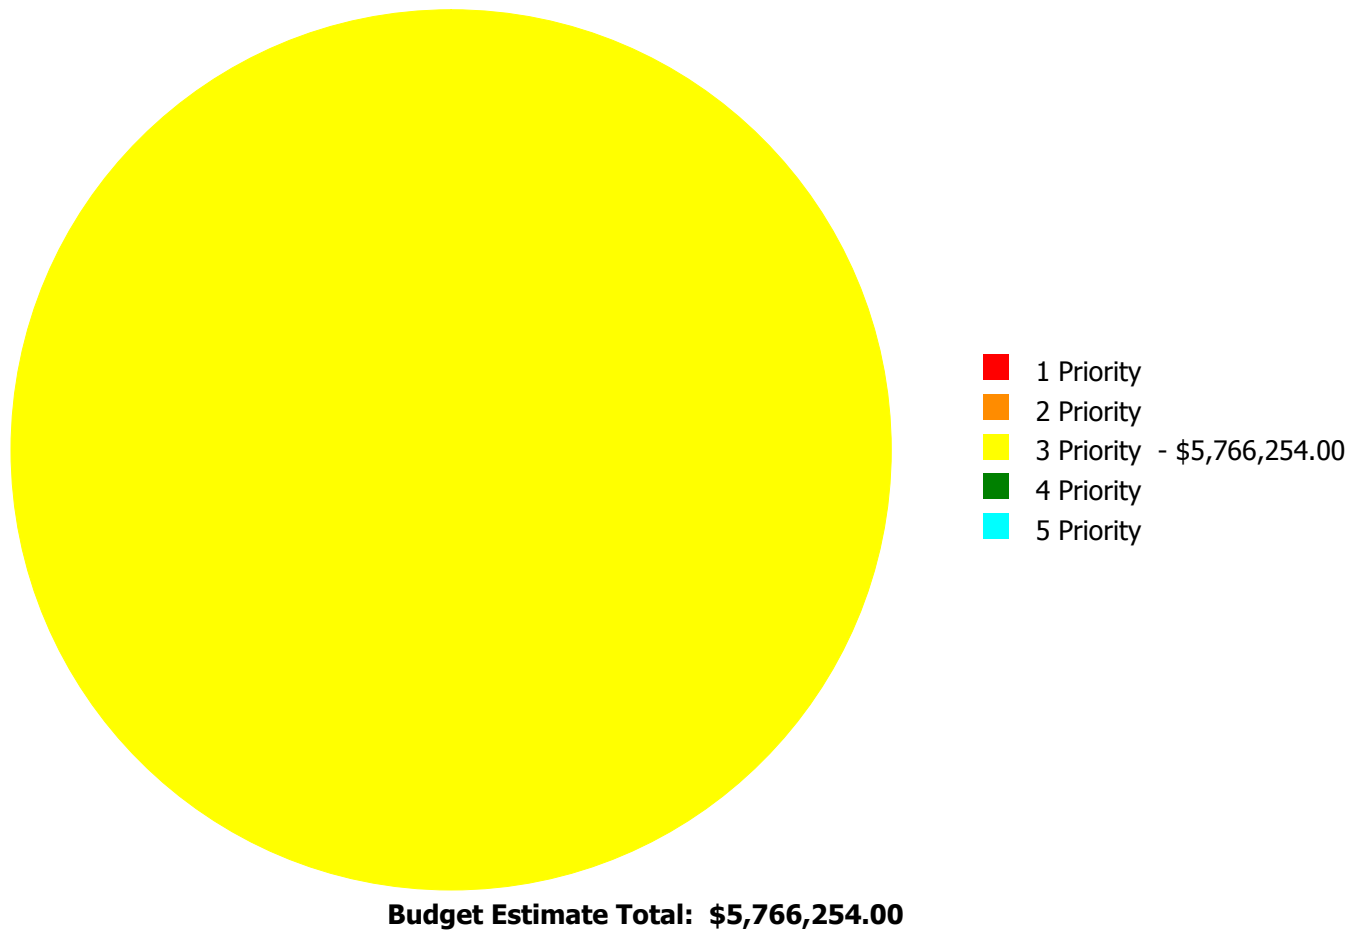

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards.
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
B2020	Exterior Windows	\$0.00	\$0.00	\$342,200.00	\$0.00	\$0.00	\$342,200.00
B2030	Exterior Doors	\$0.00	\$0.00	\$46,366.00	\$0.00	\$0.00	\$46,366.00
B3020	Roof Openings	\$0.00	\$0.00	\$31,750.00	\$0.00	\$0.00	\$31,750.00
C1020	Interior Doors	\$0.00	\$0.00	\$87,600.00	\$0.00	\$0.00	\$87,600.00
C1030	Fittings	\$0.00	\$0.00	\$140,609.00	\$0.00	\$0.00	\$140,609.00
C3020	Floor Finishes - VCT	\$0.00	\$0.00	\$264,438.00	\$0.00	\$0.00	\$264,438.00
D2010	Plumbing Fixtures	\$0.00	\$0.00	\$890,022.00	\$0.00	\$0.00	\$890,022.00
D2020	Domestic Water Distribution	\$0.00	\$0.00	\$201,086.00	\$0.00	\$0.00	\$201,086.00
D2030	Sanitary Waste	\$0.00	\$0.00	\$171,856.00	\$0.00	\$0.00	\$171,856.00
D2090	Other Plumbing Systems - Natural Gas	\$0.00	\$0.00	\$20,663.00	\$0.00	\$0.00	\$20,663.00
D3020	Heat Generating Systems	\$0.00	\$0.00	\$229,309.00	\$0.00	\$0.00	\$229,309.00
D3040	Distribution & Exhaust Systems	\$0.00	\$0.00	\$277,691.00	\$0.00	\$0.00	\$277,691.00
D3050	Terminal & Package Units	\$0.00	\$0.00	\$933,364.00	\$0.00	\$0.00	\$933,364.00
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$0.00	\$0.00	\$61,989.00	\$0.00	\$0.00	\$61,989.00
D5010	Electrical Service/Distribution	\$0.00	\$0.00	\$91,220.00	\$0.00	\$0.00	\$91,220.00
D5020	Branch Wiring	\$0.00	\$0.00	\$341,696.00	\$0.00	\$0.00	\$341,696.00
D5020	Lighting	\$0.00	\$0.00	\$448,539.00	\$0.00	\$0.00	\$448,539.00
D5030	Communications and Security - Clock & PA Systems	\$0.00	\$0.00	\$282,227.00	\$0.00	\$0.00	\$282,227.00
D5030	Communications and Security - Fire Alarm	\$0.00	\$0.00	\$61,989.00	\$0.00	\$0.00	\$61,989.00
D5030	Communications and Security - Security & CCTV	\$0.00	\$0.00	\$30,743.00	\$0.00	\$0.00	\$30,743.00
E1020	Institutional Equipment	\$0.00	\$0.00	\$20,159.00	\$0.00	\$0.00	\$20,159.00
E1090	Other Equipment - Kitchen Equipment	\$0.00	\$0.00	\$520,103.00	\$0.00	\$0.00	\$520,103.00
E2010	Fixed Furnishings	\$0.00	\$0.00	\$270,635.00	\$0.00	\$0.00	\$270,635.00
Total:		\$0.00	\$0.00	\$5,766,254.00	\$0.00	\$0.00	\$5,766,254.00

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

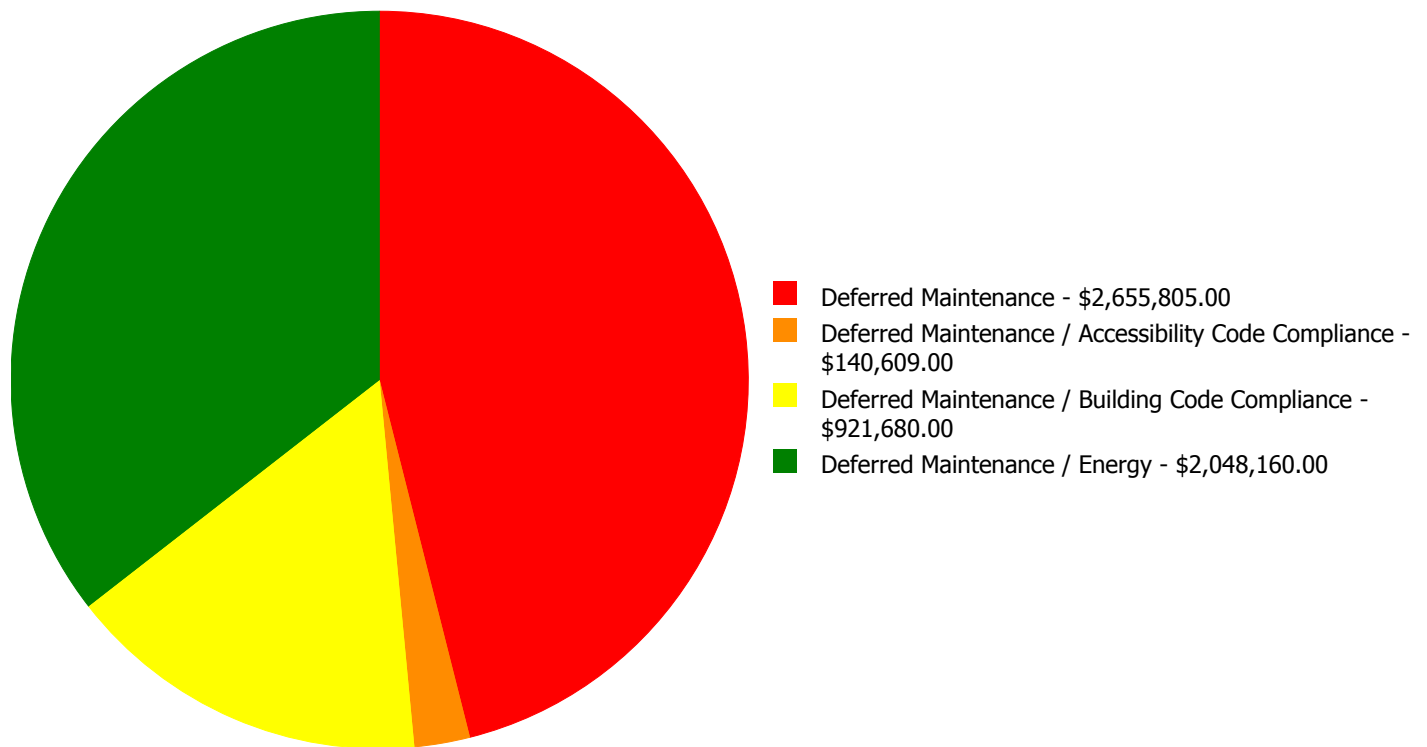

Budget Estimate Total: \$5,766,254.00

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 3 Priority:

System: B2020 - Exterior Windows



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$342,200.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The aluminum frame, operable, single pane windows are aged, damaged, not energy efficient, and should be replaced. SPLOST project 507-422 to replace the school.

System: B2030 - Exterior Doors



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$46,366.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The original exterior doors are aged, rusted and should be replaced. SPLOST project 507-422 to replace the school.

School Assessment Report - 1968 Building

System: B3020 - Roof Openings



Location: Roof

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$31,750.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Skylights are in poor condition with temporary repairs to prevent water infiltration, and are recommended to be replaced. SPLOST project 507-422 to replace the school.

System: C1020 - Interior Doors



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Building Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$87,600.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The interior doors are aged, failing, not ADA or building code compliant, and should be replaced. SPLOST project 507-422 to replace the school.

System: C1030 - Fittings



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$140,609.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Fittings, such as toilet partitions, handrails and signage, are beyond their expected service life, room signage is not ADA compliant, and the entire system should be replaced. SPLOST project 507-422 to replace the school.

System: C3020 - Floor Finishes - VCT



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 25,199.00

Unit of Measure: S.F.

Estimate: \$264,438.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The VCT flooring is aged, cracked, worn and patched, and should be replaced. SPLOST project 507-422 to replace the school.

System: D2010 - Plumbing Fixtures



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$890,022.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The plumbing fixtures are beyond their expected service life, inadequate, and should be scheduled for replacement. SPLOST project 507-422 to replace school by 2018.

System: D2020 - Domestic Water Distribution



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Building Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$201,086.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The domestic water distribution system is beyond its expected service life, not building code compliant, and should be scheduled for replacement. SPLOST project 507-422 to replace the school.

System: D2030 - Sanitary Waste



Location: Throughout Building
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 45,816.00
Unit of Measure: S.F.
Estimate: \$171,856.00
Assessor Name: Ben Nixon
Date Created: 07/07/2015

Notes: The sanitary waste system is beyond its expected service life and should be scheduled for replacement. SPLOST project 507-422 to replace the school.

System: D2090 - Other Plumbing Systems - Natural Gas



Location: Throughout Building
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 45,816.00
Unit of Measure: S.F.
Estimate: \$20,663.00
Assessor Name: Ben Nixon
Date Created: 07/07/2015

Notes: The natural gas system is beyond its expected service life and should be scheduled for replacement. SPLOST project 507-422 to replace the school.

System: D3020 - Heat Generating Systems



Location: Mechanical Room

Distress: Beyond Service Life

Category: Deferred Maintenance / Building Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$229,309.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The heat generating system is beyond its expected service life, inadequate, and should be scheduled for replacement. SPLOST project 507-422 to replace the school.

System: D3040 - Distribution & Exhaust Systems



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$277,691.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The distribution and exhaust systems are beyond their expected service life, inadequate, and should be scheduled for replacement. SPLOST project 507-422 to replace the school.

System: D3050 - Terminal & Package Units



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$933,364.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The terminal and package units are beyond their expected service life, inadequate, and should be scheduled for replacement. School staff reports that air conditioning is loud in certain rooms. SPLOST project 507-422 to replace the school.

System: D3090 - Other HVAC Systems/Equip - Kitchen Hood



Location: Kitchen

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.


Estimate: \$61,989.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The kitchen hood system is beyond its expected service life, aged, and should be scheduled for replacement. SPLOST project 507-422 to replace the school.

System: D5010 - Electrical Service/Distribution

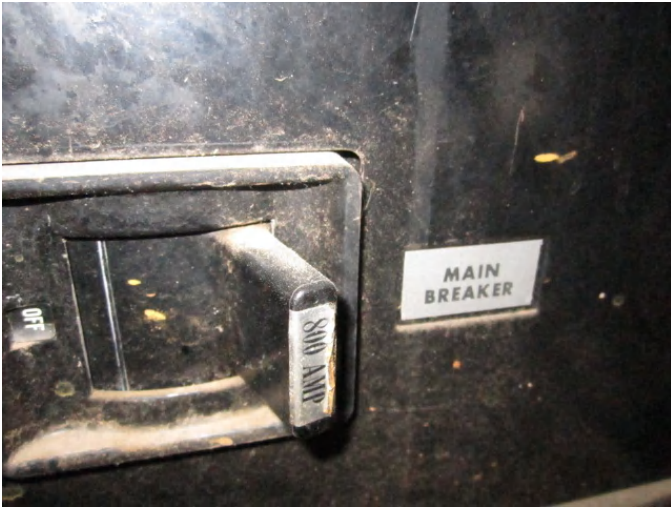

Location: Main Switch Room/Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$91,220.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The electrical service/distribution system is beyond its expected service life, aged, and should be scheduled for replacement. SPLOST project 507-422 to replace the school.

System: D5020 - Branch Wiring



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Building Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$341,696.00

Assessor Name: Ben Nixon

Date Created: 07/07/2015

Notes: The branch wiring system is beyond its expected service life, aged, and should be scheduled for replacement. GFI outlets are missing in wet areas. SPLOST project 507-422 to replace the school.

System: D5020 - Lighting



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$448,539.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The lighting system is beyond its expected service life, in poor condition, and should be scheduled for replacement. SPLOST project 507-422 to replace the school.

System: D5030 - Communications and Security - Clock & PA Systems



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$282,227.00

Assessor Name: Ben Nixon

Date Created: 07/07/2015

Notes: Clock and PA systems are beyond their expected service life, aged, and should be scheduled for replacement. SPLOST project 507-422 to replace the school.

System: D5030 - Communications and Security - Fire Alarm



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance / Building Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$61,989.00

Assessor Name: Ben Nixon

Date Created: 07/07/2015

Notes: The fire alarm system is beyond its expected service life and should be scheduled for replacement. Visible alarms (strobes) are not installed in multiple occupancy, common use areas. SPLOST project 507-422 to replace the school.

System: D5030 - Communications and Security - Security & CCTV



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$30,743.00

Assessor Name: Ben Nixon

Date Created: 07/07/2015

Notes: The security and CCTV systems are beyond their expected service life, aged, and should be scheduled for replacement. SPLOST project 507-422 to replace the school.

System: E1020 - Institutional Equipment



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$20,159.00

Assessor Name: Ben Nixon

Date Created: 07/07/2015

Notes: Institutional equipment, such as theater and stage equipment and library equipment, is beyond its expected service life and should be scheduled for replacement. SPLOST project 507-422 to replace the school.

System: E1090 - Other Equipment - Kitchen Equipment



Location: Kitchen

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$520,103.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Kitchen equipment is beyond its expected service life and should be scheduled for replacement. SPLOST project 507-422 to replace the school.

System: E2010 - Fixed Furnishings



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 45,816.00

Unit of Measure: S.F.

Estimate: \$270,635.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: Fixed furnishings, such as built-in cabinets, are beyond their expected service life and worn, and should be replaced. SPLOST project 507-422 to replace the school.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	5,478
Year Built:	2000
Last Renovation:	
Replacement Value:	\$910,151
Repair Cost:	\$104,384.61
Total FCI:	11.47 %
Total RSLI:	57.36 %
FCA Score:	88.53



Description:

The 2000 gymnasium at Pleasantdale Elementary is a one-story building located at 3695 Northlake Drive in Doraville, Georgia. There have been no additions and no major renovations to this building. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:

Building Codes:	2011	Fire Sprinkler System:	No
-----------------	------	------------------------	----

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	85.00 %	0.00 %	\$0.00
B10 - Superstructure	85.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	72.70 %	0.00 %	\$0.00
B30 - Roofing	80.00 %	0.00 %	\$0.00
C10 - Interior Construction	67.62 %	0.41 %	\$455.61
C30 - Interior Finishes	28.89 %	10.24 %	\$10,287.00
D20 - Plumbing	50.24 %	0.00 %	\$0.00
D30 - HVAC	25.62 %	53.04 %	\$70,201.00
D50 - Electrical	30.14 %	27.41 %	\$23,441.00
Totals:	57.36 %	11.47 %	\$104,384.61

Photo Album

The photo album consists of the various cardinal directions of the building.

1). North Elevation - Jul 06, 2015



2). West Elevation - Jul 06, 2015



3). South Elevation - Jul 06, 2015



4). East Elevation - Jul 06, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

School Assessment Report - 2000 Gym

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$9.34	S.F.	5,478	100	2000	2100		85.00 %	0.00 %	85			\$51,165
A1030	Slab on Grade	\$6.21	S.F.	5,478	100	2000	2100		85.00 %	0.00 %	85			\$34,018
B1020	Roof Construction	\$21.36	S.F.	5,478	100	2000	2100		85.00 %	0.00 %	85			\$117,010
B2010	Exterior Walls	\$19.80	S.F.	5,478	60	2000	2060		75.00 %	0.00 %	45			\$108,464
B2030	Exterior Doors	\$2.01	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$11,011
B3010	Roof Coverings - Standing Seam Metal	\$11.91	S.F.	5,478	75	2000	2075		80.00 %	0.00 %	60			\$65,243
C1010	Partitions	\$12.78	S.F.	5,478	100	2000	2100		85.00 %	0.00 %	85			\$70,009
C1020	Interior Doors	\$4.24	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$23,227
C1030	Fittings	\$3.46	S.F.	5,478	20	2000	2020		25.00 %	2.40 %	5		\$455.61	\$18,954
C3010	Wall Finishes - Ceramic	\$6.65	S.F.	0	0				0.00 %	0.00 %				\$0
C3010	Wall Finishes - Paint	\$1.41	S.F.	5,478	10	2000	2010		0.00 %	109.99 %	-5		\$8,496.00	\$7,724
C3020	Floor Finishes - Ceramic Tile	\$6.67	S.F.	253	50	2000	2050		70.00 %	0.00 %	35			\$1,688
C3020	Floor Finishes - Neoprene	\$14.46	S.F.	4,554	15	2000	2015	2020	33.33 %	0.00 %	5			\$65,851
C3020	Floor Finishes - VCT	\$5.01	S.F.	325	15	2000	2015		0.00 %	110.01 %	0		\$1,791.00	\$1,628
C3030	Ceiling Finishes	\$4.31	S.F.	5,478	20	2000	2020		25.00 %	0.00 %	5			\$23,610
D2010	Plumbing Fixtures	\$9.66	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$52,917
D2020	Domestic Water Distribution	\$5.85	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$32,046
D2030	Sanitary Waste	\$0.87	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$4,766
D2040	Rain Water Drainage	\$0.22	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$1,205
D2090	Other Plumbing Systems - Natural Gas	\$0.32	S.F.	5,478	40	2000	2040		62.50 %	0.00 %	25			\$1,753
D3040	Distribution Systems & Exhaust Systems	\$12.25	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$67,106
D3050	Terminal & Package Units	\$11.65	S.F.	5,478	15	2000	2015		0.00 %	110.00 %	0		\$70,201.00	\$63,819
D3060	Controls & Instrumentation	\$0.26	S.F.	5,478	20	2000	2020		25.00 %	0.00 %	5			\$1,424
D5010	Electrical Service/Distribution	\$1.24	S.F.	5,478	40	2000	2040		62.50 %	0.00 %	25			\$6,793
D5020	Branch Wiring	\$5.24	S.F.	5,478	30	2000	2030		50.00 %	0.00 %	15			\$28,705
D5020	Lighting	\$5.24	S.F.	5,478	20	2000	2020		25.00 %	0.00 %	5			\$28,705
D5030	Communications and Security - Fire Alarm	\$2.13	S.F.	5,478	15	2000	2015		0.00 %	110.00 %	0		\$12,835.00	\$11,668
D5030	Communications and Security - Public Address & Clock System	\$0.88	S.F.	5,478	15	2000	2015		0.00 %	110.00 %	0		\$5,303.00	\$4,821
D5030	Communications and Security - Security & CCTV	\$0.88	S.F.	5,478	15	2000	2015		0.00 %	110.00 %	0		\$5,303.00	\$4,821
Total									57.36 %	11.47 %			\$104,384.61	\$910,151

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$104,385	\$0	\$0	\$0	\$0	\$176,671	\$0	\$0	\$0	\$0	\$11,418	\$292,474
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$456	\$0	\$0	\$0	\$0	\$24,170	\$0	\$0	\$0	\$0	\$0	\$24,625
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Paint	\$8,496	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$11,418	\$19,914
C3020 - Floor Finishes - Ceramic Tile	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Neoprene	\$0	\$0	\$0	\$0	\$0	\$83,973	\$0	\$0	\$0	\$0	\$0	\$83,973
C3020 - Floor Finishes - VCT	\$1,791	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$1,791
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$30,108	\$0	\$0	\$0	\$0	\$0	\$30,108
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


School Assessment Report - 2000 Gym

D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2020 - Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2030 - Sanitary Waste	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2090 - Other Plumbing Systems - Natural Gas	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3040 - Distribution Systems & Exhaust Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3050 - Terminal & Package Units	\$70,201	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$70,201
D3060 - Controls & Instrumentation	\$0	\$0	\$0	\$0	\$0	\$1,817	\$0	\$0	\$0	\$0	\$0	\$1,817
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting	\$0	\$0	\$0	\$0	\$0	\$36,604	\$0	\$0	\$0	\$0	\$0	\$36,604
D5030 - Communications and Security - Fire Alarm	\$12,835	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$12,835
D5030 - Communications and Security - Public Address & Clock System	\$5,303	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$5,303
D5030 - Communications and Security - Security & CCTV	\$5,303	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$5,303

* Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

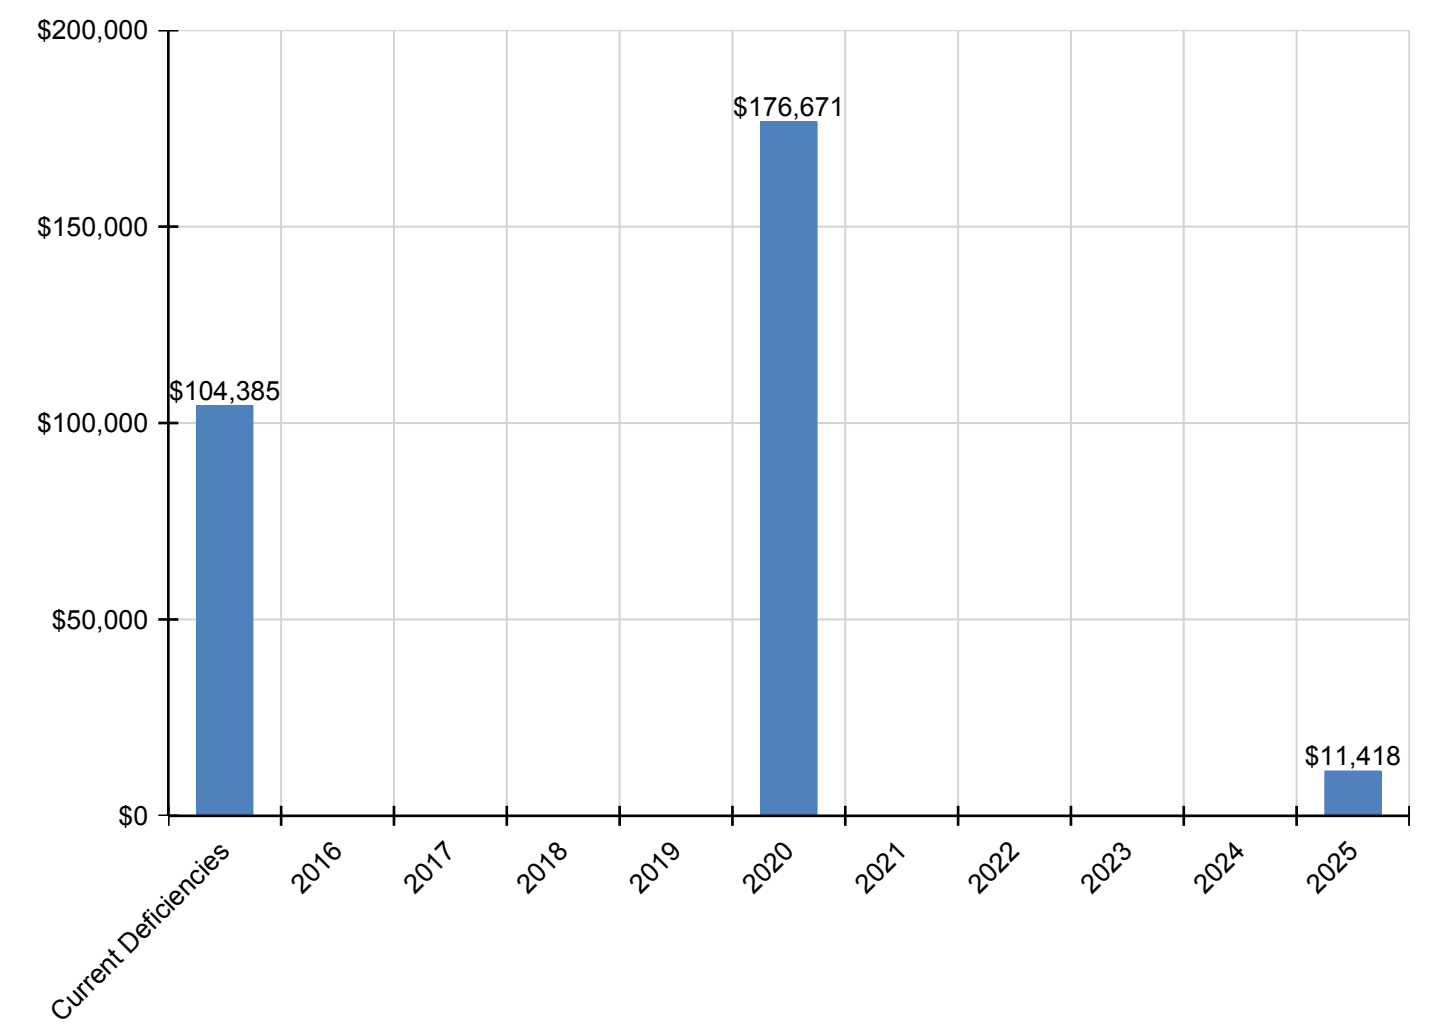

Deficiency Summary by System


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

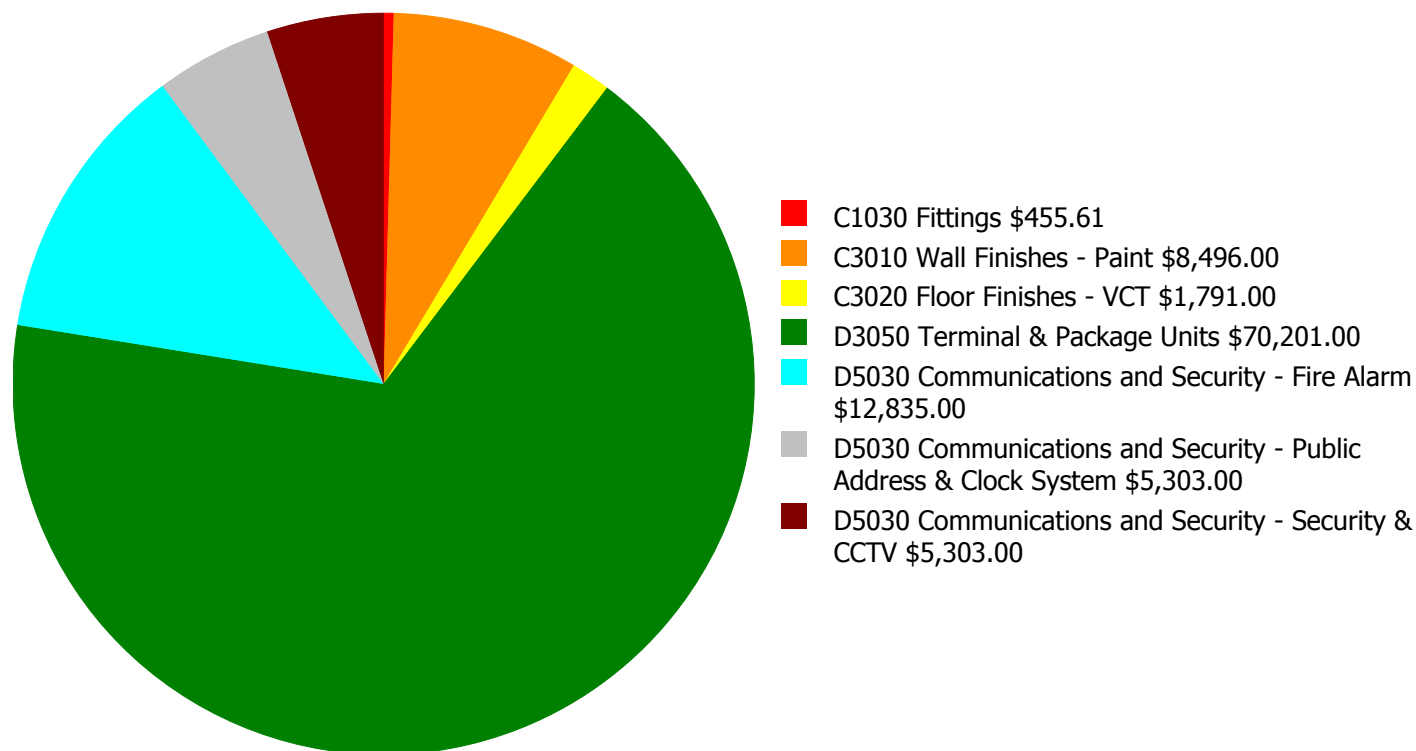

Budget Estimate Total: \$104,384.61

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

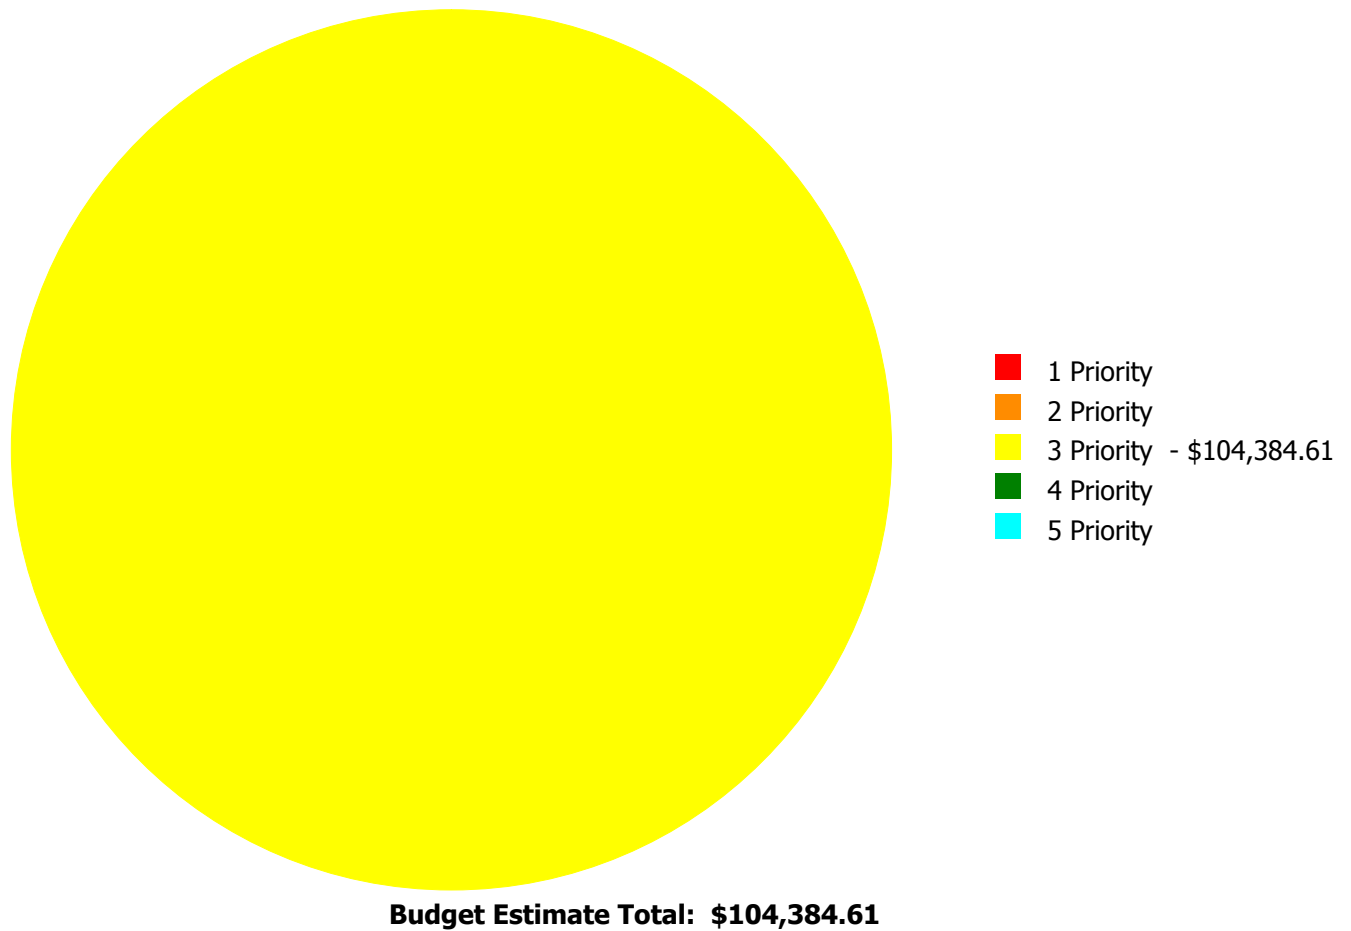

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards.
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
C1030	Fittings	\$0.00	\$0.00	\$455.61	\$0.00	\$0.00	\$455.61
C3010	Wall Finishes - Paint	\$0.00	\$0.00	\$8,496.00	\$0.00	\$0.00	\$8,496.00
C3020	Floor Finishes - VCT	\$0.00	\$0.00	\$1,791.00	\$0.00	\$0.00	\$1,791.00
D3050	Terminal & Package Units	\$0.00	\$0.00	\$70,201.00	\$0.00	\$0.00	\$70,201.00
D5030	Communications and Security - Fire Alarm	\$0.00	\$0.00	\$12,835.00	\$0.00	\$0.00	\$12,835.00
D5030	Communications and Security - Public Address & Clock System	\$0.00	\$0.00	\$5,303.00	\$0.00	\$0.00	\$5,303.00
D5030	Communications and Security - Security & CCTV	\$0.00	\$0.00	\$5,303.00	\$0.00	\$0.00	\$5,303.00
Total:		\$0.00	\$0.00	\$104,384.61	\$0.00	\$0.00	\$104,384.61

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

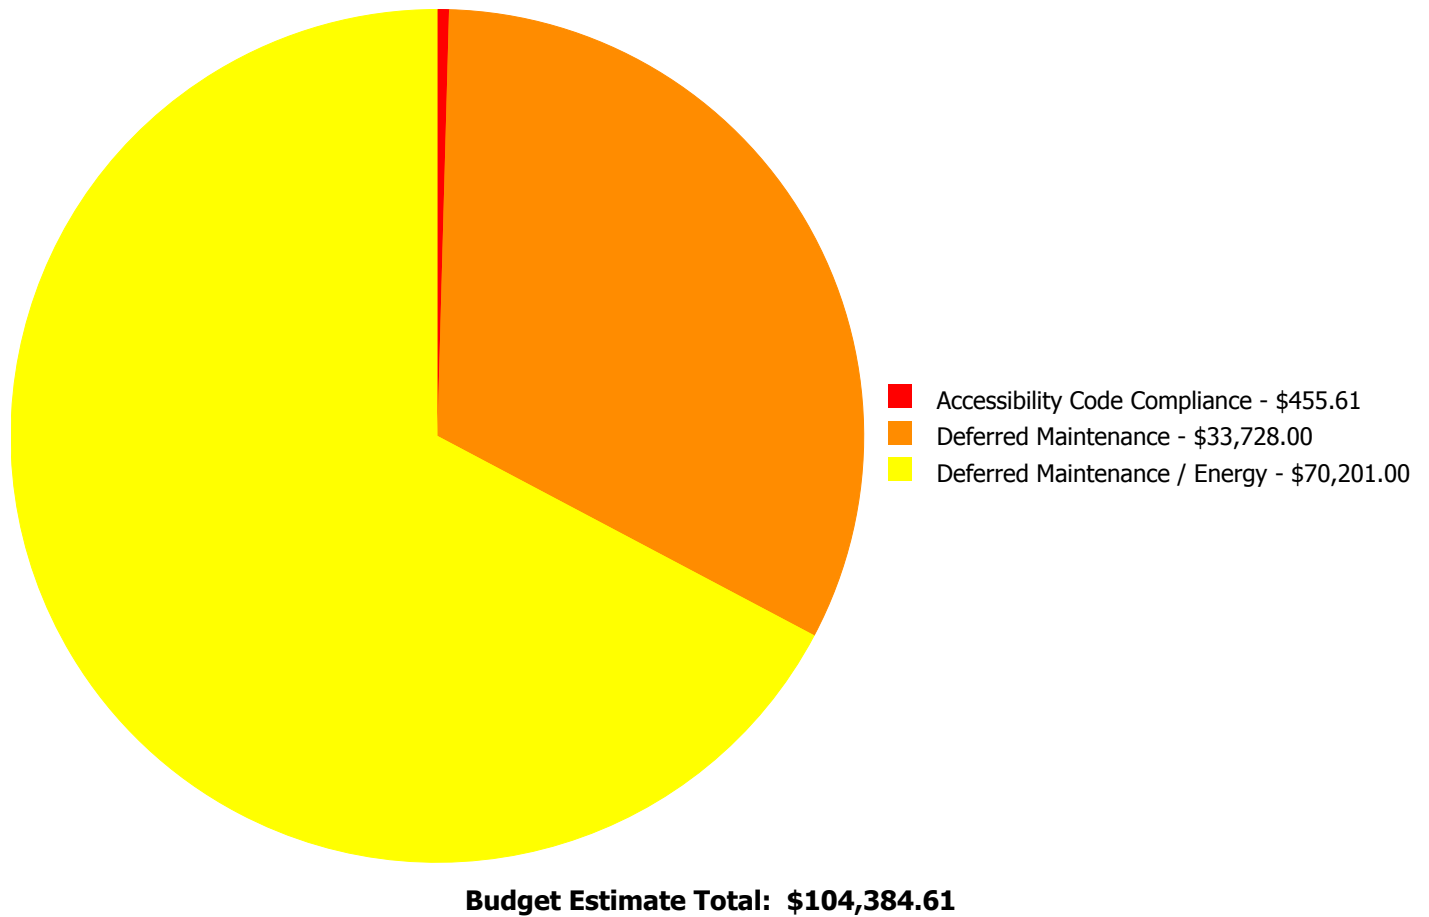

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 3 Priority:

System: C1030 - Fittings



Location: Throughout Building

Distress: Missing

Category: Accessibility Code Compliance

Priority: 3 Priority

Correction: Remove and replace the signage w/ADA compliant signage.

Qty: 5.00

Unit of Measure: S.F.


Estimate: \$455.61

Assessor Name: Sam Mandola

Date Created: 07/07/2015

Notes: Room signage per ADA standards is missing and should be provided.

System: C3010 - Wall Finishes - Paint

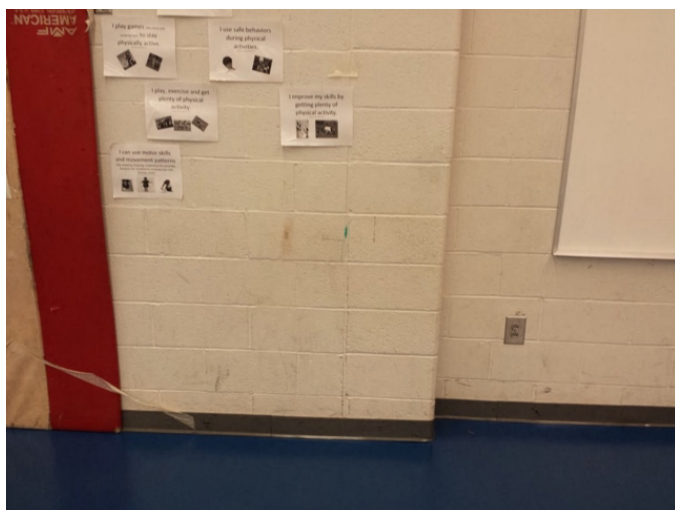

Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$8,496.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The painted wall finishes are beyond their expected service life, scuffed and stained, and should be replaced. SPLOST project 507-422 to replace the school.

System: C3020 - Floor Finishes - VCT



Location: Entrance Area and Offices

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 325.00

Unit of Measure: S.F.

Estimate: \$1,791.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The VCT flooring is aged, patched, stained and worn, and should be replaced.

System: D3050 - Terminal & Package Units



Location: Throughout Building

Distress: Inadequate

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$70,201.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: One PTAC AC unit is located in the office area of the gym. It is beyond its expected service life. The main gym area does not have air conditioning and it should be provided. SPLOST project 507-422 to replace the school.

System: D5030 - Communications and Security - Fire Alarm



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$12,835.00

Assessor Name: Ben Nixon

Date Created: 07/06/2015

Notes: The fire alarm system is beyond its expected service life and should be scheduled for replacement. SPLOST project 507-422 provides for replacing the school.

System: D5030 - Communications and Security - Public Address & Clock System



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$5,303.00

Assessor Name: Ben Nixon

Date Created: 07/06/2015

Notes: The public address and clock system is beyond its expected service life, aged, and should be scheduled for replacement. SPLOST project 507-422 to replace the school.

System: D5030 - Communications and Security - Security & CCTV



Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 5,478.00

Unit of Measure: S.F.

Estimate: \$5,303.00

Assessor Name: Ben Nixon

Date Created: 07/06/2015

Notes: The security and CCTV systems are beyond their expected service life, aged, and should be scheduled for replacement. SPLOST project 507-422 to replace the school.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	13,645
Year Built:	2004
Last Renovation:	
Replacement Value:	\$2,679,986
Repair Cost:	\$339,665.00
Total FCI:	12.67 %
Total RSLI:	53.08 %
FCA Score:	87.33



Description:

The 2005 classroom addition at Pleasantdale Elementary School is a one-story building located at 3695 Northlake Drive in Doraville, Georgia. There have been no major renovations to this addition. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:

Building Codes:	2020	Fire Sprinkler System:	Yes
-----------------	------	------------------------	-----

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	89.00 %	0.00 %	\$0.00
A20 - Basement Construction	0.00 %	0.00 %	\$0.00
B10 - Superstructure	89.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	75.71 %	0.00 %	\$0.00
B30 - Roofing	0.00 %	110.00 %	\$310,697.00
C10 - Interior Construction	73.90 %	0.00 %	\$0.00
C30 - Interior Finishes	40.92 %	10.17 %	\$28,968.00
D10 - Conveying	0.00 %	0.00 %	\$0.00
D20 - Plumbing	63.48 %	0.00 %	\$0.00
D30 - HVAC	42.89 %	0.00 %	\$0.00
D40 - Fire Protection	63.33 %	0.00 %	\$0.00
D50 - Electrical	52.69 %	0.00 %	\$0.00
E10 - Equipment	0.00 %	0.00 %	\$0.00
E20 - Furnishings	45.00 %	0.00 %	\$0.00
F10 - Special Construction	0.00 %	0.00 %	\$0.00
Totals:	53.08 %	12.67 %	\$339,665.00

Photo Album

The photo album consists of the various cardinal directions of the building.

1). East Elevation - Jul 06, 2015



2). Northeast Elevation - Oct 23, 2015



3). South Elevation - Oct 23, 2015



4). South Elevation - Oct 23, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

School Assessment Report - 2004 Addition

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$6.49	S.F.	13,645	100	2004	2104		89.00 %	0.00 %	89			\$88,556
A1020	Special Foundations	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
A1030	Slab on Grade	\$7.09	S.F.	13,645	100	2004	2104		89.00 %	0.00 %	89			\$96,743
A2010	Basement Excavation	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
A2020	Basement Walls	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B1010	Floor Construction	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B1020	Roof Construction	\$5.34	S.F.	13,645	100	2004	2104		89.00 %	0.00 %	89			\$72,864
B2010	Exterior Walls	\$16.02	S.F.	13,645	60	2004	2064		81.67 %	0.00 %	49			\$218,593
B2020	Exterior Windows	\$6.79	S.F.	13,645	30	2004	2034		63.33 %	0.00 %	19			\$92,650
B2030	Exterior Doors	\$0.92	S.F.	13,645	30	2004	2034		63.33 %	0.00 %	19			\$12,553
B3010	Roof Coverings - Asphalt Shingles	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B3010	Roof Coverings - BUR	\$20.70	S.F.	13,645	25	2004	2029	2015	0.00 %	110.00 %	0		\$310,697.00	\$282,452
B3010	Roof Coverings - EPDM	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B3010	Roof Coverings - Preformed Metal	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B3010	Roof Coverings - Standing Seam Metal	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B3020	Roof Openings	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C1010	Partitions	\$7.01	S.F.	13,645	100	2004	2104		89.00 %	0.00 %	89			\$95,651
C1020	Interior Doors	\$2.39	S.F.	13,645	30	2004	2034		63.33 %	0.00 %	19			\$32,612
C1030	Fittings	\$2.79	S.F.	13,645	20	2004	2024		45.00 %	0.00 %	9			\$38,070
C3010	Wall Finishes - Ceramic & Glazed	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3010	Wall Finishes - Paint	\$1.93	S.F.	13,645	10	2004	2014		0.00 %	110.00 %	-1		\$28,968.00	\$26,335
C3010	Wall Finishes - Wall Coverings	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3020	Floor Finishes - Carpet	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3020	Floor Finishes - Ceramic & Quarry Tile	\$14.49	S.F.	978	50	2004	2054		78.00 %	0.00 %	39			\$14,171
C3020	Floor Finishes - Textured Concrete	\$6.71	S.F.	4,469	50	2004	2054		78.00 %	0.00 %	39			\$29,987
C3020	Floor Finishes - VCT	\$9.54	S.F.	8,198	15	2004	2019		26.67 %	0.00 %	4			\$78,209
C3020	Floor Finishes - Wood	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3030	Ceiling Finishes	\$9.98	S.F.	13,645	20	2004	2024		45.00 %	0.00 %	9			\$136,177
D1010	Elevators and Lifts	\$0.00	S.F.		0				0.00 %	0.00 %				\$0
D2010	Plumbing Fixtures	\$17.66	S.F.	13,645	30	2004	2034		63.33 %	0.00 %	19			\$240,971
D2020	Domestic Water Distribution	\$3.99	S.F.	13,645	30	2004	2034		63.33 %	0.00 %	19			\$54,444
D2030	Sanitary Waste	\$3.41	S.F.	13,645	30	2004	2034		63.33 %	0.00 %	19			\$46,529
D2040	Rain Water Drainage	\$0.98	S.F.	13,645	30	2004	2034		63.33 %	0.00 %	19			\$13,372
D2090	Other Plumbing Systems - Natural Gas	\$0.41	S.F.	13,645	40	2004	2044		72.50 %	0.00 %	29			\$5,594

School Assessment Report - 2004 Addition

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
D3020	Heat Generating Systems	\$4.55	S.F.	13,645	30	2004	2034		63.33 %	0.00 %	19			\$62,085
D3030	Cooling Generating Systems	\$4.73	S.F.	13,645	25	2004	2029		56.00 %	0.00 %	14			\$64,541
D3040	Distribution & Exhaust Systems	\$5.51	S.F.	13,645	30	2004	2034		63.33 %	0.00 %	19			\$75,184
D3050	Terminal & Package Units	\$18.52	S.F.	13,645	15	2004	2019		26.67 %	0.00 %	4			\$252,705
D3060	Controls & Instrumentation	\$3.60	S.F.	13,645	20	2004	2024		45.00 %	0.00 %	9			\$49,122
D3090	Other HVAC Systems/Equip - Kitchen Hood	\$1.23	S.F.	13,645	30	2004	2034		63.33 %	0.00 %	19			\$16,783
D4010	Sprinklers	\$4.75	S.F.	13,645	30	2004	2034		63.33 %	0.00 %	19			\$64,814
D5010	Electrical Service/Distribution	\$1.81	S.F.	13,645	40	2004	2044		72.50 %	0.00 %	29			\$24,697
D5020	Branch Wiring	\$6.78	S.F.	13,645	30	2004	2034		63.33 %	0.00 %	19			\$92,513
D5020	Lighting	\$8.90	S.F.	13,645	30	2004	2034		63.33 %	0.00 %	19			\$121,441
D5030	Communications and Security - Clock & PA Systems	\$5.60	S.F.	13,645	15	2004	2019		26.67 %	0.00 %	4			\$76,412
D5030	Communications and Security - Fire Alarm	\$1.23	S.F.	13,645	15	2004	2019		26.67 %	0.00 %	4			\$16,783
D5030	Communications and Security - Security & CCTV	\$0.61	S.F.	13,645	15	2004	2019		26.67 %	0.00 %	4			\$8,323
D5090	Other Electrical Systems - Emergency Generator	\$0.35	S.F.	13,645	15	2004	2019		26.67 %	0.00 %	4			\$4,776
E1010	Commercial Equipment	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
E1020	Institutional Equipment	\$0.00	S.F.		0				0.00 %	0.00 %				\$0
E1090	Other Equipment	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
E2010	Fixed Furnishings	\$5.37	S.F.	13,645	20	2004	2024		45.00 %	0.00 %	9			\$73,274
F1010	Special Structures - Canopies	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
Total									53.08 %	12.67 %			\$339,665.00	\$2,679,986

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$339,665	\$0	\$0	\$0	\$541,291	\$0	\$0	\$0	\$0	\$425,757	\$38,931	\$1,345,643
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1020 - Special Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A20 - Basement Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2010 - Basement Excavation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A2020 - Basement Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1010 - Floor Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2020 - Exterior Windows	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Asphalt Shingles	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - BUR	\$310,697	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$310,697
B3010 - Roof Coverings - EPDM	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Preformed Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings - Standing Seam Metal	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3020 - Roof Openings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

School Assessment Report - 2004 Addition

C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$54,640	\$0	\$54,640
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Ceramic & Glazed	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes - Paint	\$28,968	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$38,931	\$67,899
C3010 - Wall Finishes - Wall Coverings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Carpet	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Ceramic & Quarry Tile	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - Textured Concrete	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes - VCT	\$0	\$0	\$0	\$0	\$96,828	\$0	\$0	\$0	\$0	\$0	\$0	\$96,828
C3020 - Floor Finishes - Wood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$195,448	\$0	\$195,448
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D10 - Conveying	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D1010 - Elevators and Lifts	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2010 - Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2020 - Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2030 - Sanitary Waste	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2090 - Other Plumbing Systems - Natural Gas	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D30 - HVAC	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3020 - Heat Generating Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3030 - Cooling Generating Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3040 - Distribution & Exhaust Systems	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D3050 - Terminal & Package Units	\$0	\$0	\$0	\$0	\$312,864	\$0	\$0	\$0	\$0	\$0	\$0	\$312,864
D3060 - Controls & Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$70,502	\$0	\$70,502
D3090 - Other HVAC Systems/Equip - Kitchen Hood	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D40 - Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D4010 - Sprinklers	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0


School Assessment Report - 2004 Addition

D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5030 - Communications and Security - Clock & PA Systems	\$0	\$0	\$0	\$0	\$94,602	\$0	\$0	\$0	\$0	\$0	\$0	\$94,602
D5030 - Communications and Security - Fire Alarm	\$0	\$0	\$0	\$0	\$20,779	\$0	\$0	\$0	\$0	\$0	\$0	\$20,779
D5030 - Communications and Security - Security & CCTV	\$0	\$0	\$0	\$0	\$10,305	\$0	\$0	\$0	\$0	\$0	\$0	\$10,305
D5090 - Other Electrical Systems - Emergency Generator	\$0	\$0	\$0	\$0	\$5,912	\$0	\$0	\$0	\$0	\$0	\$0	\$5,912
E - Equipment & Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E10 - Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1010 - Commercial Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1020 - Institutional Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E1090 - Other Equipment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E20 - Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
E2010 - Fixed Furnishings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$105,166	\$0	\$105,166
F - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F10 - Special Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
F1010 - Special Structures - Canopies	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

* Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

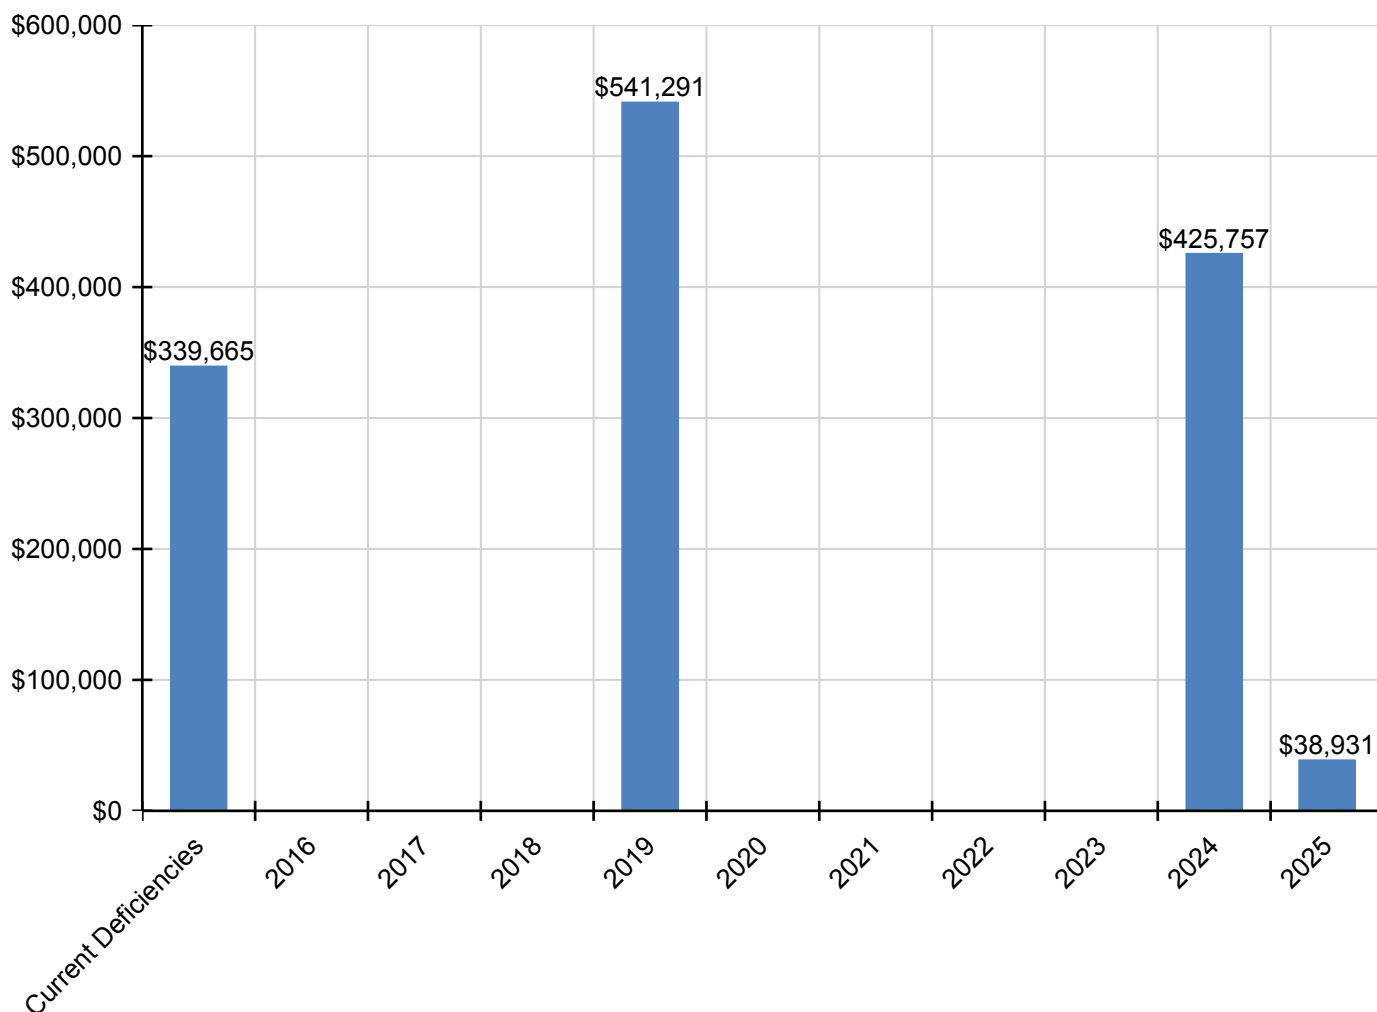

Deficiency Summary by System


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

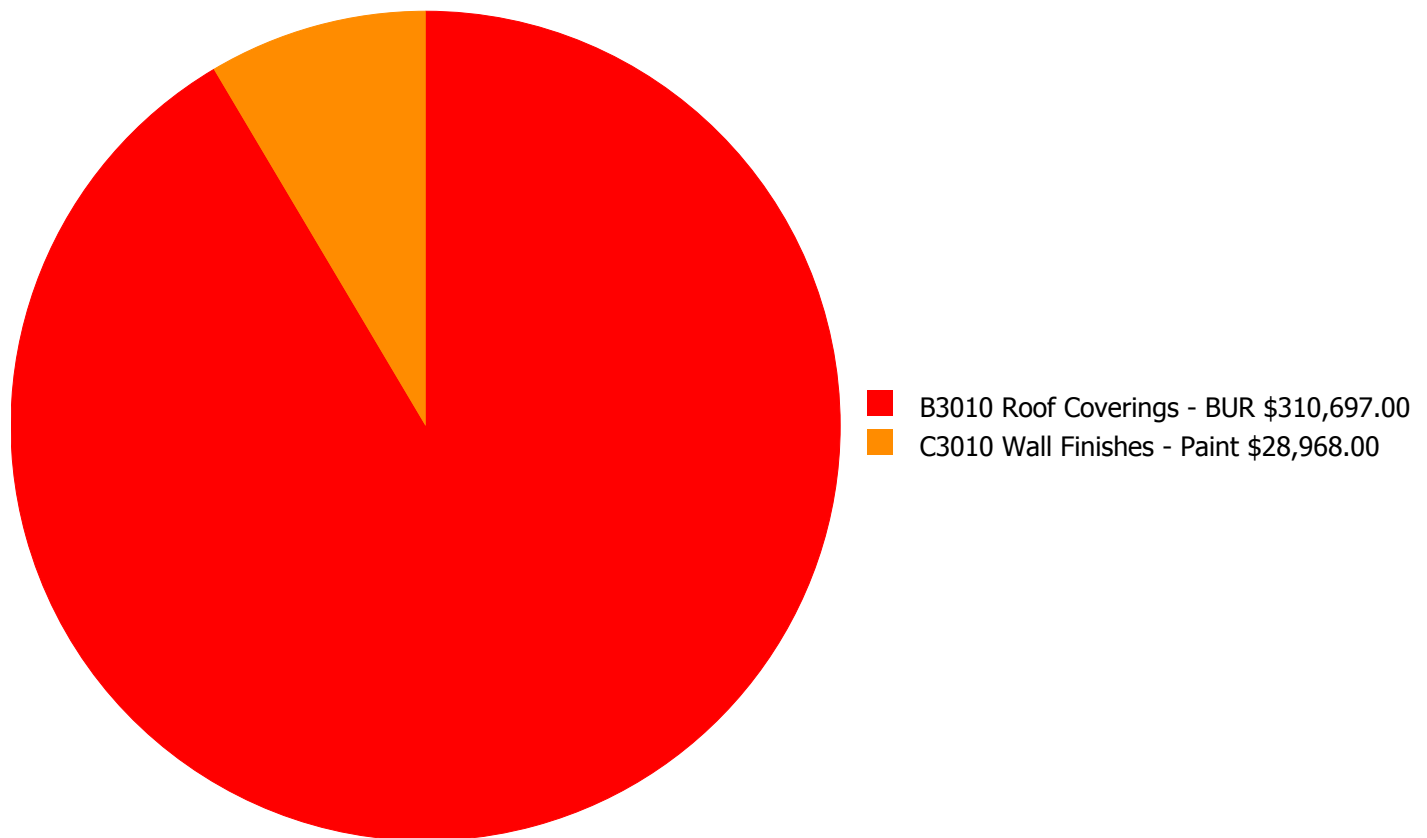

Budget Estimate Total: \$339,665.00

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

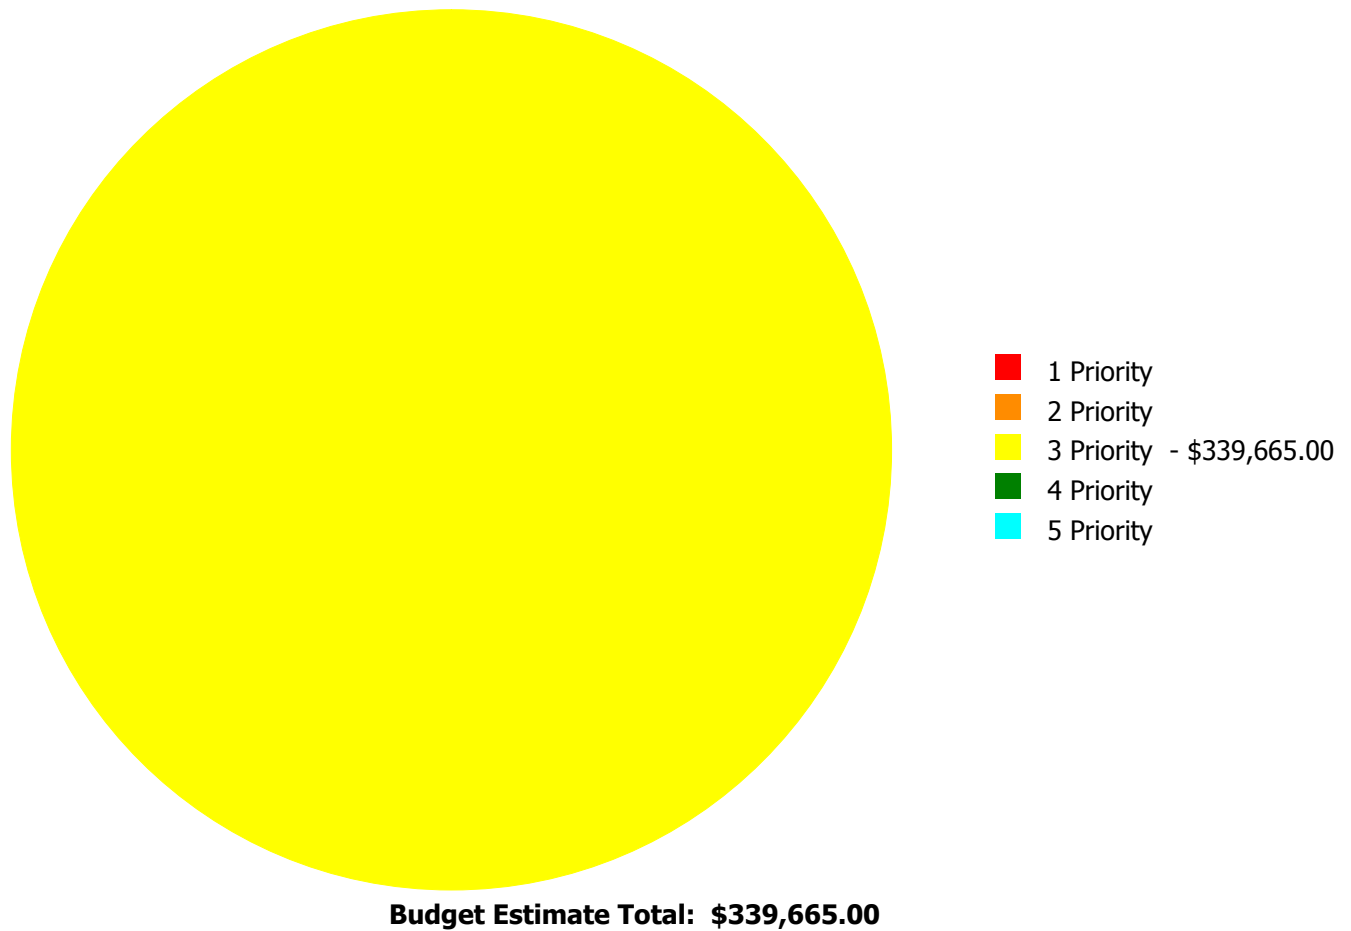

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards.
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
B3010	Roof Coverings - BUR	\$0.00	\$0.00	\$310,697.00	\$0.00	\$0.00	\$310,697.00
C3010	Wall Finishes - Paint	\$0.00	\$0.00	\$28,968.00	\$0.00	\$0.00	\$28,968.00
	Total:	\$0.00	\$0.00	\$339,665.00	\$0.00	\$0.00	\$339,665.00

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

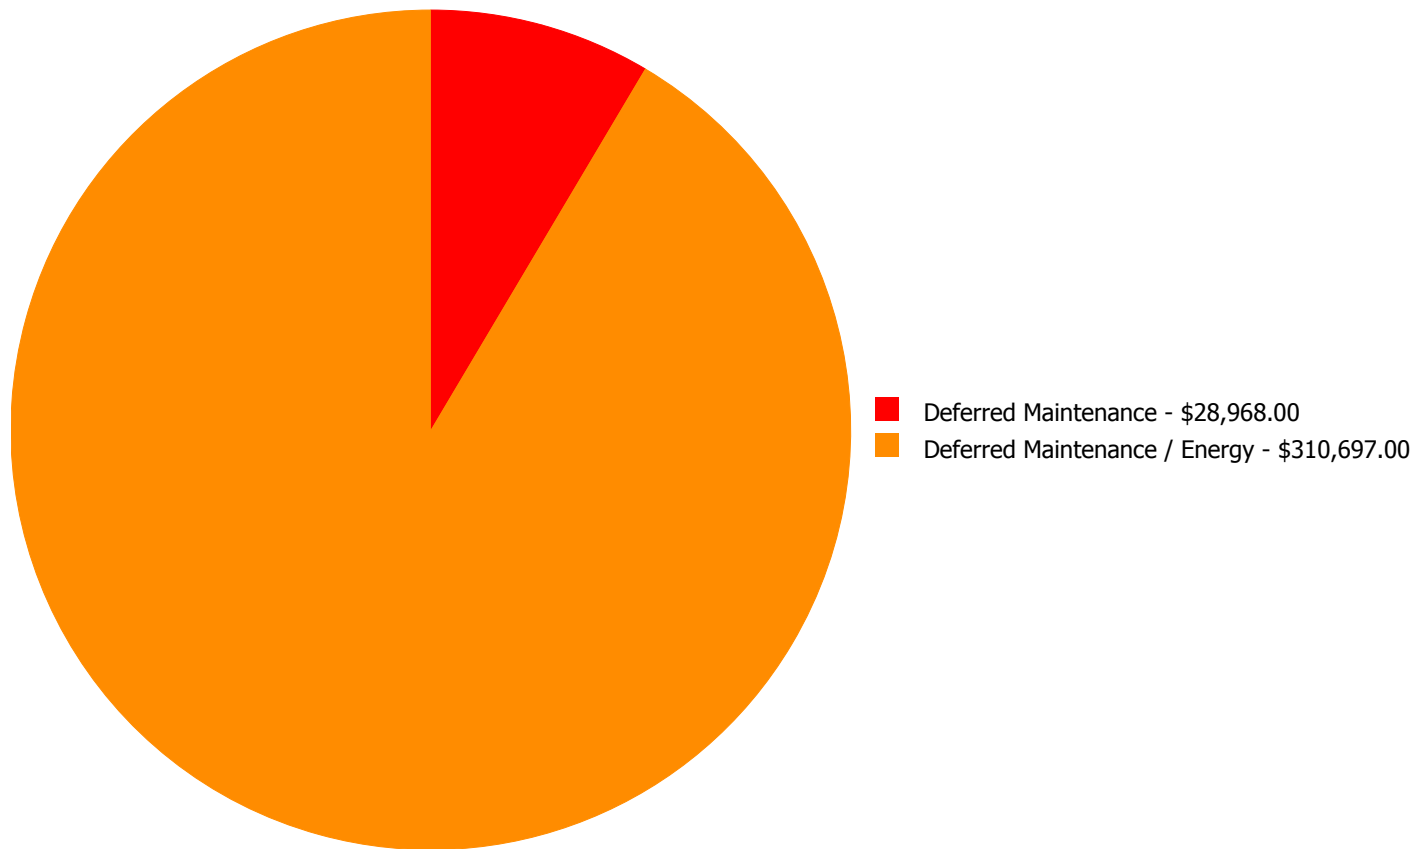

Budget Estimate Total: \$339,665.00

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 3 Priority:

System: B3010 - Roof Coverings - BUR



Location: Roof

Distress: Beyond Service Life

Category: Deferred Maintenance / Energy

Priority: 3 Priority

Correction: Renew System

Qty: 13,645.00

Unit of Measure: S.F.


Estimate: \$310,697.00

Assessor Name: Ben Nixon

Date Created: 07/07/2015

Notes: The roof covering is deteriorating with blistering and open or separating membrane seams, and is recommended to be replaced. SPLOST project 507-422 to replace the school.

System: C3010 - Wall Finishes - Paint

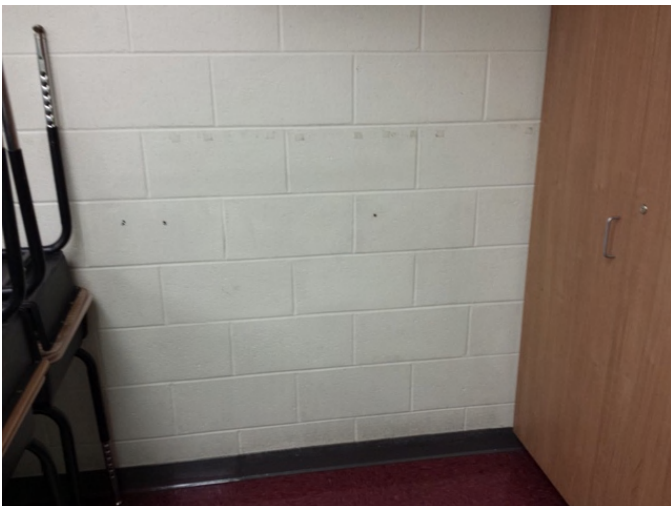

Location: Throughout Building

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 13,645.00

Unit of Measure: S.F.

Estimate: \$28,968.00

Assessor Name: Ben Nixon

Date Created: 04/11/2015

Notes: The painted wall finishes are beyond their expected service life, scuffed, faded and stained, and should be replaced. SPLOST project 507-422 to replace the school.

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	170
Year Built:	2004
Last Renovation:	
Replacement Value:	\$12,949
Repair Cost:	\$0.00
Total FCI:	0.00 %
Total RSLI:	75.31 %
FCA Score:	100.00



Description:

The storage building at Pleasantdale Elementary School is located at 3695 Northlake Drive in Doraville, Georgia. Originally built in 2004, there have been no additions and no major renovations to this building. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report.

Attributes:

General Attributes:

Building Codes:

Fire Sprinkler System:

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
A10 - Foundations	89.00 %	0.00 %	\$0.00
B10 - Superstructure	89.00 %	0.00 %	\$0.00
B20 - Exterior Enclosure	81.29 %	0.00 %	\$0.00
B30 - Roofing	45.00 %	0.00 %	\$0.00
C10 - Interior Construction	0.00 %	0.00 %	\$0.00
C30 - Interior Finishes	0.00 %	0.00 %	\$0.00
D20 - Plumbing	0.00 %	0.00 %	\$0.00
D50 - Electrical	0.00 %	0.00 %	\$0.00
Totals:	75.31 %	0.00 %	\$0.00

Photo Album

The photo album consists of the various cardinal directions of the building.

1). North Elevation - Jul 06, 2015



2). West Elevation - Jul 06, 2015



3). South Elevation - Jul 06, 2015



4). East Elevation - Jul 06, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
A1010	Standard Foundations	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
A1030	Slab on Grade	\$3.60	S.F.	170	100	2004	2104		89.00 %	0.00 %	89			\$612
B1020	Roof Construction	\$16.33	S.F.	170	100	2004	2104		89.00 %	0.00 %	89			\$2,776
B2010	Exterior Walls	\$38.65	S.F.	170	60	2004	2064		81.67 %	0.00 %	49			\$6,571
B2020	Exterior Windows	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
B2030	Exterior Doors	\$0.80	S.F.	170	30	2004	2034		63.33 %	0.00 %	19			\$136
B3010	Roof Coverings	\$16.79	S.F.	170	20	2004	2024		45.00 %	0.00 %	9			\$2,854
C1010	Partitions	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C1020	Interior Doors	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C1030	Fittings	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3010	Wall Finishes	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3020	Floor Finishes	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
C3030	Ceiling Finishes	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
D2040	Rain Water Drainage	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
D5010	Electrical Service/Distribution	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
D5020	Lighting and Branch Wiring	\$0.00	S.F.	0	0				0.00 %	0.00 %				\$0
Total									75.31 %					\$12,949

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

School Assessment Report - 2004 Storage


Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$4,097	\$0	\$4,097
* A - Substructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A10 - Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1010 - Standard Foundations	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* A1030 - Slab on Grade	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B - Shell	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B10 - Superstructure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B1020 - Roof Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B20 - Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
* B2010 - Exterior Walls	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2020 - Exterior Windows	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B2030 - Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B30 - Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
B3010 - Roof Coverings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$4,097	\$0	\$4,097
C - Interiors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C10 - Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1010 - Partitions	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1020 - Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C1030 - Fittings	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C30 - Interior Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3010 - Wall Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3020 - Floor Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
C3030 - Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D - Services	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D20 - Plumbing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D2040 - Rain Water Drainage	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D50 - Electrical	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5010 - Electrical Service/Distribution	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
D5020 - Lighting and Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

* Indicates non-renewable system

Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

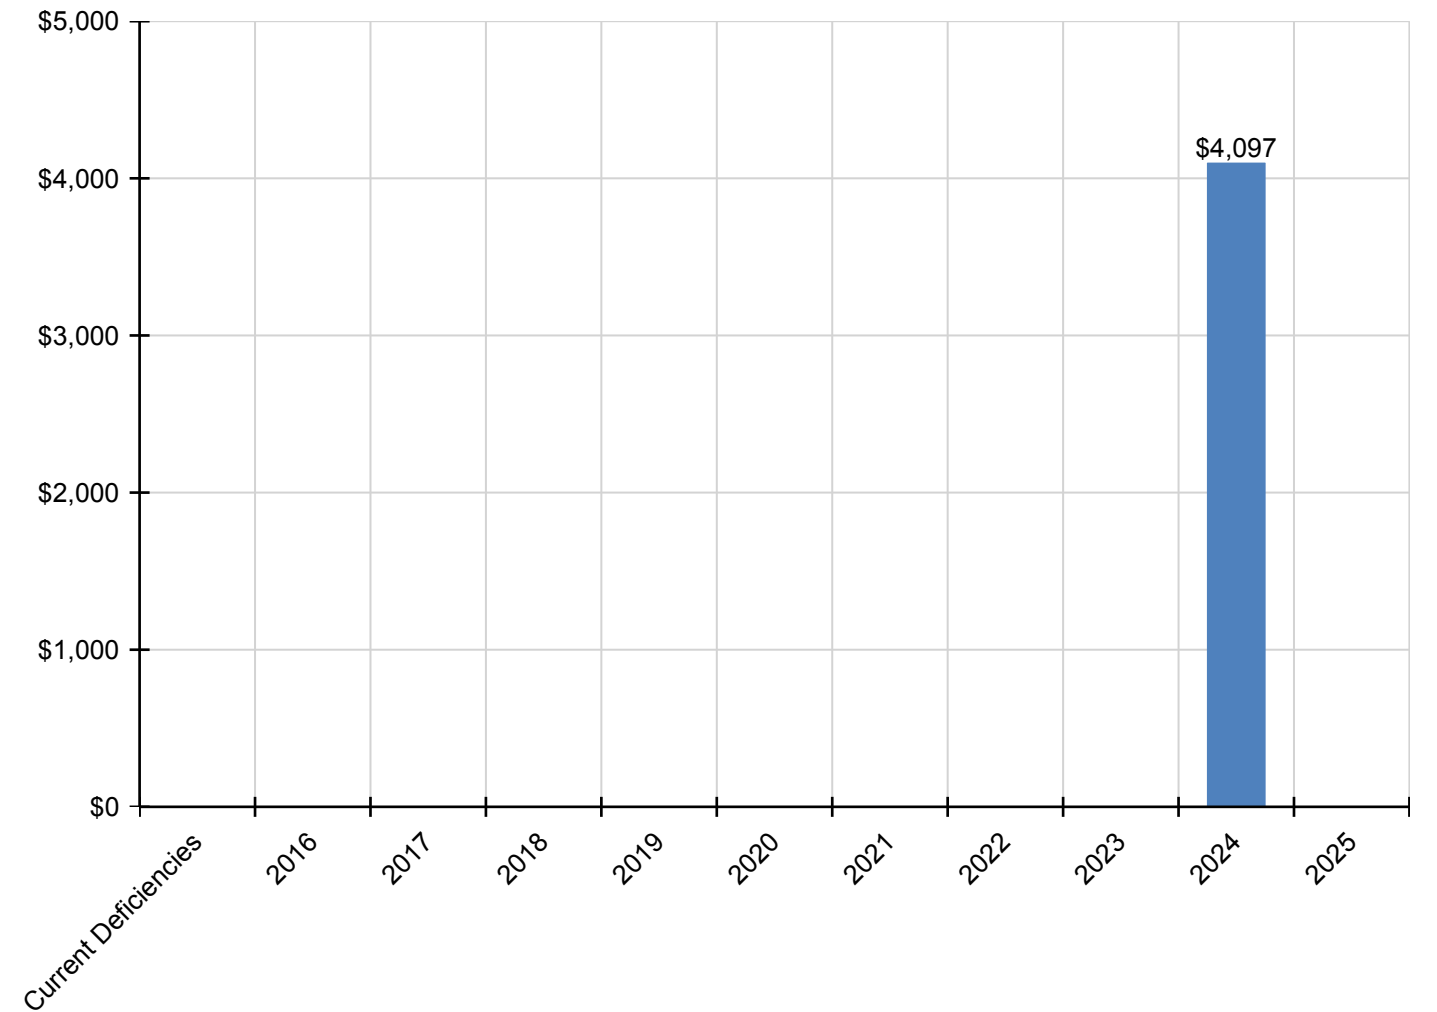

Deficiency Summary by System

Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

No data found for this asset

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

No data found for this asset

Deficiency By Priority Investment Table

The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards. .
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

No data found for this asset

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

No data found for this asset

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

No data found for this asset

Executive Summary

Building condition is evaluated based on the functional systems and elements of a building and organized according to the UNIFORMAT II Elemental Classification. The grouping of these systems and elements and applying a current replacement value to them develops a representative building cost model. Cost Models are developed for similar building types and functions. Systems and their elements are evaluated based on their current replacement values, life cycles, installation dates and next renewal dates. Systems and their elements that are within their useful lives are further evaluated to identify current deficient conditions that may have a significant impact on a system's or element's remaining service life, and to determine if they are beyond their predicted expected life. The system's or element's current replacement value is based on RS Means Commercial Cost Data.

Following are the cost model's system details for this facility. The **Replacement Value** is the amount needed to replace the property of the same present scope. The **Repair Cost** (the sum of the cost to repair/replace the Deficiencies) represents the budgeted contractor-installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging of the work. **Facility Condition Index (FCI)** is an industry-standard measurement of facility condition calculated as the ratio of the costs to correct a facility's deficiencies (Condition Needs) to the facility's Current Replacement Value. It ranges from 0% (new) to 100% (very poor - beyond service life). The **Remaining Service Life Index (RSLI)** is calculated as the sum of a renewable system's **Remaining Service Life (RSL)** divided by the sum of a system's Replacement Value (both values exclude soft-cost to simplify calculation updates) expressed as a percentage ranging from 100% (new) to 0% (expired). The relationship between the key metrics FCI and RSLI is an important indicator, at either the facility, building, system, or component levels, of the condition trend and the imminent need for capital renewal. These indices exist in an inverse relationship wherein the FCI increases when systems reach their expected life-cycle age, whereas the RSLI decreases annually indicating the relative time remaining before reaching the life-cycle expiration age. For example, a facility or a system with a high RSLI and a low FCI indicates it is in the early portion of its useful life. However, a low RSLI indicates that expiration dates are approaching at which point the FCI would increase. The term **FCA Score** is the inverse of Total FCI and calculated as 100-Total FCI (without the %) where 100 is best and 0 is worst condition.

Function:	Elementary School
Gross Area (SF):	65,109
Year Built:	1968
Last Renovation:	
Replacement Value:	\$1,482,612
Repair Cost:	\$976,391.51
Total FCI:	65.86 %
Total RSLI:	3.53 %
FCA Score:	34.14



Description:

The Pleasantdale Elementary School site was originally constructed in 1968, has a total area of 11 acres, and is occupied by approximately 65,109 square feet of permanent building space. Campus site features include paved driveways and parking lots, pedestrian pavement, flag pole, landscaping, and fencing. Site mechanical and electrical features include water, sewer, natural gas, and site lighting. This report contains condition and adequacy data collected during the 2015 Facility Condition Assessment (FCA). Detailed condition and deficiency statements are contained in this report for the site features.

Attributes:

General Attributes:

Site Code: 1530

Condition Summary

The Table below shows the RSLI and FCI for each major building system shown at the UNIFORMAT classification Level II. Note that Systems with lower FCIs require less investment than systems with higher FCIs.

UNIFORMAT Classification	RSLI %	FCI %	Current Repair Cost
G20 - Site Improvements	2.54 %	103.01 %	\$790,179.77
G30 - Site Mechanical Utilities	5.36 %	11.74 %	\$55,863.52
G40 - Site Electrical Utilities	3.03 %	54.40 %	\$130,348.22
Totals:	3.53 %	65.86 %	\$976,391.51

Photo Album

The photo album consists of the various cardinal directions of the building.

1). Aerial Image of Pleasantdale Elementary School - Jul 05, 2015



2). Covered Walkway - Jul 07, 2015



3). Playground - Jul 07, 2015



4). Playing Field - Jul 07, 2015



Condition Detail

This section of the report contains results of the Facility Condition Assessment. The building is separated into system components based on UNIFORMAT II. The columns in the System Listing table represent the following:

1. System Code: A code that identifies the system.
2. System Description: A brief description of a system present in the building.
3. Unit Price \$: The unit price of the system.
4. UoM: The unit of measure of the system.
5. Qty: The quantity for the system.
6. Life: Building Owners and Managers Association (BOMA) recommended system design life.
7. Year Installed: The date of system installation.
8. Calc Next Renewal Year: The date of system expiration based on the life, NR stands for non renewable.
9. Next Renewal Year: The suggested system expiration date by the assessor based on visual inspection.
10. RSLI: The Remaining Service Life Index of the system.
11. FCI: The Facility Condition Index of the system.
12. RSL: Remaining Service Life in years.
13. eCR: eCOMET Condition Rating (not used in this assessment).
14. Deficiency \$: The financial investment to repair/replace system to address deficiency.
15. Replacement Value \$: The replacement cost of the system.

System Listing

The System Listing table below lists each of the systems organized by their UNIFORMAT II classification. The assessment team was tasked with recording the most recent replacement year of each system, determining the remaining service life based on the theoretical life, and evaluating the condition to confirm the forecast next replacement year. The system listing is the basis for all data contained in the Building Assessment Report.

System Code	System Description	Unit Price \$	UoM	Qty	Life	Year Installed	Calc Next Renewal Year	Next Renewal Year	RSLI%	FCI%	RSL	eCR	Deficiency \$	Replacement Value \$
G2010	Roadways	\$5.17	S.F.	35,959	25	1968	1993		0.00 %	110.00 %	-22		\$204,498.83	\$185,908
G2020	Parking Lots	\$4.56	S.F.	14,684	25	1968	1993		0.00 %	110.00 %	-22		\$73,654.94	\$66,959
G2030	Pedestrian Paving	\$1.50	S.F.	65,109	30	1968	1998		0.00 %	110.00 %	-17		\$107,429.85	\$97,664
G2040	Baseball Field	\$8.35	S.F.		0				0.00 %	0.00 %				\$0
G2040	Canopies	\$0.29	S.F.		0				0.00 %	0.00 %				\$0
G2040	Covered Walkways	\$48.72	S.F.	1,000	25	2000	2025		40.00 %	0.00 %	10			\$48,720
G2040	Fencing & Guardrails	\$0.91	S.F.	65,109	30	1968	1998		0.00 %	110.00 %	-17		\$65,174.11	\$59,249
G2040	Football Field	\$5.85	S.F.		20	1968	1988		0.00 %	0.00 %	-27			\$0
G2040	Hard Surface Play Area	\$6.26	S.F.		0				0.00 %	0.00 %				\$0
G2040	Playing Field	\$3.92	S.F.	54,632	20	1968	1988		0.00 %	110.00 %	-27		\$235,573.18	\$214,157
G2040	Soccer/Lacross Field	\$5.00	S.F.		0				0.00 %	0.00 %				\$0
G2040	Softball Field	\$8.86	S.F.		0				0.00 %	0.00 %				\$0
G2040	Tennis Courts	\$18.47	S.F.		0				0.00 %	0.00 %				\$0
G2040	Track	\$7.04	S.F.		10	1968	1978		0.00 %	0.00 %	-37			\$0
G2050	Landscaping	\$1.45	S.F.	65,109	15	1968	1983		0.00 %	110.00 %	-32		\$103,848.86	\$94,408
G3010	Water Supply	\$1.83	S.F.	65,109	50	1968	2018		6.00 %	0.00 %	3			\$119,149
G3020	Sanitary Sewer	\$1.15	S.F.	65,109	50	1968	2018		6.00 %	0.00 %	3			\$74,875
G3030	Storm Sewer	\$3.55	S.F.	65,109	50	1968	2018		6.00 %	0.00 %	3			\$231,137
G3060	Fuel Distribution	\$0.78	S.F.	65,109	40	1968	2008		0.00 %	110.00 %	-7		\$55,863.52	\$50,785
G4010	Electrical Distribution	\$1.86	S.F.	65,109	50	1968	2018		6.00 %	0.00 %	3			\$121,103
G4020	Site Lighting	\$1.15	S.F.	65,109	30	1968	1998		0.00 %	110.00 %	-17		\$82,362.89	\$74,875
G4030	Site Communications & Security	\$0.67	S.F.	65,109	10	1998	2008		0.00 %	110.00 %	-7		\$47,985.33	\$43,623
Total									3.53 %	65.86 %			\$976,391.51	\$1,482,612

Renewal Schedule

eComet forecasts future Capital Renewal projects for expiring systems based on the Calculated Next Renewal year found in the system listing. There is a 3% yearly inflation factor applied to the system costs expiring in the future. The table below reflects Capital Renewal projects over the next 10 years. Note: Blank cells (or \$0) indicate no systems are scheduled for renewal in that year.

School Assessment Report - Site


Inflation Rate: 3%

System	Current Deficiencies	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	Total
Total:	\$976,392	\$0	\$0	\$656,610	\$0	\$0	\$0	\$0	\$0	\$0	\$136,511	\$1,769,512
G - Building Sitework	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G20 - Site Improvements	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2010 - Roadways	\$204,499	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$204,499
G2020 - Parking Lots	\$73,655	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$73,655
G2030 - Pedestrian Paving	\$107,430	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$107,430
G2040 - Baseball Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Canopies	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Covered Walkways	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$72,023	\$72,023
G2040 - Fencing & Guardrails	\$65,174	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$65,174
G2040 - Football Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Hard Surface Play Area	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Playing Field	\$235,573	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$235,573
G2040 - Soccer/Lacross Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Softball Field	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Tennis Courts	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2040 - Track	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G2050 - Landscaping	\$103,849	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$103,849
G30 - Site Mechanical Utilities	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G3010 - Water Supply	\$0	\$0	\$0	\$143,217	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$143,217
G3020 - Sanitary Sewer	\$0	\$0	\$0	\$90,000	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$90,000
G3030 - Storm Sewer	\$0	\$0	\$0	\$277,827	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$277,827
G3060 - Fuel Distribution	\$55,864	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$55,864
G40 - Site Electrical Utilities	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
G4010 - Electrical Distribution	\$0	\$0	\$0	\$145,565	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$145,565
G4020 - Site Lighting	\$82,363	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$82,363
G4030 - Site Communications & Security	\$47,985	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$64,488	\$112,473

* Indicates non-renewable system


Forecasted Capital Renewal Requirement

The following chart shows the current building deficiencies and the forecasted capital renewal (system replacement) requirements over the next ten years.

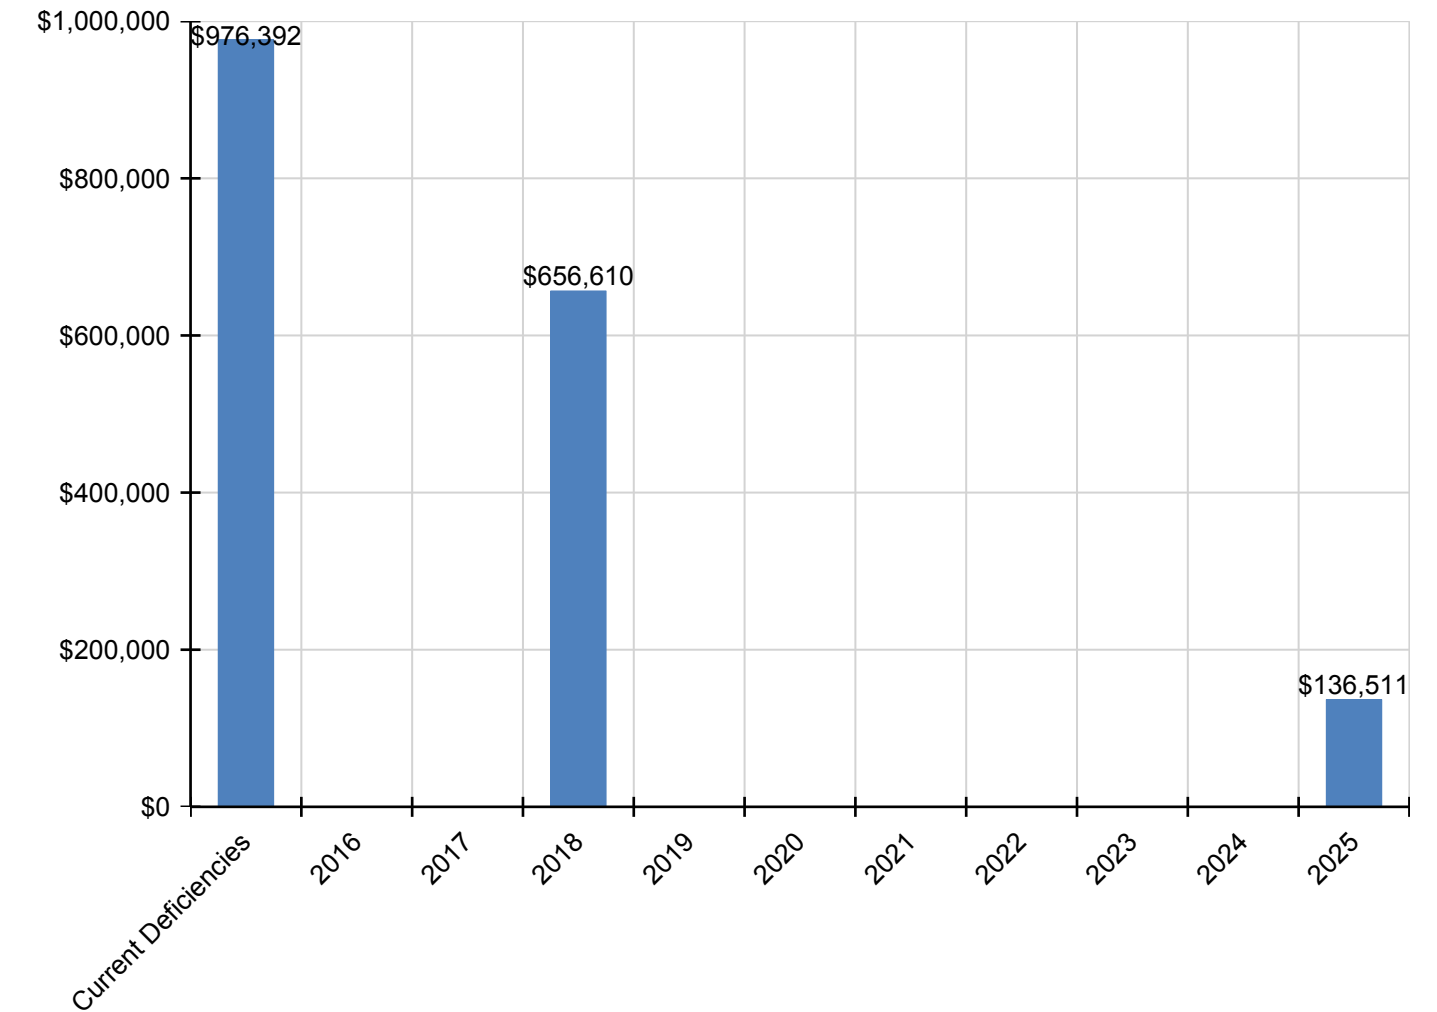

Deficiency Summary by System


Current deficiencies include assemblies that have reached or exceed their design life or components of the assemblies that are in need of repair. Assemblies that have reached their design life are identified as current deficiencies and assigned the distress 'Beyond Service Life'. The following chart lists all current deficiencies associated with this facility broken down by UNIFORMAT system.

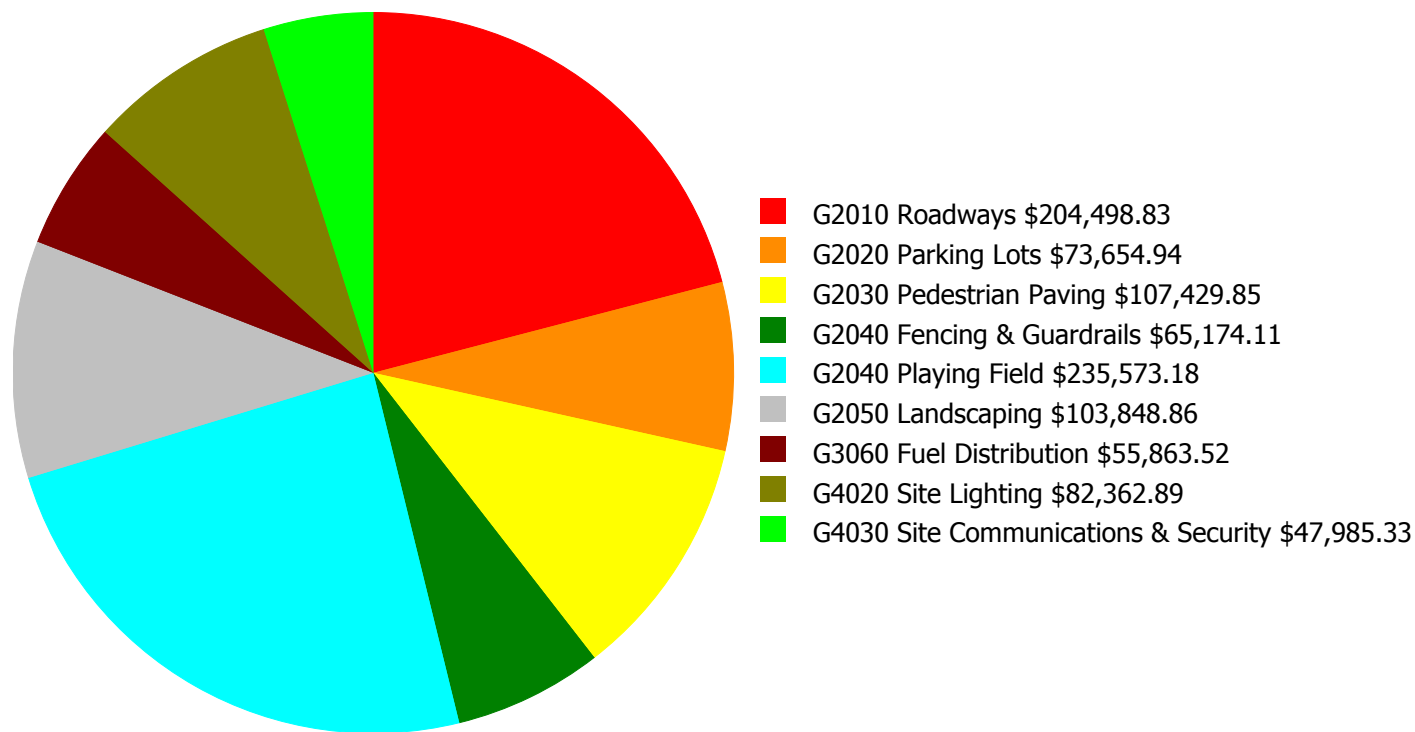

Budget Estimate Total: \$976,391.51

Deficiency Summary by Priority

The following chart shows the total repair costs broken down by priority. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

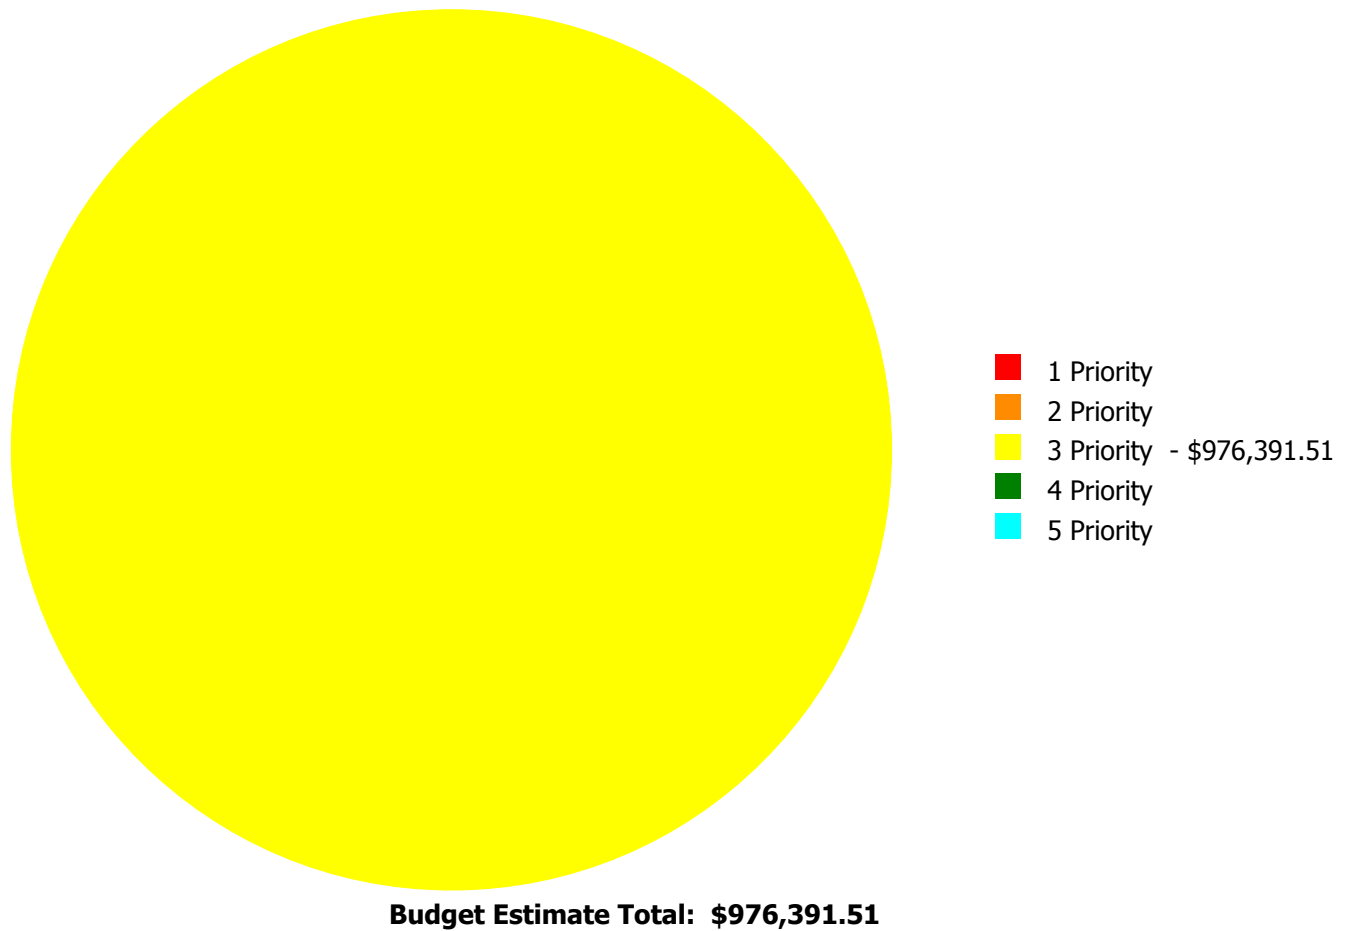

Deficiency By Priority Investment Table


The table below shows the current investment cost grouped by deficiency priority and building system. Assessors assigned deficiencies within eCOMET to one of the following priority categories:

- **Priority 1** deficiencies require immediate review to correct a potential life/safety hazard, stop accelerated deterioration, or return a facility to operation.
- **Priority 2** deficiencies could become a Priority 1 deficiency, if not corrected within the next 2-3 years. These include intermittent operations, rapid deterioration, or potential life/safety hazards.
- **Priority 3** deficiencies require appropriate attention to preclude predictable deterioration or potential downtime and the associated damage or higher costs if deferred further and not completed within the next 3-5 years.
- **Priority 4** deficiencies represent a sensible improvement to existing conditions. The recommended improvements are not required for the basic functionality of the facility; however addressing these deficiencies will improve overall usability and/or reduce long term maintenance costs. Repairs for these deficiencies may be budgeted and scheduled for completion within the next 5-7 years.
- **Priority 5** deficiencies will include conditions that have no impact on the function or usability of the facility, such as appearance. No action is required for these deficiencies, but they are tracked since they may require future inspection or be completed as part of related repairs in contiguous areas of the facility.

System Code	System Description	Priority 1	Priority 2	Priority 3	Priority 4	Priority 5	Total
G2010	Roadways	\$0.00	\$0.00	\$204,498.83	\$0.00	\$0.00	\$204,498.83
G2020	Parking Lots	\$0.00	\$0.00	\$73,654.94	\$0.00	\$0.00	\$73,654.94
G2030	Pedestrian Paving	\$0.00	\$0.00	\$107,429.85	\$0.00	\$0.00	\$107,429.85
G2040	Fencing & Guardrails	\$0.00	\$0.00	\$65,174.11	\$0.00	\$0.00	\$65,174.11
G2040	Playing Field	\$0.00	\$0.00	\$235,573.18	\$0.00	\$0.00	\$235,573.18
G2050	Landscaping	\$0.00	\$0.00	\$103,848.86	\$0.00	\$0.00	\$103,848.86
G3060	Fuel Distribution	\$0.00	\$0.00	\$55,863.52	\$0.00	\$0.00	\$55,863.52
G4020	Site Lighting	\$0.00	\$0.00	\$82,362.89	\$0.00	\$0.00	\$82,362.89
G4030	Site Communications & Security	\$0.00	\$0.00	\$47,985.33	\$0.00	\$0.00	\$47,985.33
	Total:	\$0.00	\$0.00	\$976,391.51	\$0.00	\$0.00	\$976,391.51

Deficiency Summary by Category

The following chart shows the total repair costs broken down by deficiency categories. Assessors assigned deficiencies to one of the following categories:

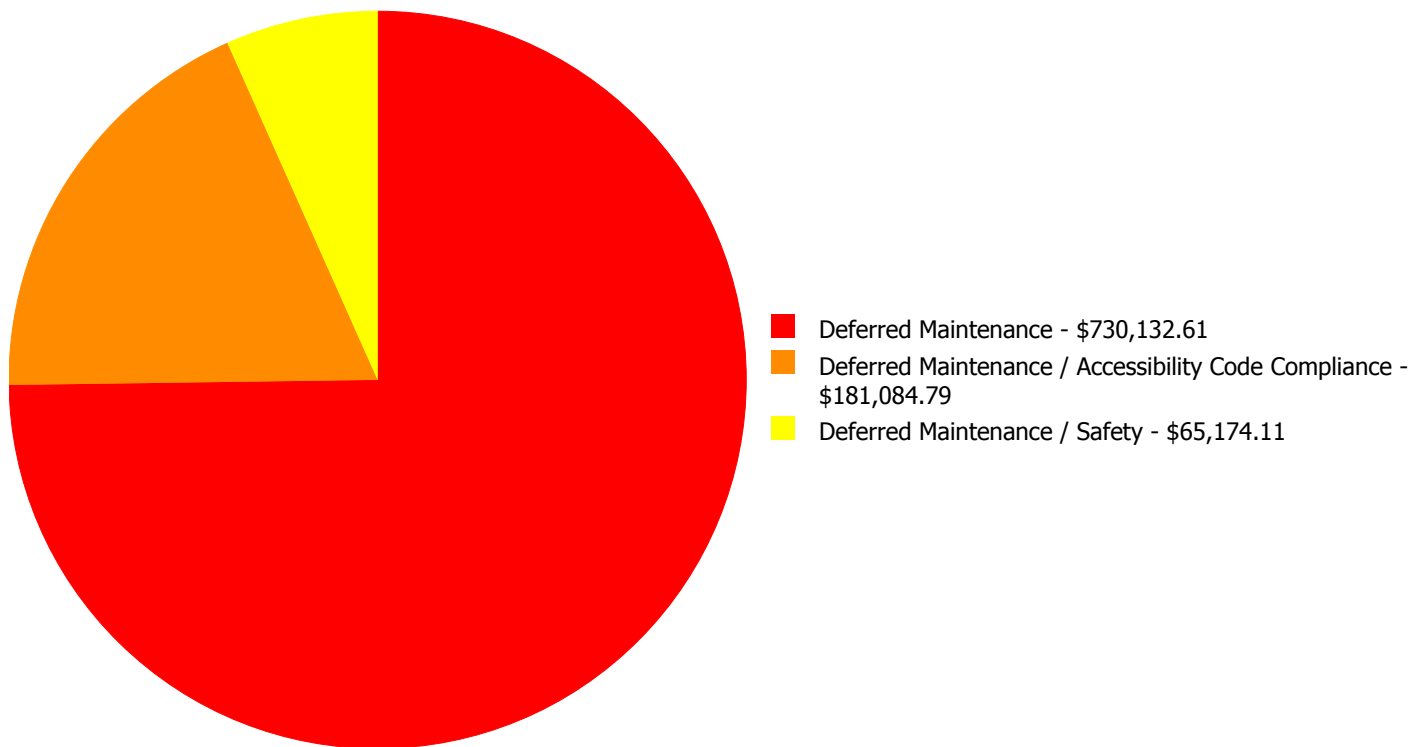

Budget Estimate Total: \$976,391.51

Deficiency Details by Priority

The deficiency detail notes listed below provide additional information on identified deficiencies found within the facility.

Priority 3 Priority:

System: G2010 - Roadways



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 35,959.00

Unit of Measure: S.F.

Estimate: \$204,498.83

Assessor Name: Eduardo Lopez

Date Created: 07/05/2015

Notes: Roadways are beyond their expected service life, damaged with many cracks and potholes, worn, and should be replaced. SPLOST project 507-422 to replace the school.

System: G2020 - Parking Lots



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 14,684.00

Unit of Measure: S.F.

Estimate: \$73,654.94

Assessor Name: Eduardo Lopez

Date Created: 07/05/2015

Notes: The parking lot is beyond its expected service life, deteriorated with cracks, not ADA compliant, and should be replaced and re-striping. Accessible parking spaces are missing at the rear parking area and should be provided per ADA standards. SPLOST project 507-422 to replace the school.

System: G2030 - Pedestrian Paving



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance / Accessibility Code Compliance

Priority: 3 Priority

Correction: Renew System

Qty: 65,109.00

Unit of Measure: S.F.

Estimate: \$107,429.85

Assessor Name: Eduardo Lopez

Date Created: 07/05/2015

Notes: Pedestrian paving is beyond its expected service life, damaged with cracks, and should be replaced to include missing ramps per ADA standards. SPLOST project 507-422 to replace the school.

System: G2040 - Fencing & Guardrails



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance / Safety

Priority: 3 Priority

Correction: Renew System

Qty: 65,109.00

Unit of Measure: S.F.

Estimate: \$65,174.11

Assessor Name: Eduardo Lopez

Date Created: 07/05/2015

Notes: Fencing is beyond its expected service life, rusted and failing, and should be scheduled for replacement. There is not a fence surrounding the playground area and PE field. SPLOST project 507-422 to replace the school.

System: G2040 - Playing Field



Location: Site
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 54,632.00
Unit of Measure: S.F.
Estimate: \$235,573.18
Assessor Name: Eduardo Lopez
Date Created: 07/05/2015

Notes: The playing fields are beyond their expected service life, have numerous bare spots, and should be re-sodded to prevent erosion. SPLOST project 507-422 to replace the school.

System: G2050 - Landscaping



Location: Site
Distress: Beyond Service Life
Category: Deferred Maintenance
Priority: 3 Priority
Correction: Renew System
Qty: 65,109.00
Unit of Measure: S.F.
Estimate: \$103,848.86
Assessor Name: Eduardo Lopez
Date Created: 07/05/2015

Notes: Landscaping is in poor condition, with overgrown weeds and eroded areas, and should be replaced. SPLOST project 507-422 to replace the school.

System: G3060 - Fuel Distribution



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 65,109.00

Unit of Measure: S.F.

Estimate: \$55,863.52

Assessor Name: Eduardo Lopez

Date Created: 07/05/2015

Notes: The site fuel distribution system is beyond its expected service life and should be scheduled for replacement. SPLOST project 507-422 to replace the school. SPLOST project 507-422 to replace the school.

System: G4020 - Site Lighting



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 65,109.00

Unit of Measure: S.F.

Estimate: \$82,362.89

Assessor Name: Eduardo Lopez

Date Created: 07/05/2015

Notes: Site lighting is beyond its expected service life, inadequate, and should be scheduled for replacement. SPLOST project 507-422 to replace the school.

System: G4030 - Site Communications & Security



Location: Site

Distress: Beyond Service Life

Category: Deferred Maintenance

Priority: 3 Priority

Correction: Renew System

Qty: 65,109.00

Unit of Measure: S.F.

Estimate: \$47,985.33

Assessor Name: Eduardo Lopez

Date Created: 07/05/2015

Notes: The site communications and security systems are beyond their expected service life and should be scheduled for replacement. SPLOST project 507-422 to replace the school.

Glossary

Abandoned	A facility owned by a district that is not occupied and not maintained. See Vacant.
Additional Cost	Total project cost is composed of hard and soft costs. Additional costs or soft expenses are costs that are necessary to accomplish the corrective work but are not directly attributable to the deficient systems direct construction cost, which are often referred to as hard cost. The components included in the soft costs vary by owner but usually include architect and contractor fees, contingencies and other owner-incurred costs necessary to fully develop and build a facility. These soft cost factors can be adjusted anytime within the eCOMET® database at the owner's discretion.
Assessment	Visual survey of a facility to determine its condition. It involves looking at the age of systems, reviewing information from local sources and visual evidence of potential problems to assign a condition rating. It does not include destructive testing of materials or testing of systems or equipment for functionality.
ASTM	ASTM International (ASTM): Originally known as the American Society for Testing and Materials, ASTM is an international standards organization that develops and publishes voluntary consensus technical standards for a wide range of materials, products, systems, and services.
BOMA	Building Owners Managers of America (BOMA): National organization of public and private facility owners focused on building management tools and maintenance techniques. eCOMET® reference: Building and component system effective economic life expectancies.
Building	A fully enclosed and roofed structure that can be traversed internally without exiting to the exterior.
Building Addition	An area, space or component of a building added to a building after the original building's year built date. NOTE: As a convention in the database, "Main" was used to designate the original building. Additions built prior to 1983 (30 years) were included in the main building area calculations to reflect their predicted system depreciation characteristics and remaining service life.
Building Systems	eCOMET® uses UNIFORMAT II to organize building data. UNIFORMAT II was originally developed by the federal General Services Administration to delineate building costs by systems rather than by material. UNIFORMAT II was formalized by an NIST standard, NISTIR 6389 in 1999. It has been further quantified and updated by ASTM standard 2005, E1557-05. The Construction Specifications Institute, CSI, has taken over the standard as part of their MasterFormat / MasterSpec system.
Calculated Next Renewal	The year a system or building element would be expected to expire based solely on the date it was installed and the expected useful lifetime for that kind of system.
Capital Renewal	Capital renewal refers to the cyclical replacement of building systems or elements as they become obsolete or beyond their useful life. It is not normally included in an annual operating/maintenance budget. See calculated next renewal and next renewal.
City Cost Index (CCI)	RS Means provides building system, equipment, and construction costs at a national level. The City Cost Index (also provided by RS Means) localizes those costs to a geographic region of the United States. In eCOMET®, each building or site is assigned a City Cost Index, which adjusts all of the associated costs for systems, deficiencies and inventory to the local value.
Condition	Condition refers to the state of physical fitness or readiness of a facility system or system element for its intended use.
Condition Budget	The Condition Budget, also known as Condition Needs, represents the budgeted contractor installed costs plus owner's soft costs for the repair, replacement or renewal for a component or system level deficiency. It excludes contributing costs for other components or systems that might also be associated with the corrective actions due to packaging the work.

School Assessment Report - Pleasantdale Elementary

Condition Index (CI) %	The Condition Index (CI) also known as the Remaining Service Life Index (RSLI) is calculated as the sum of a renewable system's Remaining Service Life (RSL) Value divided by the sum of a system's Replacement Value (both values exclude soft cost to simplify calculation updates) expressed as a percentage ranging from 100.00% (new) to 0.00% (expired - no remaining life).
Construction Specifications Institute	Construction Specifications Institute: Primary national organization specializing in construction materials data and data location in construction documents. eCOMET® reference: UNIFORMAT II materials classification.
Correction	Correction refers to an assessor's recommended deficiency repair or replacement action. For any system or element deficiency, there can be multiple and alternative solutions for its repair or replacement. A Correction is user defined and tied to a UNIFORMAT II element, or system it is intended to address. It excludes other peripheral costs that may also be included in the packaging of repair, replacement or renewal improvements that may also be triggered by the deficiency correction.
Cost Model	A cost model is a list of facility systems which could represent the installed systems a given facility. Included in the cost model are standard unit cost estimates, gross areas, life cycles and installed dates. Also represented is the repair cost for deficient systems, replacement values. See eCOMET® cost models.
Criteria	Criteria refer to the set of requirements, guidelines or standards that are assessed and rated to develop a score.
Current Period	The Current Period is the current year plus a user defined number of forward years.
Current Replacement Value (CRV)	The Current Replacement Value (CRV) of a facility, building or system represents the hypothetical cost of rebuilding or replacing an existing facility under today's codes and construction standards, using its current configuration. It is calculated by multiplying the gross area of the facility by a square foot cost developed in that facility's cost model. Replacement cost includes construction costs and owner's additional or soft costs for fees, permits and other expenses to reflect a total project cost.
Deferred Maintenance	Deferred maintenance is condition work deferred on a planned or unplanned basis to a future budget cycle or postponed until funds are available.
Deficiency	A deficiency is a repair item that is damaged, missing, inadequate or insufficient for an intended purpose.
Deficiency Category	Deficiency Category refers to the type or class of a user defined deficiency grouping with shared or similar characteristics. Category descriptions include, but are not limited to: Accessibility Code Compliance, Appearance, Building Code Compliance, Deferred Maintenance, Energy, Environmental, Life Safety Code Compliance, and Safety.
Deficiency Distress	Deficiency Distress refers to a user-defined root cause of a deficiency. Distress descriptions are: Beyond Service Life, Damaged, Inadequate, Needs Remediation, and Missing.
Deficiency Priority	Deficiency Priority refers to a deficiency's urgency for repair as determined by the assessment team. Deficiencies were assigned a priority of 1 through 5, with Priority 1 deficiencies being the most urgent.
eCOMET®	Energy and Condition Management Estimation Technology (eCOMET®) is Parsons proprietary facility asset management software developed to provide facility managers with a state of the art, web-based tool to develop and maintain a comprehensive database of FCA data and information used for facility asset management, maintenance and repair, and capital renewal planning. eCOMET® is used by Parsons and its clients as the primary tool for collecting FCA data, preparing cost estimates, generating individual facility reports and cost estimates, and developing the overall capital renewal program.

School Assessment Report - Pleasantdale Elementary

eCOMET® Cost Models	eCOMET® cost models are derived from RS Means Square Foot Cost Data cost models and these models are used to develop the current replacement value (CRV) and assign life cycle costs to the various systems within a building. Cost models are assigned current costs-per-square-foot to establish replacement values. The Cost models are designed to represent a client specific facility that meets local standards cost trends.
Element	Elements are the major components that comprise building systems as defined by UNIFORMAT II.
Expected Life	Also referred to as Useful Life. See Useful Life definition.
Facility	A facility refers to site(s), building(s), or building addition(s), or combinations thereof that provide a particular service or support of an educational purpose.
Facility Attributes	Customizable eCOMET® fields to identify attributes specific to a facility. These fields are part of the eCOMET® database set-up with the owner.
Facility Condition Assessment (FCA)	A facility condition assessment (FCA) is a visual inspection of buildings and grounds at a facility to identify and estimate current and future needed repairs or replacements of major systems for planning and budgeting purposes. It is typically performed for organizations that are tasked with the day to day maintenance, operation, and capital renewal (replacement) of building systems and components of a large inventory of facilities. The primary goal of an FCA is to objectively and quantifiably identify, inspect, and prioritize the repair and replacement needs of the building and ground systems (e.g., roofs, windows, doors, floor finishes, plumbing fixtures, parking lot, and sidewalks) within facilities that have either failed or have surpassed their service life, and to identify and forecast future capital replacement needs for systems that have not yet failed, but planned replacement of those systems is needed to ensure that the facilities will continue to meet the mission of the organization.
Facility Condition Index (FCI)	FCI is an industry-standard measurement of a facility's condition expressed as a percentage from 0.00% to 100.00% that is derived by dividing the cost to correct a facility's deficiencies by its Current Replacement Value (CRV). The higher the FCI the poorer the condition of a facility. After an FCI is established for all buildings within a portfolio, a building's condition can be ranked relative to other buildings. The FCI may also represent the condition of a portfolio based on the cumulative FCIs of the portfolio's facilities.
Forecast Period	The Forecast Period refers to a user defined number of years forward of the Current Period.
Gen (Generate)	The Cost Model has a Gen box for each system line item. By checking the box, eCOMET® will generate life cycle deficiencies based on the Year Installed and the Life for that system. Systems that typically do not re-generate (foundations, floor construction, roof construction, basement walls, etc.) would not have the Gen box checked as those systems would not re-generate at the end of a life cycle. In those instances, it would be more practical and cost effective to demolish the entire facility than renew those systems.
Gross Square Feet (GSF)	The area of the enclosed floor space of a building or building addition in square feet measured to the outside face of the enclosing wall.
Life cycle	Life cycle refers to the period of time that a building or site system or element can be expected to adequately serve its intended function. Parsons assigns expected life cycles to all building systems based on Building Operators and Managers of America (BOMA) recommended life cycles, manufacturers suggested life, and RS Means cost data, and client-provided historical data. BOMA standards are a nationally recognized source of life cycle data for various components and/or systems associated with facilities. RS Means is a national company specializing in construction estimating and costs.
Next Renewal	Next Renewal refers to a manually-adjusted expected useful life of a system or element based on on-site inspection either by reducing or extending the Calculated Next Renewal to more accurately reflect current conditions.

School Assessment Report - Pleasantdale Elementary

Order of Magnitude	Order of Magnitude refers to a rough approximation made with a degree of knowledge and confidence that the budgeted, projected or estimated cost falls within a reasonable range of cost values.
Remaining Service Life (RSL)	RSL is the number of years of service remaining for a system or equipment item. It is automatically calculated based on the difference between the current year and the Calculated Next Renewal date or the Next Renewal date whichever one is the later date.
Renewal Factors	Renewal factors represent the difference in cost of renovating or replacing an existing system, rather than new construction of a building system. For example, installing a new built-up roof on an existing building would include removing and disposing of the old roof, a cost not associated with new construction. Using a renewal premium to account for demolition and other difficulty costs, Parsons typically assigns a renewal factor of 110%.
Renewal Schedule	A timeline by year that indicates when the systems will need to be renewed and the estimated price of the renewal.
Repair Cost	Repair cost is the sum of all the deficiencies associated with a building or multiple buildings/facilities. It will include any applied soft costs or City Cost Indexes.
Replacement Value	See Current Replacement Value.
Site	A facility's grounds and its utilities, roadways, landscaping, fencing and other typical land improvements needed to support a facility.
Soft Costs	Soft Costs are a construction industry term that refers to expense items that are not considered direct construction costs. Soft costs are user-defined and include architectural, engineering, management, testing, and mitigation fees, and other owner pre- and post-construction expenses.
Sustainability	Sustainability refers to the collection of policies and strategies that meet society's present needs without compromising the ability of future generations to meet their own needs.
System	System refers to building and related site work elements as described by ASTM UNIFORMAT II Classification for Building Elements (E1557-97), a format for classifying major facility elements common to most buildings. Elements usually perform a given function regardless of the design specification construction method or materials used. See also UNIFORMAT II.
System Generated Deficiency	eCOMET® automatically generates system deficiencies based on system life cycles using the systems installation dates as the base year. By adjusting the Next Renewal date ahead or behind the predicted or stated life cycle date, a system cost will come due earlier or later than the originally installed life cycle date. This utility accounts for good maintenance conditions and a longer life, or early expiration of a system life due to any number of adverse factors such as poor installation, acts of god, material defects, poor design applications and other factors that may shorten the life of a material or system. It is important to mention that the condition of the systems is not necessarily a reflection of maintenance practices, but a combination of system usage and age.
UNIFORMAT	ASTM UNIFORMAT II, Classification for Building Elements (E1557-97), a publication of the Construction Specification Institute (CSI), is a format used to classify major facility components common to most buildings. The format is based on functional elements or parts of a facility characterized by their functions without regard to the materials and methods used to accomplish them. These elements are often referred to as systems or assemblies.
Unit Price	The Unit Price (Raw) x (100% + the Additional Cost Template percentage).
Unit Price (Raw)	The actual \$/sq. ft cost being used for the building and systems. It will include adjustments for the City Cost Index applied to the facility.

School Assessment Report - Pleasantdale Elementary

Useful Life	Also known as Expected Life, Useful Life refers to the intrinsic period of time a system or element is expected to perform as intended. Useful life is generally provided by manufacturers of materials, systems and elements through their literature, testing and experience. Useful Lives in the database are derived from the Building Owners and Managers (BOMA) organization's guidelines, RSMeans cost data, and from client- defined historical experience.
Vacant	Vacant refers to a facility that is not occupied but is a maintained facility by a district. See Abandoned.
Year Built	The year that a building or addition was originally built based on its date of substantial completion or occupancy.
Year Installed	The year a system or element was built or the most recent major renovation date where a minimum of 70% of the system's Current Replacement Value (CRV) was replaced.